

# Contoso Safety 360 Form

☒ Hazardous Condition

☐ Safety Suggestion

☐ At Risk Behavior

☐ Safety Recognition

☒ Equipment

☐ Slips, Trips, Falls

☐ Electrical

☐ Ergonomics

☐ Material Handling

☐ Spill, Release, Environmental

☐ PPE

☒ Other Safety

☒ Significant

☐ Not Significant

Findings: Mold plate was thrown out of CNC. Magnetic Plate was being used.

Mold went through Plexi Glass Roof.

Suggested Solutions: Fix the equipment ab1, exam equipment room to make sure that all safety conditions be met.

Submitter: Daleen du Plessis

Department: Tower Room

Date: July 26, 2022

Owner: Etleva Hysa

Solution Description: Fixed the equipment ab1, exam equipment room to make sure that all safety conditions are met. Expanded Checklist.

Target Date: July 29, 2022

Close Date: July 28, 2022

Submitter Approval: Yes