



Advanced Commercial  
5290 Tulane Dr SW  
Atlanta GA 30336  
Phone: 678-567-5642  
Fax: 678-567-5663

vendor name  
and address

INVOICE  
DATE

DATE

2/2/2022

INVOICE

INVOICE #

0000043107

INVOICE NO

CUST #

0000189

**BILL TO:**

Octapharma Plasma, Inc.  
Freezer & HVAC Systems Dept.  
620 N. Baugh Way  
Post Falls ID 83854

**SHIP TO:**

Octapharma Decatur  
4570 A Memorial Drive  
Decatur GA 30032

Ship To Name  
Address

CUSTOMER PO #		TERMS	JOB #	
DECATUR		NET 30 DAYS	1107002	
QUAN	DESCRIPTION	PRICE EACH	AMOUNT	
2.00	Description: Supply room thermostat is completely off 7/2 GP Checked in with management and Eiera for RTU #1 thermostat not reading. Checked operation found control lost power, traced circuit found RTU off at smoke detector above ceiling towels in supply room. Reset smoker detector, checked RTU in operation Trane M# YSC072A4RHA08 S/N 1455107742. Job complete. Labor: 7/2 GP	87.00	174.00	
2.25	Description: Kiera called and advised thermostat is still not working. 7/6 DW Checked in with management, she updated me as the same thing had happened this past Friday, the thermostat has lost power due to smoke detection system tripping and turning unit 7 completely off. Went to supply room which is what unit 7 runs, got access to ceiling and located smoke. Detection box wired into duct work reset and control, unit powered on and system started to run, monitored from roof top unit is functioning as should. After waiting on management to get out of meeting spoke again, found out that roof work has been going on, worker have been on roof top with roof torches and are positive that's what caused the smoke system to trip the sensor for that particular control is right by the duct from the roof easily trigger from the smoke coming from working. Thermostat and unit are running as should. Job complete Labor: 7/6 DW	87.00	195.75	
2.75	Description: Roofers they smoke cigarettes around the units it trips the kill switch on the thermostat. Thermostat for the supply room is still shut off. 7/7 DW Checked in with management, went to thermostat on wall found power out on it, went back to smoke detection sensor in ceiling, reset, system ran for about 10 minutes and smoke sensor tripped again. Got ladder and started wiring inspection, chased down through ceiling all the way from thermostat to unit on roof, no breaks or nicks or short in wire, cleaned sensor inside, return, reset unit ran even shorter period of time before sensor to it out again, verified functions for RTU1 unit when running is working as it should. Went to board in ceiling of smoke detection box found bad, went to roof and bypassed system, unit immediately came on and ran and satisfied at set point of 68 degrees. Part for replacement for smoke detection system is on order. Job incomplete. Labor: 7/7 DW	87.00	239.25	
		Subtotal	\$1,506.96	
		Total	\$1,506.96	
		Payments/Credits	\$0.00	
		Balance Due	\$1,506.96	

All sales and use tax has been paid by the Contractor.

2 pages →



Advanced Commercial  
5290 Tulane Dr SW  
Atlanta GA 30336  
Phone: 678-567-5642  
Fax: 678-567-5663

**INVOICE****DATE**

2/2/2022

**INVOICE #**

0000043107

**CUST #**

0000189

**BILL TO:**

Octapharma Plasma, Inc.  
Freezer & HVAC Systems Dept.  
620 N. Baugh Way  
Post Falls ID 83854

**SHIP TO:**

Octapharma Decatur  
4570 A Memorial Drive  
Decatur GA 30032

CUSTOMER PO #		TERMS	JOB #	
DECATUR		NET 30 DAYS	1107002	
QUAN	DESCRIPTION	PRICE EACH	AMOUNT	
3.50	Description: 7/26 DW Picked up part. Arrived on site checked in with management, went to back room to replace smoke detection box, due to injury was pulled to job. Will follow and finish, part left on site. Job incomplete.	87.00	304.50	
1.25	Labor: 7/26 DW	-87.00	-108.75	
1.00	Description: 8/23 SM Located RTU 1. Located smoke detector needing replaced over rack in storage room. Explained and shown management the predicament, will need to return with 12" a-frame to install. Already took part of rack apart to access. Job incomplete.	87.00	87.00	
1.00	Labor: 8/23 SM	87.00	87.00	
4.25	Description: 9/8 SM Arrived on site and made contact with management. Located smoke detector and got tools and ladder set into place, called fire alarm company to see if anyone was available to come to sight but was told no one was unable to. I had went ahead and changed out smoke detector while leaving unit turned off then called fire alarm company back and was instructed to turn unit on then reset fire alarm panel. I did as instructed and monitored panel and unit. Fire alarm panel had "trouble" flashing for side door pull station, but the red led indicator on smoke detector was still solid showing it was still in alarm. Unit is up and operating. Job complete.	87.00	369.75	
1.00	Labor: 9/8 SM	174.46	174.46	
1.00	SMOKE DETECTOR, PLASTIC, 4-1/2" L	16.00	16.00	
1.00	Freight Charge			
4.50	Description: Check wiring in unit and smoke detector.	87.00	391.50	
4.50	1/27 SM Arrived on site and made contact with management. Located smoke detector in ceiling in the storage area, took video and pics of smoke detector and wiring. I went to access roof to find it locked, so I asked for key and had waited 30 minutes until we found correct key, went to roof to find unit was still bypassed, so I had reviewed schematics to figure out.	-87.00	-391.50	
1.00	Labor: 1/27 SM	55.00	55.00	
1.00	Discount: 2/3 Per TB			
1.00	Truck Charge			

Subtotal	\$1,506.96
Total	\$1,506.96
Payments/Credits	\$0.00
Balance Due	\$1,506.96

All sales and use tax has been paid by the Contractor.

**Dills, Trina**

---

**From:** Clish, Kerry  
**Sent:** Friday, February 25, 2022 1:21 PM  
**To:** Dills, Trina  
**Subject:** EM 1546

Not sure I told you but NWR invoice package EM 1546 is approved, I'll bring it down now.

Kerry

**Kerry J. Clish**  
Director of Facilities  
Octapharma Plasma, Inc.  
10644 Westlake Dr. Charlotte, NC 28273  
Office: 704-654-4685 Cell: 704-806-7460 Fax: 704-654-4700  
[Kerry.clish@octapharma.com](mailto:Kerry.clish@octapharma.com) [www.octapharmaplasma.com](http://www.octapharmaplasma.com)