


Errors and fixes:  
 - TR2 and TR3 are not referenced to GND on the secondary.  
 - 3-pole filter needs to have a lower output Z.  
 - Use 1k resistors and 470nF caps for starters.  
 - TR2 loads the mic ckt too heavily; jump input to output.  
 - Increase R24 to 10k (preference, green LED crazy bright)

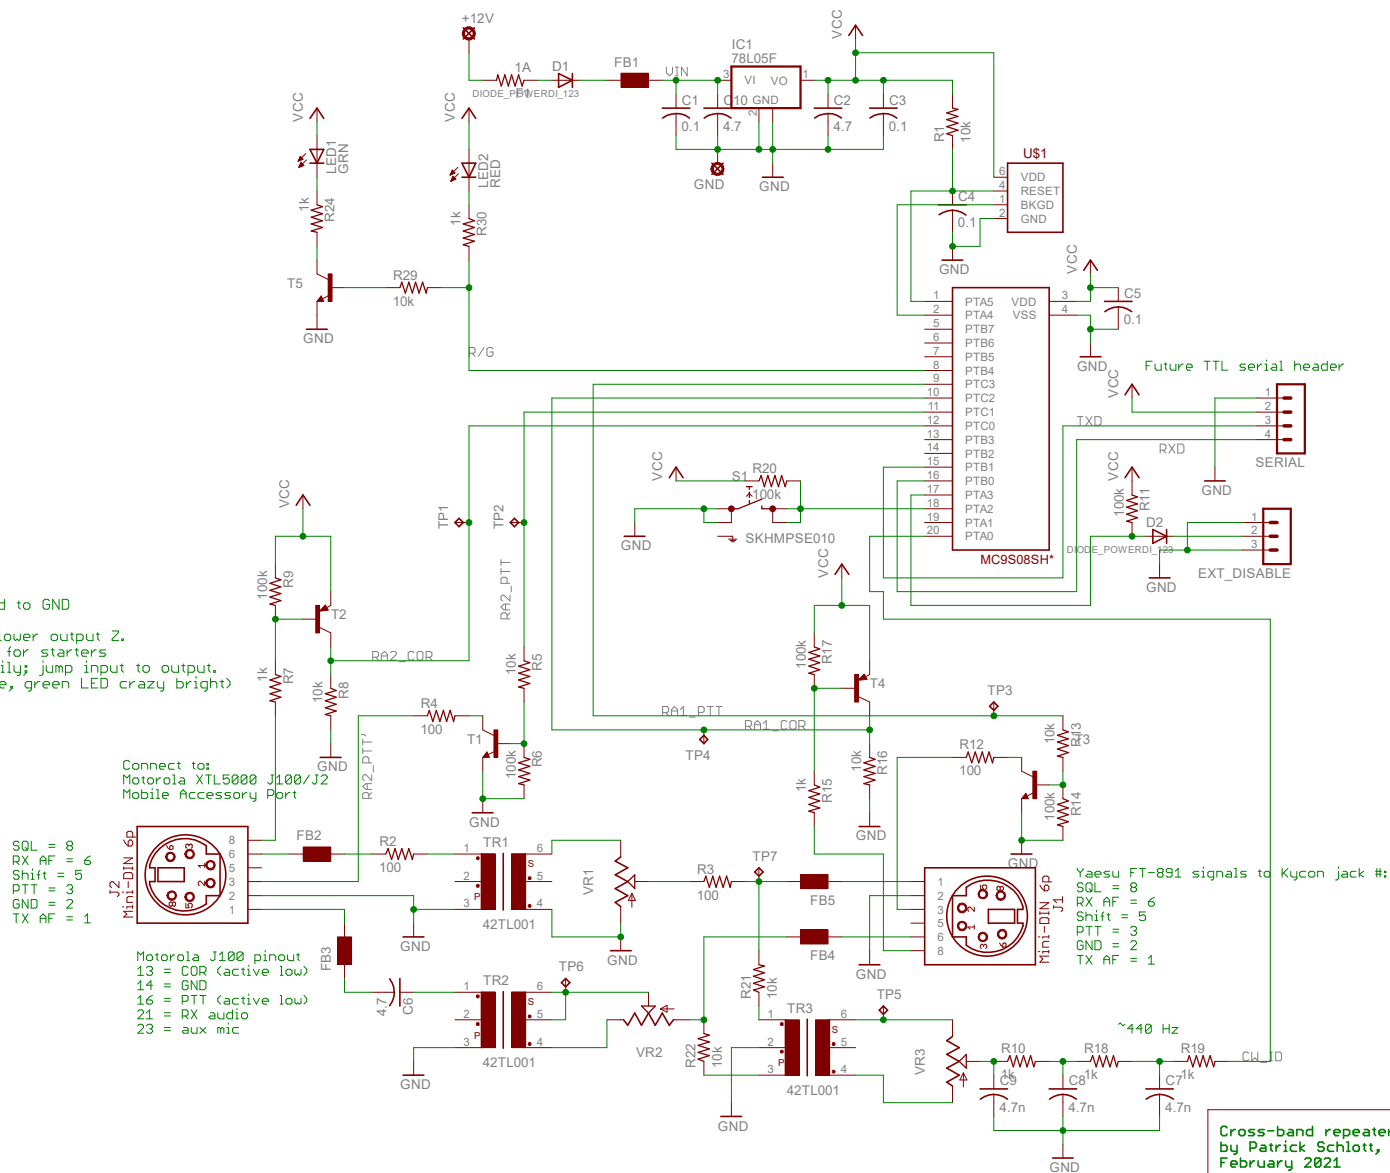

Cross-band repeater controller  
 by Patrick Schlott, KC1DPM  
 February 2021

xbr
2021-04-28 14:26:04
Sheet: 1/1