

Partybox200/300 software version: 38

This upgrade improves:

- Fix audio-sync issue in TWS-mode

Note: this software version 38 is only for units with 2. generation (new) hardware – see below sheet for affected serial number range:

Model	Region	SN Cut in
Partybox 200	EU	TL0698-LI0022086 >>>
	AM	TL0682-LI0003725 >>>
	RU	TL0689-LI0002700 >>>
	IN	TL0687-KI0002450 >>>
	BR	TL0688-LI0003024 >>>
	CN	TL0684-KI0002302 >>>
Partybox 300	EU	TL0699-LI0028825 >>>
	AM	TL0690-LI0002935 >>>
	IN	TL0695-KI0002550 >>>
	BR	TL0696-AJ0005872 >>>
	RU	TL0697-LI0003800 >>>
	CN	TL0692-KI0002591 >>>

Upgrade procedure:

1. Place the “Harman_G15.HUI” file into the root directory of an empty USB-stick.
2. Connect the Partybox to mains power.
3. Power ON the Partybox.
4. Insert the USB-stick into the USB socket placed on the rear side of the Partybox.
5. Press the Volume+ & Bluetooth buttons simultaneously for more than 10 seconds. The unit enters DFU mode and begins the upgrade (All panel LEDs show white constant light).
6. About 7 minutes later, the unit upgrade is complete. The unit may automatic restart after upgrade is completed.

Software check/pronounce:

In power ON mode press the Volume- & Bass-boost buttons simultaneously for more than 2 seconds. The unit pronounces software version by voice (38 12 21)