



MISTAKES OF v1:
 - USD CD was not connected
 - RTC RST (DS1391) causes ESP not to boot.
 Disconnect this signal or use DS1390
 - S2 footprint is wrong

TITLE: LogBoard

AUTHOR: Renan R. Duarte

DOC NUMBER:

DATE: 15/10/2019 15:01

Sheet: 1/1

IC1 (ESP12E) must be configured in DIO SPI mode. To do this, desolder the metal shield, lift pins 3 and 7 of the SPI flash memory chip and connect these pins to pin 8 (3V3).