



SERVICE BULLETIN 236
ISSUED: 11/07/2025

**Mandatory Inspection and Replacement of
Clutch on STTII and SCZII Units**

SUBJECT: Inspect and replace 461826 Electric Clutch.

SITUATION: It has come to our attention that the 461826 Electric Clutch may have been manufactured with the incorrect pulley diameter. This may lead to the incorrect blade tip speed.

SOLUTION: To ensure optimal performance and customer satisfaction we advise that all units within the serial number ranges below be inspected for proper clutch pulley diameter. If the clutch pulley diameter is found to be larger than specification, clutch must be replaced prior to retail of the unit.

Any clutch that is found to be defective must be returned for warranty credit to be issued.

1. Inspect clutch and measure the outside diameter of clutch pulley.
2. Clutch pulley outside diameter should measure 154mm (6.1").
3. If clutch pulley outside diameter measures beyond this and up to 164mm (6.5") replace the electric clutch. Return to Scag Warranty Department for credit.

UNITS

AFFECTED: Machines with a serial number within the following ranges:

MODEL	SERIAL NUMBER RANGE
STTII-72V-40BV-EFI	151D00066 - 151D00086
STTII-61V-38CH-EFI	145D00049 - 145D00085
STTII-72V-38CH-EFI	150D00001 - 150D00036
SCZII-72V-38FX-EFI	137D00001 - 137D00095
SCZII-72V-40BV-EFI	138D00001 - 138D00040
SCZII-72V-38CV-EFI	136D00001 - 136D00020
SCZII-61V-38FX-EFI-BB	184D00097 - 184D00120
SCZII-61V-38FX-EFI-NFT	186D00136 - 186D00224

REQUIRED: 461826 Electric Clutch W/Tag GT5

WARRANTY: Use Failure Code X4-176 for Inspection Only - 0.25 hours labor
Use Failure Code X4-177 for Inspection and Replacement - 0.75 hrs labor