



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

**Bill To:** DAR JANA GROUP

Email  
48 KING ROAD  
6TH FLOOR  
JANA HEIGHTS  
KING RD HAIL AL-BASATEEN  
JEDDAH, KSA 21352

**Payment Type:** Credit Card **Terms:** Due Upon Receipt

**INVOICE SUMMARY FOR WORK ORDER NUMBER:** 43105

**Invoice number:**

**Account code:** 18415A

**P.O. number:**

**Registration #:** VP-CDJ

**Invoice date:**

5575

	Time & Materials	Fiat Rate	Total
<b>Squawk:</b>	---	\$2,500.00	\$2,500.00
<b>Labor:</b>	\$87,292.46	\$395,406.50	\$482,698.96
<b>Parts:</b>	\$243,480.35	\$64,135.00	\$307,615.35
<b>Services:</b>	\$105,258.10	\$20,505.00	\$125,763.10
<b>Total:</b>	<b>\$436,030.91</b>	<b>\$482,546.50</b>	<b>\$918,577.41</b>
<b>Freight:</b>			\$5,675.61
<b>Subtotal:</b>			\$924,253.02
<b>Total:</b>			<b>\$924,253.02</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Item: 1. FALCON 2000

Part/Model #: Falcon 2000

Team Leader:

Serial Number: 148

Time & Materials \$924,253.02

Discrepancy: 1.1. Comply with Preliminary Inspection

Discrepancy: 1.2. Work Order Miscellaneous Charges

	Flat Rate	Total
Squawk:	\$2,500.00	\$2,500.00
Total:	\$2,500.00	\$2,500.00



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.3. Task - 05 08-00-200-800-32 - 2C INSPECTION

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$188,000.00	\$188,000.00
Parts:	\$32,396.78	\$0.00	\$32,396.78
Services:	\$15,753.97	\$0.00	\$15,753.97
Freight:	\$939.62	---	\$939.62
Total:	<b>\$49,090.37</b>	<b>\$188,000.00</b>	<b>\$237,090.37</b>

### Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.3 #1	ALLPRUS-0350-050-0025	AllProtect Nonwoven, 20" W rolls packaged in two packs	0.50	\$0.00	\$0.00
1.3 #2	W932-32B	PACKING	4	\$0.00	\$0.00
1.3 #3	GPG072-5X12S250	PIN	4	\$3.15	\$12.60
1.3 #4	147100-19	SPRING	4	\$30.80	\$123.20
1.3 #5	234-050	FILTER	1	\$723.24	\$723.24
1.3 #6	R05040X353A50D7	SEAL	4	\$14.18	\$56.72
1.3 #7	R07580X353A50D7	PACKING	4	\$19.08	\$76.32
1.3 #8	AC-A767F-415	FILTER	3	\$557.34	\$1,672.02
1.3 #9	AC3255F8Y60	FILTER	5	\$725.90	\$3,629.50
1.3 #10	AC9607F10	FILTER	1	\$884.52	\$884.52
1.3 #11	DIA018NFE21351	SEAL	2	\$151.03	\$302.06
1.3 #12	EN2367-37040	PIN	2	\$8.80	\$100.22
			Freight:	<b>82.62</b>	
1.3 #13	F50B116005005B5	ORING	1	\$178.92	\$178.92
1.3 #14	103-0001-18A800	ORING	2	\$118.00	\$236.00
1.3 #15	FGFB237002052	SEAL	2	\$201.04	\$402.08
1.3 #16	FGFB237001041	SEAL	1	\$211.68	\$211.68
1.3 #17	F2MA237001041	O RING	1	\$197.54	\$197.54
1.3 #18	MS29513-223	PACKING	2	\$1.85	\$3.70
1.3 #19	MS29513-253	ORING	2	\$3.38	\$6.76
1.3 #20	MS28775-211	O RING	3	\$1.20	\$3.60
1.3 #21	MS28775-020	O RING	1	\$1.75	\$1.75
1.3 #22	MS28775-018	O RING	5	\$0.65	\$3.25
1.3 #23	MS28775-011	O-RING	3	\$1.10	\$3.30
1.3 #24	MS28774-211	RETAINER	3	\$0.67	\$2.01
1.3 #25	MICROBMONITOR2	KIT, TEST	1	\$73.00	\$73.00
1.3 #26	F50B331101201A1	RETAINER, NUT	1	\$36.79	\$36.79
1.3 #28	F50B331101201A1	RETAINER, NUT	1	\$36.79	\$36.79
1.3 #29	F50B331101201A1	RETAINER, NUT	2	\$36.79	\$73.58
1.3 #30	F50B331101202A1	RETAINER	2	\$39.65	\$79.30
1.3 #31	F7XC202159106A2	VACCUM TEST FOR PPRV TEST	1	\$1,967.36	\$2,214.03
			Freight:	<b>246.67</b>	
1.3 #32	AV8DME13-50Z	CORROSION INHIBITOR/13.50Z	2	\$50.59	\$227.98
			Freight:	<b>126.80</b>	
1.3 #33	AV30-13-50Z	CORROSION INHIBITOR	2	\$41.74	\$83.48
1.3 #34	F2MA237001041	O RING	1	\$197.54	\$197.54
1.3 #35	FGFB237001041	SEAL	1	\$211.68	\$211.68
1.3 #36	FGFB237002052	SEAL	2	\$181.58	\$363.16
1.3 #37	103-0001-18A800	ORING	2	\$118.00	\$236.00
1.3 #38	103-0001-21A800	ORING	2	\$76.24	\$152.48



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

**Parts:**

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.3 #39	F50B331101201A1	RETAINER, NUT	4	\$36.79	\$147.16
1.3 #41	M81969/14-02	PIN INSERT/EXTRACT, red/white, for #20 contacts	4	\$0.70	\$2.80
1.3 #42	R04100X178A21B6	O RING	2	\$9.39	\$101.40
Freight:			<b>82.62</b>		
1.3 #43	AF85-71	LOCK TAB	4	\$55.32	\$221.28
1.3 #44	3M425-2" 24RL/CS	TAPE, ALUMINUM	2	\$108.93	\$217.86
1.3 #45	5606(GAL)	HYD. FLUID MIL-PRF-5606H (p/n 27007AECN)	1	\$68.73	\$68.73
1.3 #46	75103A244150	BONDING BRAID	1	\$18.77	\$18.77
1.3 #47	BA4709-1	SEAL	6	\$143.93	\$863.58
1.3 #48	MS29512-08	O RING	1	\$2.00	\$2.00
1.3 #49	FGFB295125003A1	PIN RETAINER	2	\$60.92	\$121.84
1.3 #50	FGFB295125005A1	pin retainer	8	\$18.48	\$147.84
1.3 #51	FGFB295123007A1	pin retainer	2	\$63.27	\$126.54
1.3 #52	23350CA050	WASHER, TAB ***notes***	2	\$2.55	\$5.10
1.3 #53	AEROSHELL 7	CARTRIDGE 14 OZ	2	\$33.64	\$67.28
1.3 #54	F2MA271115024	PLATE	2	\$151.34	\$371.61
Freight:			<b>68.93</b>		
1.3 #55	MS9386-160	SEAL	2	\$6.42	\$12.84
1.3 #56	MS9386-170	SEAL	2	\$11.78	\$23.56
1.3 #58	F2MB272631	setting ring	1	\$1,309.10	\$1,309.10
1.3 #59	F2MB272629	friction ring	1	\$1,212.54	\$1,212.54
1.3 #60	950015-0	SEAL	2	\$1,105.16	\$2,210.32
1.3 #61	MS17826-16	nut	2	\$20.96	\$41.92
1.3 #62	MS9386-170	SEAL	1	\$11.78	\$11.78
1.3 #63	TA35	BEARING	2	\$441.00	\$882.00
1.3 #64	WATA40	bearing	1	\$584.50	\$584.50
1.3 #65	WATA30	bearing	1	\$377.58	\$377.58
1.3 #66	MS9386-160	SEAL	1	\$6.42	\$6.42
1.3 #67	FGFB295001473	LOCK WASHER	1	\$129.83	\$129.83
1.3 #68	EN2367-37040	PIN	2	\$8.80	\$17.60
1.3 #69	WATA30	bearing	1	\$377.58	\$481.00
Freight:			<b>103.42</b>		
1.3 #70	WATA40	bearing	1	\$584.50	\$584.50
1.3 #71	F2MB272630001	washer	1	\$77.78	\$77.78
1.3 #72	MS17826-16	nut	2	\$20.96	\$41.92
1.3 #73	F2MB272630001	washer	1	\$77.78	\$77.78
1.3 #74	100031-0	CARBON SEAL	1	\$1,061.20	\$1,061.20
1.3 #76	NAS6403A4D	screw	1	\$31.79	\$106.09
Freight:			<b>74.30</b>		
1.3 #77	PR1422A2 (PT)	SEALER	4	\$193.43	\$773.72
1.3 #78	PR1422B2	SEALANT, 136 GRAM 6 OZ SEMKIT	12	\$109.68	\$1,316.16
1.3 #79	100031-0	CARBON SEAL	1	\$1,146.04	\$1,266.04
Freight:			<b>120.00</b>		
1.3 #80	PAC33	ANTI CORR. PRIMER	1.00	\$805.74	\$805.74
1.3 #83	NAS6403A5D	screw	1	\$16.97	\$16.97
1.3 #85	MS17825-8	NUT,SELF-LOCKING,SLOTTED,HEXAGON	1	\$9.19	\$9.19
1.3 #86	AN960PD1416	WASHER	1	\$3.13	\$3.13
1.3 #88	PR1750B1/2	SEALER/PT KIT/2.5OZ	1	\$91.17	\$91.17
1.3 #89	PR1750B1/2	SEALER/PT KIT/2.5OZ	1	\$91.17	\$91.17
1.3 #90	MS21919WDG4	CLAMP, LOOP TYPE, CUSHIONED	4	\$1.69	\$6.76
1.3 #91	MS21919WDG8	CLAMP	2	\$1.89	\$3.78



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

### Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.3 #92	MS21919WDG5	CLAMP	3	\$1.04	\$3.12
1.3 #93	F50B373003005A1	TAB WASHER	2	\$135.95	\$271.90
1.3 #95	RTV106	SEALANT, HIGH HEAT, TUBE, MIL-A-46106, 06904734MSC	2	\$55.97	\$111.94
1.3 #96	22453BC080LE	nut	1	\$24.55	\$24.55
1.3 #97	NAS673V5XA	SCREW	6	\$4.68	\$28.08
1.3 #98	RTV106	SEALANT, HIGH HEAT, TUBE, MIL-A-46106, 06904734MSC	1	\$55.97	\$55.97
1.3 #99	75103A255140	bonding braid	1	\$18.72	\$52.98
Freight:			<b>34.26</b>		
1.3 #101	5RH8035M	NUT	2	\$2.33	\$4.66
1.3 #102	22208BC050010L	BOLT	2	\$7.30	\$14.60
1.3 #103	MS21059L08	NUT PLATE	2	\$1.27	\$2.54
1.3 #104	MS21059L3	NUTPLATE	2	\$1.24	\$2.48
1.3 #105	PR1422B1/2	SEALANT, 136 GRAM 6 OZ SEMKIT	3	\$100.61	\$301.83
1.3 #106	MS24693-S3	SCREW	40	\$0.30	\$12.00
1.3 #107	MS24693-S4	SCREW	40	\$0.30	\$12.00
1.3 #108	AN960-6	WASHER	8	\$0.25	\$2.00
1.3 #112	PR1422B1/2	SEALANT, 136 GRAM 6 OZ SEMKIT	5	\$100.61	\$503.05
1.3 #113	PR1422A2 (PT)	SEALER	2	\$193.43	\$386.86
1.3 #114	DP100	ADHESIVE, 1.7oz/50ml TUBE, CLEAR (P/N 638060-08994)	1	\$37.14	\$37.14
1.3 #115	DP110	ADHESIVE, CLEAR	1	\$41.36	\$41.36
1.3 #116	EZTURN5OZ	FUEL LUBE	1	\$28.26	\$28.26
1.3 #117	PR1422B2	SEALANT, 136 GRAM 6 OZ SEMKIT	4	\$109.68	\$438.72
1.3 #118	PR1422B2	SEALANT, 136 GRAM 6 OZ SEMKIT	5	\$109.68	\$548.40
1.3 #119	PR1422A2 (PT)	SEALER	2	\$193.43	\$386.86
1.3 #120	MS29513-137	O-RING	8	\$1.83	\$14.64
1.3 #121	KR6-35HS	CLAMP	20	\$1.41	\$28.20
1.3 #122	MS29513-148	O RING	2	\$2.85	\$5.70
1.3 #123	MS29513-150	O RING	2	\$7.67	\$15.34
1.3 #124	MS29513-219	O RING	2	\$1.44	\$2.88
1.3 #125	MS29513-246	O RING	2	\$5.61	\$11.22
1.3 #126	23111DG050A	WASHER	70	\$1.67	\$116.90
1.3 #127	MS29513-010	O RING	2	\$0.75	\$1.50
1.3 #128	NAS517-3-8	SCREW,MACHINE	3	\$0.42	\$1.26
1.3 #129	MY20341-032	TAB WASHER	4	\$100.21	\$400.84
1.3 #130	MY20341-033	TAB WASHER	4	\$87.06	\$348.24
1.3 #131	23350CA080	WASHER, TAB **alt**	2	\$3.10	\$6.20
1.3 #132	MY20341-032	TAB WASHER	1	\$94.98	\$94.98
1.3 #133	MY20341-033	TAB WASHER	1	\$82.52	\$82.52

### Services:

Ref. No.	Description	Quantity	Sell Price	Extended
1.3 #1	NDT	4.00	\$121.09	\$484.36
	Part Ref: F2MA581770015 LINK ROD ASSY			
1.3 #2	NDT	4.00	\$121.09	\$484.36
	Part Ref: F2MA581770017 Link rod assy			
1.3 #4	RESTORATION	1.00	\$14,785.25	\$14,785.25
	Part Ref: 021121-12 STAB ACTUATOR			



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.4. Task - 05 50-00-910-801-01 - ACCOMPLISH AIRCRAFT CHECK FLIGHT

	Flat Rate	Total
Labor:	\$620.00	\$620.00
Total:	\$620.00	\$620.00

Discrepancy: 1.5. Task - 05 60-00-200-801-01 - PERFORM BASIC INSPECTION

Discrepancy: 1.6. Task - 05 60-00-200-801-03 - BASIC INSPECTION - GROUND SERVICING CHECKS

Discrepancy: 1.7. Task - 00-801-07 - BASIC INSPECTION - CABIN WARNING TEST

Discrepancy: 1.8. Task - 72 0010 - NO. 2 ENGINE - PERFORM ENGINE (MPI) MIDPOINT INSPECTION

Discrepancy: 1.9. Task - GACAR Chapter C Requirement, 36 month Weight and Balance of Aircraft.

	Flat Rate	Total
Labor:	\$1,280.00	\$1,280.00
Total:	\$1,280.00	\$1,280.00

Discrepancy: 1.10. Task - 21 52-18-100-801 - CLEAN OF THE HIGH PRESSURE WATER SEPARATOR FILTER

	Flat Rate	Total
Labor:	\$396.00	\$396.00
Total:	\$396.00	\$396.00

Discrepancy: 1.11. Task - 24 32-01-700-801-01 - REGULAR CHECK MAIN BATTERY (NICKEL-CADMIUM BATTERIES ONLY)

	Flat Rate	Total
Labor:	\$132.00	\$132.00
Services:	\$240.00	\$240.00
Total:	\$372.00	\$372.00

Services:

Ref. No.	Description	Quantity
1.11 #1	Regular Check	1.00

Part Ref: 405CH10 BATTERY, NICAD, Saft



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.12. Task - 24 32-09-610-801-01 - SERVICE STAND-BY INSTRUMENT BATTERY

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$132.00	\$132.00
Services:	\$656.25	\$0.00	\$656.25
Total:	<b>\$656.25</b>	<b>\$132.00</b>	<b>\$788.25</b>

## Services:

Ref. No.	Description	Quantity	Sell Price	Extended
1.12 #1	SERVICE	1.00	\$656.25	\$656.25

Part Ref: 804747 ST/BY POWER SUPPLY

Discrepancy: 1.13. Task - 24 32-09-610-801-02 &amp; 24 32-09-610-801-03 - SERVICE NO.1 &amp; NO.2 INERTIAL REFERENCE SYSTEM (IRS) STAND-BY BATTERY

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$264.00	\$264.00
Services:	\$1,312.50	\$0.00	\$1,312.50
Total:	<b>\$1,312.50</b>	<b>\$264.00</b>	<b>\$1,576.50</b>

## Services:

Ref. No.	Description	Quantity	Sell Price	Extended
1.13 #1	SERVICE	1.00	\$656.25	\$656.25
Part Ref: 804747 ST/BY POWER SUPPLY				
1.13 #2	SERVICE	1.00	\$656.25	\$656.25

Part Ref: 804747 ST/BY POWER SUPPLY

Discrepancy: 1.14. Task - 25 61-13-960-801-01 - DISCARD EMERGENCY LOCATOR TRANSMITTER (ELT) BEACON BATTERY PACKS GACA Chap C requirement. OPERATIONAL TEST OF THE EMERGENCY LOCATOR BEACON - SELF-TEST OF ELT 96/97/ADT 406

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$264.00	\$264.00
Parts:	\$3,461.90	\$0.00	\$3,461.90
Freight:	\$126.82	---	\$126.82
Total:	<b>\$3,588.72</b>	<b>\$264.00</b>	<b>\$3,852.72</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.14 #1	02N60052	BATTERY SERVICING KIT	1	\$3,461.90	\$3,588.72

Freight: 126.82

Discrepancy: 1.15. Task - 25 60-00-200-801-03 &amp; 25 6K06 - INSPECT/RECERTIFY FIRST AID KIT

	Flat Rate	Total
Labor:	\$132.00	\$132.00
Total:	<b>\$132.00</b>	<b>\$132.00</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.16. Task - 25 62-01-720-801-01 & 25 62-01-720-801-02 - FUNCTIONAL TEST OF THE FDR / CVR UNDERWATER LOCATOR BEACONS - CVR UNDERWATER LOCATOR BEACON (10FZ1) (P/N 316-6004-005, 316-6004-006, DK100, DK120, DK120/90, DK140, ELP-362D, ELP-362D90)

	Flat Rate	Total
Labor:	\$396.00	\$396.00
Total:	<b>\$396.00</b>	<b>\$396.00</b>

Discrepancy: 1.17. Task - 25 90-03-200-801-02S - INSPECTION OF THE DUAL PASSENGER SEATS

	Flat Rate	Total
Labor:	\$132.00	\$132.00
Total:	<b>\$132.00</b>	<b>\$132.00</b>

Discrepancy: 1.18. Task - 25 90-53-220-801-01S & 25 90-53-220-801-02S - DETAILED INSPECTION OF THE PILOT FLASHLIGHT

	Flat Rate	Total
Labor:	\$66.00	\$66.00
Total:	<b>\$66.00</b>	<b>\$66.00</b>

Discrepancy: 1.19. Task - 26 20-15-720-801-01, 26 20-15-720-801-02 & 26 20-15-720-801-03 - WEIGHING OF THE PORTABLE FIRE EXTINGUISHERS

	Flat Rate	Total
Labor:	\$264.00	\$264.00
Total:	<b>\$264.00</b>	<b>\$264.00</b>

Discrepancy: 1.20. Task - 27 00-00-710-803 - OPERATIONAL TEST OF THE SERVO-ACTUATOR ACCUMULATOR MONITORING LOGIC

	Flat Rate	Total
Labor:	\$132.00	\$132.00
Total:	<b>\$132.00</b>	<b>\$132.00</b>





SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.21. Task - 27 14-01-350-801-01 - RESTORATION ROLL TRIM ACTUATOR (FUNCTIONAL TEST)

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$800.00	\$800.00
Parts:	\$93.64	\$0.00	\$93.64
Services:	\$0.00	\$2,750.00	\$2,750.00
Total:	<b>\$93.64</b>	<b>\$3,550.00</b>	<b>\$3,643.64</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.21 #1	1050340056	TAB LOCK, WASHER	4	\$23.41	\$93.64

## Services:

Ref. No.	Description	Quantity
1.21 #1	RESTORATION	1.00

Part Ref: 021057-37 AILERON TRIM ACTUATOR

Discrepancy: 1.22. Task - 27 14-03-350-801-01 - RESTORATION ROLL EMERGENCY TRIM ACTUATOR

	Flat Rate	Total
Labor:	\$800.00	\$800.00
Services:	\$3,125.00	\$3,125.00
Total:	<b>\$3,925.00</b>	<b>\$3,925.00</b>

## Services:

Ref. No.	Description	Quantity
1.22 #1	RESTORATION	1.00

Part Ref: 021127-01 AILERON EMERGENCY TRIM ACTUATOR

Discrepancy: 1.23. Task - 27 15-05-350-801-01 - RESTORATION ROLL MAIN (AFU) ARTIFICIAL FEEL UNIT

	Flat Rate	Total
Labor:	\$800.00	\$800.00
Services:	\$1,050.00	\$1,050.00
Total:	<b>\$1,850.00</b>	<b>\$1,850.00</b>

## Services:

Ref. No.	Description	Quantity
1.23 #1	RESTORATION	1.00

Part Ref: 105124 AILERON MAIN, AFU



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.24. Task - 27 25-05-350-801-01 - RESTORATION YAW MAIN (AFU) ARTIFICIAL FEEL UNIT

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$480.00	\$480.00
Parts:	\$96.26	\$0.00	\$96.26
Services:	\$0.00	\$1,050.00	\$1,050.00
Total:	<b>\$96.26</b>	<b>\$1,530.00</b>	<b>\$1,626.26</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.24 #1	1050430014	WASHER, LOCK	2	\$48.13	\$96.26

## Services:

Ref. No.	Description	Quantity
1.24 #1	RESTORATION	1.00

Part Ref: 105125-01 RUDDER ARTIFICIAL FEEL UNIT

Discrepancy: 1.25. Task - 27 25-07-350-801-01 - RESTORATION YAW (AAFU) AUXILIARY ARTIFICIAL FEEL UNIT

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$800.00	\$800.00
Parts:	\$91.24	\$0.00	\$91.24
Services:	\$0.00	\$1,080.00	\$1,080.00
Freight:	\$39.87	---	\$39.87
Total:	<b>\$131.11</b>	<b>\$1,880.00</b>	<b>\$2,011.11</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.25 #1	F50B331101201A1	RETAINER, NUT	2	\$45.62	\$131.11

Freight: 39.87

## Services:

Ref. No.	Description	Quantity
1.25 #1	RESTORATION	1.00

Part Ref: 105070-06 RUDDER, AFU

Discrepancy: 1.26. Task - 27 50-00-720-802 - FUNCTIONAL TEST OF THE FLAP ASYMMETRY DETECTION SYSTEM

	Flat Rate	Total
Labor:	\$66.00	\$66.00
Total:	<b>\$66.00</b>	<b>\$66.00</b>

Discrepancy: 1.27. Task - 27 53-01-220-801-01, 27 53-01-220-801-02, 27 53-01-220-801-03, 27 53-01-220-801-04, 27 53-01-220-801-05 &amp; 27 53-01-220-801-06 CLEANING / CHECK OF THE FLAP SCREW JACK ACTUATING SCREWS

	Flat Rate	Total
Labor:	\$640.00	\$640.00
Total:	<b>\$640.00</b>	<b>\$640.00</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.28. Task - 27 53-01-640-803-01, 27 53-01-640-803-02, 27 53-01-640-803-03, 27 53-01-640-803-04, 27 53-01-640-803-05 & 27 53-01-640-803-06 - GREASING OF FLAP SCREW JACKS

	Flat Rate	Total
Labor:	\$640.00	\$640.00
Total:	<b>\$640.00</b>	<b>\$640.00</b>

Discrepancy: 1.29. Task - 28 30-00-680-804-01 - DRAINING WATER FROM THE FUEL TANKS

	Flat Rate	Total
Labor:	\$66.00	\$66.00
Total:	<b>\$66.00</b>	<b>\$66.00</b>

Discrepancy: 1.30. Task - 29 11-01-350-801-01 - RESTORATION NO. 1 ENGINE SYSTEM NO. 1 HYDRAULIC PUMP

	Flat Rate	Total
Labor:	\$480.00	\$480.00
Services:	\$8,100.00	\$8,100.00
Total:	<b>\$8,580.00</b>	<b>\$8,580.00</b>

Services:

Ref. No.	Description	Quantity
1.30 #1	RESTORATION	1.00

Part Ref: 3031749-001 PUMP, HYDRAULIC \*\*\*alt\*\*\*

Discrepancy: 1.31. Task - 29 12-05-710-801-01, 29 12-05-710-801-02 & 29 12-05-710-801-03 - OPERATIONAL TEST OF THE ENGINE HYDRAULIC SYSTEM SHUT-OFF VALVES

	Flat Rate	Total
Labor:	\$396.00	\$396.00
Total:	<b>\$396.00</b>	<b>\$396.00</b>

Discrepancy: 1.32. Task - 29 13-09-960-801-01, 29 13-09-960-801-02, 29 13-09-960-801-03, 29 13-09-960-801-04, 29 13-09-960-801-05, 29 13-09-960-801-06, 29 13-09-960-801-07, 29 13-09-960-801-08 & 29 13-09-960-801-09 - REPLACEMENT OF THE HYDRAULIC FILTERS

Discrepancy: 1.33. Task - 31 54-00-720-801-01 - FUNCTIONAL TEST OF THE TAKE-OFF SAFETIES: ALARM TEST (MANDATORY 5-40)

	Flat Rate	Total
Labor:	\$462.00	\$462.00
Total:	<b>\$462.00</b>	<b>\$462.00</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.34. Task - 32 10-00-640-801 & 32 20-00-640-801 - LUBRICATION OF THE LH/RH/NLG GEAR AND DOORS

	Flat Rate	Total
Labor:	\$660.00	\$660.00
Total:	\$660.00	\$660.00

Discrepancy: 1.35. Task - 32 11-25-220-801-01, 32 11-25-220-801-02, 32 11-25-220-801-03, 32 11-25-220-801-04, 32 21-09-220-801-01, 32 21-09-220-801-02, 32 21-09-220-801-03 & 32 21-09-220-801-04 - DETAILED INSPECTION OF THE MLG/NLG BALL-JOINT BEARINGS AND BEARING BORES

Discrepancy: 1.36. Task - 32 44-00-780-801 - PRESSURE CHECK OF THE MLG AND NLG WHEEL TIRES

	Flat Rate	Total
Labor:	\$132.00	\$132.00
Total:	\$132.00	\$132.00

Discrepancy: 1.37. Task - 33 20-00-200-801 - INSPECTION OF "ALC" LIGHTING TUBES

	Flat Rate	Total
Labor:	\$132.00	\$132.00
Total:	\$132.00	\$132.00

Discrepancy: 1.38. TASK - 33 50-05-350-801-01 & 33 50-05-350-801-02 - OVERHAUL OF THE DME EF-2C RECHARGEABLE FLASHLIGHTS

	Flat Rate	Total
Labor:	\$132.00	\$132.00
Services:	\$1,160.00	\$1,160.00
Total:	\$1,292.00	\$1,292.00

Discrepancy: 1.39. Task - 33 50-37-960-802-01, 33 50-37-960-802-02 & 33 50-37-960-802-03 - DISCARD OF THE EPS BATTERY PACKS

	Flat Rate	Total
Labor:	\$132.00	\$132.00
Services:	\$1,950.00	\$1,950.00
Total:	\$2,082.00	\$2,082.00

#### Services:

Ref. No.	Description	Quantity
1.39 #1	REPLACE BATTERY	1.00
Part Ref:	D734-02-001 EMERG POWER SUPPLY	
1.39 #2	REPLACE BATTERY	1.00
Part Ref:	D734-02-001 EMERG POWER SUPPLY	
1.39 #3	REPLACE BATTERY	1.00
Part Ref:	D734-02-001 EMERG POWER SUPPLY	



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.40. Task - 34 0002 - EGPWS TERRAIN DATABASE UPDATE

	Flat Rate	Total
Labor:	\$198.00	\$198.00
Total:	<b>\$198.00</b>	<b>\$198.00</b>

Discrepancy: 1.41. Task - FAR 91.411/413 - 34 14-01-700-881-01, 34 14-01-700-881-02, 34 16-00-720-801-01, 34 16-00-720-801-02, 34 16-00-720-801-05, 34 23-00-720-801-01, 34 23-00-720-801-02, 34 23-05-700-881-01, 34 25-00-820-801-01, 34 54-00-700-881-01, 34 54-00-700-881-02, 34 54-00-720-802-01 & 34 54-00-720-802-02

	Flat Rate	Total
Labor:	\$3,300.00	\$3,300.00
Total:	<b>\$3,300.00</b>	<b>\$3,300.00</b>

Discrepancy: 1.42. Task - 34 34 - RVSM Inspection control document. RTS to be a separate Log entry to include all RVSM components P/N , S/N, and Release statement to include "Aircraft has been inspected in accordance with RVSM manual # B-046-1, and F 2000 AMM Chap 5. Is approved for return to RVSM service."

Discrepancy: 1.43. Task - 35 30-05-210-801-01 - GENERAL VISUAL INSPECTION NO. 1 PORTABLE OXYGEN BOTTLE

	Flat Rate	Total
Labor:	\$132.00	\$132.00
Total:	<b>\$132.00</b>	<b>\$132.00</b>

Discrepancy: 1.44. Task - 38 10-00-670-801-01 - STERILIZATION OF THE POTABLE WATER SYSTEM

	Flat Rate	Total
Labor:	\$396.00	\$396.00
Total:	<b>\$396.00</b>	<b>\$396.00</b>

Discrepancy: 1.45. Task - 51 00-00-200-802-01 - INSPECTION OF CORROSION INHIBITOR COMPOUND DURING 24 M OR 1600 FH INSPECTION (CPCP)

Discrepancy: 1.46. Task - 51 00-00-200-803-01 - INSPECTION OF CORROSION INHIBITOR COMPOUND DURING 1C INSPECTION

	Flat Rate	Total
Labor:	\$132.00	\$132.00
Total:	<b>\$132.00</b>	<b>\$132.00</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.47. Task - 52 20-00-610-801-01 &amp; 52 20-00-610-801-02 - SERVICING OF THE EMERGENCY EXIT DOOR - TEST OF THE EMERGENCY EXIT DOOR UNLOCKING FROM INSIDE THE CABIN

	Flat Rate	Total
Labor:	\$198.00	\$198.00
Total:	<b>\$198.00</b>	<b>\$198.00</b>

Discrepancy: 1.48. Task - 55 30-00-270-801 - ULTRASONIC INSPECTION OF THE VERTICAL STABILIZER / STUB ATTACHMENTS

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$400.00	\$400.00
Services:	\$3,281.25	\$0.00	\$3,281.25
Total:	<b>\$3,281.25</b>	<b>\$400.00</b>	<b>\$3,681.25</b>

## Services:

Ref. No.	Description	Quantity	Sell Price	Extended
1.48 #1	NDT	1.00	\$3,281.25	\$3,281.25

Discrepancy: 1.49. Task - 55 10-00-270-801 - ULTRASONIC INSPECTION OF THE HORIZONTAL STABILIZER HINGE FITTINGS

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$660.00	\$660.00
Services:	\$3,281.25	\$0.00	\$3,281.25
Total:	<b>\$3,281.25</b>	<b>\$660.00</b>	<b>\$3,941.25</b>

## Services:

Ref. No.	Description	Quantity	Sell Price	Extended
1.49 #1	NDT	1.00	\$3,281.25	\$3,281.25

Discrepancy: 1.50. Task - 57 00-00-210-801-03 &amp; 57 00-00-210-801-04 - GENERAL VISUAL INSPECTION OF THE WINGS ANTI-ICING SYSTEM

Discrepancy: 1.51. Task - 73 40-00-700-801 - TEST OF THE AUTOMATIC POWER RESERVE (APR) INDICATION

	Flat Rate	Total
Labor:	\$206.25	\$206.25
Total:	<b>\$206.25</b>	<b>\$206.25</b>

Discrepancy: 1.52. Task - 78 31-00-640-802-01 - GREASING OF THE THRUST REVERSER DOOR HINGE BOLTS

	Flat Rate	Total
Labor:	\$396.00	\$396.00
Total:	<b>\$396.00</b>	<b>\$396.00</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.53. Task - 79 3010 - NO. 2 ENGINE - DISCARD OIL FILTER ELEMENT

	Flat Rate	Total
Labor:	\$132.00	\$132.00
Total:	<b>\$132.00</b>	<b>\$132.00</b>

Discrepancy: 1.54. Task - 80 10-05-700-801-01 &amp; 80 10-05-700-801-02 OIL LEVEL CHECK OF THE LH/RH ENGINE PNEUMATIC STARTER

	Flat Rate	Total
Labor:	\$132.00	\$132.00
Total:	<b>\$132.00</b>	<b>\$132.00</b>

Discrepancy: 1.55. Task - AD 1999-25-09 AMD - PERFORM HINGE PIN ASSEMBLIES OF HORIZONTAL STABILIZER DIMENSIONAL CHECK HORIZONTAL STABILIZER HINGE PIN ASSEMBLIES

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$1,980.00	\$1,980.00
Parts:	\$3,358.89	\$0.00	\$3,358.89
Freight:	\$246.67	---	\$246.67
Total:	<b>\$3,605.56</b>	<b>\$1,980.00</b>	<b>\$5,585.56</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.55 #2	FGFB955501	MEASURMENT TOOL	1	\$3,358.89	\$3,605.56

Freight: **246.67**

Discrepancy: 1.56. Task - AD 2008-04-14 - OVERWING EMERGENCY EXIT - OPERATIONAL TEST AND INSPECTION

	Flat Rate	Total
Labor:	\$660.00	\$660.00
Total:	<b>\$660.00</b>	<b>\$660.00</b>

Discrepancy: 1.57. Task - AD 2016-09-03 - EQUIPMENT/FURNISHINGS - REPLACE EACH SPRING HAVING PART NUMBER (P/N) 132100-19 AND P/N 147100-19 INSTALLED ON THE PILOT AND CO-PILOT SEATS WITH A SPRING AS SPECIFIED (FOR AIRPLANES THAT HAVE ACCUMULATED MORE THAN 3,750 TOTAL FLIGHT CYCLES OR HAVE EXCEEDED 74 MONTHS SINCE THE AIRPLANE'S FIRST FLIGHT. EFFECTIVE DATE OF THIS AD)

	Flat Rate	Total
Labor:	\$371.25	\$371.25
Total:	<b>\$371.25</b>	<b>\$371.25</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.58. Investigate APU oil leak.

	Time & Materials	Total
Labor:	\$4,449.23	\$4,449.23
Parts:	\$288.15	\$288.15
Total:	<b>\$4,737.38</b>	<b>\$4,737.38</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.58 #1	M83248-1-905	PACKING	1	\$2.00	\$2.00
1.58 #2	F10A705200011A1	SEAL	1	\$163.24	\$163.24
1.58 #3	MOBILJETOIL254	SYNTH ENGINE OIL	3	\$40.97	\$122.91

## Services:

Ref. No.	Description	Quantity	Sell Price	Extended
1.58 #1	Evaluation	1.00	\$0.00	\$0.00

Part Ref: 3800548-2 p-200

Discrepancy: 1.59. Troubleshoot oven inop (suspect controller)

	Time & Materials	Total
Labor:	\$485.10	\$485.10
Parts:	\$1,935.00	\$1,935.00
Services:	\$2,187.50	\$2,187.50
Freight:	\$40.38	\$40.38
Total:	<b>\$4,647.98</b>	<b>\$4,647.98</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.59 #1	119-0232	TIMP RESISTER	1	\$245.00	\$245.00
1.59 #2	400-0929-01	OVEN CONTROLLER	1	\$1,690.00	\$1,690.00

## Services:

Ref. No.	Description	Quantity	Sell Price	Extended
1.59 #1	REPAIR	1.00	\$0.00	\$0.00

Part Ref: 400-0929-03 OVEN CONTROLLER

1.59 #2	REPAIR	1.00	\$2,187.50	\$2,227.88
---------	--------	------	------------	------------

Part Ref: 1539-IM-OH ELECTRIC OVEN

Freight: 40.38

Discrepancy: 1.60. Galley ice drawer (top) inop. Will not close fully.

	Flat Rate	Total
Labor:	\$330.00	\$330.00
Total:	<b>\$330.00</b>	<b>\$330.00</b>





SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.61. Fwd cabin pocket door will not deploy

	Time & Materials	Total
Parts:	\$446.40	\$446.40
Total:	\$446.40	\$446.40

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.61 #1	15-DM13	#13 X 3/4 COBALT THREADED DRILL BIT	30	\$14.88	\$446.40

Discrepancy: 1.62. Ops check before interior removal - water system, sewer system, lighting, audio/video systems, electrical and airflow.

	Time & Materials	Total
Labor:	\$707.85	\$707.85
Total:	\$707.85	\$707.85

Discrepancy: 1.63. Ops check after interior install - water system, sewer system, lighting, audio/video systems, electrical and airflow.

Discrepancy: 1.64. Headliner panel above jumpseat is falling and has a missing fastener.

Discrepancy: 1.65. LH #1 personal monitor is inop.

Resolution: Hold per customer

Discrepancy: 1.66. RH #1 personal monitor is inop.

Resolution: Hold per customer

Discrepancy: 1.67. LH #2 personal monitor has no video.

Resolution: Hold per customer

Discrepancy: 1.68. DVD player will not eject.

Resolution: Hold per customer

Discrepancy: 1.69. Center EIED screen damaged.

	Time & Materials	Total
Parts:	\$37,500.00	\$37,500.00
Total:	\$37,500.00	\$37,500.00

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.69 #1	C14000DB06	EIED - Engine Indicator Electronic Display	1	\$37,500.00	\$37,500.00

Discrepancy: 1.70. FDR and CVR ULBs expire September 2025



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.71. No MDC information available. MDC battery was last replaced in 2013.

	Time & Materials	Total
Labor:	\$169.95	\$169.95
Total:	<b>\$169.95</b>	<b>\$169.95</b>

Discrepancy: 1.72. Excessive leak in Co-Pilot static air system.

	Time & Materials	Total
Labor:	\$617.10	\$617.10
Parts:	\$120.39	\$120.39
Total:	<b>\$737.49</b>	<b>\$737.49</b>

Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.72 #1	900000	BLOCK DRAIN	1	\$120.39	\$120.39

Discrepancy: 1.73. LH aileron servo shows signs of leakage

Discrepancy: 1.74. RH level light on overhead inop.

Discrepancy: 1.75. MED side fairings cracked.

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$2,145.00	\$2,145.00
Parts:	\$10,053.82	\$0.00	\$10,053.82
Total:	<b>\$10,053.82</b>	<b>\$2,145.00</b>	<b>\$12,198.82</b>

Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.75 #1	FGFB295011010D3	fairing, fwd	1	\$4,634.50	\$4,634.50
1.75 #2	FGFB295011020D3	fairing, Aft	1	\$4,687.80	\$4,687.80
1.75 #3	NAS517V2-8XF	SCREW	20	\$33.09	\$661.80
1.75 #4	MS27039BV7XF	SCREW	12	\$5.81	\$69.72

Discrepancy: 1.76. LH pressure plate has paint damage and corrosion directly in front of it.

	Flat Rate	Total
Labor:	\$495.00	\$495.00
Total:	<b>\$495.00</b>	<b>\$495.00</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.77. RH overwing anti-ice tube has blown out grommet.

	Time & Materials	Total
Labor:	\$620.40	\$620.40
Parts:	\$164.50	\$164.50
Total:	<b>\$784.90</b>	<b>\$784.90</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.77 #1	F2MA724351100	BUSHING	1	\$164.50	\$164.50

Discrepancy: 1.78. RH fuselage has several spots of missing and bubbling paint.

	Flat Rate	Total
Labor:	\$1,650.00	\$1,650.00
Total:	<b>\$1,650.00</b>	<b>\$1,650.00</b>

Discrepancy: 1.79. LH and RH pylon leading edges have bad fairing seals (Pylon to fuselage sealant)

	Time & Materials	Total
Labor:	\$747.45	\$747.45
Parts:	\$37.14	\$37.14
Total:	<b>\$784.59</b>	<b>\$784.59</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.79 #1	DP100	ADHESIVE, 1.7oz/50ml TUBE, CLEAR (P/N 638060-08994)	1	\$37.14	\$37.14

Discrepancy: 1.80. Upper antennas have bad sealer.

	Time & Materials	Total
Labor:	\$1,399.20	\$1,399.20
Parts:	\$1,502.22	\$1,502.22
Freight:	\$17.00	\$17.00
Total:	<b>\$2,918.42</b>	<b>\$2,918.42</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.80 #1	NAS1611-153	O RING	1	\$1.98	\$1.98
1.80 #2	AG822000-08	GASKET	1	\$630.00	\$630.00
1.80 #3	AG477000-56	GASKET	2	\$435.12	\$887.24
Freight:			<b>17.00</b>		



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.81. LH wingtip lense cover cracked.

	Time & Materials	Total
Labor:	\$176.55	\$176.55
Parts:	\$6,166.41	\$6,166.41
Total:	<b>\$6,342.96</b>	<b>\$6,342.96</b>

Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.81 #1	SPSF900-12-1-0	LIGHT ASSY, FAIRING L/H ***alt***	1	\$6,154.20	\$6,154.20
1.81 #2	DC732 WHITE	RTV WHITE SILICONE, MIL-A-46106	1	\$12.21	\$12.21

Discrepancy: 1.82. LH inboard and outboard flaps failed lateral play check.

	Time & Materials	Total
Labor:	\$978.45	\$978.45
Parts:	\$3,705.28	\$3,705.28
Freight:	\$34.40	\$34.40
Total:	<b>\$4,718.13</b>	<b>\$4,718.13</b>

Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.82 #1	OB45142	STOP	6	\$145.24	\$871.44
1.82 #2	F50B957603	tool for flap roller peg replacement	1	\$1,090.96	\$1,090.96
1.82 #3	OB45142	STOP	6	\$145.24	\$871.44
1.82 #4	OB45142	STOP	6	\$145.24	\$905.84
			Freight:	<b>34.40</b>	

Discrepancy: 1.83. Upper Satcom tail panel shows signs of impact.

Discrepancy: 1.84. #4 brake wear down to 2mm (70 Landings)

	Flat Rate	Total
Labor:	\$825.00	\$825.00
Total:	<b>\$825.00</b>	<b>\$825.00</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.85. Numerous fasteners need to be extracted and replace

	Time & Materials	Total
Labor:	\$1,971.75	\$1,971.75
Parts:	\$609.29	\$609.29
Freight:	\$222.63	\$222.63
Total:	<b>\$2,803.67</b>	<b>\$2,803.67</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.85 #1	NAS1153V2A	SCREW	25	\$9.30	\$267.05
			Freight:	<b>34.55</b>	
1.85 #2	NAS1153V3A	SCREW	25	\$5.27	\$131.75
1.85 #3	NAS1153V4A	SCREW	25	\$3.58	\$89.50
1.85 #4	AN173-4A	BOLT	4	\$4.05	\$98.82
			Freight:	<b>82.62</b>	
1.85 #5	MS27039-1-17	SCREW, MACHINE, PAN HEAD	4	\$0.52	\$2.08
1.85 #6	MS27039-1-18	SCREW, MACHINE, PAN HEAD	2	\$0.75	\$1.50
1.85 #7	22208BC040012L	SCREW	1	\$46.50	\$112.37
			Freight:	<b>65.87</b>	
1.85 #9	NAS1726-4D	NUT	1	\$9.73	\$9.73
1.85 #11	NAS1149F0463P	WASHER	3	\$0.17	\$0.51
1.85 #12	33411TX080035XA	PIN	2	\$39.51	\$118.61
			Freight:	<b>39.59</b>	

Discrepancy: 1.86. Portable Oxygen Bottle: Oxygen bottle expiration date missing.

Discrepancy: 1.87. Secure armrest covers for LH and RH Pilot seats.

Discrepancy: 1.88. LH and RH Pilot Smoke Goggles: Velcro is worn out. Resecure Velcro for the smoke goggle bags.

	Flat Rate	Total
Labor:	\$247.50	\$247.50
Total:	<b>\$247.50</b>	<b>\$247.50</b>

Discrepancy: 1.89. Cabin Entry: Velcro to secure rug/carpet is worn or detached.

	Flat Rate	Total
Labor:	\$288.75	\$288.75
Total:	<b>\$288.75</b>	<b>\$288.75</b>

Discrepancy: 1.90. Evaluate and Repair Customer Interior LH side behind Seat #3: Panel has small detail in the wall cover.

	Flat Rate	Total
Labor:	\$330.00	\$330.00
Total:	<b>\$330.00</b>	<b>\$330.00</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.91. Evaluate and Repair Customer Interior Club Table: Some wood work pieces missing in the table.

	Flat Rate	Total
Labor:	\$1,980.00	\$1,980.00
Parts:	\$250.00	\$250.00
Total:	<b>\$2,230.00</b>	<b>\$2,230.00</b>

Discrepancy: 1.92. Evaluate and Repair Customer Interior: Seat #10 aisle light lens is loose.

	Flat Rate	Total
Labor:	\$206.25	\$206.25
Total:	<b>\$206.25</b>	<b>\$206.25</b>

Discrepancy: 1.93. Evaluate and Repair Customer Interior: The finish on all window screen tabs worn.

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$1,155.00	\$1,155.00
Services:	\$1,530.00	\$0.00	\$1,530.00
Freight:	\$35.14	---	\$35.14
Total:	<b>\$1,565.14</b>	<b>\$1,155.00</b>	<b>\$2,720.14</b>

## Services:

Ref. No.	Description	Quantity	Sell Price	Extended
1.93 #1	REPLATE	1.00	\$1,530.00	\$1,565.14
		Freight:	<b>35.14</b>	
1.93 #2	COLOR MATCH ONLY	1.00	\$0.00	\$0.00

Discrepancy: 1.94. Evaluate and Repair Customer Interior: Lav Door Secure Latch stuck in the "open" position.

	Flat Rate	Total
Labor:	\$247.50	\$247.50
Total:	<b>\$247.50</b>	<b>\$247.50</b>

Discrepancy: 1.95. Evaluate and Repair Customer Interior: Lav lower drawer interior panel detached and needs secured.

	Flat Rate	Total
Labor:	\$330.00	\$330.00
Total:	<b>\$330.00</b>	<b>\$330.00</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.96. Evaluate and Repair Customer Interior: Interior side of Lav Door damaged.

	Flat Rate	Total
Labor:	\$1,980.00	\$1,980.00
Parts:	\$250.00	\$250.00
Total:	<b>\$2,230.00</b>	<b>\$2,230.00</b>

Discrepancy: 1.97. Evaluate and Repair Customer Interior: Cargo rug/carpet detached from water service panel and needs secured.

	Flat Rate	Total
Labor:	\$288.75	\$288.75
Total:	<b>\$288.75</b>	<b>\$288.75</b>

Discrepancy: 1.98. Aircraft Exterior: Radome lighting strips partially detached and need secured.

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$4,950.00	\$4,950.00
Parts:	\$4,026.40	\$0.00	\$4,026.40
Freight:	\$37.51	---	\$37.51
Total:	<b>\$4,063.91</b>	<b>\$4,950.00</b>	<b>\$9,013.91</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.98 #2	LSRLWAH-0150	LIGHTENING ARREST STRIP	4	\$507.64	\$2,068.07
			Freight:	<b>37.51</b>	
1.98 #3	LSRLWAH-0185	LIGHTENING ARREST STRIP	2	\$644.28	\$1,288.56
1.98 #4	LSRLWAH-0195	LIGHTENING ARREST STRIP	1	\$707.28	\$707.28

Discrepancy: 1.99. Aircraft Placards are worn or missing.

Discrepancy: 1.100. LH aileron inboard bonding braid broken

	Time & Materials	Total
Labor:	\$193.05	\$193.05
Parts:	\$15.02	\$15.02
Total:	<b>\$208.07</b>	<b>\$208.07</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.100 #1	75103A244100	BONDING WIRE	1	\$15.02	\$15.02



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.101. Numerous spots of corrosion on LH upper and lower wing surfaces.

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$4,125.00	\$4,125.00
Parts:	\$96.83	\$0.00	\$96.83
Total:	<b>\$96.83</b>	<b>\$4,125.00</b>	<b>\$4,221.83</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.101 #1	PR1422B1/2-2.5OZ	SEALANT, 136 GRAM 2.5 OZ SEMKIT	1	\$96.83	\$96.83

Discrepancy: 1.102. Numerous spots of corrosion on RH upper and lower wing surfaces.

	Flat Rate	Total
Labor:	\$5,775.00	\$5,775.00
Total:	<b>\$5,775.00</b>	<b>\$5,775.00</b>

Discrepancy: 1.103. RH #1 and #3 slat actuators show signs of leakage.

Discrepancy: 1.104. LH wing TE has hydraulic leak at #2 aileron servo return line.

	Time & Materials	Total
Labor:	\$1,621.95	\$1,621.95
Parts:	\$10,532.60	\$10,532.60
Freight:	\$1,459.12	\$1,459.12
Total:	<b>\$13,613.67</b>	<b>\$13,613.67</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.104 #1	F50B755252A2	PIPE	1	\$3,355.30	\$3,355.30
1.104 #2	F50B755253	LINE	1	\$3,822.00	\$5,281.12
		Freight:	<b>1,459.12</b>		
1.104 #3	F50B755252A2	PIPE	1	\$3,355.30	\$3,355.30





SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.105. Heat exchanger flange corroded and multiple fasteners corroded.

	Time & Materials	Total
Labor:	\$1,824.90	\$1,824.90
Parts:	\$196.80	\$196.80
Freight:	\$25.11	\$25.11
Total:	<b>\$2,046.81</b>	<b>\$2,046.81</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.105 #1	W932-32B	PACKING	1	\$95.46	\$95.46
1.105 #2	AN960PD10L	WASHER	15	\$0.08	\$1.20
1.105 #3	R05040X353A50D7	SEAL	3	\$14.18	\$67.65
		Freight:	<b>25.11</b>		
1.105 #4	NAS673V3XF	BOLT	15	\$3.84	\$57.60

Discrepancy: 1.106. Broken bonding braid on heat exchanger.

	Time & Materials	Total
Parts:	\$20.12	\$20.12
Total:	<b>\$20.12</b>	<b>\$20.12</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.106 #1	75103255180	BONDING BRAID	1	\$20.12	\$20.12

Discrepancy: 1.107. FSC floor panel 320BZ has 2 broken fasteners

Discrepancy: 1.108. FSC aft bulkhead panel has impact damage.

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$3,300.00	\$3,300.00
Parts:	\$2,636.76	\$0.00	\$2,636.76
Freight:	\$299.96	---	\$299.96
Total:	<b>\$2,936.72</b>	<b>\$3,300.00</b>	<b>\$6,236.72</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.108 #1	LY5052	ARALDITE RESIN, KG	1	\$1,385.16	\$1,535.14
		Freight:	<b>149.98</b>		
1.108 #2	HY5052	ARALDITE HARDENER	1	\$1,181.60	\$1,331.58
		Freight:	<b>149.98</b>		
1.108 #3	HAZ MAT CHARGE	HAZ MAT CHARGE	2	\$35.00	\$70.00

Discrepancy: 1.109. Galley tambour door switches cut-off switches inop.

Discrepancy: 1.110. Fwd work station light intermittent.



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.111. Galley fwd cabinet missing center hinge hardware

Discrepancy: 1.112. Fwd galley display light cracked surround plate.

Discrepancy: 1.113. LH entertainment closet upper vent screen missing.

Discrepancy: 1.114. LH entertainment closet doors sticking and do not open or close properly.

Discrepancy: 1.115. RH fwd table edges delaminated.

Discrepancy: 1.116. LH fwd table does not operate properly.

Discrepancy: 1.117. RH #4 pax seat aisle light broken off.

Discrepancy: 1.118. LH aft double seat tracking lever inop

Discrepancy: 1.119. RH aft window liner cracked.

Discrepancy: 1.120. DV window sun visor broken

Discrepancy: 1.121. Pilots shield light inop

Discrepancy: 1.122. Pilot and Co-Pilot seats have broken arm rests

Discrepancy: 1.123. Oxygen leaking

Discrepancy: 1.124. RH lateral/aft windshield scratched on inside.

	Flat Rate	Total
Labor:	\$330.00	\$330.00
Total:	\$330.00	\$330.00

Discrepancy: 1.125. LH and RH center windshields have burnt edges and are crazed.

	Flat Rate	Total
Labor:	\$288.75	\$288.75
Total:	\$288.75	\$288.75



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.126. Hydraulic stow-away kit in ASC has disbonded storage bumpers

	Flat Rate	Total
Labor:	\$371.25	\$371.25
Total:	<b>\$371.25</b>	<b>\$371.25</b>

Discrepancy: 1.127. Two refueling valves corroded (in snake pit)

	Flat Rate	Total
Labor:	\$1,320.00	\$1,320.00
Total:	<b>\$1,320.00</b>	<b>\$1,320.00</b>

Discrepancy: 1.128. LH outboard flap has gouged and worn Teflon paint.

	Flat Rate	Total
Labor:	\$825.00	\$825.00
Total:	<b>\$825.00</b>	<b>\$825.00</b>

Discrepancy: 1.129. All four aileron brushes worn

	Time & Materials	Total
Labor:	\$1,244.10	\$1,244.10
Parts:	\$3,854.48	\$3,854.48
Freight:	\$968.71	\$968.71
Total:	<b>\$6,067.29</b>	<b>\$6,067.29</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.129 #1	F50B114000253B2	BRUSH (L/H)	1	\$1,019.62	\$1,868.33
			Freight:	<b>848.71</b>	
1.129 #2	F50B124000253B2	BRUSH (R/H)	1	\$1,019.62	\$1,139.62
			Freight:	<b>120.00</b>	
1.129 #3	F50B113020011B2	BRUSH	1	\$907.62	\$907.62
1.129 #4	F50B123020011B2	BRUSH, R/H	1	\$907.62	\$907.62

Discrepancy: 1.130. RH flap actuators have siezed eye bushings

	Time & Materials	Total
Labor:	\$891.00	\$891.00
Total:	<b>\$891.00</b>	<b>\$891.00</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.131. Nutplate on fuselage fairing 186AR has bad rivet.

	Time & Materials	Total
Labor:	\$1,034.55	\$1,034.55
Total:	<b>\$1,034.55</b>	<b>\$1,034.55</b>

Discrepancy: 1.132. Disabled panel spacers on panel 312AR

	Time & Materials	Total
Labor:	\$3,052.50	\$3,052.50
Total:	<b>\$3,052.50</b>	<b>\$3,052.50</b>

Discrepancy: 1.133. Corrosion LH fuselage Fr. 4 around stand-by pitot probe.

	Time & Materials	Total
Labor:	\$1,183.05	\$1,183.05
Total:	<b>\$1,183.05</b>	<b>\$1,183.05</b>

Discrepancy: 1.134. Marked corrosion RH fwd fuselage at Fr. 1 and Fr. 3

	Flat Rate	Total
Labor:	\$4,950.00	\$4,950.00
Total:	<b>\$4,950.00</b>	<b>\$4,950.00</b>

Discrepancy: 1.135. Lower RH pylon panel 442BB broken.

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$13,200.00	\$13,200.00
Parts:	\$3,344.40	\$0.00	\$3,344.40
Freight:	\$42.97	---	\$42.97
Total:	<b>\$3,387.37</b>	<b>\$13,200.00</b>	<b>\$16,587.37</b>

Discrepancy: 1.136. #1 and #2 engine heat shields corroded.

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.136 #1	NAS1921M04S02WU	RIVET	4	\$4.88	\$19.52
1.136 #2	F2MA581453001	SEAL	1	\$1,713.40	\$1,756.37
			Freight:	<b>42.97</b>	
1.136 #3	PAC33	ANTI CORR. PRIMER	1.00	\$805.74	\$805.74
1.136 #4	PAC33	ANTI CORR. PRIMER	1.00	\$805.74	\$805.74



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.137. T/R buckets corroded (both sides)

	Flat Rate	Total
Labor:	\$4,950.00	\$4,950.00
Parts:	\$1,200.00	\$1,200.00
Total:	\$6,150.00	\$6,150.00

Parts:

Ref. No.	Part number:	Description	Quantity
1.137 #1	PAC33	ANTI CORR. PRIMER	1.00

Discrepancy: 1.138. Several screws are leaking on LH plank.



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.139. RH and LH engine inlets have loose and broken fasteners and are corroded.

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$23,100.00	\$23,100.00
Parts:	\$9,958.28	\$0.00	\$9,958.28
Services:	\$1,437.50	\$0.00	\$1,437.50
Freight:	\$143.79	---	\$143.79
Total:	<b>\$11,539.57</b>	<b>\$23,100.00</b>	<b>\$34,639.57</b>

### Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.139 #1	816068ESQT	PAINT, SLATE GREY PEARL, QT	1	\$503.16	\$503.16
1.139 #2	570-596 GAL	PAINT, BAC707 GRAY (GAL)	1	\$631.72	\$643.63
			Freight:	<b>11.91</b>	
1.139 #3	3M425-2" 24RL/CS	TAPE, ALUMINUM	1	\$108.93	\$108.93
1.139 #4	NAS1919M04S03WU	RIVET	6	\$3.72	\$22.32
1.139 #5	F2MA581138-001	ANGLE	2	\$656.46	\$1,432.92
			Freight:	<b>120.00</b>	
1.139 #6	F2MA581155002	ANGLE	1	\$872.62	\$872.62
1.139 #7	PAC33	ANTI CORR. PRIMER	1.00	\$805.74	\$805.74
1.139 #8	PR1750B2	SEALANT 6 OZ SEMKIT/CLASS B, AMS3276	1	\$120.45	\$120.45
1.139 #9	NAS1919M04S03WU	RIVET	40	\$5.67	\$226.80
1.139 #10	PR1750B1/2(6OZ)	SEALER	4	\$109.43	\$437.72
1.139 #11	NAS1919M04S02WU	RIVET	18	\$0.00	\$0.00
1.139 #12	NAS1919M04S06WU	RIVET, HUCK	3	\$10.43	\$31.29
1.139 #13	NAS1919M04S02WU	RIVET	657	\$4.12	\$2,706.84
1.139 #14	NAS1919M04S06WU	RIVET, HUCK	17	\$10.85	\$184.45
1.139 #15	MS21075L3	NUTPLATE	1	\$0.70	\$0.70
1.139 #16	AF404	AXALTA MATTERHORN WHITE (AF402-EP) IMRON	1	\$127.46	\$139.34
			Freight:	<b>11.88</b>	
1.139 #17	MS21075L3	NUTPLATE	10	\$0.70	\$7.00
1.139 #18	NAS1919M04S05WU	RIVET	20	\$3.97	\$79.40
1.139 #19	F2MA581131005	SPRING	1	\$460.88	\$460.88
1.139 #20	NAS1919M04S04	RIVET,BLIND	20	\$3.55	\$71.00
1.139 #21	NAS1921M04S02WU	RIVET	20	\$0.00	\$0.00
1.139 #22	MS21075L3	NUTPLATE	9	\$0.70	\$6.30
1.139 #23	NAS1581C3T3	SCREW/OFFSET	1	\$1.13	\$1.13
1.139 #24	NAS1169C8L	WASHER, DIMPLE	6	\$0.28	\$1.68
1.139 #25	NAS1919M04S08WU	RIVET, BLIND	12	\$19.07	\$228.84
1.139 #26	NAS1473A3	DOME NUT PLATE	2	\$5.13	\$10.26
1.139 #27	NAS1919M04S04	RIVET,BLIND	20	\$3.55	\$71.00
1.139 #28	2024-0.050BARE	ALUMINUM	1	\$12.50	\$12.50
1.139 #29	PR1750B1/2(6OZ)	SEALER	1	\$109.43	\$109.43
1.139 #30	PAC33	ANTI CORR. PRIMER	1.00	\$805.74	\$805.74

### Services:

Ref. No.	Description	Quantity	Sell Price	Extended
1.139 #1	Heat Treat	1.00	\$1,437.50	\$1,437.50

Part Ref: F2MA581100809 AIR INTAKE



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.140. LH airbrake panels 571CT, 571AT and 561AT are corroded.

	Flat Rate	Total
Labor:	\$1,320.00	\$1,320.00
Total:	<b>\$1,320.00</b>	<b>\$1,320.00</b>

Discrepancy: 1.141. LH telescopic duct and hardware corroded.

	Time & Materials	Total
Labor:	\$965.25	\$965.25
Parts:	\$181.64	\$181.64
Total:	<b>\$1,146.89</b>	<b>\$1,146.89</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.141 #1	W932-24B	SEAL	2	\$86.80	\$173.60
1.141 #2	R04095X262A50D7	O RING	1	\$8.04	\$8.04

Discrepancy: 1.142. RH telescopic duct and hardware corroded.

	Time & Materials	Total
Labor:	\$151.80	\$151.80
Total:	<b>\$151.80</b>	<b>\$151.80</b>

Discrepancy: 1.143. RH fuel cap has corrosion cap.

	Flat Rate	Total
Labor:	\$495.00	\$495.00
Total:	<b>\$495.00</b>	<b>\$495.00</b>

Discrepancy: 1.144. Park brake valve assy is leaking fluid.

Discrepancy: 1.145. LG control valve 150CM in LH gear well is leaking fluid.

Discrepancy: 1.146. RH tank pressure line bonding braid clamp is corroded.

Discrepancy: 1.147. LH fuselage Fr. 22 terminal block and hardware corroded (155JN, 151JN, 153JN)

	Flat Rate	Total
Labor:	\$825.00	\$825.00
Total:	<b>\$825.00</b>	<b>\$825.00</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.148. RH fuselage Fr. 22 terminal block and hardware corroded (152JN, 154JN, 156JN)

	Flat Rate	Total
Labor:	\$742.50	\$742.50
Total:	\$742.50	\$742.50

Discrepancy: 1.149. Perform repair of front engine mount bores. RH and LH pylon

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$28,050.00	\$28,050.00
Parts:	\$0.00	\$1,200.00	\$1,200.00
Services:	\$375.00	\$0.00	\$375.00
Total:	\$375.00	\$29,250.00	\$29,625.00

## Parts:

Ref. No.	Part number:	Description	Quantity
1.149 #1	F2MA257021001SL	BUSHING	2
1.149 #2	2735A615	Cobalt Steel Round-Shank Reamer 17 mm Reamer Diameter	2
1.149 #3	96977A523	Press-Fit Drill Bushing with Head, 17 mm ID, 26 mm OD, 24 mm Long	2
1.149 #4	76559731	Chucking Reamer: 0.6800" Dia, Straight-Cylindrical Shank, Carbide-Tipped	2
1.149 #5	96977A511	15mm DRILL BUSHING	1
1.149 #6	2735A613	15mm REAMER	1

## Services:

Ref. No.	Description	Quantity	Sell Price	Extended
1.149 #1	EDDY CURRENT CHECK OF ENGINE MOUNT BORES	1.00	\$375.00	\$375.00

Discrepancy: 1.150. APU inlet wiring harness ground corroded.

	Time & Materials	Total
Labor:	\$618.75	\$618.75
Total:	\$618.75	\$618.75

Discrepancy: 1.151. APU has multiple spots of corrosion. Clamps, excitor box, brackets.

	Time & Materials	Total
Labor:	\$280.50	\$280.50
Parts:	\$4.13	\$4.13
Total:	\$284.63	\$284.63

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.151 #1	MS21919WDG11	CLAMP	1	\$2.05	\$2.05
1.151 #2	MS21919WDG5	CLAMP	2	\$1.04	\$2.08





SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.152. APU combustion flange corroded and leaking.

Discrepancy: 1.153. APU hobbs meter broken

	Time & Materials	Total
Labor:	\$440.55	\$440.55
Total:	<b>\$440.55</b>	<b>\$440.55</b>

Discrepancy: 1.154. #1 and #2 hydraulic reservoir show signs of multiple leaks.

Discrepancy: 1.155. Stand-by pump leaking fluid.

Discrepancy: 1.156. LH and RH hydraulic manifolds have multiple leaks.

Discrepancy: 1.157. CVR and flight recorder mounts worn out and loose.

Discrepancy: 1.158. Acceleration contacts have paint damage.

	Time & Materials	Total
Labor:	\$384.45	\$384.45
Total:	<b>\$384.45</b>	<b>\$384.45</b>

Discrepancy: 1.159. Stand-by pump handle lanyard missing

	Time & Materials	Total
Labor:	\$366.30	\$366.30
Parts:	\$9,135.67	\$9,135.67
Freight:	\$69.41	\$69.41
Total:	<b>\$9,571.38</b>	<b>\$9,571.38</b>

### Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.159 #1	23340AK1020LE	pin	1	\$23.67	\$93.08
			Freight:	<b>69.41</b>	
1.159 #2	F2MA740522010	cable	1	\$9,101.25	\$9,101.25
1.159 #3	AN173-3ATXXF	screw	1	\$5.01	\$5.01
1.159 #4	NAS1149F0332P	WASHER	1	\$0.35	\$0.35
1.159 #5	HW17-3DF	NUT	1	\$5.39	\$5.39

Discrepancy: 1.160. Water accumulator tank clamps corroded and need safetied.

	Time & Materials	Total
Labor:	\$397.65	\$397.65
Total:	<b>\$397.65</b>	<b>\$397.65</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.161. Turbo compressor and clamps corroded.

	Time & Materials	Total
Labor:	\$602.25	\$602.25
Total:	<b>\$602.25</b>	<b>\$602.25</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.161 #1	3511A020000	TRB COMPRESSOR	1	\$0.00	\$0.00

Discrepancy: 1.162. Ladder storage rack corroded and has loose and worn abrasion strips.

	Fiat Rate	Total
Labor:	\$495.00	\$495.00
Total:	<b>\$495.00</b>	<b>\$495.00</b>

Discrepancy: 1.163. Hot air valve from heat exchanger has corroded mounting hardware.

Discrepancy: 1.164. Multiple bonding braids broken in FSC on air conditioning pipes.

	Time & Materials	Total
Parts:	\$20.13	\$20.13
Total:	<b>\$20.13</b>	<b>\$20.13</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.164 #1	75103-255160	bonding braid	1	\$20.13	\$20.13

Discrepancy: 1.165. FSC to ASC upper partition coming loose, needs new Velcro

	Time & Materials	Total
Labor:	\$793.65	\$793.65
Total:	<b>\$793.65</b>	<b>\$793.65</b>

Discrepancy: 1.166. LH and RH gravity refueling port has corroded hardware.



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.167. All galley hardware corroded and inserts

	Flat Rate	Total
Labor:	\$2,640.00	\$2,640.00
Parts:	\$225.00	\$225.00
Total:	<b>\$2,865.00</b>	<b>\$2,865.00</b>

## Parts:

Ref. No.	Part number:	Description	Quantity
1.167 #1	NAS1836-3-07	INSERT	2
1.167 #2	SL604-3-250S	INSERT	11
1.167 #3	NAS1836-3-9	INSERT	1

Discrepancy: 1.168. RH towbar bushing broken off of NLG leg

	Time & Materials	Total
Labor:	\$120.45	\$120.45
Parts:	\$1,354.36	\$1,354.36
Freight:	\$31.80	\$31.80
Total:	<b>\$1,506.61</b>	<b>\$1,506.61</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.168 #1	D62685	BUSHING	1	\$1,329.90	\$1,361.70
			Freight:	<b>31.80</b>	
1.168 #2	88043-15-04	RING	1	\$24.46	\$24.46

Discrepancy: 1.169. Upper and lower wing recesses have chipped paint and need touched up.

Discrepancy: 1.170. Lwr windshield panel 222BT has disbonded shim.

	Time & Materials	Total
Labor:	\$140.25	\$140.25
Total:	<b>\$140.25</b>	<b>\$140.25</b>

Discrepancy: 1.171. Lwr windshield panel 222AT has corrosion

	Flat Rate	Total
Labor:	\$1,650.00	\$1,650.00
Total:	<b>\$1,650.00</b>	<b>\$1,650.00</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.172. Corrosion on window frame around LH windshield wiper

	Flat Rate	Total
Labor:	\$1,402.50	\$1,402.50
Total:	<b>\$1,402.50</b>	<b>\$1,402.50</b>

Discrepancy: 1.173. Corrosion on lwr RH windshield frame at Fr. 3

	Flat Rate	Total
Labor:	\$495.00	\$495.00
Total:	<b>\$495.00</b>	<b>\$495.00</b>

Discrepancy: 1.174. RH and LH wing tanks have heavy contamination and corrosion

	Time & Materials	Total
Labor:	\$396.00	\$396.00
Services:	\$69,237.50	\$69,237.50
Total:	<b>\$69,633.50</b>	<b>\$69,633.50</b>

## Services:

Ref. No.	Description	Quantity	Sell Price	Extended
1.174 #1	Inspect and repair	1.00	\$52,031.25	\$52,031.25
1.174 #2	Inspect and repair	1.00	\$17,206.25	\$17,206.25

Discrepancy: 1.175. Fwd NLG door links have corroded hardware.

	Time & Materials	Total
Labor:	\$605.55	\$605.55
Total:	<b>\$605.55</b>	<b>\$605.55</b>

Discrepancy: 1.176. NLG RH fwd door prox switch and bracket corroded.

	Flat Rate	Total
Labor:	\$495.00	\$495.00
Total:	<b>\$495.00</b>	<b>\$495.00</b>

Discrepancy: 1.177. NLG RH and LH latch hardware corroded.



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.178. RH fwd NLG seal ripped.

	Time & Materials	Total
Parts:	\$291.06	\$291.06
Total:	<b>\$291.06</b>	<b>\$291.06</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.178 #1	7452B452PRF91	SEAL	1	\$291.06	\$291.06

Discrepancy: 1.179. Multiple hydraulic lines in NLG well corroded.

	Time & Materials	Total
Parts:	\$7,124.00	\$7,124.00
Total:	<b>\$7,124.00</b>	<b>\$7,124.00</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.179 #1	GA58325-1	PIPE ASSEMBLY	1	\$3,562.00	\$3,562.00
1.179 #2	GA58326-1	pipe assy.	1	\$3,562.00	\$3,562.00

Discrepancy: 1.180. NLG follow-up door links corroded.

	Time & Materials	Total
Labor:	\$1,666.50	\$1,666.50
Parts:	\$11,099.06	\$11,099.06
Total:	<b>\$12,765.56</b>	<b>\$12,765.56</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.180 #1	F50B291510	Eye End	2	\$3,139.50	\$6,279.00
1.180 #2	GLS10-19	BALL STUD	4	\$131.36	\$525.44
1.180 #3	22436BC100LE	nut	2	\$16.17	\$32.34
1.180 #4	31650AC100TA	TAB WASHER	4	\$14.69	\$58.76
1.180 #6	22435BC100LE	nut	2	\$16.17	\$32.34
1.180 #7	31650AC100TA	TAB WASHER	2	\$14.69	\$29.38
1.180 #8	FGFB291500001	rod	2	\$2,070.90	\$4,141.80

Discrepancy: 1.181. NLG steering pin corroded

	Time & Materials	Total
Parts:	\$6,929.34	\$6,929.34
Total:	<b>\$6,929.34</b>	<b>\$6,929.34</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.181 #1	GA58268	PIN ASSY, LUBRICATING	1	\$6,250.00	\$6,250.00
1.181 #2	282101	WASHER, MARKING	1	\$12.56	\$12.56
1.181 #3	SP115	NIPPLE ***SEE ALT****	1	\$24.18	\$24.18
1.181 #4	D66072	NUT	1	\$642.60	\$642.60



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.182. Taxi light bezel corroded

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$2,640.00	\$2,640.00
Parts:	\$19.20	\$0.00	\$19.20
Total:	<b>\$19.20</b>	<b>\$2,640.00</b>	<b>\$2,659.20</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.182 #1	4168792	SCREW	1	\$11.67	\$11.67
1.182 #2	3PA108	NUT ***alt***	1	\$7.53	\$7.53

Discrepancy: 1.183. Corroded cannon plug connector 55P LH gear well

	Time & Materials	Total
Labor:	\$838.20	\$838.20
Total:	<b>\$838.20</b>	<b>\$838.20</b>

Discrepancy: 1.184. Pressure switch L141GC corroded. LH gear well

	Time & Materials	Total
Labor:	\$1,173.15	\$1,173.15
Total:	<b>\$1,173.15</b>	<b>\$1,173.15</b>

Discrepancy: 1.185. Fwd and aft servo valves show signs of leakage. LH gear well

Discrepancy: 1.186. LH gear outboard door corroded on outboard side.

	Flat Rate	Total
Labor:	\$206.25	\$206.25
Total:	<b>\$206.25</b>	<b>\$206.25</b>

Discrepancy: 1.187. RH gear outboard door corroded on outboard side.

	Flat Rate	Total
Labor:	\$247.50	\$247.50
Total:	<b>\$247.50</b>	<b>\$247.50</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.188. LH inboard flap control rod bracket corroded

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$2,475.00	\$2,475.00
Parts:	\$128.13	\$0.00	\$128.13
Total:	<b>\$128.13</b>	<b>\$2,475.00</b>	<b>\$2,603.13</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.188 #1	PREVAL267	PREVAL SPRAY UNIT W/ BOTTLE	2	\$9.35	\$18.70
1.188 #2	PR1750B1/2(6OZ)	SEALER	1	\$109.43	\$109.43

Discrepancy: 1.189. RH inboard amd outboard flaps have surface corrosion.

	Flat Rate	Total
Labor:	\$5,775.00	\$5,775.00
Total:	<b>\$5,775.00</b>	<b>\$5,775.00</b>

Discrepancy: 1.190. LH inboard and outboard flaps have surface corrosion.

	Flat Rate	Total
Labor:	\$6,600.00	\$6,600.00
Total:	<b>\$6,600.00</b>	<b>\$6,600.00</b>

Discrepancy: 1.191. Aft belly panel 310AB missing spacer

Discrepancy: 1.192. LH and RH flap junction areas have missing and gouged Teflon paint.

	Flat Rate	Total
Labor:	\$330.00	\$330.00
Total:	<b>\$330.00</b>	<b>\$330.00</b>

Discrepancy: 1.193. LH center wing L60QS fuel probe corroded.

	Time & Materials	Total
Labor:	\$221.10	\$221.10
Parts:	\$4,412.20	\$4,412.20
Freight:	\$150.60	\$150.60
Total:	<b>\$4,783.90</b>	<b>\$4,783.90</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.193 #1	768342-3	FUEL PROBE, CENTERWING	1	\$4,407.00	\$4,557.60
			Freight:	<b>150.60</b>	
1.193 #2	MS29513-137	O-RING	5	\$1.04	\$5.20



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.194. Panel mount between Fr. 13-14 on belly corroded.

Discrepancy: 1.195. Fasteners on LH belly stringer corroded Fr. 12-14.

	Flat Rate	Total
Labor:	\$1,072.50	\$1,072.50
Total:	<b>\$1,072.50</b>	<b>\$1,072.50</b>

Discrepancy: 1.196. Corrosion spots, LH and RH interior side of airframe directly in front of fuel tank in belly panel 140BZ

	Flat Rate	Total
Labor:	\$1,072.50	\$1,072.50
Total:	<b>\$1,072.50</b>	<b>\$1,072.50</b>

Discrepancy: 1.197. TCAS antenna on door 170AB has corroded doubler

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$660.00	\$660.00
Parts:	\$631.98	\$0.00	\$631.98
Total:	<b>\$631.98</b>	<b>\$660.00</b>	<b>\$1,291.98</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.197 #1	NAS1611-153	O RING	1	\$1.98	\$1.98
1.197 #2	AG822000-08	GASKET	1	\$630.00	\$630.00

Discrepancy: 1.198. Corrosion on stringer inboard LH belly at Fr. 15

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$1,980.00	\$1,980.00
Parts:	\$18.40	\$0.00	\$18.40
Total:	<b>\$18.40</b>	<b>\$1,980.00</b>	<b>\$1,998.40</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.198 #1	MS21075L3	NUTPLATE	12	\$0.70	\$8.40
1.198 #2	MS21059L3	NUTPLATE	10	\$1.00	\$10.00

Discrepancy: 1.199. Metal contact strip aft side of door 170AB (Snake Pit) on stringer corroded.

	Flat Rate	Total
Labor:	\$330.00	\$330.00
Total:	<b>\$330.00</b>	<b>\$330.00</b>





SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.200. Fuselage stringers/ribs/frames and mounts corroded in areas aft of LH and RH wings.

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$3,300.00	\$3,300.00
Parts:	\$201.22	\$0.00	\$201.22
Total:	\$201.22	\$3,300.00	\$3,501.22

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.200 #1	PR1422B1/2	SEALANT, 136 GRAM 6 OZ SEMKIT	2	\$100.61	\$201.22

Discrepancy: 1.201. LH and RH overwing anti-ice ducts heatshields have corrosion.

	Flat Rate	Total
Labor:	\$247.50	\$247.50
Total:	\$247.50	\$247.50

Discrepancy: 1.202. Large spots of corrosion on rib fillet at Fr. 23 LH side.

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$4,125.00	\$4,125.00
Parts:	\$205.14	\$0.00	\$205.14
Total:	\$205.14	\$4,125.00	\$4,330.14

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.202 #1	1445846	ALODINE PEN/BONDERITE TOUCH AND PREP PEN	1	\$189.14	\$189.14
1.202 #2	MS21059L3	NUTPLATE	16	\$1.00	\$16.00

Discrepancy: 1.203. LH and RH (Fwd and Aft) feeder tanks have some contamination.

	Time & Materials	Total
Labor:	\$3,321.45	\$3,321.45
Parts:	\$84.40	\$84.40
Total:	\$3,405.85	\$3,405.85

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.203 #1	23112DG060A	WASHER	40	\$2.11	\$84.40

Discrepancy: 1.204. Heat exchanger exhaust duct corroded.

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.204 #1	F2MA721540A2	VENTURI	1	\$0.00	\$0.00



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.205. Valve 80HP failed cabin altitude limitation check (5 times)

	Time & Materials	Total
Labor:	\$704.55	\$704.55
Parts:	\$18.36	\$18.36
Services:	\$6,205.38	\$6,205.38
Total:	<b>\$6,928.29</b>	<b>\$6,928.29</b>

Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.205 #3	R14450X300A31B6	O RING	1	\$17.87	\$17.87
1.205 #4	36160	TERMINAL END	1	\$0.49	\$0.49

Services:

Ref. No.	Description	Quantity	Sell Price	Extended
1.205 #1	OVERHAUL	1.00	\$6,205.38	\$6,205.38

Part Ref: 2099N031300 OUTFLOW VALVE

Discrepancy: 1.206. RH flap rod R9410CF has bad inboard yoke.

	Time & Materials	Total
Parts:	\$945.28	\$945.28
Total:	<b>\$945.28</b>	<b>\$945.28</b>

Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.206 #4	54266	YOKE	1	\$945.28	\$945.28



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.207. Overwing anti-ice pipes and couplings corroded both sides.

	Time & Materials	Total
Labor:	\$1,885.95	\$1,885.95
Parts:	\$9,498.93	\$9,498.93
Freight:	\$194.30	\$194.30
Total:	<b>\$11,579.18</b>	<b>\$11,579.18</b>

Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.207 #1	460-300	PERI-SEAL	8	\$119.35	\$954.80
1.207 #2	W932-24B	SEAL	4	\$86.80	\$347.20
1.207 #3	490-300	PERI-SEAL	8	\$133.30	\$1,066.40
1.207 #4	BA4709-2	O-RING	12	\$161.84	\$2,016.38
		Freight:	<b>74.30</b>		
1.207 #5	BA4709-3	PACKING	12	\$233.66	\$2,803.92
1.207 #6	R03747X533A61D6	SEAL	4	\$17.34	\$69.36
1.207 #7	MS29513-325	O RING	4	\$1.44	\$5.76
1.207 #8	R02500X353A61D6	packing	2	\$26.55	\$173.10
		Freight:	<b>120.00</b>		
1.207 #9	BA4709-2	O-RING	6	\$161.84	\$971.04
1.207 #10	BA4709-3	PACKING	2	\$233.66	\$467.32
1.207 #11	DC732 WHITE	RTV WHITE SILICONE, MIL-A-46106	1	\$12.21	\$12.21
1.207 #12	PAC33	ANTI CORR. PRIMER	1.00	\$805.74	\$805.74

Discrepancy: 1.208. LH upper wing panel 351DT

Discrepancy: 1.209. LH aileron bonding braid broken

	Time & Materials	Total
Parts:	\$58.47	\$58.47
Total:	<b>\$58.47</b>	<b>\$58.47</b>

Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.209 #1	75103A244100	BONDING WIRE	1	\$15.02	\$15.02
1.209 #2	23111BC040LE	WASHER ***alt***	1	\$1.07	\$1.07
1.209 #3	22208BC040012LE	screw	1	\$42.38	\$42.38

Discrepancy: 1.210. LH aileron has numerous spots of surface corrosion.

	Time & Materials	Total
Labor:	\$727.65	\$727.65
Total:	<b>\$727.65</b>	<b>\$727.65</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.211. LH elevator has numerous spots of surface corrosion.

	Time & Materials	Total
Labor:	\$930.60	\$930.60
Total:	<b>\$930.60</b>	<b>\$930.60</b>

Discrepancy: 1.212. RH elevator has numerous spots of surface corrosion.

	Time & Materials	Total
Labor:	\$697.95	\$697.95
Total:	<b>\$697.95</b>	<b>\$697.95</b>

Discrepancy: 1.213. Obtain reproductions of the original completion Avionics and Electrical wiring diagrams, as well as the Supplemental IPC.

	Time & Materials	Total
Parts:	\$8,515.00	\$8,515.00
Total:	<b>\$8,515.00</b>	<b>\$8,515.00</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.213 #1	SUPPLEMENTAL ILLUSTRATED PARTS CATALOG	Supplemental Illustrated Parts Catalog for Falcon 2000 s/n 148	1	\$2,860.00	\$2,860.00
1.213 #2	SUPPLEMENTAL WIRING DIAGRAM MANUAL	Supplemental Wiring Diagram Manual for Falcon 2000 s/n 148	1	\$5,655.00	\$5,655.00

Discrepancy: 1.214. Rudder hinge close-out panels have light surface corrosion

	Flat Rate	Total
Labor:	\$330.00	\$330.00
Total:	<b>\$330.00</b>	<b>\$330.00</b>

Discrepancy: 1.215. Rudder corroded.

	Flat Rate	Total
Labor:	\$2,475.00	\$2,475.00
Parts:	\$300.00	\$300.00
Total:	<b>\$2,775.00</b>	<b>\$2,775.00</b>

Discrepancy: 1.216. LH horizontal leading edge corroded.

	Time & Materials	Total
Labor:	\$1,947.00	\$1,947.00
Total:	<b>\$1,947.00</b>	<b>\$1,947.00</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.217. RH horizontal LE corroded and full of FOD

	Time & Materials	Total
Labor:	\$1,211.10	\$1,211.10
Total:	<b>\$1,211.10</b>	<b>\$1,211.10</b>

Discrepancy: 1.218. LH afterbody corroded.

	Flat Rate	Total
Labor:	\$1,320.00	\$1,320.00
Total:	<b>\$1,320.00</b>	<b>\$1,320.00</b>

Discrepancy: 1.219. RH afterbody corroded.

	Flat Rate	Total
Labor:	\$1,320.00	\$1,320.00
Total:	<b>\$1,320.00</b>	<b>\$1,320.00</b>

Discrepancy: 1.220. Vertical LE corroded.

	Flat Rate	Total
Labor:	\$1,980.00	\$1,980.00
Total:	<b>\$1,980.00</b>	<b>\$1,980.00</b>

Discrepancy: 1.221. Corrosion LH fuselage at Fr. 0 around standby static port.

	Flat Rate	Total
Labor:	\$825.00	\$825.00
Total:	<b>\$825.00</b>	<b>\$825.00</b>

Discrepancy: 1.222. MED airstairs Fr. 5 fairing and Fr.7 fairing (side fairings) cracked

	Flat Rate	Total
Labor:	\$4,950.00	\$4,950.00
Total:	<b>\$4,950.00</b>	<b>\$4,950.00</b>

Discrepancy: 1.223. Standing water in belly of aircraft



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.224. Upper MED corroded in grey band

	Time & Materials	Total
Labor:	\$965.25	\$965.25
Total:	\$965.25	\$965.25

Discrepancy: 1.225. IRU rack at Fr. 6 aft knurled knob attaching screw broken. (IRU 3)

Discrepancy: 1.226. LH outboard DLE has corrosion on LE and underside.

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$660.00	\$660.00
Parts:	\$1,846.64	\$0.00	\$1,846.64
Total:	\$1,846.64	\$660.00	\$2,506.64

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.226 #1	3M31486	PAD, SANDING, 6"INTERFACE HOOK IT/50CT 600 GRIT (REPLACEMENT FOR 3M30761)	4	\$98.36	\$393.44
1.226 #2	3M30670-7	6 IN SANDING DISC, 800 GRIT, HOOKIT	4	\$121.10	\$484.40
1.226 #3	3M30669	SANDING DISCS, HOOKIT, 6", 1000G, 50/BX	4	\$121.10	\$484.40
1.226 #4	3M30668-4	6 IN SANDING DISC, 1200 GRIT, HOOKIT	4	\$121.10	\$484.40

Discrepancy: 1.227. LH inboard fixed LE has oxidation

Discrepancy: 1.228. RH outboard DLE has corrosion inboard and underside.

	Flat Rate	Total
Labor:	\$660.00	\$660.00
Total:	\$660.00	\$660.00

Discrepancy: 1.229. RH fixed LE has corrosion inboard.

	Flat Rate	Total
Labor:	\$1,650.00	\$1,650.00
Total:	\$1,650.00	\$1,650.00

Discrepancy: 1.230. Upper vertical LE has corrosion on LH side.



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.231. Upper rudder bearing bad.

	Time & Materials	Total
Labor:	\$140.25	\$140.25
Parts:	\$418.88	\$418.88
Total:	<b>\$559.13</b>	<b>\$559.13</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.231 #1	WKN8E	BEARING	1	\$418.88	\$418.88

Discrepancy: 1.232. Lower rudder mount attach fitting corroded (exfoliated)

	Time & Materials	Flat Rate	Total
Labor:	\$0.00	\$9,900.00	\$9,900.00
Parts:	\$14,273.21	\$0.00	\$14,273.21
Freight:	\$162.72	---	\$162.72
Total:	<b>\$14,435.93</b>	<b>\$9,900.00</b>	<b>\$24,335.93</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.232 #1	FGFB311031B1	BEARING ASSEMBLY	1	\$13,950.00	\$14,070.00
		Freight:	<b>120.00</b>		
1.232 #2	22201TX05011XF	SCREW	15	\$5.47	\$124.77
		Freight:	<b>42.72</b>		
1.232 #3	22201TX05012XF	SCREW	15	\$4.71	\$70.65
1.232 #4	4RH8035M	SELF LOCKING NUT	30	\$2.33	\$69.90
1.232 #5	PR1422B1/2	SEALANT, 136 GRAM 6 OZ SEMKIT	1	\$100.61	\$100.61

Discrepancy: 1.233. LH outboard elevator bearing bad

	Time & Materials	Total
Parts:	\$499.80	\$499.80
Total:	<b>\$499.80</b>	<b>\$499.80</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.233 #1	WK8FESP1	BEARING	1	\$499.80	\$499.80

Discrepancy: 1.234. Both lower plugs corroded and seized LH lower horizontal

	Time & Materials	Total
Labor:	\$702.90	\$702.90
Parts:	\$306.60	\$306.60
Total:	<b>\$1,009.50</b>	<b>\$1,009.50</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.234 #1	MY20331-6402	PLUG (VERT)	2	\$153.30	\$306.60



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.235. Both bearings bad for RH elevator

	Time & Materials	Total
Labor:	\$615.45	\$615.45
Parts:	\$999.60	\$999.60
Freight:	\$31.78	\$31.78
Total:	<b>\$1,646.83</b>	<b>\$1,646.83</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.235 #1	WK8FESP1	BEARING	2	\$499.80	\$1,031.38

Freight: **31.78**

Discrepancy: 1.236. Both plugs corroded and seized RH vertical stab

	Time & Materials	Total
Labor:	\$207.90	\$207.90
Parts:	\$306.60	\$306.60
Total:	<b>\$514.50</b>	<b>\$514.50</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.236 #1	MY20331-6402	PLUG (VERT)	2	\$153.30	\$306.60

Discrepancy: 1.237. Both lower plugs corroded and seized RH lower horizontal.

	Time & Materials	Total
Labor:	\$386.10	\$386.10
Parts:	\$306.60	\$306.60
Freight:	\$34.40	\$34.40
Total:	<b>\$727.10</b>	<b>\$727.10</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.237 #1	MY20331-6402	PLUG (VERT)	2	\$153.30	\$341.00

Freight: **34.40**

Discrepancy: 1.238. Pitch Aux AFU corroded.

	Time & Materials	Total
Parts:	\$6,250.00	\$6,250.00
Total:	<b>\$6,250.00</b>	<b>\$6,250.00</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.238 #1	105045-13	AFU, AUX PITCH *** Alt ***	1	\$6,250.00	\$6,250.00

Discrepancy: 1.239. Upper tailcone delaminated.





SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.240. APU cradle mount corroded.

	Time & Materials	Total
Labor:	\$278.85	\$278.85
Total:	\$278.85	\$278.85

Discrepancy: 1.241. RH outboard elevator attach point corroded.

	Flat Rate	Total
Labor:	\$1,155.00	\$1,155.00
Total:	\$1,155.00	\$1,155.00

Discrepancy: 1.242. Radome lightening arrestors disbonded.

	Flat Rate	Total
Labor:	\$4,950.00	\$4,950.00
Total:	\$4,950.00	\$4,950.00

Discrepancy: 1.243. LH #2 slat actuator shows signs of leakage.

Discrepancy: 1.244. Co-Pilot dome light plug cracked.

Discrepancy: 1.245. Missing hardware in glareshield

Discrepancy: 1.246. LH aileron servo bonding braid broken.

Discrepancy: 1.247. RH overwing panel has bad nutplate inside, under #9 window.

	Time & Materials	Total
Labor:	\$1,100.55	\$1,100.55
Parts:	\$105.74	\$105.74
Total:	\$1,206.29	\$1,206.29

### Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.247 #1	NAS1473A3	DOME NUT PLATE	1	\$5.13	\$5.13
1.247 #2	PR1422B1/2	SEALANT, 136 GRAM 6 OZ SEMKIT	1	\$100.61	\$100.61



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.248. Numerous anchor nuts and retainers corroded on windshield frames

	Time & Materials	Total
Labor:	\$23,185.83	\$23,185.83
Parts:	\$2,999.06	\$2,999.06
Freight:	\$97.81	\$97.81
Total:	<b>\$26,282.70</b>	<b>\$26,282.70</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.248 #1	5RH8035M	NUT	5	\$2.23	\$11.15
1.248 #2	1445846	ALODINE PEN/BONDERITE TOUCH AND PREP PEN	1	\$189.14	\$189.14
1.248 #3	2552-02RET	RETAINER STEEL, BARREL NUT	24	\$17.36	\$416.64
1.248 #4	CR5869	NUT	24	\$12.01	\$288.24
1.248 #5	FGFB261000007	PLUG	196	\$3.04	\$595.84
1.248 #6	FGFB261000005A1	PLUG	12	\$0.78	\$9.36
1.248 #7	2552-02RET	RETAINER STEEL, BARREL NUT	18	\$17.36	\$312.48
1.248 #8	CR5869	NUT	18	\$17.19	\$407.23
			Freight:	<b>97.81</b>	
1.248 #9	FGFB261000005A1	PLUG	225	\$1.35	\$303.75
1.248 #10	FGFB261000006	SCREW DIA.5	12	\$23.61	\$283.32
1.248 #11	22258TX050027XF	SCREW	1	\$27.44	\$27.44
1.248 #12	22258TX050014XF	SCREW	26	\$5.08	\$132.08
1.248 #13	22258TX050008XF	SCREW	2	\$4.48	\$8.96
1.248 #14	22258TX050006XF	SCREW	1	\$7.08	\$7.08
1.248 #15	22258TX050005XF	SCREW	1	\$7.33	\$7.33
1.248 #16	PR1422B1/2-2.5OZ	SEALANT, 136 GRAM 2.5 OZ SEMKIT	1	\$96.83	\$96.83

Discrepancy: 1.249. Corrosion on lower #6 windshield frame.

	Flat Rate	Total
Labor:	\$1,320.00	\$1,320.00
Total:	<b>\$1,320.00</b>	<b>\$1,320.00</b>

Discrepancy: 1.250. MED retractable step drip pan has multiple cracks.

	Time & Materials	Total
Labor:	\$1,572.45	\$1,572.45
Parts:	\$8,469.75	\$8,469.75
Freight:	\$154.24	\$154.24
Total:	<b>\$10,196.44</b>	<b>\$10,196.44</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.250 #1	F2MB222205300	case assy	1	\$8,466.25	\$8,620.49
			Freight:	<b>154.24</b>	
1.250 #2	CCR264SS3-5	RIVET	5	\$0.70	\$3.50



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.251. Both upper ATC antennas corroded. P/N DMN150-2-2

	Time & Materials	Total
Parts:	\$2,496.48	\$2,496.48
Freight:	\$17.00	\$17.00
Total:	<b>\$2,513.48</b>	<b>\$2,513.48</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.251 #2	DMN150-2-2	L-BAND ANTENNA	2	\$954.24	\$1,925.48
			Freight:	<b>17.00</b>	
1.251 #3	AG282000-03	GASKET	2	\$294.00	\$588.00

Discrepancy: 1.252. Upper VHF antenna corroded. P/N S65-8280-10

	Time & Materials	Total
Parts:	\$867.05	\$867.05
Total:	<b>\$867.05</b>	<b>\$867.05</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.252 #1	S65-8280-10	ANTENNA	1	\$500.00	\$500.00
1.252 #2	AG843000-03	GASKET	1	\$255.64	\$255.64
1.252 #3	HT3326-5-50	SEALANT ( 50 CC )	1	\$111.41	\$111.41

Discrepancy: 1.253. Corrosion upper fuselage under ATC antennas

	Time & Materials	Total
Labor:	\$622.05	\$622.05
Total:	<b>\$622.05</b>	<b>\$622.05</b>

Discrepancy: 1.254. One smoke mask lens cracked.

Discrepancy: 1.255. Upper VHF antenna has broken coax.

	Time & Materials	Total
Labor:	\$216.15	\$216.15
Parts:	\$302.82	\$302.82
Total:	<b>\$518.97</b>	<b>\$518.97</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.255 #1	01C0CBNC8-202	CONNECTOR	1	\$302.82	\$302.82



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.256. MED bonding braid and hardware broken and corroded.

	Time & Materials	Total
Labor:	\$541.20	\$541.20
Total:	<b>\$541.20</b>	<b>\$541.20</b>

Discrepancy: 1.257. APU diffuser-vane actuator appears cracked.

Discrepancy: 1.258. Stab jack boot deteriorated.

	Time & Materials	Total
Labor:	\$709.50	\$709.50
Parts:	\$1,331.20	\$1,331.20
Total:	<b>\$2,040.70</b>	<b>\$2,040.70</b>

Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.258 #1	F50B255000101	BELLOWS, ACTUATOR	1	\$1,331.20	\$1,331.20

Discrepancy: 1.259. APU aft mount and hardware corroded.

	Time & Materials	Total
Labor:	\$707.85	\$707.85
Total:	<b>\$707.85</b>	<b>\$707.85</b>

Discrepancy: 1.260. Cockpit headliner cracked.

Discrepancy: 1.261. Co-Pilots reading light knob connection broken.

	Time & Materials	Total
Labor:	\$13.20	\$13.20
Parts:	\$1,355.90	\$1,355.90
Freight:	\$51.85	\$51.85
Total:	<b>\$1,420.95</b>	<b>\$1,420.95</b>

Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.261 #1	419-21	RHEOSTAT	1	\$1,355.90	\$1,407.75

Freight: **51.85**

Discrepancy: 1.262. Elevator drive linkage assembly rough and super dirty. (Needs removed, cleaned, inspected and lubed.)

	Time & Materials	Total
Labor:	\$1,608.75	\$1,608.75
Total:	<b>\$1,608.75</b>	<b>\$1,608.75</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United States

Please Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.263. All five windshield retainers have corrosion beyond acceptable limits or illegal repairs.

	Time & Materials	Flat Rate	Total
Labor:	\$3,545.85	\$0.00	\$3,545.85
Parts:	\$0.00	\$52,210.00	\$52,210.00
Total:	<b>\$3,545.85</b>	<b>\$52,210.00</b>	<b>\$55,755.85</b>

Discrepancy: 1.264. Corrosion around door lift button and oxygen service door. LH fuselage at Fr. 7

	Flat Rate	Total
Labor:	\$330.00	\$330.00
Total:	<b>\$330.00</b>	<b>\$330.00</b>

Discrepancy: 1.265. Lower fwd edge of MED frame, skin deformed.

	Flat Rate	Total
Labor:	\$495.00	\$495.00
Total:	<b>\$495.00</b>	<b>\$495.00</b>

Discrepancy: 1.266. Upper edge of fuselage needs paint touched up at MED frame.

Discrepancy: 1.267. Three spots of corrosion LH upper fuselage Fr. 26-27 above pylon.

	Flat Rate	Total
Labor:	\$1,320.00	\$1,320.00
Total:	<b>\$1,320.00</b>	<b>\$1,320.00</b>

Discrepancy: 1.268. LH Horizontal Stab coupling has a corroded shackle assy.

	Flat Rate	Total
Labor:	\$495.00	\$495.00
Total:	<b>\$495.00</b>	<b>\$495.00</b>



SPIRIT OF SAINT LOUIS AIRPORT (SUS)

750 North Beechcraft  
Chesterfield, MISSOURI  
63005  
United StatesPlease Remit To:  
18377 Edison Avenue  
Chesterfield, MO 63005  
United States of America

## Preliminary Invoice

July 24, 2025

Telephone 636-532-2674  
FAX 636-530-9044

Bill To: DAR JANA GROUP

WO #: 43105

Invoice Number:

Discrepancy: 1.269. RH and LH horizontal stab trailing edge straps are corroded.

	Time & Materials	Total
Labor:	\$5,215.65	\$5,215.65
Parts:	\$139.24	\$139.24
Total:	<b>\$5,354.89</b>	<b>\$5,354.89</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.269 #1	PR1422B2	SEALANT, 136 GRAM 6 OZ SEMKIT	1	\$109.68	\$109.68
1.269 #2	6061-0.050BARE	ALUMINUM SHEET	2	\$14.78	\$29.56

Discrepancy: 1.270. Mounting brackets for heat exchanger are broken and cracked.

	Time & Materials	Total
Parts:	\$2,620.08	\$2,620.08
Total:	<b>\$2,620.08</b>	<b>\$2,620.08</b>

## Parts:

Ref. No.	Part number:	Description	Quantity	Sell price	Extended
1.270 #2	F2MA705004010	support brakel	1	\$1,677.00	\$1,677.00
1.270 #1	F2MA705004020	bar brakel	1	\$943.08	\$943.08

Discrepancy: 1.271. Jet pump vaccuum corroded.

	Flat Rate	Total
Labor:	\$495.00	\$495.00
Parts:	\$8,500.00	\$8,500.00
Total:	<b>\$8,995.00</b>	<b>\$8,995.00</b>

Discrepancy: 1.272. 2 each pressure switches in LH gear well corroded: L145GC and L148GC

Discrepancy: 1.273. 3 each wire channels broken in flap well (2 on Rt wing, 1 on Lt wing)

Discrepancy: 1.274. MLG actuator hydraulic lines bracket in RH gear well corroded.

\* Credit, debit, and bank card transactions are subject to a convenience fee.  
AVMATS accepts all major credit cards, wire-transfer, ACH and Company Checks.  
Please use the link below to arrange or remit payment for this invoice:

Pay with **AVMATS** | **PAY**  
<https://www.avmats.com/pay>