

INVOICE

DGM Aircraft / Justice Air
Maintenance
9100 Republic Airport
Farmingdale, NY 11735

diana@justiceair.com
+1 (631) 270-4144



Bill to
Avi
Aspire Aviation
1100 New Highway
Farmingdale, NY 11735

Ship to
Avi
Aspire Aviation
1100 New Highway
Farmingdale, NY 11735

Invoice details

Invoice no.: 2630
Terms: Net 10
Invoice date: 02/10/2025
Due date: 02/20/2025

#	Product or service	Description	Qty	Rate	Amount
1.	Flight School Labor Rate	<p>N388JF</p> <p>- Pilot reports throttle difficult to move throughout entire range. Inspected throttle cable, cable at the carburetor end was dirty. Cleaned and lubricated controls with LPS2. Lubricated rod ends but throttle still stiff. Upon further inspection, throttle cable sheathing appears to be damaged and causing binding. New throttle cable was ordered. Removed and replaced throttle cable with new. (3.0 hr)</p> <p>- Nose wheel shimmy during landing. Found shimmy dampener low fluid and excessive play. Removed and service shimmy damper IAW Cessna service manual section 2 fig 5-11. Owner advised to report back if shimmy continues. (1.0 hr)</p> <p>- Main landing gear and nose landing gear wheel fairings need to be removed. MLG and NLG fairings removed as per owner's request. (0.5 hr)</p> <p>- Co pilot microphone cutting in and out when transmitting. Inspected PTT, cleaned button with electrical contact cleaner. All wiring connectors are secured, button functions normally. Inspected headphone and microphone jacks, all wiring and mounting is secured. Performed microphone check by tuning remote frequency and transmitting to hand held radio to ensure transmission is</p>	8	\$100.00	\$800.00

un-interrupted. Also performed mic check with ATC, Ops check OK. (1.0 hr)
- Verify RPM gauge proper indications. RPM reads approx less than 100 RPM lower in referenced with calibrated digital RPM gauge. Removed cable from instrument and engine accessory drive. Cleaned, inspected and lubricated cable. No abnormalities found, reinstalled and secured RPM cable. During run up indicated RPM is still lower than the reference digital tachometer but within 4% accuracy. Placard RPM gauge to adjust for error. Owner advised. (2.5 hr)

2.	Parts	Throttle cable	1	\$803.19	\$803.19
3.	Parts	O-ring	1	\$1.05	\$1.05
4.	Parts	Cotter pins	1	\$0.35	\$0.35
5.	Shop Supplies	Consumables & shop supplies	1	\$20.00	\$20.00

Total

\$1,624.59

Ways to pay



Note to customer

WO 1199