

INVOICE

DGM Aircraft / Justice Air
Maintenance
9100 Republic Airport
Farmingdale, NY 11735

diana@justiceair.com
+1 (631) 270-4144



Bill to

Avi
Aspire Aviation
1100 New Highway
Farmingdale, NY 11735

Ship to

Avi
Aspire Aviation
1100 New Highway
Farmingdale, NY 11735

Invoice details

Invoice no.: 2590
Terms: Net 10
Invoice date: 01/17/2025
Due date: 01/27/2025

#	Product or service	Description	Qty	Rate	Amount
1.	Cessna 172 100 Hr Inspection	N433SP - 100 HR inspection plus AD research and compliance.	1	\$900.00	\$900.00
2.	Flight School Labor Rate	<p>N433SP - Multiple squawks found during inspection.</p> <p>- Customer requested compass to be checked.</p> <p>Checked compass in multiple directions referencing master compass all indications coincide with master compass. All work preformed in reference to Cessna service manual. (1.0 hr)</p> <p>- Co-pilot PTT needs replacement.</p> <p>During troubleshoot found right PTT was intermittent also found left PTT works but needed to be press with lot of force.</p> <p>Replaced both PTT's with new. All work performed in reference to Cessna service manual and AC 43.13-1B. (1.5 hr)</p> <p>- Customer reported high oil pressure.</p> <p>Run up performed, no abnormal indication noted IAW Cessna service manual. (No additional labor charge)</p> <p>- Customer reported engine roughness.</p> <p>Spark plugs were cleaned, magnetos timing, intake and exhaust leaks were check during inspection. Run up checks good. (No additional labor)</p> <p>- During inspection found two static wicks broken/missing on right hand aileron.</p> <p>Removed and replaced static wicks with</p>	8	\$100.00	\$800.00



new as per service manual. (0.5 hr)
 - During inspection found right MLG brake pads worn beyond limitations.
 Removed and replaced brake pads with new IAW Cessna AMM. (0.5 hr)
 - During inspection found top cowling bowl chipped and worn.
 Repaired top cowling bowl, sanded and repainted IAW AC 43.13-1B. (2.0 hr)
 - During inspection found left MLG tire with bald spot.
 Removed and replaced tire with new IAW Cessna AMM. (1.0 hr)
 - During inspection found left MLG brake pads worn beyond limits.
 Removed and replaced brake linings with new IAW Cessna AMM. (0.5 hr)
 - Customer reported they had a problems with pilot side door, getting stuck and sometimes does not open.
 Adjusted door handle and latch to open and close smoothly IAW Cessna service manual. (No additional labor charge)

3.	Parts	Phillips 20W-50 oil	7	\$12.00	\$84.00
4.	Parts	Metal check oil analysis kit	1	\$30.31	\$30.31
5.	Parts	Tempest oil filter	1	\$40.00	\$40.00
6.	Parts	Instrument filter	1	\$3.39	\$3.39
7.	Parts	PTT Switch	2	\$20.12	\$40.24
8.	Parts	Static wick	2	\$77.91	\$155.82
9.	Parts	Bulb	1	\$26.88	\$26.88
10.	Parts	Cleveland brake lining pads	4	\$16.44	\$65.76
11.	Parts	Air Hawk tire	1	\$143.75	\$143.75
12.	Parts	Leakguard inner tube	1	\$124.02	\$124.02
13.	Parts	Miscellaneous hardware	1	\$7.45	\$7.45
14.	Shop Supplies	Consumables & shop supplies	1	\$50.00	\$50.00

Ways to pay






Total

\$2,471.62

Note to customer

WO #1156

