

INVOICE

Justice Air Maintenance
9100 Republic Airport
Farmingdale, NY 11735

diana@justiceair.com
+1 (631) 465-0138



Bill to
Avi
Aspire Aviation
1100 New Highway
Farmingdale, NY 11735

Ship to
Avi
Aspire Aviation
1100 New Highway
Farmingdale, NY 11735

Invoice details

Invoice no.: 2860
Terms: Net 10
Invoice date: 05/27/2025
Due date: 06/06/2025

#	Product or service	Description	Qty	Rate	Amount
1.	Cessna 172 50 HR Inspection	N8184G - 50 HR Inspection requested by owner. Inspection accomplished as required.	1	\$250.00	\$250.00
2.	Flight School Labor Rate	N8184G - Owner reported right wing missing a bolt. Installed new hardware in wing panel cover on left side. (No additional labor charge) - FAA aircraft condition notice: Right hand lower hinge pin not fully seated. Replaced top and bottom left and right door pins hinges with new IAW Cessna service manual. (0.5 HR) - FAA aircraft condition notice: Right hand lower door has large crease near and around lower hinge. Contacted Textron to get references to repair. Textron advice damage is considered too wide spread for repair. Recommended part to be replaced. During inspection also found left door with similar damage. Both door require replacement. Owner advised. Removed and replaced both left and right door with serviceable ones. Removed left door window and installed on serviceable door. Adjusted to fit and replaced all hinges pins with new. All work performed in reference to Cessna service manual. (12.0 HR) - FAA aircraft condition notice: Fabric above panel eyebrow has deteriorated and is	40	\$100.00	\$4,000.00

peeling off. eyebrow appears loose.
 Removed and replaced eyebrow fabric with new as required approved fabric. (3.5 HR)
 - FAA aircraft condition notice: Right hand side fuselage appears cracked on forward side of fuel step.
 Fuel step removed and inspected. Approx 2.5 inch crack found. Performed doubler patch to fuselage behind right side foot step. Primed and painted to match. All work performed in reference to Ac 43.13-1B and Cessna service manual. (18.0 HR)
 - FAA aircraft condition notice: Cowl fastener is loose on right hand side of cowl. Tightened faster after cowling install. (No labor charge)
 - Owner requested the remaining interior upholstery to be installed.
 Remaining interior installation completed in reference to Cessna service manual. (4.0 HR)
 - Pilot reported primer plunger was stuck. Removed and replaced primer plunger O-rings with new primer overhaul kit IAW Cessna Service manual. (1.0 HR)
 - Owner requested anti-abrasive prop guard to be installed.
 Dressed propeller blades, cleaned and installed anti-abrasion boot for propeller IAW McFarlane prop guard drawing 1100 Rev A. (1.0 HR)

3.	Parts	Aero Shell 15W-50 oil	6	\$12.00	\$72.00
4.	Parts	Tempest oil filter	1	\$40.00	\$40.00
5.	Parts	Oil analysis kit	1	\$30.31	\$30.31
6.	Parts	Spark plug	8	\$47.01	\$376.08
7.	Parts	McFarlane Hinge Pin Kit	2	\$132.35	\$264.70
8.	Parts	Primer overhaul kit	1	\$8.91	\$8.91
9.	Parts	Airtex Black vinyl for glare shield	1	\$103.50	\$103.50
10.	Parts	RH serviceable door	1	\$805.00	\$805.00
11.	Parts	LH pilot serviceable door	1	\$575.00	\$575.00
12.	Parts	890 B 1/2 Sealant / 2.5 oz SEM Kit	1	\$68.37	\$68.37
13.	Parts	Miscellaneous hardware	1	\$15.57	\$15.57
14.	Shop Supplies	Consumables & shop supplies	1	\$50.00	\$50.00
15.	Shipping Fee	Shipping for spark plugs	1	\$15.36	\$15.36

16.	Shipping Fee	Shipping 2nd day for black vinyl	1	\$35.90	\$35.90
17.	Shipping Fee	Shipping for door set	1	\$988.80	\$988.80

Total	\$7,699.50
-------	------------

Ways to pay



Note to customer
WO#1405