

INVOICE

DGM Aircraft / Justice Air
Maintenance
9100 Republic Airport
Farmingdale, NY 11735

diana@justiceair.com
+1 (631) 270-4144



Bill to

Avi
Aspire Aviation
1100 New Highway
Farmingdale, NY 11735

Ship to

Avi
Aspire Aviation
1100 New Highway
Farmingdale, NY 11735

Invoice details

Invoice no.: 2602
Terms: Net 10
Invoice date: 01/29/2025
Due date: 02/08/2025

#	Product or service	Description	Qty	Rate	Amount
1.	Cessna 172 100 Hr Inspection	N64527- 100 HR inspection plus AD research and compliance.	1	\$900.00	\$900.00
2.	Flight School Labor Rate	<p>N64527- Multiple squawks found during inspection.</p> <p>- Pilots reported left hand pilot seat not sliding fully aft position. Cleaned, lubricated and readjusted seat stop belt. OPS check good IAW Cessna service manual. (0.5 hr)</p> <p>- Pilots reported carburetor heat cable not staying in ON position. Needs to be held and will spring closed when released. Upon inspection found no fault on this time. Run up unable to duplicate fault. Owner advised. (0.5 hr)</p> <p>- Pilot requested verifying if cabin heat is operational. During run up cabin heat works and its operational. (No additional labor charge)</p> <p>- During inspection found cylinder #1 and #3 intake gaskets leaking and broken. Removed and replaced new intake gaskets IAW Cessna AMM. (1.0 hr)</p> <p>- During run up cylinders #2 and #3 had erratic readings for EGTs. Upon inspection found EGTs are broken. Removed and replaced both cylinder 2 and 3 EGT probes IAW Piper service manual. Run up check good. (2.0 hr)</p> <p>- During inspection found air duct from</p>	7	\$100.00	\$700.00

exhaust shroud to cabin heat worn and ripped.
Removed and replaced air duct. (0.5 hr)
- During inspection found left hand tire with bold spot.
Removed and replaced left main tire and inner tube with new IAW Cessna service manual. (1.0 hr)
- During inspection found lock pins for battery cover missing.
Installed new lock pins for battery cover IAW Cessna service manual. (0.5 hr)
- Owner reported fire extinguisher moving in mounting bracket.
During inspection found extinguisher handle and mounting bracket broken. New fire extinguisher was ordered. Fire extinguisher installed. (0.5 hr)

3.	Parts	Phillips 20W-50 oil	7	\$12.00	\$84.00
4.	Parts	Tempest 110 oil filter	1	\$40.00	\$40.00
5.	Parts	Metal check oil analysis kit	1	\$30.31	\$30.31
6.	Parts	EGT Probe	2	\$61.84	\$123.68
7.	Parts	Air Hawk tire	1	\$143.75	\$143.75
8.	Parts	Tube	1	\$124.02	\$124.02
9.	Parts	Superior gasket	2	\$2.50	\$5.00
10.	Parts	Fire extinguisher	1	\$561.62	\$561.62
11.	Parts	Lycoming exhaust gasket	4	\$8.15	\$32.60
12.	Parts	Air Duct	1	\$14.01	\$14.01
13.	Parts	Miscellaneous hardware	1	\$12.73	\$12.73
14.	Shop Supplies	Consumables & shop supplies	1	\$25.00	\$25.00

Ways to pay



Note to customer
WO#1178

Total \$2,796.72