



## BRAZING, SOLDERING, AND ADHESIVE BONDING

---

1. Brazing
2. Soldering
3. Adhesive Bonding

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Overview of Brazing and Soldering

---

- Both use filler metals to permanently join metal parts, but there is no melting of base metals
- When to use brazing or soldering instead of fusion welding:
  - Metals have poor weldability
  - Dissimilar metals are to be joined
  - Intense heat of welding may damage components being joined
  - Geometry of joint not suitable for welding
  - High strength is not required

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Overview of Adhesive Bonding

---

- Uses forces of attachment between a filler material and two closely-spaced surfaces to bond the parts
  - Filler material in adhesive bonding is not metallic
  - Joining process can be carried out at room temperature or only modestly above

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Brazing

---

Joining process in which a filler metal is melted and distributed by capillary action between faying surfaces of metal parts being joined

- No melting of base metals occurs
  - Only the filler melts
- Filler metal  $T_m$  greater than 450°C (840°F) but less than  $T_m$  of base metal(s) to be joined

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Strength of Brazed Joint

---

- If joint is properly designed and brazing operation is properly performed, solidified joint will be stronger than filler metal out of which it was formed
- Why?
  - Small part clearances used in brazing
  - Metallurgical bonding that occurs between base and filler metals
  - Geometric constrictions imposed on joint by base parts

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Brazing Compared to Welding

---

- Any metals can be joined, including dissimilar metals
- Can be performed quickly and consistently, permitting high production rates
- Multiple joints can be brazed simultaneously
- Less heat and power required than FW
- Problems with HAZ in base metal are reduced
- Joint areas that are inaccessible by many welding processes can be brazed; capillary action draws molten filler metal into joint

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Disadvantages and Limitations of Brazing

---

- Joint strength is generally less than a welded joint
- Joint strength is likely to be less than the base metals
- High service temperatures may weaken a brazed joint
- Color of brazing metal may not match color of base metal parts, a possible aesthetic disadvantage

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Brazing Applications

---

- Automotive (e.g., joining tubes and pipes)
- Electrical equipment (e.g., joining wires and cables)
- Cutting tools (e.g., brazing cemented carbide inserts to shanks)
- Jewelry
- Chemical process industry
- Plumbing and heating contractors join metal pipes and tubes by brazing
- Repair and maintenance work

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Brazed Joints

- Butt and lap joints common
  - Geometry of butt joints is usually adapted for brazing
  - Lap joints are more widely used, since they provide larger interface area between parts
- Filler metal in a brazed lap joint is bonded to base parts throughout entire interface area, rather than only at edges

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Butt Joints for Brazing

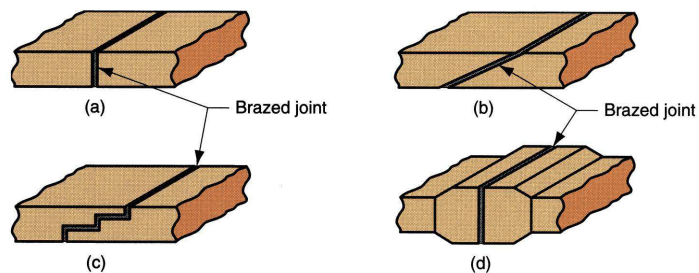


Figure 32.1 (a) Conventional butt joint, and adaptations of the butt joint for brazing: (b) scarf joint, (c) stepped butt joint, (d) increased cross-section of the part at the joint.

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e

## Lap Joints for Brazing

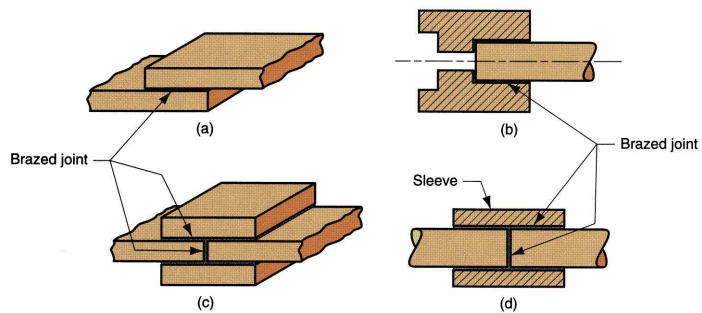


Figure 32.2 (a) Conventional lap joint, and adaptations of the lap joint for brazing: (b) cylindrical parts, (c) sandwiched parts, and (d) use of sleeve to convert butt joint into lap joint.

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e

## Some Filler Metals for Brazing

### Base metal(s)

Aluminum  
Nickel-copper alloy  
Copper  
Steel, cast iron  
Stainless steel

### Filler metal(s)

Aluminum and silicon  
Copper  
Copper and phosphorous  
Copper and zinc  
Gold and silver

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e

## Desirable Brazing Metal Characteristics

- Melting temperature of filler metal is compatible with base metal
- Low surface tension in liquid phase for good wettability
- High fluidity for penetration into interface
- Capable of being brazed into a joint of adequate strength for application
- Avoid chemical and physical interactions with base metal (e.g., galvanic reaction)

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e

## Applying Filler Metal

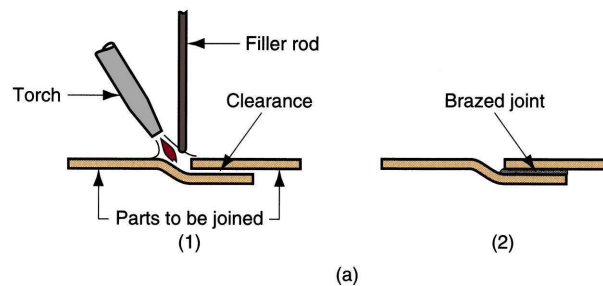


Figure 32.4 Several techniques for applying filler metal in brazing: (a) torch and filler rod. Sequence: (1) before, and (2) after.

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e

## Applying Filler Metal

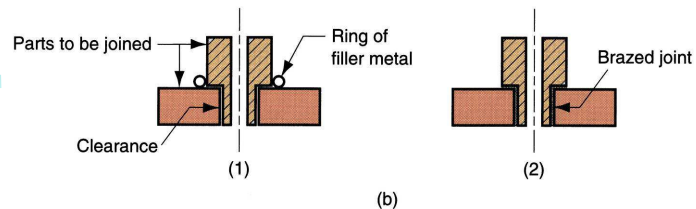


Figure 32.4 Several techniques for applying filler metal in brazing:  
(b) ring of filler metal at entrance of gap. Sequence: (1) before, and  
(2) after.

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e

## Brazing Fluxes

- Similar purpose as in welding; they dissolve, combine with, and otherwise inhibit formation of oxides and other unwanted byproducts in brazing process
- Characteristics of a good flux include:
  - Low melting temperature
  - Low viscosity so it can be displaced by filler metal
  - Facilitates wetting
  - Protects joint until solidification of filler metal

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e





## Heating Methods in Brazing

---

- Torch Brazing - torch directs flame against work in vicinity of joint
- Furnace Brazing - furnace supplies heat
- Induction Brazing – heating by electrical resistance to high-frequency current in work
- Resistance Brazing - heating by electrical resistance in parts
- Dip Brazing - molten salt or molten metal bath
- Infrared Brazing - uses high-intensity infrared lamp

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Soldering

---

Joining process in which a filler metal with  $T_m$  less than or equal to 450C (840F) is melted and distributed by capillary action between faying surfaces of metal parts being joined

- No melting of base metals, but filler metal wets and combines with base metal to form metallurgical bond
- Soldering similar to brazing, and many of the same heating methods are used
- Filler metal called *solder*
- Most closely associated with electrical and electronics assembly (wire soldering)

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Soldering Advantages / Disadvantages

---

### Advantages:

- Lower energy than brazing or fusion welding
- Variety of heating methods available
- Good electrical and thermal conductivity in joint
- Easy repair and rework

### Disadvantages:

- Low joint strength unless reinforced by mechanically means
- Possible weakening or melting of joint in elevated temperature service

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Solders

---

Usually alloys of tin (Sn) and lead (Pb). Both metals have low  $T_m$

- Lead is poisonous and its percentage is minimized in most solders
- Tin is chemically active at soldering temperatures and promotes wetting action for successful joining
- In soldering copper, copper and tin form intermetallic compounds that strengthen bond
- Silver and antimony also used in soldering alloys

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e

## Mechanical Means to Secure Joint

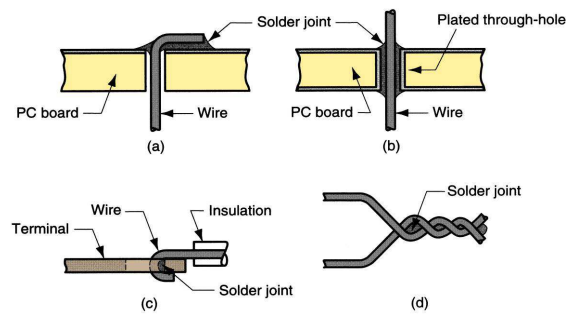


Figure 32.8 Techniques for securing the joint by mechanical means prior to soldering in electrical connections: (a) crimped lead wire on PC board; (b) plated through-hole on PC board to maximize solder contact surface; (c) hooked wire on flat terminal; and (d) twisted wires.

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e

## Functions of Soldering Fluxes

- Be molten at soldering temperatures
- Remove oxide films and tarnish from base part surfaces
- Prevent oxidation during heating
- Promote wetting of faying surfaces
- Be readily displaced by molten solder during process
- Leave residue that is non-corrosive and nonconductive

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e

## Soldering Methods

- Many soldering methods same as for brazing, except less heat and lower temperatures are required
- Additional methods:
  - Hand soldering – manually operated *soldering gun*
  - Wave soldering – soldering of multiple lead wires in printed circuit cards
  - Reflow soldering –used for surface mount components on printed circuit cards

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e

## Wave Soldering

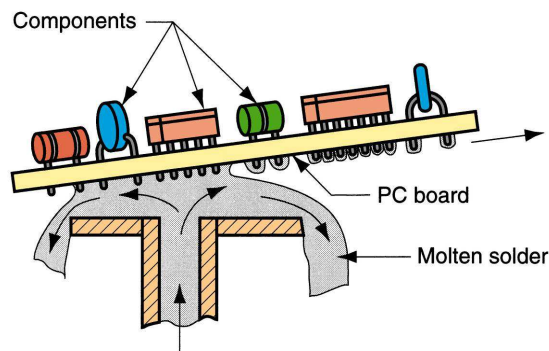


Figure 32.9 Wave soldering, in which molten solder is delivered up through a narrow slot onto the underside of a printed circuit board to connect the component lead wires.

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Adhesive Bonding

---

Joining process in which a filler material is used to hold two (or more) closely-spaced parts together by surface attachment

- Used in a wide range of bonding and sealing applications for joining similar and dissimilar materials such as metals, plastics, ceramics, wood, paper, and cardboard
- Considered a growth area because of opportunities for increased applications

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Terminology in Adhesive Bonding

---

- **Adhesive** = filler material, nonmetallic, usually a polymer
- **Adherends** = parts being joined
- **Structural adhesives** – of greatest interest in engineering, capable of forming strong, permanent joints between strong, rigid adherends

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Curing in Adhesive Bonding

---

Process by which physical properties of the adhesive are changed from liquid to solid, usually by chemical reaction, to accomplish surface attachment of parts

- Curing often aided by heat and/or a catalyst
  - If heat used, temperatures are relatively low
- Curing takes time - a disadvantage in production
- Pressure sometimes applied between parts to activate bonding process

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Joint Strength

---

- Depends on strength of:
  - Adhesive
  - Attachment between adhesive and adherends
- Attachment mechanisms:
  - Chemical bonding – adhesive and adherend form primary bond on curing
  - Physical interactions - secondary bonding forces between surface atoms
  - Mechanical interlocking - roughness of adherend causes adhesive to become entangled in surface asperities

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Joint Design


- Adhesive joints are not as strong as welded, brazed, or soldered joints
- Joint contact area should be maximized
- Adhesive joints are strongest in shear and tension
  - Joints should be designed so applied stresses are of these types
- Adhesive bonded joints are weakest in *cleavage* or *peeling*
  - Joints should be designed to avoid these types of stresses

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Types of Stresses in Adhesive Bonding

Figure 32.10 Types of stresses that must be considered in adhesive bonded joints: (a) tension, (b) shear, (c) cleavage, and (d) peeling.

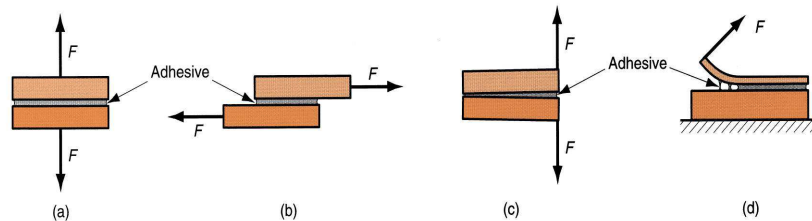

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e

## Joint Designs in Adhesive Bonding

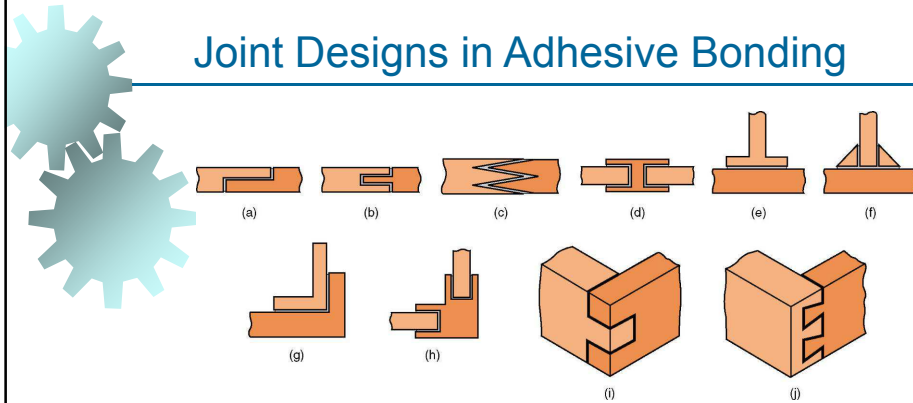


Figure 32.11 Some joint designs for adhesive bonding: (a) through (d) butt joints; (e) through (f) T-joints; (b) and (g) through (j) corner joints.

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e

## Adhesive Types

- Natural adhesives - derived from natural sources, including gums, starch, dextrin, soya flour, collagen
  - Low-stress applications: cardboard cartons, furniture, bookbinding, plywood
- Inorganic - based principally on sodium silicate and magnesium oxychloride
  - Low cost, low strength
- Synthetic adhesives - various thermoplastic and thermosetting polymers

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e





## Synthetic Adhesives

---

- Most important category in manufacturing
- Synthetic adhesives cured by various mechanisms:
  - Mixing catalyst or reactive ingredient with polymer prior to applying
  - Heating to initiate chemical reaction
  - Radiation curing, such as UV light
  - Curing by evaporation of water
  - Application as films or pressure-sensitive coatings on surface of adherend

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Applications of Adhesives

---

- Automotive, aircraft, building products, shipbuilding
- Packaging industries
- Footwear
- Furniture
- Bookbinding
- Electrical and electronics

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Surface Preparation

---

- For adhesive bonding to succeed, part surfaces must be extremely clean
- Bond strength depends on degree of adhesion between adhesive and adherend, and this depends on cleanliness of surface
  - For metals, solvent wiping often used for cleaning, and abrading surface by sandblasting improves adhesion
  - For nonmetallic parts, surfaces are sometimes mechanically abraded or chemically etched to increase roughness

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Application Methods

---

- Manual brushing and rolling
- Silk screening
- Flowing, using manually operated dispensers
- Spraying
- Automatic applicators
- Roll coating

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



Adhesive is dispensed by a manually controlled dispenser to bond parts during assembly (photo courtesy of EFD Inc.).



©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Advantages of Adhesive Bonding

- Applicable to a wide variety of materials
- Bonding occurs over entire surface area of joint
- Low temperature curing avoids damage to parts being joined
- Sealing as well as bonding
- Joint design is often simplified, e.g., two flat surfaces can be joined without providing special part features such as screw holes

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e



## Limitations of Adhesive Bonding

---

- Joints generally not as strong as other joining methods
- Adhesive must be compatible with materials being joined
- Service temperatures are limited
- Cleanliness and surface preparation prior to application of adhesive are important
- Curing times can limit production rates
- Inspection of bonded joint is difficult

©2007 John Wiley & Sons, Inc. M P Groover, *Fundamentals of Modern Manufacturing* 3/e