

DTC	B1273/73	Sliding roof ECU communication stop (w/ Sliding roof vehicle only)
-----	----------	--

CIRCUIT DESCRIPTION

This DTC is output when communication stops between sliding roof ECU and body No.1 ECU.

DTC No.	DTC Detecting Condition	Trouble Area
B1273/73	No communication from sliding roof ECU more than 10 seconds.	• Sliding roof ECU • Wireharness

WIRING DIAGRAM


See page DI-747.


INSPECTION PROCEDURE

1	Check sliding roof ECU.
---	-------------------------

CHECK:
Check that the operation of the sliding roof function is normal.
HINT:
With this inspection, the sliding roof ECU CPU can be diagnosed if it works normally or not.

NG	Replace the sliding roof ECU.
----	-------------------------------



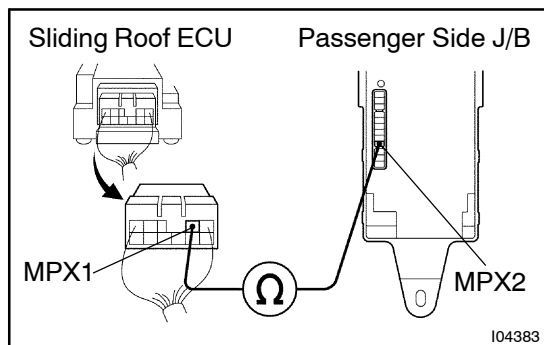2 Check wireharness**PREPARATION:**

Disconnect connector sliding roof ECU and body No.1 ECU.

HINT:

Connector is disconnected by removing Body No.1 ECU from passenger side junction block.

CHECK:

Check continuity between terminals MPX2 of body No.1 ECU and MPX1 of sliding roof ECU.

OK:

Continuity exists in wireharness.

NG**Repair or replace wireharness.****OK****Replace the sliding roof ECU.**