



OPERATING INSTRUCTIONS FOR SHEET TENSION METER WC-SERIES

ALL WC-SERIES METERS ARE SHIPPED CALIBRATED, CERTIFIED, AND READY FOR USE.

Arrests are provided at 1-1/2 revolutions to avoid overstraining.

NOTE: This instrument is extremely sensitive to the force of gravity upon it.


**This meter has been calibrated using free-hanging weights on a vertical axis.
THUS, READINGS FOR THIS INSTRUMENT WILL FLUCTUATE DEPENDING ON THE
ANGLE AT WHICH THE METER IS HELD.**

To compensate for vertical or horizontal position: Hold instrument in position to be used. The material should go over the center sensing roller and under the outside guide rollers.

Loosen bezel lock-screw. Turn dial to zero setting. Retighten lock-screw.
DO NOT PLACE THUMB ON THE INDICATOR SENSING BLOCK.

This instrument has a linear dial. The dial reading is a reference to the load applied – not exact tension. For instance, calibrating to a specific material, using a 50 lb weight on a 10" wide strip of material, the dial reading denotes a tension of 5 pli.

If necessary to determine the exact pli tension, use the Calibration Procedure described below. Stiffness and thickness will affect the dial readings; therefore, separate calibrations are necessary for each different stiffness and thickness, even if the material is the same.

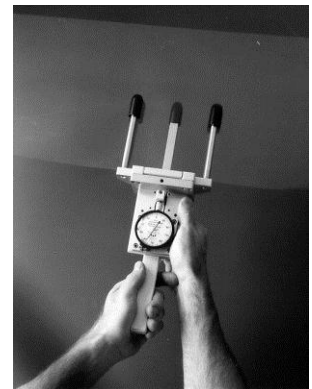

CALIBRATION PROCEDURE:

Suspend a 10" wide strip of your material from overhead. Apply the maximum safe load for the material (ex: 100 lbs on a 10" wide strip equals 10 pli; 50 lbs equals 5 pli, etc.). Care should be taken when applying weight to the material.

Hold the tension meter so that one reference roller is above the other. Loosen bezel lock-screw. Turn dial bezel to zero setting. Retighten lock-screw.

Clip the tension meter onto the loaded material. Slide the meter up and down on the material, while carefully holding the handle completely down. Note the reading.

OPERATION:

Clip the meter onto your material while holding the handle completely down. The dial reading should be the same as noted at time of calibration.

To determine existing pli readings, take a dial reading under performance conditions. Suspend a 10" wide strip of the same material from overhead. Clip on the tension meter. Add known weights until the dial reading matches performing conditions. Divide the total of the applied weights by the material width. The resulting figure is the actual pli tension.

CARE AND MAINTENANCE:

Do not apply pressure to indicator sensing block.

Keep clean and free of dust.

DO NOT OIL DIAL INDICATOR.

If handle becomes stiff, apply a slight drop of oil or grease onto the contact point. If necessary, oil or grease can be applied to contact rollers and hinge pins.

If service is required, return to:

Tensitron, Inc.
733 South Bowen Street
Longmont, CO 80501

Tel: (303) 702-1980
Fax: (303) 702-1982
E-Mail: repairs@tensitron.com