



Task Force SAFE

Objective

The objective of this service contract is for the Contractor to provide technical services including, but not limited to inspections, assessments, repairs, testing, reports, training for facilities, and operations-related projects.

Definitions

- **LHS Electrical Deficiency:** A deficiency that is in its current state likely to bring harm or damage.
- **Imminent LHS Electrical Deficiency is defined as:** A deficiency that is in its current state is certain to bring harm or damage.
- **Mitigated is defined as:** The action of reducing an Imminent LHS deficiency.
- **RAC – Risk Assessment Code:** To provide insight for safety personnel the severity of identified deficiencies if left as found and is meant for information purposes only.
- **RAC 1:** Immediate danger to public or property with critical to catastrophic consequences.
- **RAC 2:** Possible danger to public or property with significant to minor consequences.

Workflow

1. Inspections will be performed from source to end users.
2. When a deficiency is identified, it will always be documented, at that point and time it was found.
3. If a deficiency is found it will never be left in its current unsafe condition. A deficiency will either be repaired or mitigated.
4. Mitigating actions could include, but are not limited to, isolating the supply, posting warning signs and/or barriers or even just making the site aware of the risk.
5. On recording any deficiency, it will be recorded at the status as to which it was initially inspected.
6. Actions have been put in place by TFS, in order to allow a true reflection of the condition of all inspected electrical systems and facilities.

Closing Summary

The inspection report provides a simple engineering view of a facilities electrical safety condition where it can continue to be used safely, along with all LHS deficiencies being highlighted in accordance with the general scope of the TF SAFE contract. This medium can supply a brief insight to the possible risk factors in and around a specific location within the AOR either CENTCOM wide or locally for the commander at a specific FOB. The TFS team can provide specialist knowledge and experience to assist in reducing the overall risk.

Inspection-Report_TFSAFE_F797V_12345_Team 101_19-12-25_1-3

Base Location	Erbil (Iraq)	Date:	2025-12-19
Base Code	F797V	Team #:	Team 101
Building #	12345	System Voltage	230/400
Building Type	Warehouse	Inspection Phase	Initial Inspection
Previous Report #:	N/A	Work Order:	TFS-F797V-2025-00001

Physical Building Location Description:

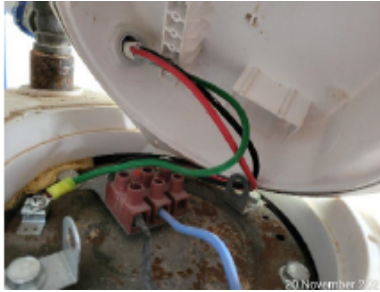
Main warehouse building, north side of compound near gate 3

Overall Building Electrical System: **Poor**

Building Picture:



Deficiencies (3):

Deficiency #1**RAC 1****Occurrences: 1****Description:** Missing cover on junction box exposing live terminals

Location:	Panel room, main distribution board
Category:	Improper Use / Damaged
Equipment:	WLT
Imminent:	Yes
Action:	Circuit Isolated
Code:	BritishStandard 522: Selection and erection of wiring systems in relation to external influences
Status:	Open

Deficiency #2**RAC 1****Occurrences: 1****Description:** GFCI outlet not functioning - no trip on test

Location:	Kitchen area, above sink
Category:	Improper Use / Damaged
Equipment:	WLT
Imminent:	Yes
Action:	Isolated circuit
Code:	BritishStandard 522: Selection and erection of wiring systems in relation to external influences
Status:	Mitigated

Deficiency #3**RAC 1****Occurrences: 3****Description:** Exposed wiring running along exterior wall without proper conduit protection

Location:	External wall, east side
Category:	Poor Workmanship
Equipment:	WLT
Imminent:	Yes
Action:	Circuit isolated and locked off until repair can be made
Code:	BritishStandard 522: Selection and erection of wiring systems in relation to external influences
Status:	Open

Inspection-Report_TFSAFE_F797V_12345_Team 101_19-12-25_1-3

Base Location	Erbil (Iraq)	Date:	2025-12-19
Base Code	F797V	Team #:	Team 101
Building #	12345	System Voltage	230/400
Building Type	Warehouse	Inspection Phase	Initial Inspection
Previous Report #:	N/A	Work Order:	TFS-F797V-2025-00001

Summary of Findings:

Building is in a deplorable state of repair.

Signatures:

Inspector 1:	Glenn	Signed:	2025-12-19 20:55:00
Inspector 2:	Greg	Signed:	2025-12-19 20:55:00
QC:	Brian	Signed:	2025-12-19 20:55:18