



Task Force SAFE

Objective

The objective of this service contract is for the Contractor to provide technical services including, but not limited to inspections, assessments, repairs, testing, reports, training for facilities, and operations-related projects.

Definitions

- **LHS Electrical Deficiency:** A deficiency that is in its current state likely to bring harm or damage.
- **Imminent LHS Electrical Deficiency is defined as:** A deficiency that is in its current state is certain to bring harm or damage.
- **Mitigated is defined as:** The action of reducing an Imminent LHS deficiency.
- **RAC – Risk Assessment Code:** To provide insight for safety personnel the severity of identified deficiencies if left as found and is meant for information purposes only.
- **RAC 1:** Immediate danger to public or property with critical to catastrophic consequences.
- **RAC 2:** Possible danger to public or property with significant to minor consequences.

Workflow

1. Inspections will be performed from source to end users.
2. When a deficiency is identified, it will always be documented, at that point and time it was found.
3. If a deficiency is found it will never be left in its current unsafe condition. A deficiency will either be repaired or mitigated.
4. Mitigating actions could include, but are not limited to, isolating the supply, posting warning signs and/or barriers or even just making the site aware of the risk.
5. On recording any deficiency, it will be recorded at the status as to which it was initially inspected.
6. Actions have been put in place by TFS, in order to allow a true reflection of the condition of all inspected electrical systems and facilities.

Closing Summary

The inspection report provides a simple engineering view of a facilities electrical safety condition where it can continue to be used safely, along with all LHS deficiencies being highlighted in accordance with the general scope of the TF SAFE contract. This medium can supply a brief insight to the possible risk factors in and around a specific location within the AOR either CENTCOM wide or locally for the commander at a specific FOB. The TFS team can provide specialist knowledge and experience to assist in reducing the overall risk.

Inspection-Report_TFSAFE_CP2FL_ACCOM-1_128_24-12-25_1-1

Base Location	Tower 22 (Jordan)	Date:	2025-12-24
Base Code	CP2FL	Team #:	128
Building #	ACCOM-1	System Voltage	230/400
Building Type	Barracks	Inspection Phase	Initial Inspection
Previous Report #:	N/A	Work Order:	TFS-CP2FL-2025-00001

Physical Building Location Description:

Accom-1-North-Rooms is located to the east of the main generator pad within T22.

Overall Building Electrical System: Fair

Building Picture:

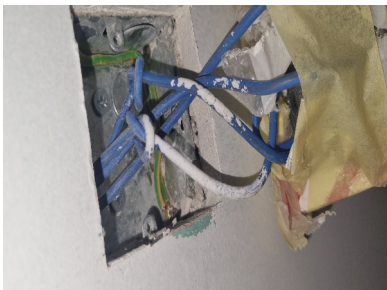


Deficiencies (1):

Deficiency #1

RAC 2

Occurrences: 18

Description: Twisted conductor, compression on cable

Location:	At each light switch within billeting rooms.
Category:	Improper Terminations
Equipment:	WLT
Imminent:	No
Action:	N/A
Code:	BritishStandard 642: Inspection
Status:	Open

Inspection-Report_TFSAFE_CP2FL_ACCOM-1_128_24-12-25_1-1

Base Location	Tower 22 (Jordan)	Date:	2025-12-24
Base Code	CP2FL	Team #:	128
Building #	ACCOM-1	System Voltage	230/400
Building Type	Barracks	Inspection Phase	Initial Inspection
Previous Report #:	N/A	Work Order:	TFS-CP2FL-2025-00001

Summary of Findings:

Accommodation 1 North Rooms were found to be at 40% completion upon inspection. All first fix wiring has been completed. No lighting has been installed yet as there is no ceiling present. Cables are still within copex. Partial 2nd fix on low level accessories within billeting rooms. Back boxes installed for sockets/AC has large gap between accessory and wall. Excess cable at connection of accessories. Compression when fixed into position.

Signatures:

Inspector 1:	Andrew McLean	Signed:	2025-12-24 12:16:21
Inspector 2:	Kieran Regan	Signed:	2025-12-24 12:16:21
QC:	Brian Thornton	Signed:	2025-12-24 12:45:17