


W01

AC Induction Motor

Electromechanical systems

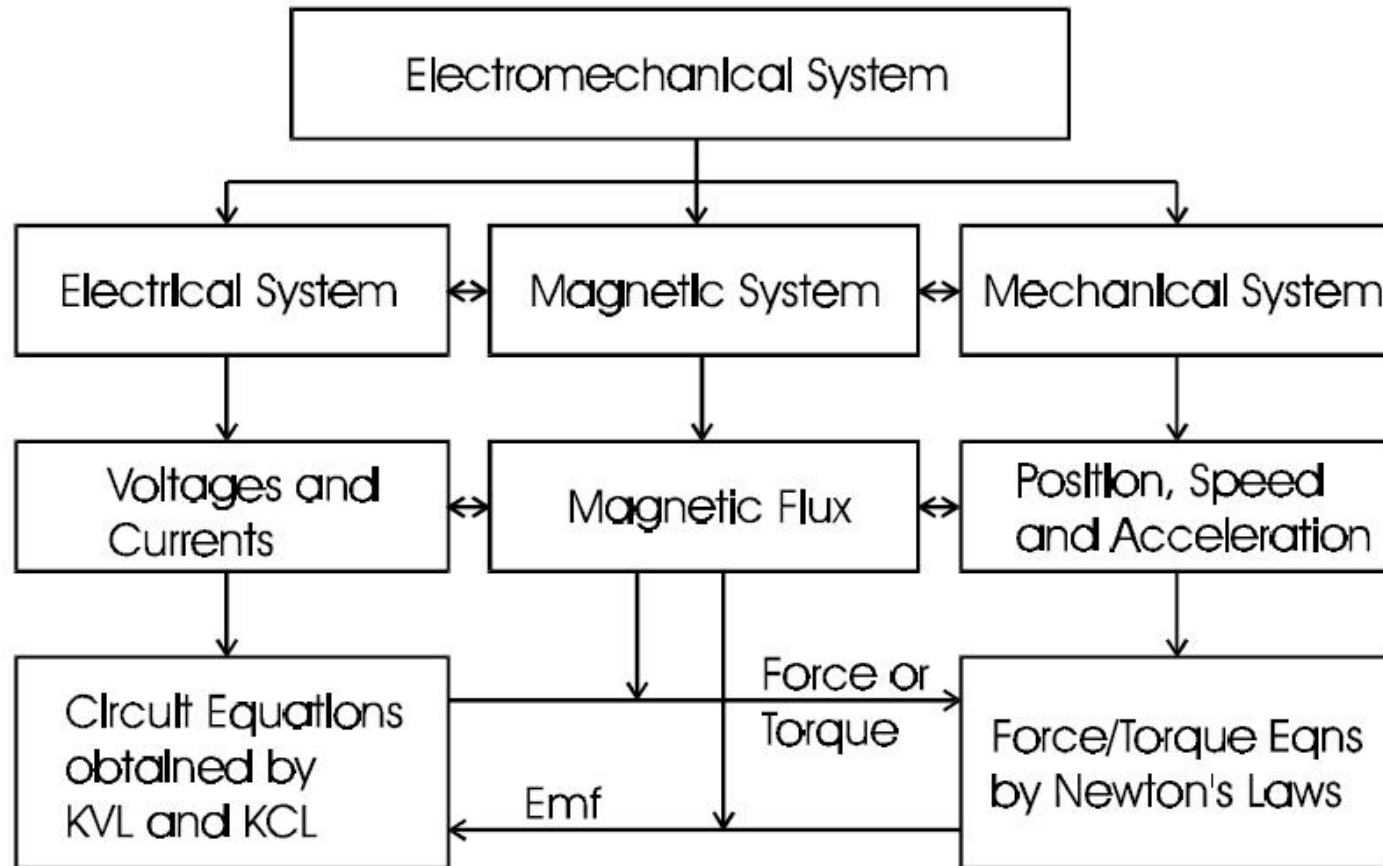

Electric Motors


The electric motor is an electromechanical continuous energy conversion equipment that converts electrical energy into electrical energy mechanical energy. An electric motor utilizes three things to produce motion:

1. Current – In a brush motor when electricity is applied across the motor termination causes a current flows through a brush and commutator system into an electromagnetic armature that moves inside a fixed permanent magnet or fixed electromagnetic stator field. In brushless motor when electricity is applied across the motor termination, a current flows through a fixed stator field and is interacting with a moving permanent magnet or a moving induced magnetic field inside a rotor / armature.
2. Magnetic Flux - A motor can have a fixed wound coil or a permanent magnet stator and a moving wound coil armature or PM rotor that will have interacting magnetic flux fields to produce a force and motion.
3. Force - The amount of current that flows through the electromagnetic field is proportional to the amount of interacting electromagnetic field force required to achieve the opposing work load.

$$i(t) \rightarrow H(t) \rightarrow B(t) \Rightarrow F_{\text{mag}} = i(L \times B) / V_{\text{ind}} = L(v \times B) \rightarrow \theta : \text{rotation}$$


Magnetic field is static in DC Motors and rotary in AC Motors

Electric Motors

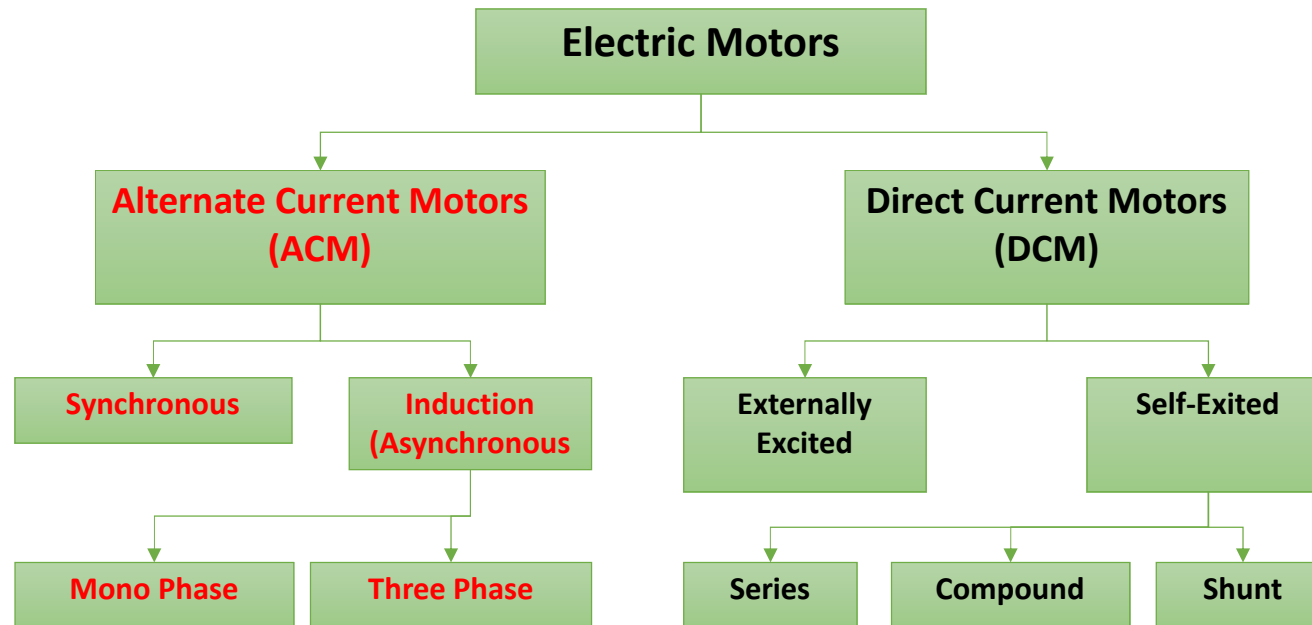

Magnetic field is static in DC Motors and rotary in AC Motors

Alternating Current Motors

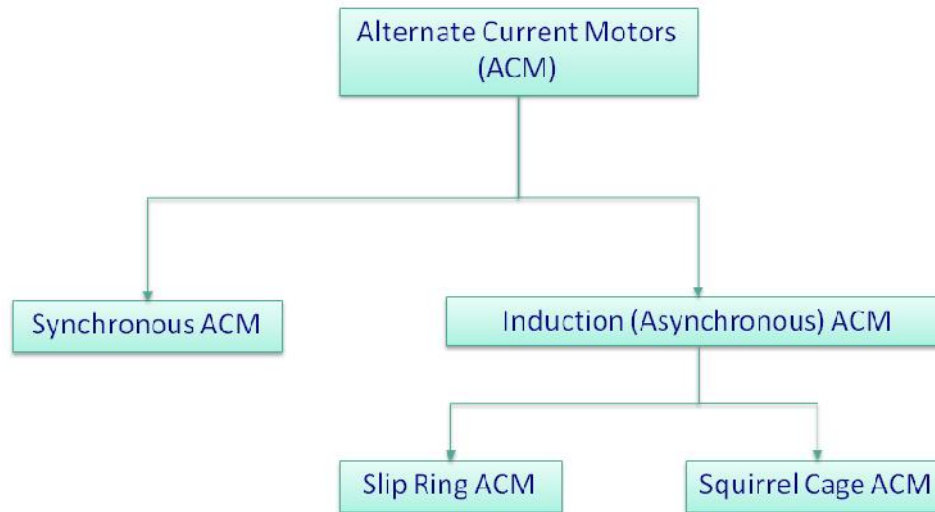

The ACM's are simpler in structure and more economic than DCM's.

An ACM generates more power comparing with a DC motor that has the same weight.


Maintenance of ACM's is easier.

However, their speed control is harder. They can be connected to the AC source directly.

If accuracy in velocity or position control is needed, DCM's are used. But, ACM's are used more than DCM's in industry.

Motor Components


This AC motor has three main parts, rotor, stator, and enclosure. The stator and rotor do the work and the enclosure protects the stator and rotor.

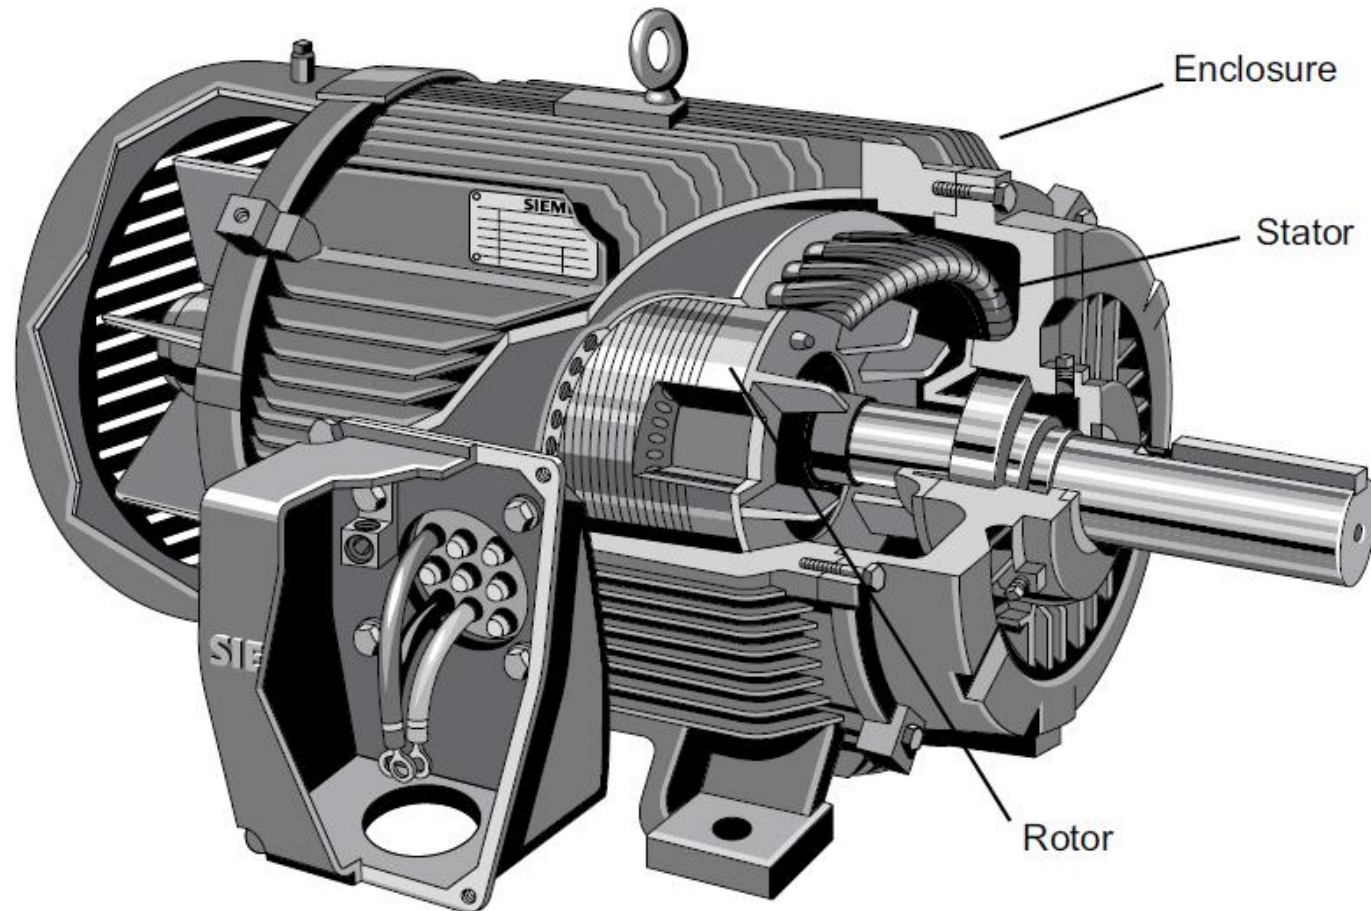

Motor Components

Stator

The stator is the stationary part of the motor's electromagnetic circuit. The stator core is made up of many thin metal sheets, called laminations. Laminations are used to reduce energy losses that would result if a solid core were used. Stator laminations are stacked together forming a hollow cylinder.

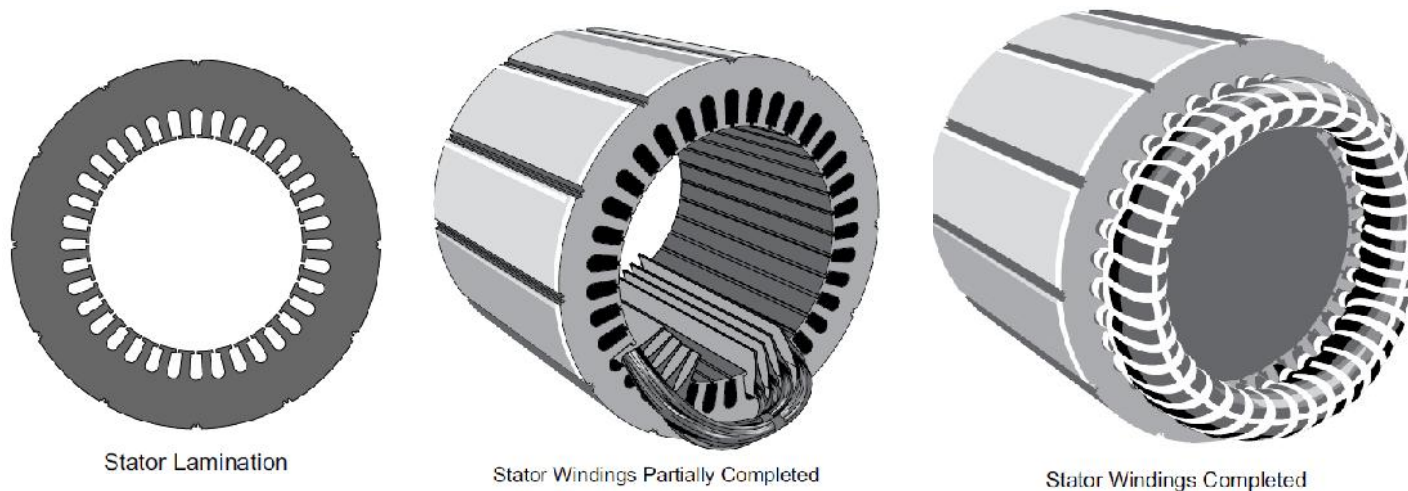

Coils of insulated wire are inserted into slots of the stator core. When the assembled motor is in operation, the stator windings are connected directly to the power source. Each grouping of coils, together with the steel core it surrounds, becomes an electromagnet when current is applied.


Motor Components

Rotor

The rotor is the rotating part of the motor's electromagnetic circuit.

There is no electrical power supplied to rotor conductors in induction motors. Electrical current in rotor flows because of the electromagnetic induction. There are two common types of constructions for rotor used in an **induction motor**.

1. Squirrel cage rotor
2. Wound Rotor

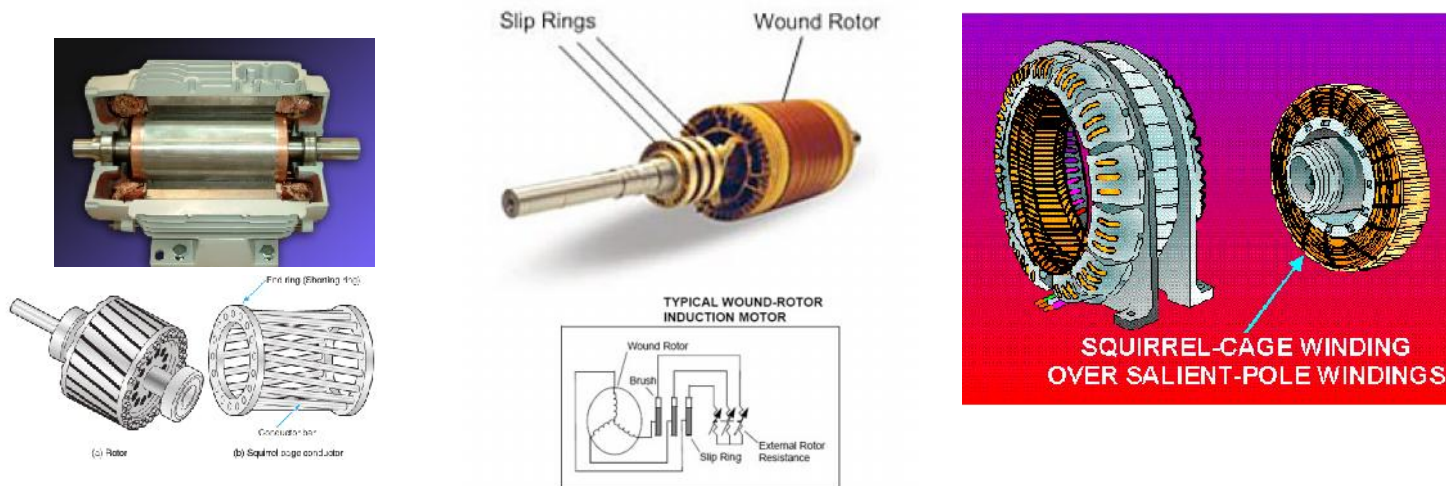

In synchronous motors, the rotor is an electromagnet and a DC power is applied to it. In synchronous rotor construction it is common to use a combination of squirrel cage and wound rotor.


Motor Components

Enclosure


The enclosure consists of a frame (or yoke) and two end brackets (or bearing housings). The stator is mounted inside the frame.

The rotor fits inside the stator with a slight air gap separating it from the stator.

There is no direct physical connection between the rotor and the stator.

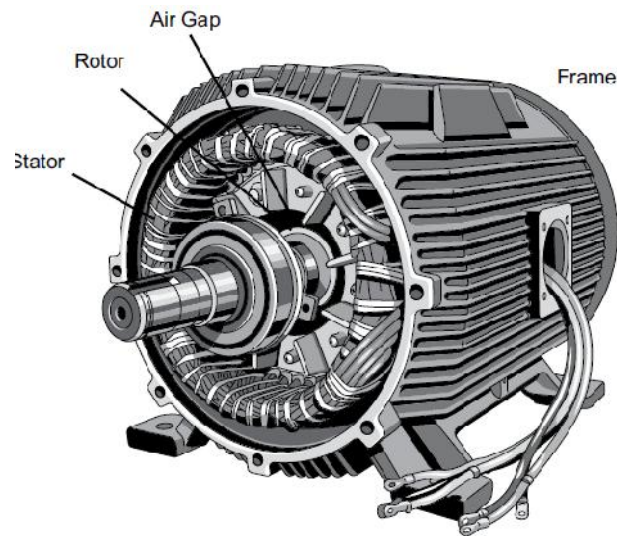

Partially Assembled Motor

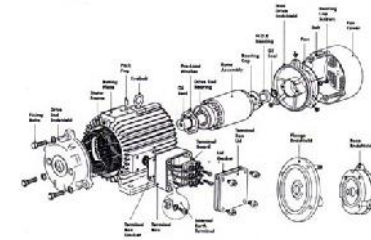

The enclosure protects the internal parts of the motor from water and other environmental elements. The degree of protection depends upon the type of enclosure.


AC Induction (asynchronous) Motor

An induction or asynchronous motor is an AC electric motor in which the electric current in the rotor needed to produce torque is induced by electromagnetic induction from the magnetic field of the stator winding.

An induction motor therefore does not require mechanical commutation, separate-excitation or self-excitation for all or part of the energy transferred from stator to rotor

An induction motor's rotor can be either **wound type** or **squirrel-cage type**.

The squirrel cage rotor is so called because its construction is reminiscent of the rotating exercise wheels found in some pet cages.

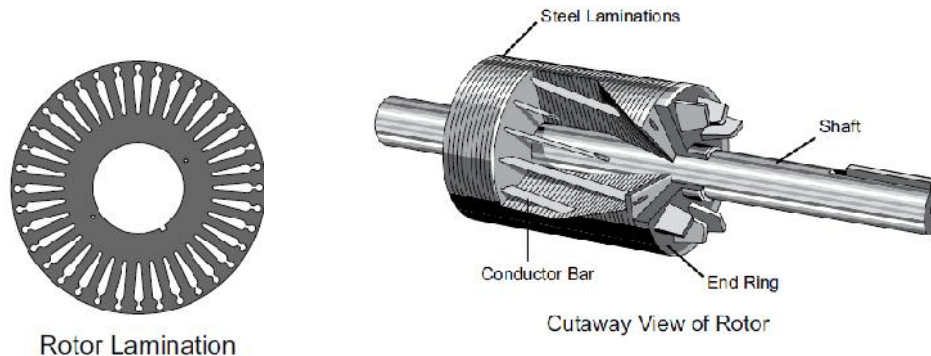


A **squirrel cage rotor** core is made by stacking thin steel laminations to form a cylinder. Rather than using coils of wire as conductors, **conductor bars** are die cast into the slots evenly spaced around the cylinder. Most squirrel cage rotors are made by die casting aluminum to form the conductor bars.

AC Induction (asynchronous) Motor

A major difference between **the wound rotor** motor and the squirrel cage rotor is that the conductors of the wound rotor consist of wound coils instead of bars.

These coils are connected through slip rings and brushes to external variable resistors. The rotating magnetic field induces a voltage in the rotor windings.

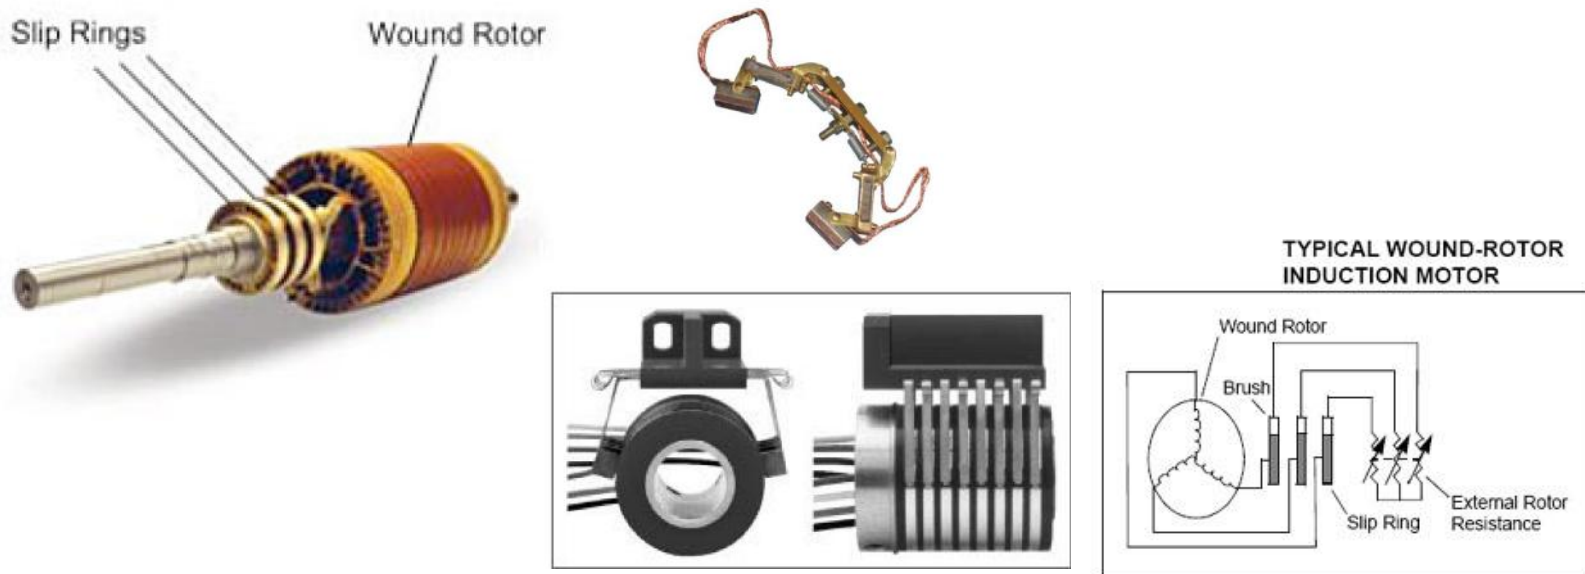

Increasing the resistance of the rotor windings causes less current to flow in the rotor windings, decreasing rotor speed. Decreasing the resistance causes more current to flow, increasing rotor speed.

Magnetic Field in Stator Coil


The magnetic field of an electromagnet has the same characteristics as a natural magnet, including a north and south pole. However, when the direction of current flow through the electromagnet changes, the polarity of the electromagnet changes. The polarity of an electromagnet connected to an AC source changes at the frequency of the AC source.

At time 1, there is no current flow, and no magnetic field is produced.

At time 2, current is flowing in a positive direction, and a magnetic field builds up around the electromagnet

At time 3, current flow is at its peak positive value, and the strength of the electromagnetic field has also peaked


At time 6, current is increasing in the negative direction. Note that the polarity of the electromagnetic field has changed. The negative half of the cycle continues through times 7 and 8, returning to zero at time 9.

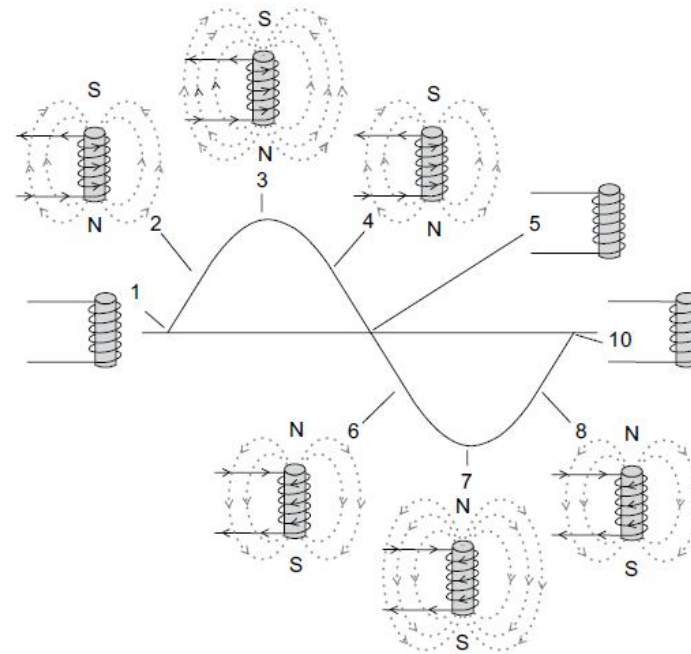

For a 60 Hz AC power supply, this process repeats 60 times a second.

Developing a Rotating Magnetic Field in Stator Coil

The stator of an AC motor is a hollow cylinder in which coils of insulated wire are inserted.

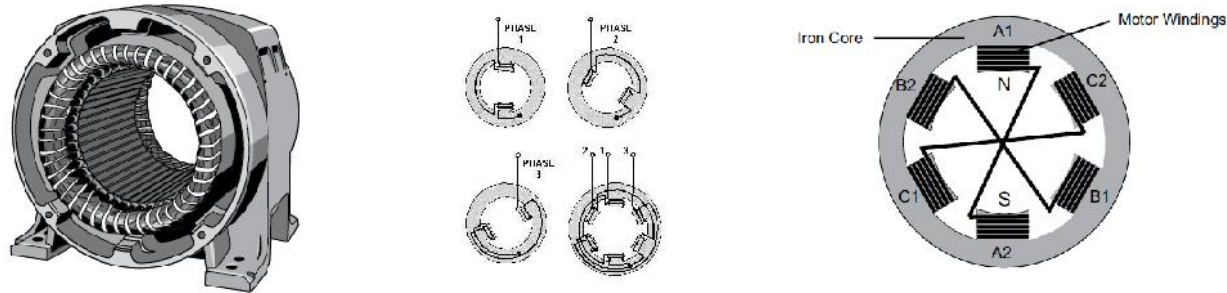


The coils are wound around the soft iron core material of the stator. Six stator windings are used, two for each of the three phases (two pole configuration).

When current is applied, each winding becomes an electromagnet, with the two windings for each phase operating as the opposite ends of one magnet.


The stator is connected to a three-phase AC power source. The A1 and A2 connected to phase A of the power supply. When the connections are completed, B1 and B2 will be connected to phase B, and C1 and C2 will be connected to phase C.

. This corresponds to the 120° separation between each electrical phase.

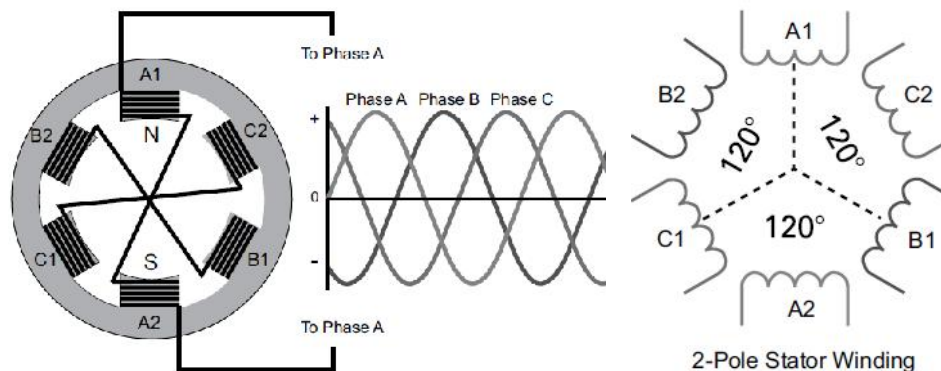

Developing a Rotating Magnetic Field in Stator Coil

At the end of six such time intervals (it takes one period of applied AC voltage), the magnetic field will have rotated one full revolution or 360° .

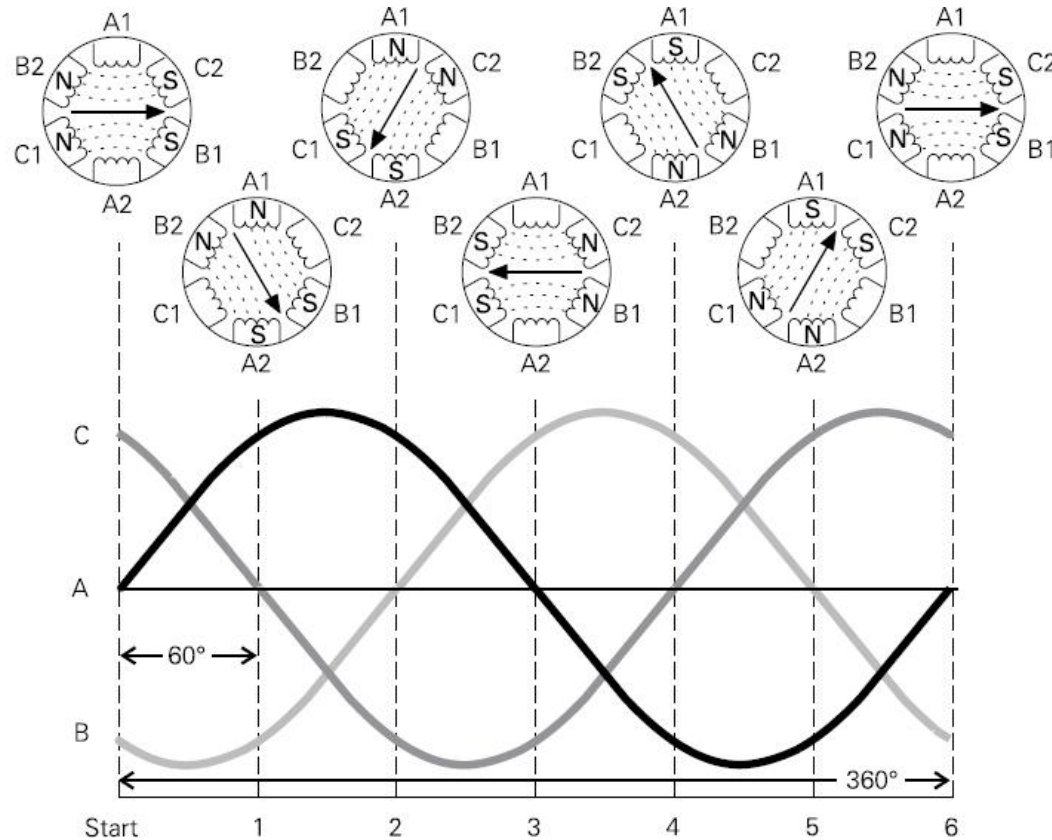

This process repeats 50 times a second for a 60 Hz power source.


Synchronous Speed of an AC Motor

The speed of the rotating magnetic field is referred to as the **synchronous speed (NS)** of the motor.


Synchronous speed is equal to 120 times the frequency (f_{AC}), divided by the number of motor poles (p).

$$n_s = \frac{120f_{AC}}{p}$$

No. Poles	<u>Synchronous Speed</u> (no Load)	
	60 hz	50 hz
2 Pole	3600	3000
4 Pole	1800	1500
6 Pole	1200	1000
8 Pole	900	750

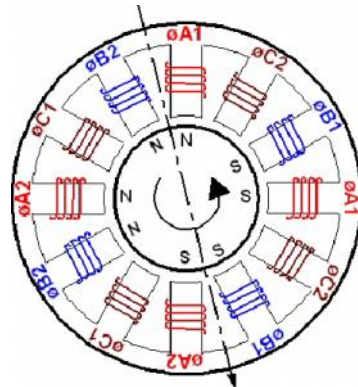

4 pole motor stator

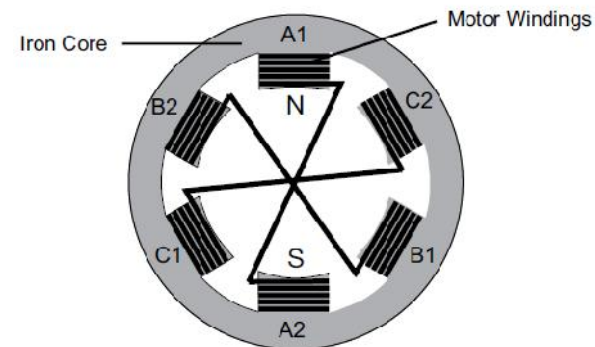


2 pole motor stator

Rotor Rotation

An induction motor **induces a current in its rotor so that a magnetic force can exist on rotor conductors**

When current is flowing in a stator winding, the electromagnetic field created cuts across the nearest rotor bars.

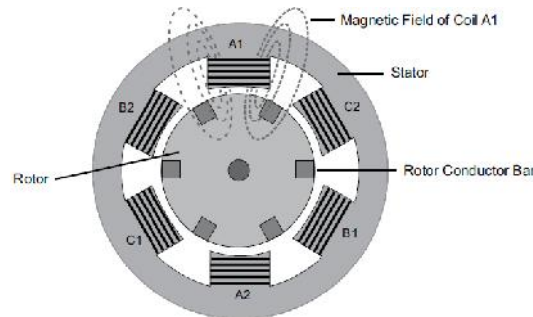

$$E_{\text{rotor}} = (V \times B_{\text{stator}}) L_{\text{conductor}}$$

When a conductor, such as a rotor bar, passes through a magnetic field, a voltage (emf) is induced in the conductor.

“V” is the relative velocity of the conductor with respect to stator magnetic field. This relative velocity term is critical in operation of AC induction motors because the voltage can only be induced on rotor conductors if this velocity term is not zero.

So it is evident that the rotor and stator magnetic field have different angular speeds

The induced voltage causes current flow in the conductor. In a squirrel cage rotor, current flows through the rotor bars and around the end ring and produces a magnetic field round each rotor bar. In a wound rotor current flows through the external circuit, which is connected to slip rings

Rotor Rotation

An induction motor **induces a current in its rotor so that a magnetic force can exist on rotor conductors**

A magnetic force acts on rotor conductors which, eventually, turns the rotor

$$F = (i_{\text{rotor}} \times B_{\text{stator}}) L_{\text{conductor}}$$

For a three-phase AC induction motor, the rotating magnetic field must rotate faster than the rotor to induce current in the rotor.

When power is first applied to the motor with the rotor stopped, this difference in speed is at its maximum and a large amount of current is induced in the rotor. (higher torque need)
After the motor has been running long enough to get up to operating speed, the difference between the synchronous speed of the rotating magnetic field and the rotor speed is much smaller.

This speed difference is called slip. Slip is expressed as a percentage of the synchronous speed


$$s = \frac{n_{\text{sync}} - n_{\text{async}}}{n_{\text{sync}}} 100$$

Slip is necessary to produce torque. Slip is also dependent on load. An increase in load causes the rotor to slow down, increasing slip.

Operation of Induction Motors


Approximate Electrical Motor Speed (RPM)				
No. Poles	Speed with Rated Load		<u>Synchronous Speed</u> (no Load)	
	60 hz	50 hz	60 hz	50 hz
2 Pole	3450	2850	3600	3000
4 Pole	1725	1425	1800	1500
6 Pole	1140	950	1200	1000
8 Pole	850	700	900	750

Slip Example Curve Explanation

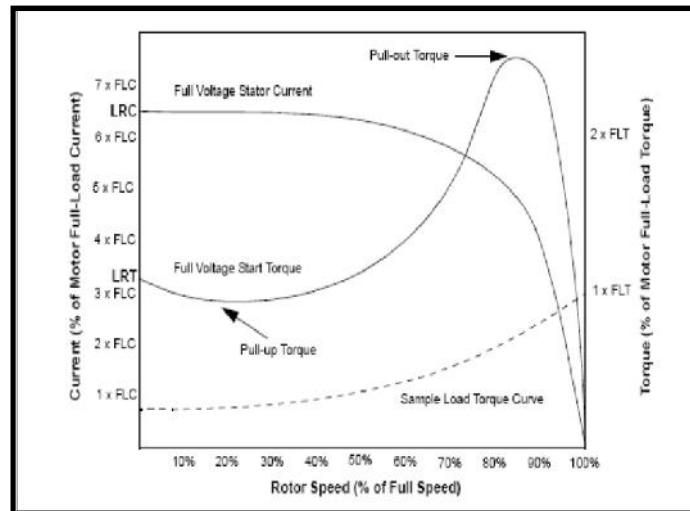

Aynchronous Speed of Motors

Losses in Asynchronous Motors

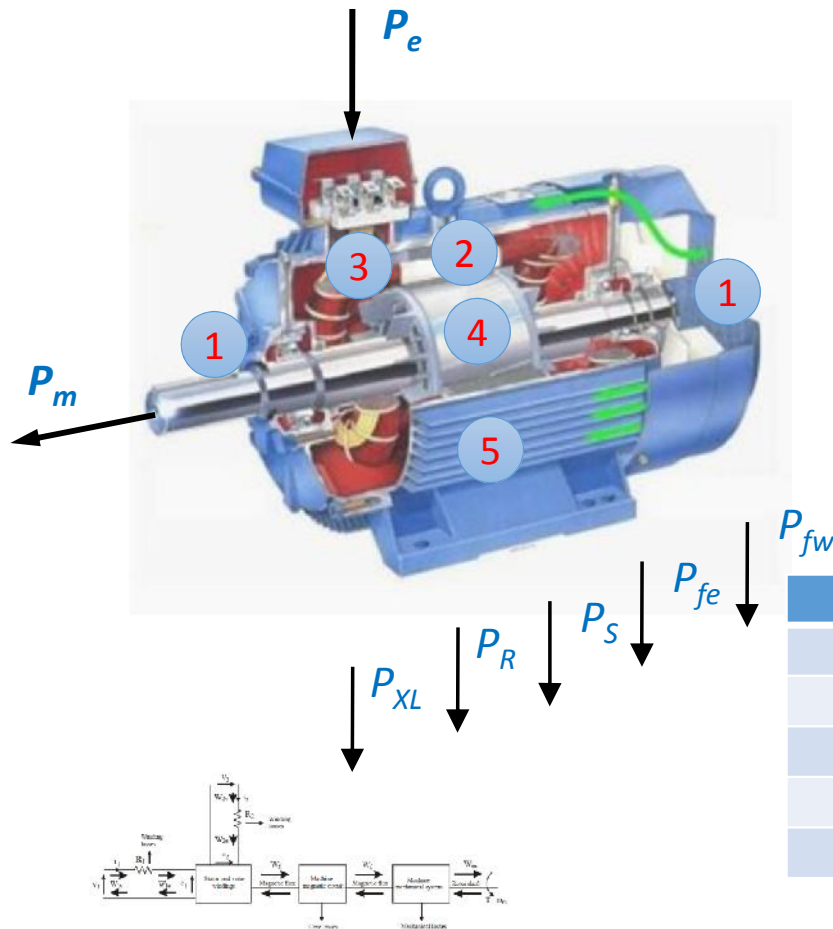

Losses	Notation
Friction and air flow losses	P_{fw}
Iron loss	P_{fe}
Loss of conductor (stator - copper)	P_S
Loss of conductor (rotor - alluminium)	P_R
Additinal load loss	P_{XL}

Losses	
Friction and Air Flow Losses	% 0,5 ~ 1,5
Iron loss	% 1,5 ~ 2,5
Conductor loss (stator)	% 2,5 ~ 4,0
Conductor Loss (rotor)	% 1,5 ~ 2,5
Additional load losses	% 0,5 ~ 2,5