

REPLACEMENT

HINT:


Installation is in the reverse order of removal.

1. PRECAUTION (SEE PAGE 60-1)

2. DISCONNECT BATTERY NEGATIVE TERMINAL

CAUTION:

After removing the terminal, wait for at least 90 seconds before starting the operation.

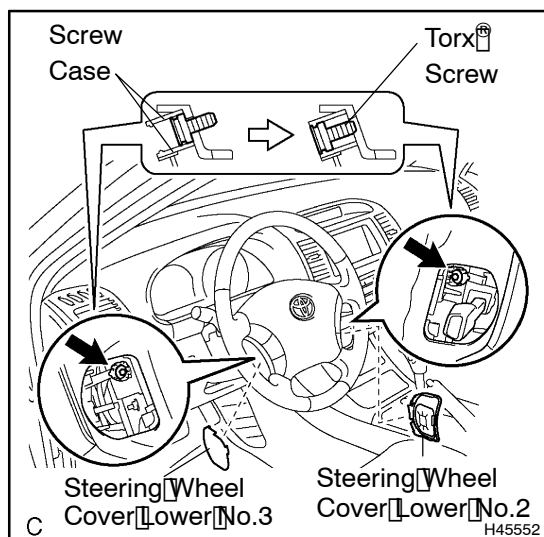

3. REMOVE STEERING WHEEL COVER LOWER NO.2

- (a) Using a screwdriver, remove the steering wheel cover lower No.2.

HINT:

Tape up the screwdriver tip before use.

4. REMOVE STEERING WHEEL COVER LOWER NO.3

- (a) Using a screwdriver, remove the steering wheel cover lower No.3.

HINT:

Tape up the screwdriver tip before use.

5. REMOVE HORN BUTTON ASSY

- (a) Place the front wheels facing straight ahead.
- (b) Using a torx® socket wrench (T30), loosen the 2 torx® screws until the groove along the screw circumference catches on the screw case.
- (c) Pull out the horn button assy from the steering wheel assy and support the horn button assy with one hand as shown in the illustration.

NOTICE:


When removing the horn button assy, do not pull the airbag wire harness.


- (d) Disconnect the horn connector.
- (e) Disconnect the connector from the horn button assy.

NOTICE:

When handling the airbag connector, take care not to damage the airbag wire harness.

- (f) Remove the horn button assy.

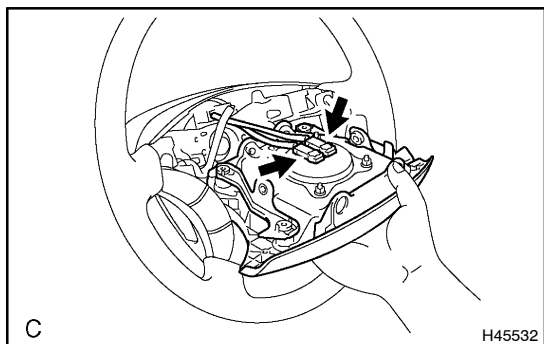

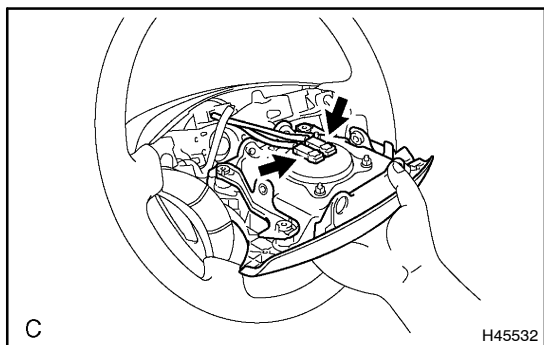

6. INSTALL HORN BUTTON ASSY

- Support the horn button assy with one hand as shown in the illustration.
- Connect the connector to the horn button assy.


NOTICE:

When handling the airbag connector, take care not to damage the airbag wire harness.

- Connect the horn connector.
- Confirm that the circumference groove of the Torx® screw fits in the screw case, and place the horn button assy onto the steering wheel assy.
- Using a Torx® socket wrench (T30), tighten the 2 Torx® screws.

Torque: 3.8 N·m (90 kgf·cm, 78 in.·lb)

7. CONNECT BATTERY NEGATIVE TERMINAL

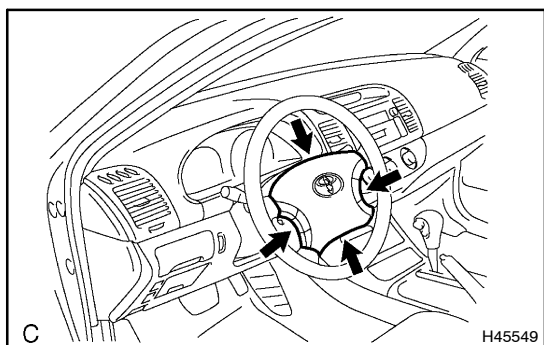

8. INSPECT HORN BUTTON ASSY

- With the horn button assy installed on the vehicle, perform a visual check. If there are any defects as mentioned below, replace the horn button assy with a new one: Cuts, minute cracks or marked discoloration on the horn button assy top surface or in the grooved portion.
- Make sure that the horn sounds.

HINT:

If the horn does not sound, inspect the horn system (see pub. No. RM915E, page 69-3).

9. INSPECT SRS WARNING LIGHT (SEE PAGE 05-10)