AlphaLink CAM Reference Manual

Oct 13, 2026 · @Eduard

Contents

- Introduction
- Starting and the screen
  - Starting
  - A new drawing
  - Screen layout
- Drawing commands (CAD)
  - Finding
  - Lines and arcs
  - Corners and editing
  - Measuring, text and view
- Machining commands (CAM)
  - Settings every operation has
  - Identifying the contour
  - Cutting direction
  - Operations
  - Notes
  - Standard threads
  - Job templates
- Checking the work
- File handling
  - ALPHA-T drawings
  - DXF drawings
  - Second setup
  - Program number and units
- Sending to the machine
  - Connection

    - Load a CAM program
    - Manual Ops backup and restore
    - Cable test
- Tool library
- Preferences, input and keyboard
    - Touch, pen and mouse
    - Keyboard summary
- Problems and support

Introduction

AlphaLink CAM is a drawing and machining program made only for the Harrison Alpha 400T lathe with its FANUC Power Mate 0 control and the Harrison T macros. It replaces the DOS program ALPHA-T (ALPHALINK V1.2): it writes the same programs, byte for byte, and sends them over the same serial cable.

This manual follows the order of the ALPHA-T manual (LNK/T-G1.2, 2002): the screen, then every drawing (CAD) command, every machining (CAM) command, checking the work, files, sending to the machine, the tool library and problems. Where ALPHA-T had a one-letter key (*Heisse Taste*), it is given with the command; those keys work the same here. For a step-by-step introduction, use the Training Manual first.

Conventions:

- **Bold** names are buttons, menu items and fields as the app shows them in English. The Ukrainian tab uses the Ukrainian names.
- X is always a **diameter**, Z a length; Z0 is the front face and the part lies in -Z.
- **Tap** means a finger, pen or mouse click. **Enter** accepts, **Esc** cancels, as in ALPHA-T.
- Feeds are always per revolution in the drawing's units (mm or inch).

Starting and the screen

Starting

Start **AlphaLink CAM** from the applications menu, or `flatpak run io.github._0wn3r.AlphaLinkCAM`. Without a part open the window offers **New Part…** and **Open…**, and **Open the Training Manual** under them.

A new drawing

New Part… (Ctrl+N) asks what ALPHA-T asked when starting a drawing, plus two display options:

Field	Meaning
Units	mm or inch for the drawing
Billet diameter	the bar's diameter (X)
Billet length	how far the bar sticks out of the chuck (Z)
Bore	inner diameter of a tube billet; 0 = solid bar
Chuck jaws	on the outside (as ALPHA-T draws them) or in the bore
Show tailstock	draws the tailstock centre at the front face

The tool change position is X100 Z50 and the first tool comes from **Preferences**; both can be changed later with a **Tool Change** operation. **Part Settings** in the main menu changes the billet, jaws and tailstock of an open part.


Screen layout

Area	What it holds
Header bar	open, save, undo/redo, page switcher, touch lock, **Export PRG**, main menu
Operations list (left)	the machining steps in order; **+** adds one
Drawing (Part page)	billet, chuck jaws, part, toolpaths, grid, axis arrows (+Z right, +X up), the cross at X0 Z0
Simulation bar	first move, previous pass, play/pause, next pass, show all, playback speed, start of the selected operation; move, operation, pass and program line
Tool bar	Select, Line, Arc, Fillet, Chamfer, Corner, **More**, the `X , Z` entry, **Done**
Coordinate readout	the pointer's X and Z

Area	What it holds
Operation editor (right)	the settings of the selected operation

Pages: **Part** (drawing and toolpaths), **Program** (the program as sent), **Sheet** (setup sheet), **Tools** (tool library), **Machine** (sending and backup). On a narrow window (below 1000 px, such as half a Surface or a Surface held upright) the operations list becomes its own page and the page switcher moves to the bottom.

CAD and CAM are not separate screens as in ALPHA-T: draw with the tool bar, machine with the operations list, on the same page. ALPHA-T's **C** key opens the operations menu.

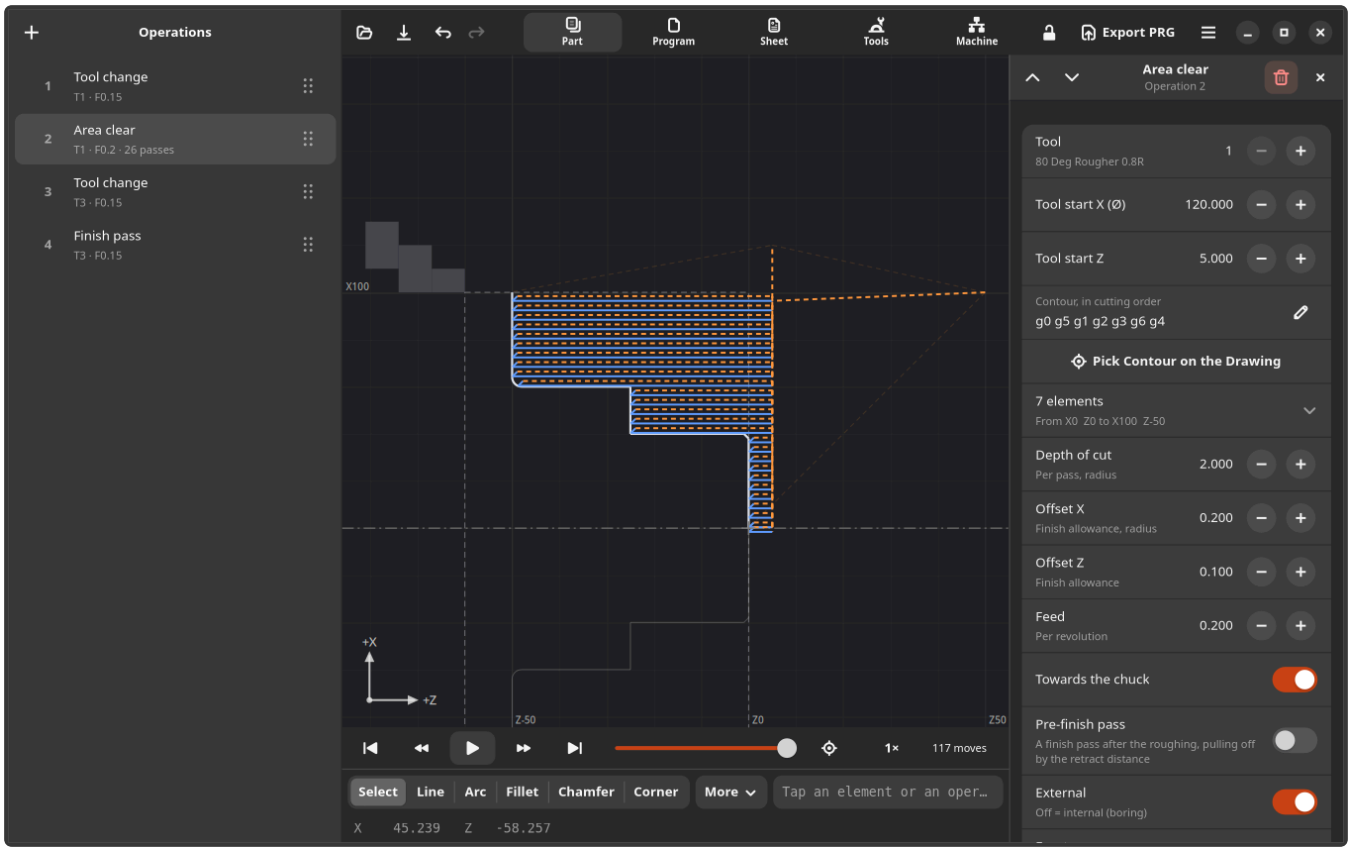

Drawing commands (CAD)

Only the upper half of the part is drawn; the faint lower half is its mirror image. Coordinates are typed in the entry under the drawing as `X,Z` (absolute) or `@dX,dZ` (from the last point), then Enter, or set by tapping: taps snap to line ends, the axis and the grid, and lock to Z, X or 45°. Tapping the first point again closes the profile and ends the line. With a finger, a chip on the last line shows where it ends; tapping it opens the keypad to correct that point.

The cursor. As in ALPHA-T there is a cursor (a cross): the pointer's last place on the drawing, or where the keys below put it. Arrow keys move it by the step (start 10 mm; PgUp/PgDn ×10 / ÷10, down to 0.001), Home puts it in the middle of the view, End on X0 Z0, and Enter takes it as the next point.

Finding

Command	Key	What it does
Find point	P	cursor to the nearest line end, arc end or arc centre
Find intersection	I	cursor to the nearest crossing of two elements
Find line	L	marks the nearest line; then - or Delete erases it
Find arc	A	marks the nearest arc; then - or Delete erases it
Cursor to X,Z	G	asks X,Z; the cursor goes there
Cursor by dX,dZ	H	asks an increment
Cursor by length, angle	Y	asks length,angle (0° towards -Z, 90° towards +X)

Lines and arcs

Command	Key	What it does
Start point	S	starts a line at the cursor
Line X,Z	X	the Line tool, ready for typed points (typing a number does the same)
Line length, angle	D	asks length,angle from the last point
Line by taps	+	the Line tool for tapping points; **Done** or Esc ends the line
Arc (3 points)		**Arc** tool: start, a point on the arc, end
Circle		**More ▸ Circle…**: centre X, Z and radius; drawn as two halves split at the 3 o'clock point

Command	Key	What it does
Tangent		**More ▸ Tangent**: a point (or line end) and an arc, or two arcs; tap the wanted line among the dashed ones
Tangent at an angle		**More ▸ Tangent at an Angle…**: an arc and an angle; 1.5 × long
Parallel line		**More ▸ Parallel Line…**: a line and a distance; 1.5 × as long, either side
Blend arc	O	**More ▸ Blend Arc…**: an arc of a radius touching two points, lines or arcs

Corners and editing

Command	Key	What it does
Radius / chamfer at a corner	F	the corner nearest the cursor: radius (Fillet) or chamfer size × angle (Chamfer)
Fillet tool	—	tap corners for radii
Trim corner	K	**Corner**: two lines are extended or trimmed until they meet
Split arc		**More ▸ Split Arc**: tap where the arc should be split
Mirror		**More ▸ Mirror Image**: the whole drawing copied mirrored about the spindle axis at once, then "Is this correct?" (No takes it back), as in ALPHA-T
Erase element	Delete	erases the selected line or arc (Undo brings it back)
Erase drawing	Q	erases everything after asking
Chamfer / round outside corners	—	More ▸ Chamfer Outside Corners… / Round Outside Corners…: one size (and angle) on every convex corner between two lines of the outer profile, as one undo step; corners whose lines are too short are left


Command	Key	What it does
Standard thread	—	More ▸ Standard Thread… on a selected diameter line: see Standard threads under Machining commands

Note: a chamfer's size is measured along the line that runs along Z and its angle is from that line: 2×30° on a shoulder is 2 mm along the diameter, 1.155 mm down the face.

Measuring, text and view

Command	Key	What it does
Measure X,Z	M	two points; shows the X and Z distance
Measure length, angle	N	two points; shows the length and angle
Text	T	puts text at the cursor (not machined)
Erase text	U	erases the nearest text
Zoom	Z	zooms in at the cursor (pinch, Ctrl+wheel and Ctrl++ too)
Redraw / fit	R	fits the whole part (double tap, Ctrl+0)
Recall view	V	back to the view before
Operations menu	C	ALPHA-T's CAD/CAM switch: opens the list of operations

Esc ends the current line or command and gives the keyboard back to the drawing, so the letter keys work again. Tab is not mapped (E, ALPHA-T's exit, edits here); F1 is this program's help.

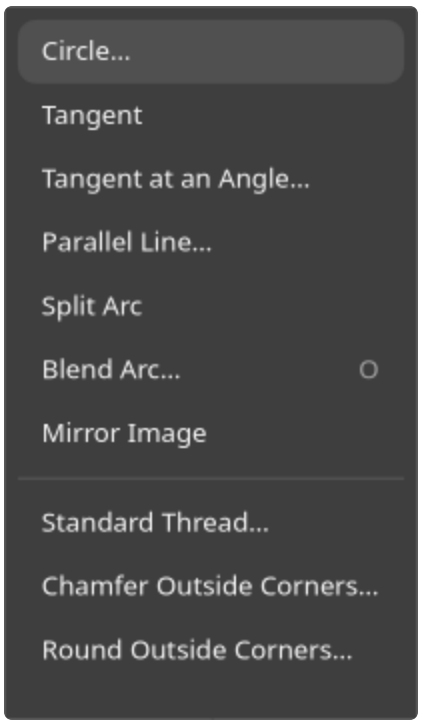

Editing an element (not in ALPHA-T, which could only erase and redraw): select a line or arc and tap the pencil next to the bin, or press E. Type new start and end points (and, for an arc, a radius). With **Move connected ends too** on, the elements that met it move with it, so the profile stays joined. Undo puts it back.

A selected element shows handles at its ends: drag one to move that point, and the elements joined to it follow. With a finger a loupe shows the spot; moving slowly drags finely. A long press or a right click on an element opens **Edit Values…**, **Delete**, **Zoom Here** and **Fit Part**; the Menu key or Shift+F10 opens the same menu at the cursor. Tapping a corner where two elements meet offers both.

Three keys are added that ALPHA-T left free: **E** edits the selected element and **B** is the Chamfer tool and W the Arc tool. Hovering over a tool on the drawing bar shows its keys. **Esc** also clears the messages at the bottom of the window (or main menu ▸ **Clear Messages**).

Machining commands (CAM)

Operations are added with **+** above the operations list (or the **C** key) and are carried out in list order. Selecting one opens its editor; the arrows in its header move it up or down, the bin deletes it, and each row's handle drags it to another place. Duplicate Operation at the end of the editor copies it. Every change regenerates the toolpaths at once. Adding Grooving, Threading or Drilling while the tool in the turret does not suit them inserts a Tool

Change to a suitable tool first. Tool warnings (a turning tool on a thread, a groove tip width that differs from the tool, an external tool inside) show as a sign on the row and on the setup sheet; they never block the program.

Settings every operation has

- **Tool**: the tool memory slot on the control. The name from the tool library is shown under it.
- **Tool start** X, Z: where the tool goes before the operation and after each pass. Keep it clear of the billet. On the lathe the macros only start the operation with the tool within about 5 mm of this point.
- **Feed**: per revolution, any value from 0.001 up to the machine's maximum.

Identifying the contour

Area clear, finish pass, face clear and grooving follow a **contour**: drawing elements in cutting order. A new operation takes the outer profile, without thread lines and construction lines; Grooving takes the nearest groove and its neighbours, Threading the two thread lines. To choose: **Pick Contour on the Drawing**, tap the elements in the order the tool should follow them (numbers show the order; tap again to remove), then **Done** or Enter (or 3, as in ALPHA-T). The editor lists the picked elements with their start and end points.

Note: as in ALPHA-T, the direction of the contour matters: it sets the direction of cutting.

Cutting direction

Setting	Meaning
External on/off	outside work, or internal (boring): sets the retract direction and the side the allowance is left on
Towards the chuck	cut towards the headstock; ALPHA-T's AWAY is refused (see Problems)
Front on/off	area clear along Z, or across the face (FACE)

Note: the ALPHA-T manual says the direction the contour is picked in sets the cutting direction. Tried in ALPHA-T, a contour picked from the chuck end gives unusable programs: area clear only skims the front face and face clear makes one cut at the

shoulder. The app therefore cuts area and face clear as if the contour had been picked from the front, whichever end you start at.

Operations

Operation	What it does	Settings	#127
Tool Change	stops at the tool change point for the operator to fit the tool	tool, tool change point, feed	1
Area Clear	roughing passes along Z, each diameter its own pass, 45° pull-off by the retract distance (1 mm); with Follow contour each pass also cleans up the step it leaves	depth of cut (per side), offset X/Z (allowance), external, towards, front, pre-finish, follow contour, retract distance	6 / 7 internal / 8 face
Pre-finish pass	a finish pass along the contour after the roughing, part of the same operation	(switch in Area Clear and Face Clear)	10 / 11 / 12
Finish Pass	one pass along the contour; approach and 0.2 mm pull-off at 45°, nose radius compensated	offset X/Z, external, face (pull-off towards the axis)	14 / 15 internal / 16 face
Face Clear	roughing passes across the faces towards the axis, one depth of cut at a time along Z	depth of cut, offset X/Z, pre-finish	8
Grooving	plunges along a drawn groove, or one pass along it (finish mode); Front off = face grooving (plunges along -Z into a face)	tip width, stepover, peck depth (0 = in one go), full retract, dwell, datum left/right, finish offset X/Z, Z shift and repeats, mode area/finish, external	9 / 17 finish

Operation	What it does	Settings	#127
Threading	thread cuts between an outer and an inner diameter line	pitch, first cut depth or number of cuts, lead in (default 5), lead out, spring passes (count), external, infeed angle (0 = straight in, e.g. 30 = along one flank)	20 / 21 spring
Drilling	a hole on the centre line, pecking and dwelling as set	hole bottom Z (absolute), peck (0 = in one go), dwell, retract distance (2 mm), full retract	18
Dwell	waits a number of spindle revolutions	revolutions	
Move / Rapid	feed or rapid move to a point	X, Z, rapid	

Notes


- **Depth of cut** is the true depth per side; the number of passes is worked out from it, exactly as ALPHA-T does.
- **Offset X, Z** leaves material for finishing: X on radius, Z along the axis.
- **Grooving datum** says which corner of the tip the tool memory measures; left is the -Z corner. A groove's tip width must be the real width of the tool.
- **Threading**: cut n goes to first × √n. With **Number of cuts** the first cut is depth ÷ √n. Every cut starts the lead-in in front of the thread so the slide is up to speed; the spring pass repeats the last cut. The thread's length and depth come from the two lines.
- **Dwell** and **Move / Rapid** placed after an operation run at its end, as ALPHA-T's *Verweilen*, *Vorschub zur Lichtmarke* and *Eilgang zur Lichtmarke*.
- ALPHA-T's *delete last move* and *delete all moves* are the bin and Undo here; nothing is lost until you close without saving.

Standard threads

More ▸ Standard Thread… threads the selected diameter line (a line along Z) in one step; with no such line selected, a banner asks you to tap it, from the ISO 261 metric or the unified inch (ASME B1.1) tables:

- **Standard**: ISO metric, UNC (inch, coarse) or UNF (inch, fine); a mm part starts on metric, an inch part on UNC.
- **Size**: M6 to M64, or 1/4″ to 2″ (UNF to 1-1/2″), the line's nearest size first. **Pitch**: for metric the coarse pitch first, then the fine ones (M40 and M50 have fine pitches only); for UNC and UNF the standard threads per inch.
- The line moves to the nominal diameter d, and the minor-diameter line is drawn under it: d − 1.22687 P for metric (depth 0.61343 P on the radius), d − 1.19078 P for UNC/UNF with the rounded UNR root (depth 0.59539 P).
- **Relief groove** (on by default) cuts an undercut with DIN 76 proportions, Ø d − 1.5 P and 3 P long, into the back end of the line; the minor line runs to its middle.
- **Add a Threading operation** adds the Threading operation with that pitch, with a Tool Change before it when the tool in the turret is not a threading tool.

An inch thread on a mm part, or a metric thread on an inch part, is converted to the part's units. The program writes the doubled pitch to 0.001 mm (0.0001 inch), so a 1/2-13 UNC on a mm part is out by less than 0.0002 mm per turn. All of it is one undo step.

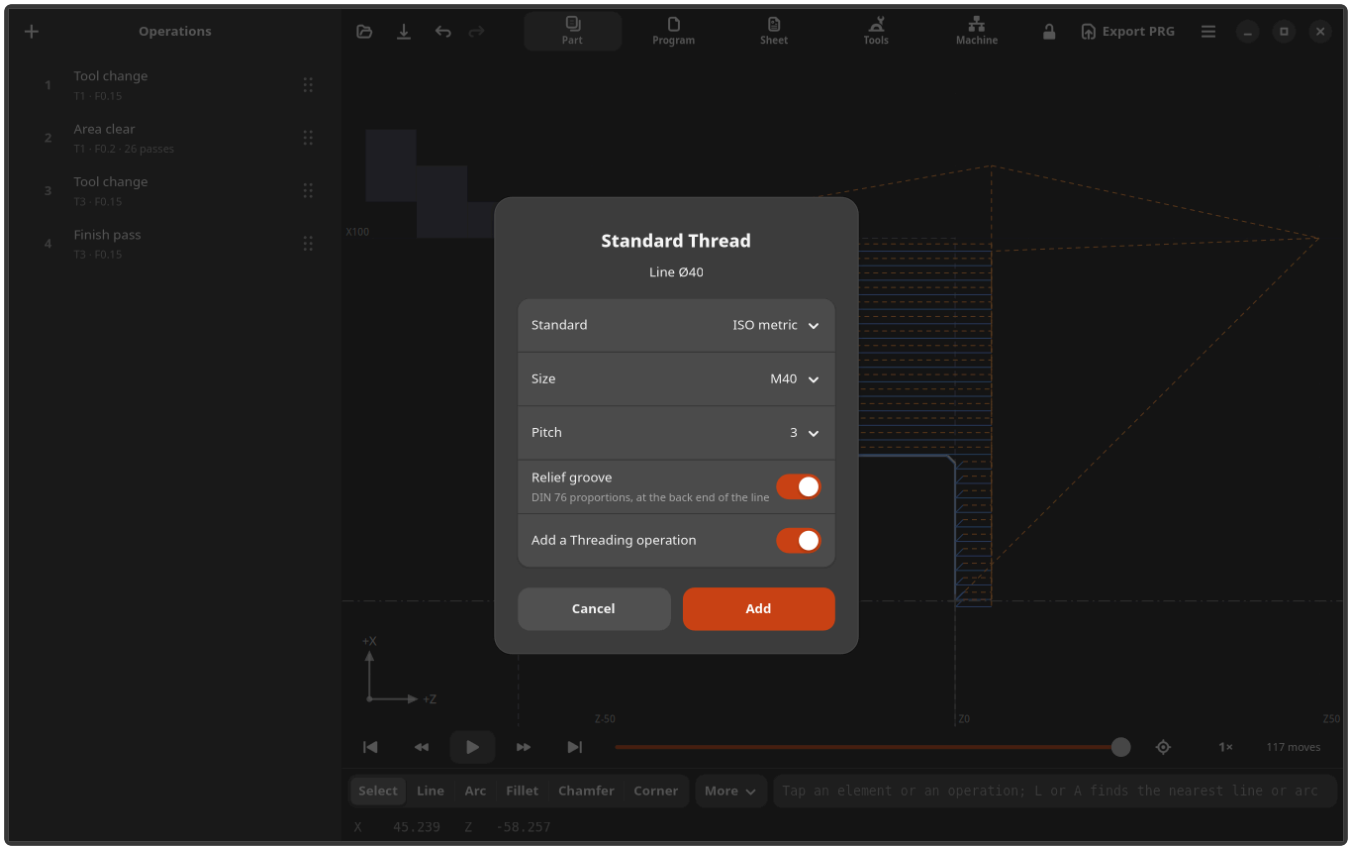


Job templates

A template is a saved list of operations with their tools and settings but no drawing. **+ ▸ Templates** lists them; choosing one adds its operations to the part as one undo step, with the contours picked from this drawing the way a new operation picks them: the outer profile, the bore for internal operations (the chain closest to the axis), the groove and the two thread lines. Tool starts come from the billet; a drill set to go through takes the billet's length.

Template	Operations
Shaft: rough T1, finish T3	tool change T1, area clear (2 mm cuts, 0.2/0.1 allowance), tool change T3, finish pass
Bush: drill T25, bore rough and finish T12	tool change T25, drill through, tool change T12, internal area clear, internal finish pass
Groove and thread: groove T16, thread T31	tool change T16, grooving (2 mm tip), tool change T31, threading (one spring pass)

+ ▸ Save Operations as Template… keeps the open part's operations as a template of your own (in ~/.config/alphalink-cam/templates). A template saved in mm is converted when it is applied to an inch part, and the other way round.

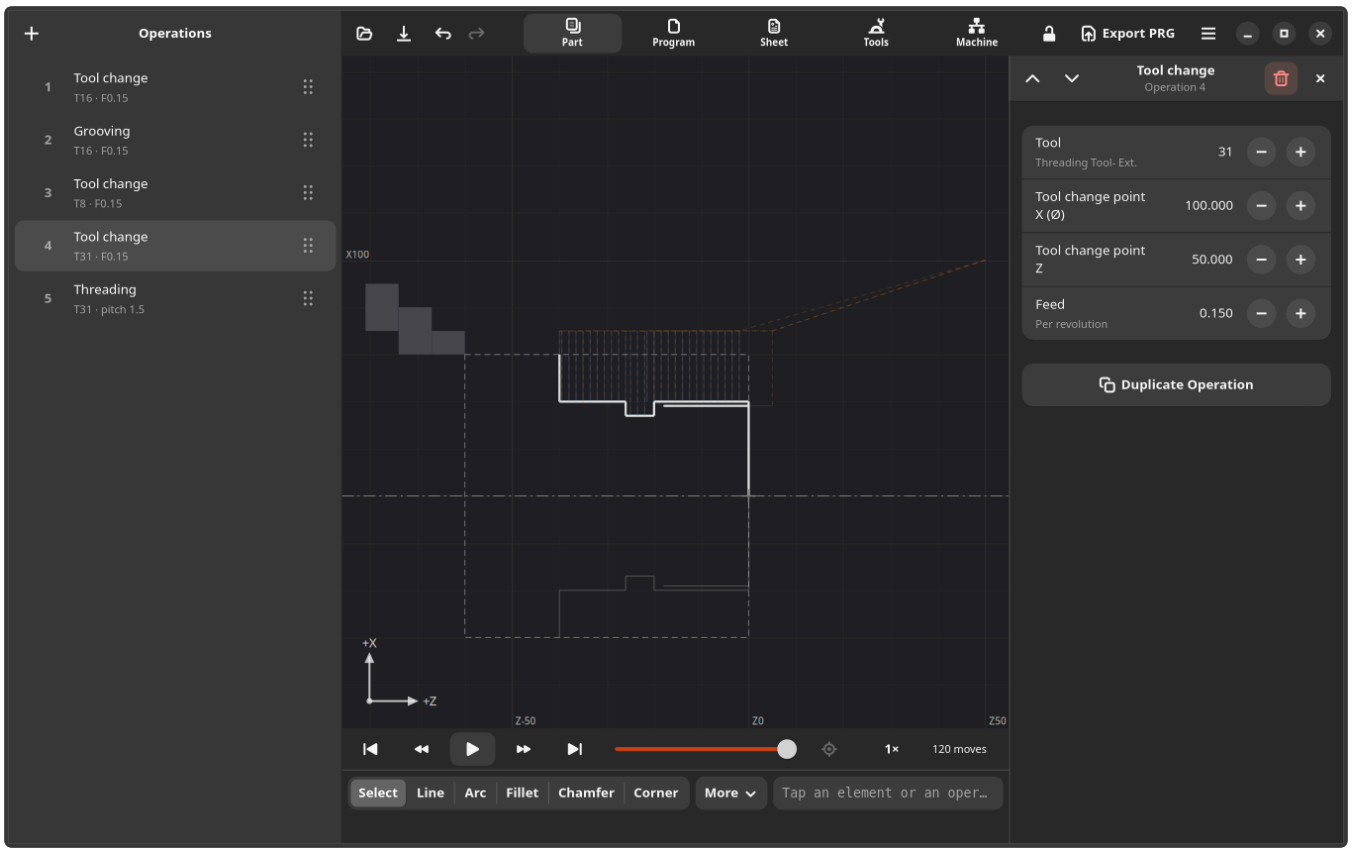

Checking the work

Check every program before it goes to the lathe, as the ALPHA-T manual asks before saving.


- **Simulation** (under the drawing; ALPHA-T's *single step* and *animation*): ⏮ first move, ⏪ previous pass, ▶ play / pause, ⏩ next pass, ⏭ show everything. Moves not yet made are faded; the label shows the move, operation, pass and program line, and the Program page follows. Tap a toolpath to select its operation and jump there. The 1× button sets the playback speed; the button next to it jumps to the start of the selected operation.
- **Hiding toolpaths**: select no operation to see all of them; select one to highlight its own.
- **Program** page: the program exactly as the lathe receives it. Tapping an operation highlights its lines; pinch changes the text size. The status line gives the program number, units, lines and size. Ctrl+F or the search button finds text; N10 goes to block 10 and Esc closes the search.
- **Sheet** page: the setup sheet, as ALPHA-T's print: for each operation the tool and its name, start point, limits, offsets, passes, depth of cut and feed, the block and its restart number (#140) and any tool warnings; **Tool moves** adds every move. **Save as Text…** writes it to a file.

- A **banner** at the top names any operation that cannot be made into a program and why; **Export PRG** stays off until it is fixed.

Safety check. Every move of the preview is checked, and a banner names the worst finding with **Show**, which zooms to it and marks it with a red ring. The operation row and the setup sheet carry the warning too. It flags:

- a feed move into the finished part (the operation's own contour), or a rapid through it;
- any move into the chuck jaws (behind the billet length) or, with the tailstock shown, into its centre;
- a feed move along the contour diving steeper than the tool's front and rear clearance angles allow (ALPHA-T's Invalid tip angle).


The check finds nothing on any of ALPHA-T's sample programs. It only warns: Export PRG still works.

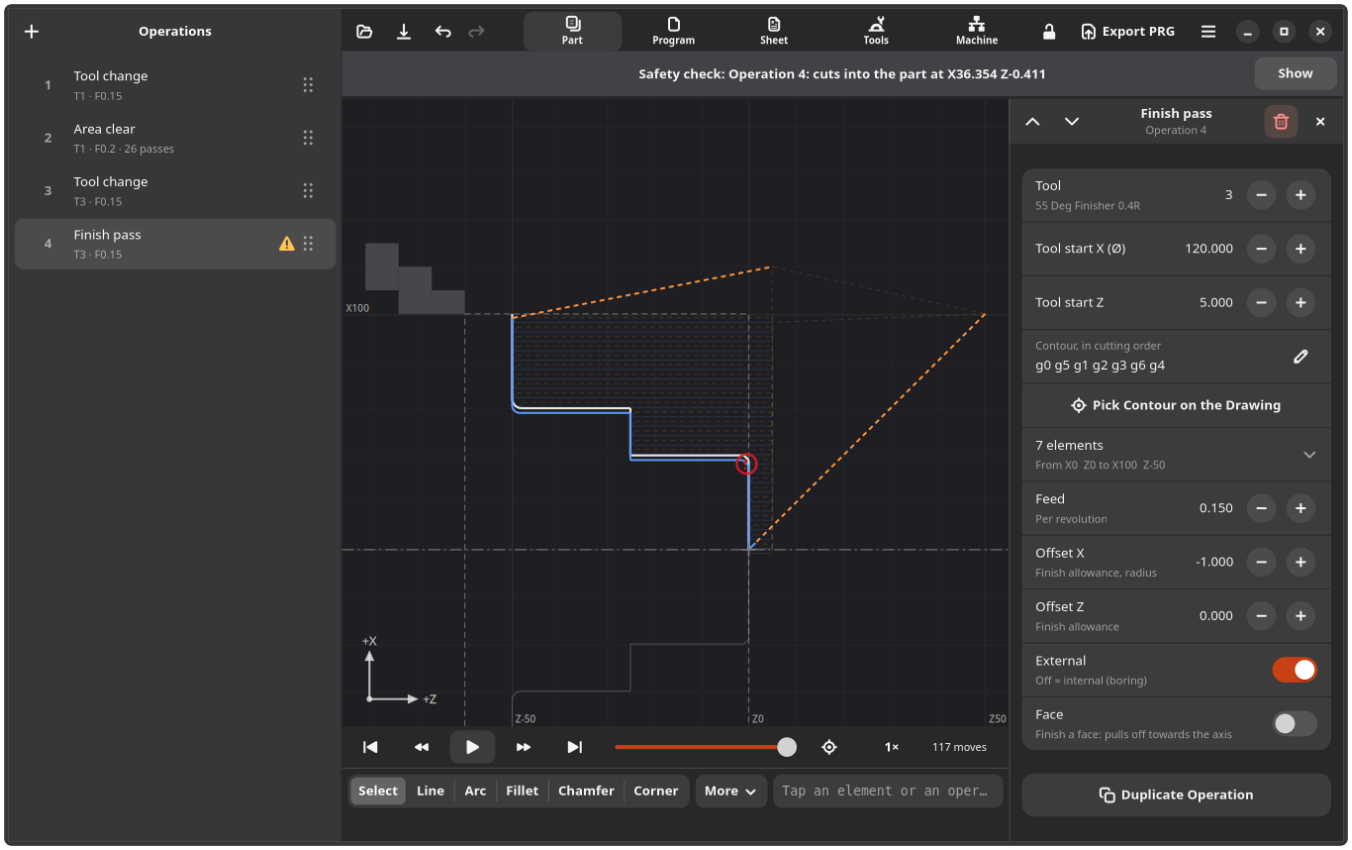

Cycle time and the printable sheet. The Sheet page estimates the cycle time per operation and in total, from every move of the program. Feed moves run at the tool's surface speed (constant surface speed, rpm = 1000 Vc / πD) up to the spindle limit; threads and drills at the rpm of their largest diameter; rapids at the rapid rate; each tool change adds the time the operator needs. Surface speed and a spindle limit can be set per

tool on the Tools page (otherwise 180 m/min turning, 140 boring, 90 grooving, 60 threading and drilling); the machine's spindle limit, rapid rate and tool change time are in Preferences ▸ Cycle time. It is an estimate: acceleration and block times are left out.

Notes for the operator (on the Sheet page) are saved with the part. **Save as PDF…** writes a printable A4 sheet: the part with every toolpath, program number, billet and cycle time, the tools in the order they are loaded, the notes, then the sheet itself.

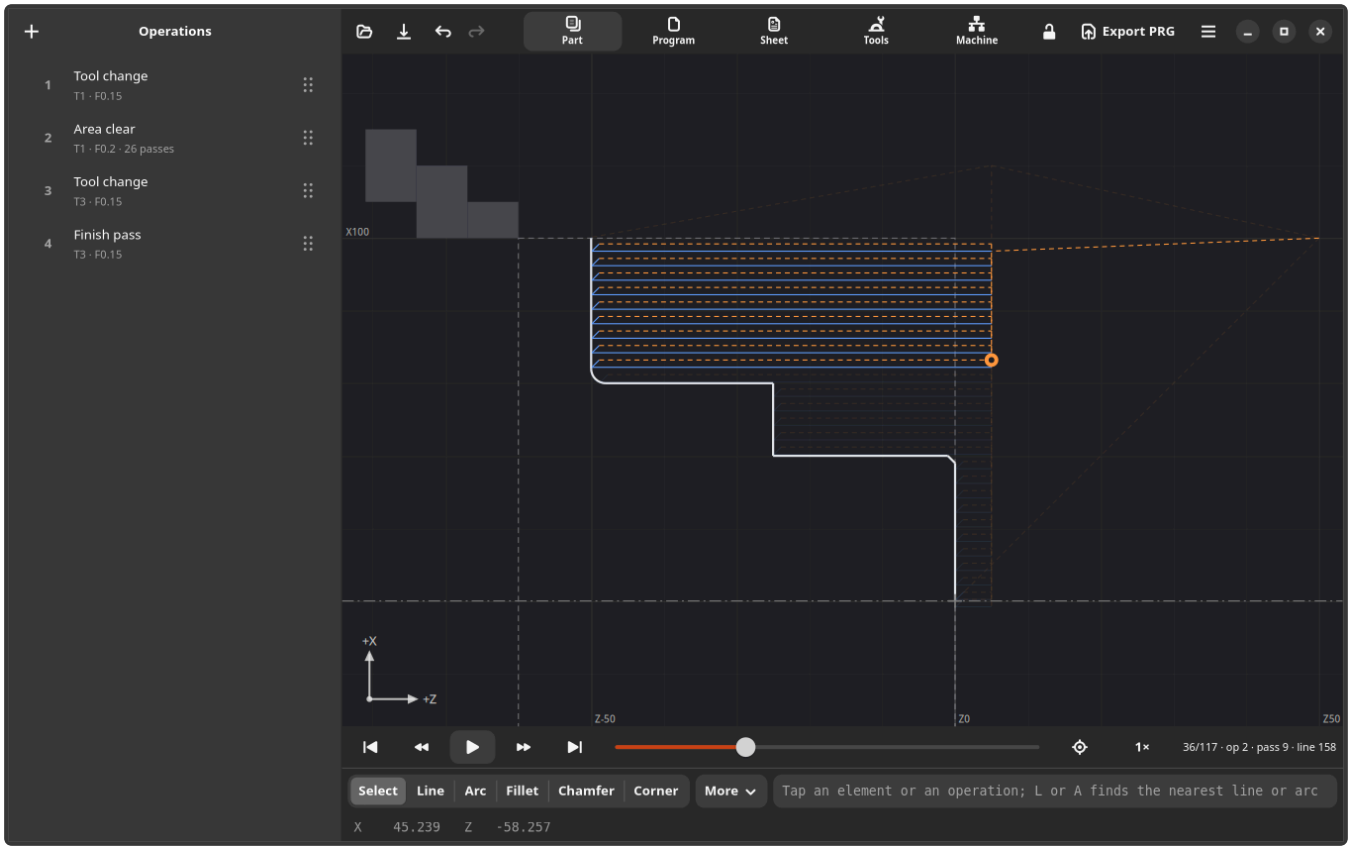

File handling

Action	Keys	What happens
New part	Ctrl+N	asks billet, units, bore, jaws, tailstock
Open	Ctrl+O	AlphaLink parts (.alcam), ALPHA-T drawings (.SDG) and DXF drawings
Save	Ctrl+S	writes the part (.alcam): drawing, operations, billet
Save as	Ctrl+Shift+S	the same under a new name

Action	Keys	What happens
Export PRG	Ctrl+E	writes the program (.PRG) and, next to it, the .SD1 listing with the same name, as ALPHA-T does

Main menu ▸ Save as ALPHA-T Drawing… writes the drawing as an .SDG (with its .SDT) that DOS ALPHA-T can open; keep the name to 8 characters. With **Preferences ▸ Also save the ALPHA-T drawing (.SDG)** on, Export PRG writes it next to the program as well. An ALPHA-T drawing holds the geometry and billet only; the operations are in the .SD1.

ALPHA-T drawings

An ALPHA-T .SDG holds only the drawing and billet; ALPHA-T keeps the operations in the .SD1 written next to it with the program. Opening an .SDG rebuilds the operations from that .SD1 and says whether the result matches the .PRG beside it. If the .SD1 cannot be found, the message offers **Choose .SD1…**.

DXF drawings

Lines, arcs and polylines are read with the spindle axis along DXF X; the distance from the axis may be a radius (usual) or a diameter, as chosen when opening. Only the half above the axis is kept. As in ALPHA-T, CIRCLE, TEXT and blocks are skipped.

The import dialog also puts a drawing from the office in place: **Turn the drawing** (90° steps, for a part drawn upright), **Front face is on the** right or left (left mirrors it), **Spindle axis** at Y0 as drawn, in the middle (a full section) or at the lowest point (a half drawing), and **Front face on Z0**. Circles come in as two half arcs.

Second setup


Main menu ▸ **Turn Part Around…** makes the setup for the other end of the part. The drawing is turned end for end about the middle of the part's length, so the back face is the new Z0 and the old front face lands at Z−length; arcs change direction. The new setup has no operations, the billet as long as the part, and the next program number, so both programs fit in the control. Setup 2 is kept in the same .alcam as setup 1. A Setup 1 / Setup 2 switch appears above the operations list; each setup has its own drawing, billet, operations, program number and undo history, and Export PRG (suggesting NAME2.PRG), the sheet and Send work on the setup shown. Turning around again replaces setup 2 after asking; Remove This Setup… (main menu) takes it out.

Program number and units

The program number shown on the control (#132) is set in Part Settings (main menu; 1 to 9999); Z, feed and pitch are written doubled for the T macros automatically. Programs are written in the part's units (M71 metric, M70 inch); the control must be set to the same units.


Program units in Part Settings writes the program in mm (M71) or inch (M70) whatever units the part is drawn in, like ALPHA-T's "Select Units To Store Output In". Lengths, feeds and pitches are converted, exactly as ALPHA-T does; the .SD1 stays in the drawing's units. The default is the drawing's units.

Note: unlike ALPHA-T there is no 8-character name limit; the exported file name is up to you. Export suggests the part's name cut to 8 characters, for the lathe's sake, and opens the folder used last.

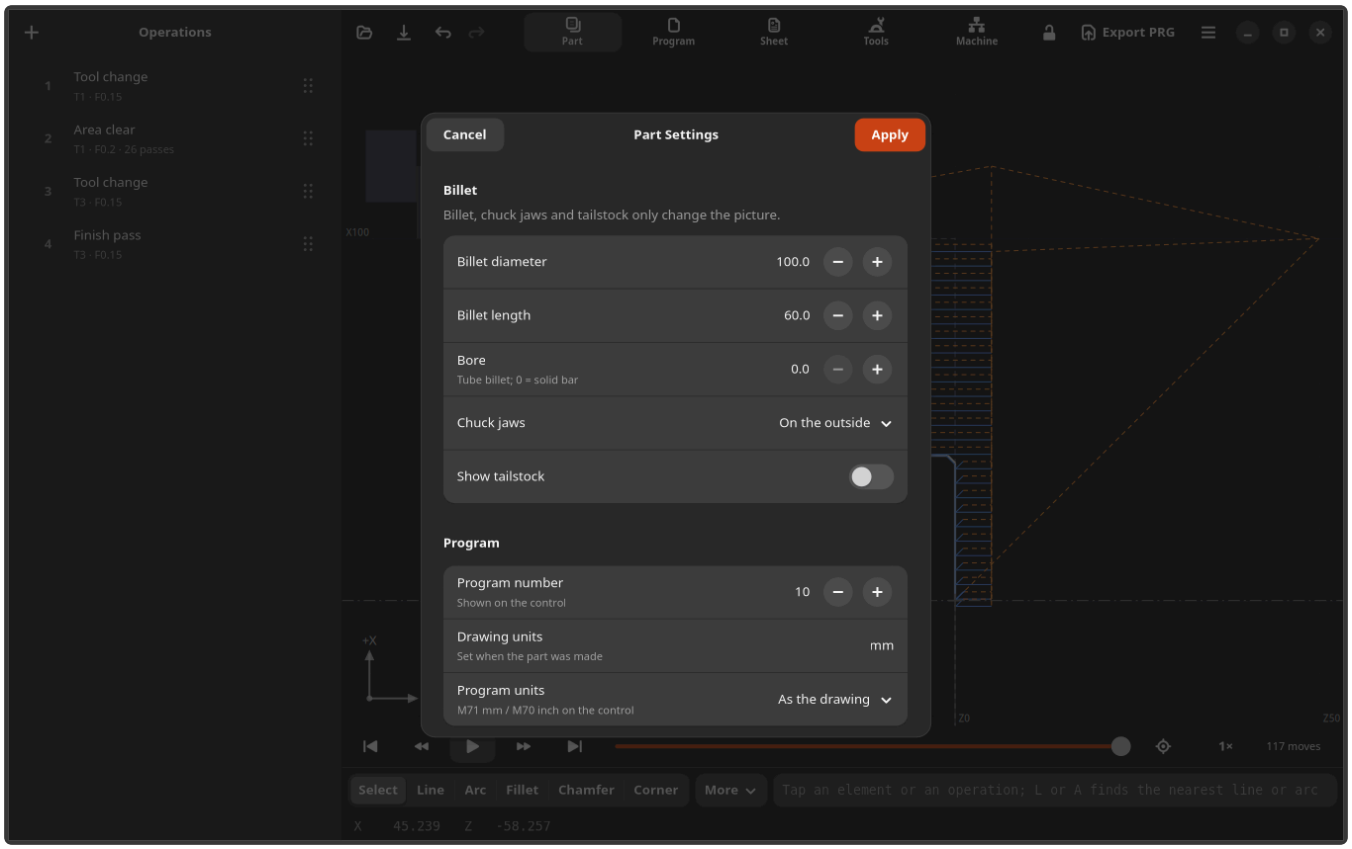

Sending to the machine

Everything is on the **Machine** page.

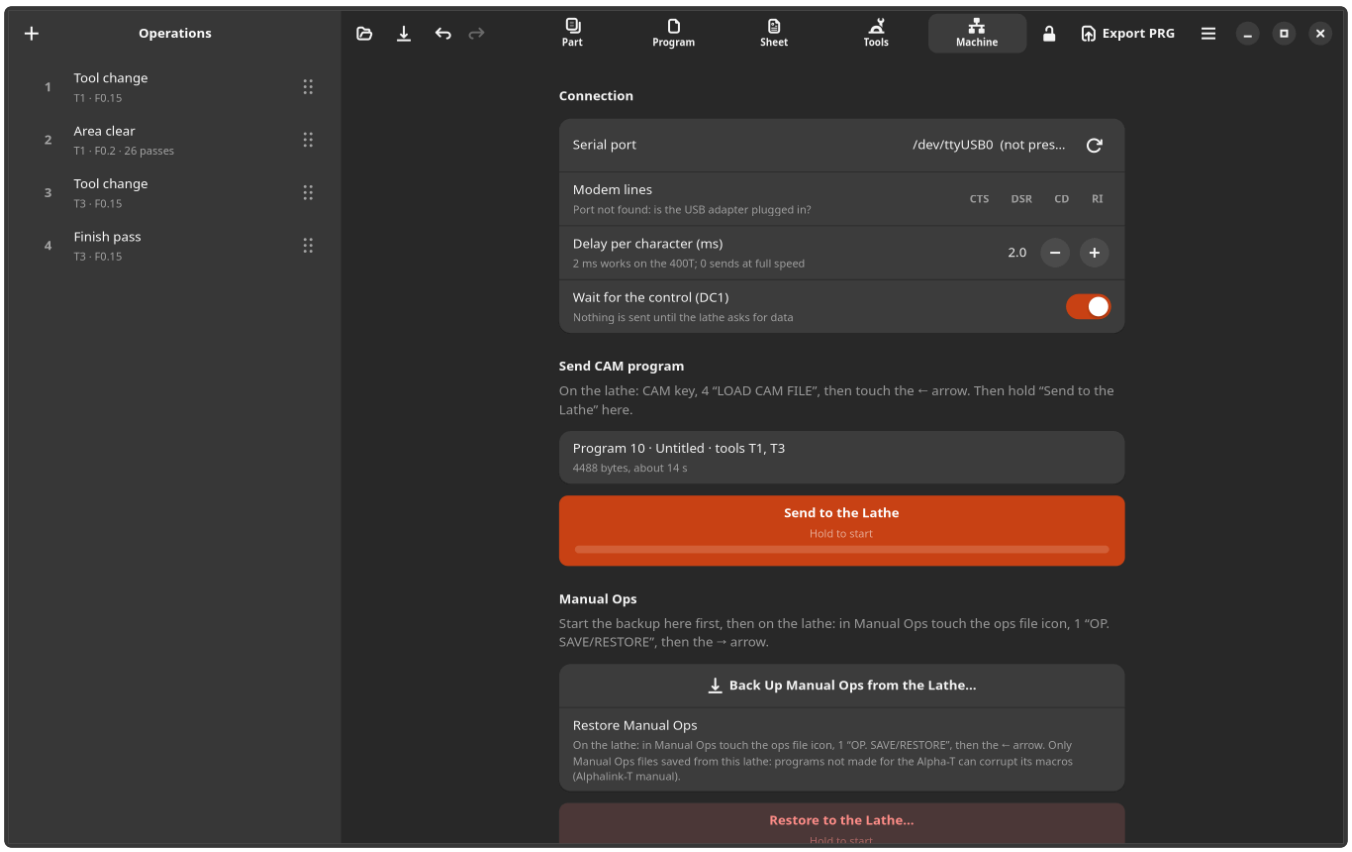

Connection

Setting	Meaning
Serial port	the USB serial adapter, usually /dev/ttyUSB0; the refresh button looks again
Modem lines	CTS, DSR, CD and RI as the lathe sets them; the lathe signals ready on them
Delay per character	2 ms works on the 400T; 0 sends at full speed
Wait for the control (DC1)	nothing is sent until the lathe asks for data

The line is 9600 baud, 7 data bits, even parity, 2 stop bits, with XON/XOFF, as ALPHA-T uses. The cable is the one in the Alphalink-T manual: DB9 pins 2-2, 3-3, 5-7, with the bridges in the machine plug (4-5 and 6-8-20).

Bluetooth serial adapter. Pair the adapter in the system's Bluetooth settings; the port list then offers it as "name (Bluetooth)" (the app connects over RFCOMM itself) and also shows any rfcomm device. Over Bluetooth the PC's port settings do not reach the line, so:

- set the adapter itself to 9600 baud, 7 data bits, even parity, 2 stop bits, and its own flow control to none, so that the lathe's DC1 and DC3 pass through to the app;
- an adapter that only frames 8 data bits goes to 9600 8N2 with **Parity from the app** on: the app adds the even parity bit, which gives the same frame on the wire;
- use a delay per character of 5 ms or more: Bluetooth adds latency, and the control raises alarm 087 if more than 10 characters arrive after its DC3;
- there are no modem lines over Bluetooth (the row is hidden), and the adapter needs its own power: the lathe's port does not supply it. Wired like a PC port (DB9 male, DTE), it takes the same cable.

Load a CAM program

1. On the lathe press the CAM key, choose **4 LOAD CAM FILE** and touch the ← arrow.
2. In the app hold **Send to the Lathe** until it fills, check the summary (program number, tools, size) and confirm.
3. A window shows the bytes sent and can cancel. The program number then shows on the control.

Note: load only programs from ALPHA-T or this app (they are the same); others can damage the T macros. The standard control holds about 16 KB of CAM program. The app never starts the machine.

Manual Ops backup and restore

- **Back up**: tap **Back Up Manual Ops from the Lathe…** first; then on the lathe in Manual Ops touch the ops file icon, choose **1 OP. SAVE/RESTORE** and touch →. Save the file.
- **Restore**: on the lathe the same menu and ←, then hold **Restore to the Lathe…** and choose the file. Only files saved from this lathe.

Cable test

Unplug the cable from the lathe, bridge pins 2 and 3 of the adapter and tap **Run Loopback Test**. It shows whether the adapter and port work. Every transfer is logged in ~/.local/state/alphalink-cam/logs.

Tool library


The **Tools** page replaces ALPHA-T's tool library editor (ATTOOLS). The tool numbers are the control's tool memory slots: an operation's **Tool** must be the slot that holds that tool's offsets.

Button	What it does
Add Tool	a new tool in the next free slot
Delete Tool	removes the selected tool after asking
Import ATOOLIB.TL1…	reads an ALPHA-T tool library
Reset to ALPHA-T Tools	back to ALPHA-T's standard library (32 tools)

Each tool has:


Field	Meaning
Name	as shown in the editor and on the setup sheet
Type	turning, boring, grooving, threading, drilling
Hand	right, left or neutral
Nose radius	changes the toolpath (nose compensation)
Front / rear clearance angle	degrees from Z; ALPHA-T uses them to keep clear of the part
Width	grooving tip width or drill diameter
Default feed	the feed new operations start with
Description	free text
Surface speed	m/min, for the cycle time estimate; 0 = a default for the tool type
Spindle limit	rpm for this tool; 0 = the machine's limit

The library is kept in ~/.config/alphalink-cam/tools.json; a part can also carry its own tools.

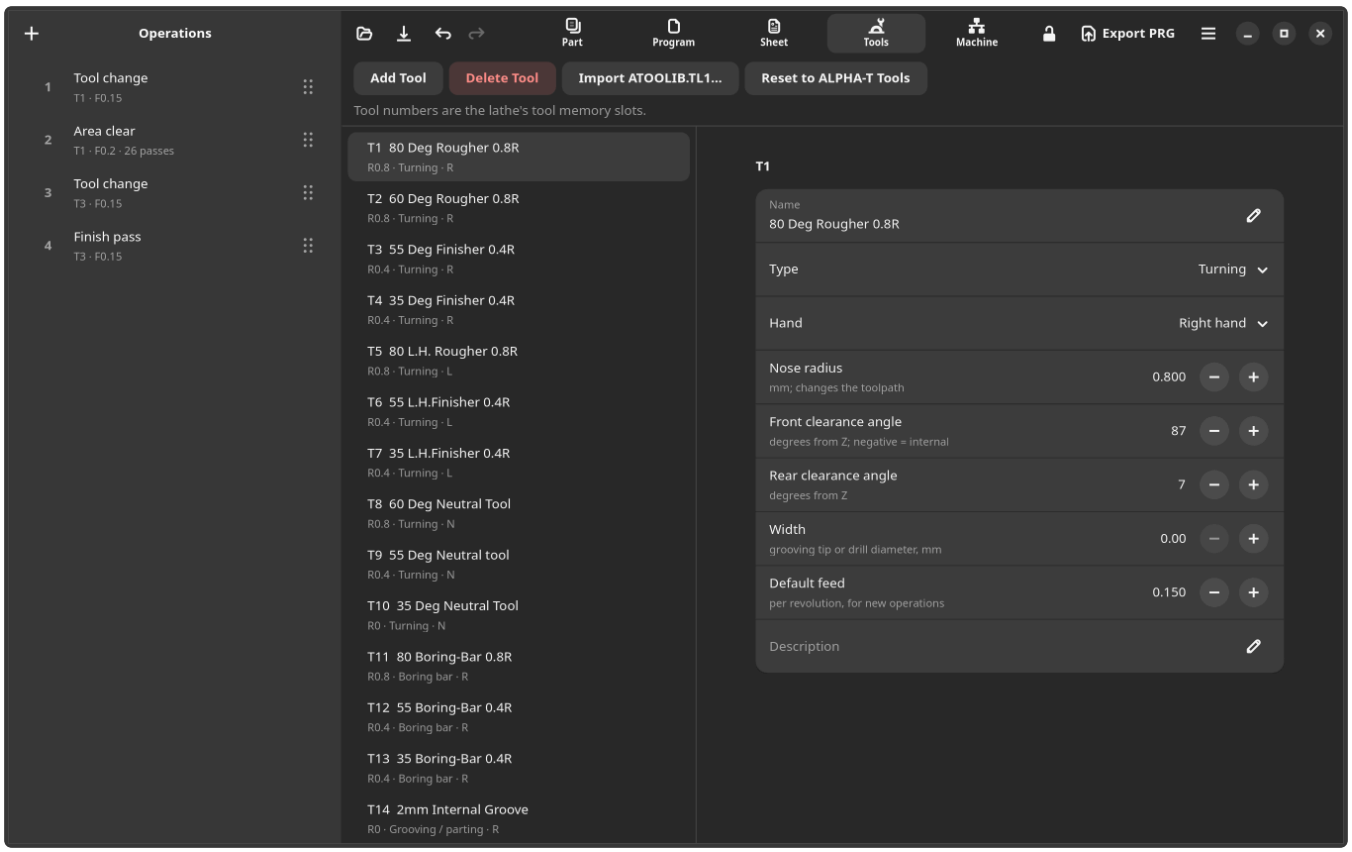

Preferences, input and keyboard

Main menu ▸ Preferences (Ctrl+,): units, billet size and first tool for new parts, and the language (English, Ukrainian, or as the desktop; after a restart). Other main-menu items: **Fit Part**, **Show Grid**, **Part Settings**, **Input Layout** (Automatic, Pointer, Touch), **Help** (F1). Preferences ▸ Cycle time sets the spindle limit (2500 rpm), the rapid rate (6000 mm/min) and the time a tool change takes (30 s) for the estimate.

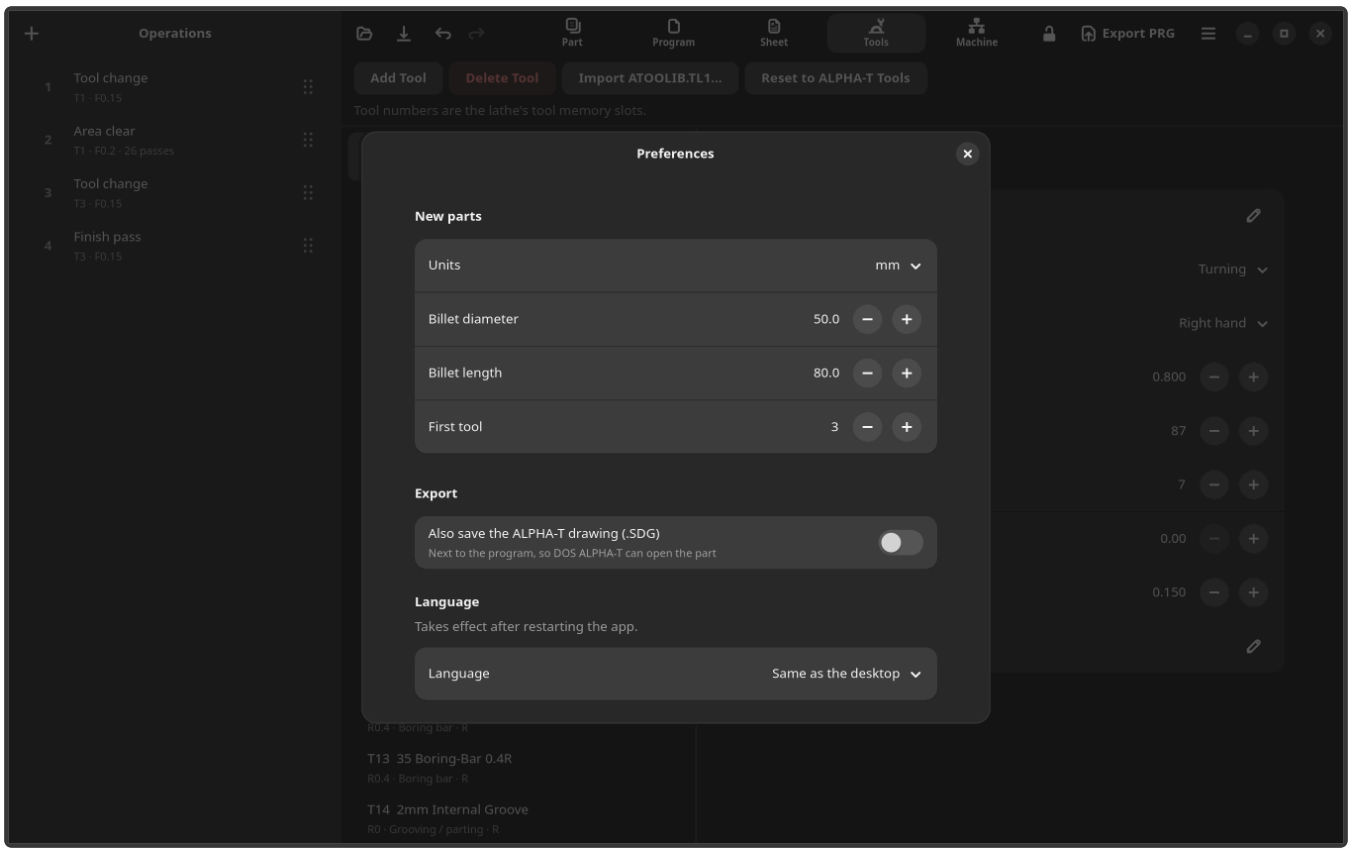

Touch, pen and mouse

- One finger drags the view, two fingers pinch to zoom, a double tap fits the part (again goes back).
- Mouse wheel pans up and down, Shift+wheel sideways, Ctrl+wheel zooms.
- In touch layout the bars get bigger and a keypad button opens a number pad for X and Z.
- **Touch Lock** (padlock in the header) ignores touches, for example while coolant runs; hold it to unlock by touch. It also turns on during transfers.
- A faint grid follows the zoom; every fifth line is labelled (X as a diameter).

Keyboard summary

Keys	Action
Ctrl+N / O / S / Shift+S	new, open, save, save as
Ctrl+E	export PRG and SD1
Ctrl+Z, Ctrl+Shift+Z or Ctrl+Y	undo, redo

Keys	Action
Ctrl+0, Ctrl++, Ctrl+-	fit, zoom in, zoom out
Esc	end the line or command, cancel picking, deselect; keyboard back to the drawing
Delete	erase the selected element
F1	help
Ctrl+?	all keyboard shortcuts, including the ALPHA-T letters
Ctrl+W	close the window
Ctrl+Q	quit
ALPHA-T letters	see Drawing commands (CAD)
Ctrl+F	search the program; N10 goes to block 10
Shift+F10, Menu key, right click	the drawing's menu: Edit Values, Delete, Zoom Here, Fit Part

Problems and support

You see	Cause	What to do
Export PRG is greyed out, a banner at the top	an operation cannot be made into a program	read the banner: it names the operation and the reason
"… AWAY: ALPHA-T itself …"	AWAY on area clear, face clear or threading	keep **Towards the chuck** on; ALPHA-T's own AWAY programs cut past the shoulder, make one pass only or start inside the thread
"… (no sample)"	an option ALPHA-T has but no sample shows yet	use the default; samples are being made
"contour is not connected at X… Z…"	a gap or a wrong element in the contour	pick the contour again, in cutting order

You see	Cause	What to do
Opening an .SDG gives no operations	the .SD1 is not next to it	**Choose .SD1…** in the message
Nothing arrives at the lathe	port, cable, or the lathe not waiting	check the port, the LOAD CAM FILE screen and its arrow, then the loopback test
The control shows the wrong tool or offsets	tool number is not the tool memory slot	set the operation's **Tool** to the slot
The window is cut off	too narrow	below 1000 px the operations list moves to its own page; widen the window
Letters type into the entry	the X,Z entry has the keyboard	press Esc

Transfer logs are in ~/.local/state/alphalink-cam/logs; settings in ~/.config/alphalink-cam. The program's own help is under F1.