

The Stewardship Roadmap

A 360° Method Roadmap

PREPARED FOR

Daniel

PROPERTY

7414 NE Alder Crest Drive, Vancouver, WA 98662

EDITION

Jun 2026

We don't sell repairs. We propose a standard of care.

What follows is the homeowner's edition of the 360° Roadmap. Inspection reports are written in the language of liability: every finding flagged, every observation hedged. That is a good and necessary job; it is not, however, a plan.

Our task is to read the report carefully, apply the lens of the Pacific Northwest's rain load and the era of your home, and organize what the inspector saw into three honest time horizons: address now, plan for soon, monitor on the next cycle.

Every investment range here is the fully-loaded customer price for quality restoration work in Clark County: vetted tradespeople, materials that match the home, end-to-end project management. No "starting at" pricing, no hedge.

The Handy Pioneers stewardship team

EXECUTIVE SUMMARY

For Daniel of 7414 NE Alder Crest Drive, Vancouver

Daniel, this is a 1966 split-level home that has lived a full life and now asks for a steady, knowledgeable hand. The inspector was candid: the structure shows high levels of wear, the garage has been converted, interior walls have been removed, and several systems are at or past the end of their service horizons. I want to be equally candid with you, but in a way that gives you a path rather than a list. The lens I am applying is triage by consequence. A home of this era in our climate fails quietly at the edges first (the roof, the gutters, the eaves, the crawlspace), and those edges are exactly where this report concentrates. None of this is cause for alarm. It is cause for sequence.

Three findings shape everything else. First, the safety items inside the electrical system: a scorched outlet in the office, non-terminated wiring in the attic, an open shop sub-panel, and worn receptacles throughout. These are in the NOW horizon because they carry active risk and should not wait for a weather cycle. Second, the composition roof, which the inspector describes as very worn with heavy granule loss and poor adhesion, paired with a gutter system that is pulling away and staining the fascia. In our rain load, a tired roof over a failing drainage system is the single condition most likely to compound into interior damage, so I place the roof in SOON and the drainage discipline in NOW. Third, the crawlspace, where disrupted vapor barrier, nested insulation, and an improperly installed sump pump together undermine the dry foundation this house depends on. That belongs in the SOON window, addressed as one coordinated visit.

I would like to set up your portal as the living health record for this property. Rather than a binder that ages on a shelf, it becomes the place where every finding here, every photo the inspector took, and every restoration we complete is tracked over time. It turns a difficult report into a managed standard of care.

AT A GLANCE

HOME SCORE 73 /100 Baseline: improves with each completed item and visit	NOW 3 items \$5.0k-\$11.6k Within 90 days	SOON 2 items \$15.2k-\$37.5k 6 to 18 months	WAIT 0 items - 3 to 5 year horizon
---	--	--	---

How the Home Score works: every home starts at 100 and each finding lowers it by urgency. NOW items weigh the most, SOON items less, WAIT items barely. It is a provisional baseline read from your report alone (never below 40, never a perfect 100), and it climbs as items are completed and verified at visits.

PROPERTY CHARACTER

Built in 1966, this is a split-level home with a brick and wood siding skin, a masonry chimney, a converted garage, and a wood-burning fireplace. Homes of this vintage in Clark County age at their water-handling details first. Our long wet season puts relentless load on the roof field, the gutters, the eaves, and the crawlspace, and this report reads exactly that way: drip-edge staining at the fascia, gutters pulling away, moisture stains on the roof sheathing, and a crawlspace with disrupted vapor barrier. The house also carries the marks of past modifications without documented permits. A property of this kind rewards disciplined gutter and crawlspace stewardship more than almost anything else.

NOW

WITHIN 90 DAYS

SECTION LEDGER

3 items

\$5.0k-\$11.6k

investment range

NOW

ITEM 01

Electrical: scorched receptacle and damaged outlet remediation

FINDING

The inspector found a scorched electrical outlet on the west wall of the office, a damaged outlet in the southeast bedroom, an outlet with no power in the dining room, and most receptacles throughout worn to where they no longer hold a plug.

WHAT THIS MEANS FOR YOUR HOME

A scorched receptacle is evidence of heat at a connection, which is the kind of finding that carries fire risk and does not improve on its own. In a 1966 home with an obsolete split-buss panel and a mix of copper and braided aluminum branch wiring, worn receptacles that arc when loaded are a pattern worth taking seriously rather than item by item. This is the clearest NOW item in the report.

HOW WE'D APPROACH IT


We would have a vetted licensed electrician open and evaluate the scorched circuit first, then move through the damaged, dead, and worn receptacles as one coordinated visit under a single written scope of work, rather than returning piecemeal.

INVESTMENT RANGE

\$1,400-\$3,800

NOW for the active heat and fire risk; range reflects multiple GFCI/AFCI and standard receptacle replacements across several circuits at the per-circuit anchor of \$250 to \$650, scaled to a whole-home worn-outlet condition.

FROM THE INSPECTION REPORT

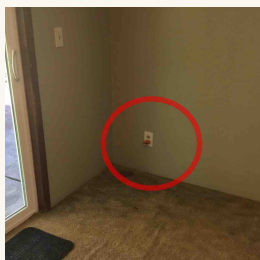

Roof drainage: gutter system restoration and drip edge

FINDING

The gutters have damaged and disconnected downspouts, debris, and sections pulling away, and there are water stains between the gutter and fascia in many areas indicating leaks from missing drip edge or overflow.

WHAT THIS MEANS FOR YOUR HOME

In our climate the gutter system is the first line of defense for the eaves, the siding, and the crawlspace below. With this house already showing fascia rot and crawlspace moisture, a failing gutter run is the condition most likely to accelerate damage through the coming wet season. I am placing this in NOW even though the gutters themselves are not a safety item, because the water they are mishandling is reaching wood.

HOW WE'D APPROACH IT

We would re-secure and re-pitch the existing runs, reconnect and redirect downspouts well away from the foundation, and add drip edge flashing where the staining shows it is absent, ideally before the roof decision below so the new drainage is ready to protect a future roof.

INVESTMENT RANGE

\$2,800-\$5,400

NOW because the water is already reaching fascia and crawlspace; range uses the gutter replacement anchor (\$2,800 to \$5,400) since disconnected, pulling-away runs across home and garage are closer to replacement than a re-pitch.

FROM THE INSPECTION REPORT



Plumbing: master bath drain leak and moisture damage

FINDING

The drain trap below the master bathroom sink is actively leaking, with dry stains and damage at the vanity base, and the floor and wall in front of the master shower are moisture-damaged.

WHAT THIS MEANS FOR YOUR HOME

An active drain leak under a cabinet, even at normal moisture readings, is putting water into finished structure every time the fixture is used. Left through a wet season it grows the existing stained and damaged area the inspector already noted. This is the kind of small active leak that earns a NOW placement because it compounds quietly.

HOW WE'D APPROACH IT


We would have a vetted plumber resolve the trap leak first, then assess and restore the moisture-damaged floor and wall structure at the shower as a connected scope so the source and the consequence are addressed together.

INVESTMENT RANGE

\$850-\$2,400

NOW for an active leak into finished structure; range pairs the single-fixture anchor (\$425 to \$1,200) with localized moisture-damaged floor and wall restoration.

FROM THE INSPECTION REPORT

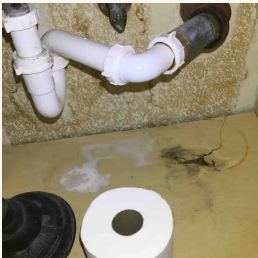

SOON

6 TO 18 MONTHS

SECTION LEDGER

2 items

\$15.2k-\$37.5k
investment range

Roofing: composition shingle replacement planning

FINDING

The inspector describes the composition roof on home and garage as very worn with heavy granule loss, exposed shingle fibers, excessive wear, and poor adhesion, and notes it may require replacement in the near future. Moisture stains are also visible on the roof sheathing.

WHAT THIS MEANS FOR YOUR HOME

This roof is at the end of its 25 to 30 year service life, and the sheathing stains tell us water has already found its way in at least intermittently. Through one more Pacific Northwest winter a roof in this condition moves from worn to actively leaking. I place it in SOON rather than NOW only because no active interior leak was visible, but it is at the leading edge of that window.

HOW WE'D APPROACH IT


We would commission a full composition replacement in architectural shingle, sequenced after the gutter and drip-edge work so the new drainage details integrate cleanly, and we would inspect and address the stained sheathing as the deck is exposed.

INVESTMENT RANGE

\$14,000-\$32,000

SOON because it is end-of-life with sheathing evidence but not yet actively leaking; range is the full composition replacement anchor (\$14,000 to \$32,000) for a 30-year architectural roof.

FROM THE INSPECTION REPORT

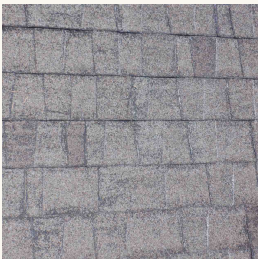

Exterior: eaves, fascia, and trim rot restoration

FINDING

The inspector found rot and deterioration throughout the eaves and fascia, minor rot at the lower trim on home and garage, and gaps in the eaves serving as rodent entry points.

WHAT THIS MEANS FOR YOUR HOME

Eave and fascia rot in a 1966 home is the visible result of the gutter problems above, and the gaps doubling as rodent access tie directly to the activity found in the attic and crawlspace. Addressed in the SOON window, alongside corrected drainage, this becomes a finite restoration. Left longer, the rot migrates inward to rafter tails and soffit.

HOW WE'D APPROACH IT


We would remove and replace the rot-affected eave, fascia, and trim material after the gutter work is set, sealing the eave gaps in the same pass so the pest entry points close as the wood is restored.

INVESTMENT RANGE

\$1,200-\$5,500

SOON because rot spreads but is not yet structural; range uses the exterior trim restoration anchor (\$1,200 to \$5,500), with the wider eave rot pushing toward the upper end.

FROM THE INSPECTION REPORT

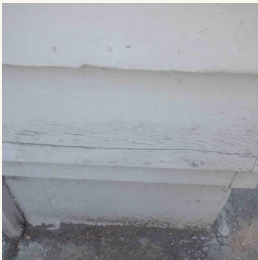

YOUR NEXT STEPS

I would like to open your portal as the living health record for this property, where these findings, the inspector's own photos, and every restoration we complete are tracked together over time. Please read this as a starting standard of care rather than a bid. Every range here is honest and two-sided, and each will be confirmed against the home before any work begins. The natural next step is a complimentary baseline walkthrough, where we stand in the crawlspace and under the eaves together and turn this roadmap into a calm sequence. Whenever you are ready, I am here.

OPEN YOUR PORTAL

Living health record

Your private 360° portal collects every finding, every return visit, every written scope of work in one place. Magic-link access in your delivery email.

BOOK A WALKTHROUGH

Complimentary baseline

A 60-minute on-site visit with our stewardship advisor. We confirm what's in this roadmap, surface what isn't, and propose sequencing for the year.

ASK A QUESTION

Speak with us

Email help@handypioneers.com or call (360) 544-9858. Replies in one business day. No call lists, no upselling, just the homeowner's edition.

HANDY PIONEERS · 360° METHOD

808 SE Chkalov Dr, 3-433 · Vancouver, WA 98683

(360) 544-9858 · help@handypioneers.com · handypioneers.com

The 360° Roadmap summarizes the inspection report you provided. It is not a legal home inspection and does not replace a licensed home inspector's findings. Investment ranges reflect current Clark County, Washington pricing for quality restoration work and may change with market conditions and site-specific scope.