


Troubleshooting Layer Shifting in Plastic-Only or Fiber-Only Printing

This SOP provides adjustment procedures for layer shifting in single-plastic or single-fiber printing on FibreSeeker 3, aiming to safely and effectively resolve the issue.


1. Tools

H3, H2.5, and H1.5 hex keys, an unclogging pin tool, and heat-resistant gloves.

2. Precautions :

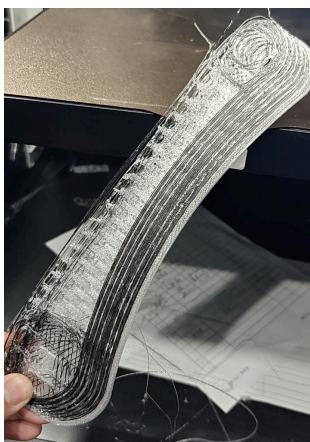

1


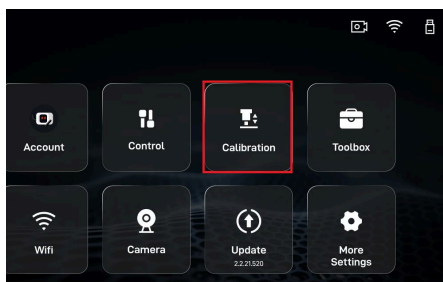


Step 1


Nozzle Offset

Step 1.1

Calibrate nozzle offset.

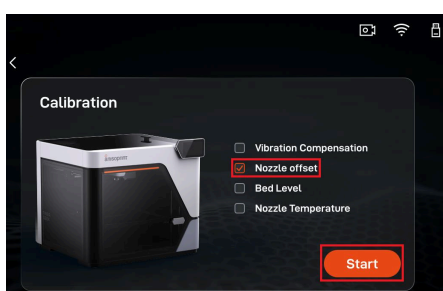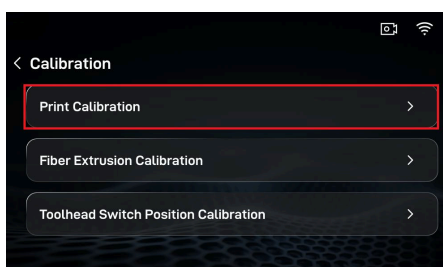

2

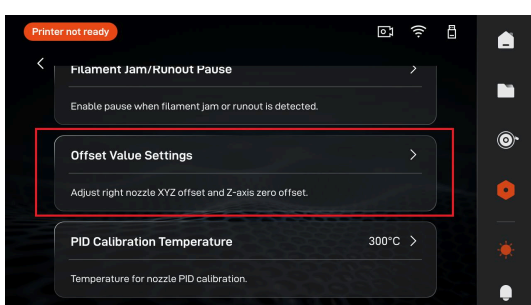

Step 1.2

If the nozzle offset calibration does not resolve the issue, measure the deviation between the plastic and the fiber, and adjust the offset value accordingly. Using the machine zero point as the reference: if the plastic is overall to the right, decrease the X offset value; if the plastic is overall upward, decrease the Y offset value. The specific amount to increase or decrease is equal to the actual model offset, in millimeters. For example, if the plastic is offset to the right by 2 mm, and the current X offset value is -32.55, the adjusted X offset value shall be -34.55.

Step 2

X/Y Belt Wear

Refer to the Replacement guide for more details.

Step 3

X/Y Motor Step Loss

Refer to the Replacement guide for more details.

3