Build Overview:

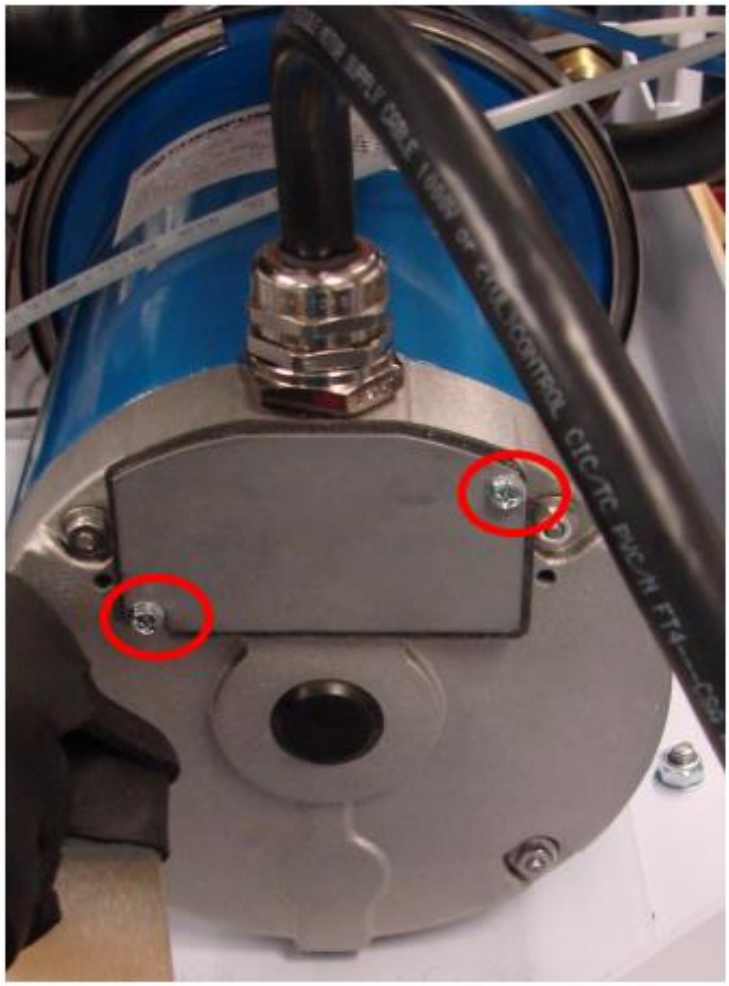

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by
	1	New Issue	JOSEPH AMAD

Prepared By:
JOSEPH R. AMAD
Manufacturing Engineer

Checked By:
IVAN NOWELL PANIQUE
Team Lead

Approved By:
SHERWIN ARIOSTE
Operations Manager

SPECIAL TOOLS

1. CRIMP TOOL T&B WT2130A

METHOD:

Flow chart of operation steps

SIC preparation
↓
Preparation Tools
↓
Prepare Materials
↓
Complete Operation
↓
Inventory Materials
↓
Operation Check
↓
Inventory tool

Size Hardware	Newton Meter
M2 x 0.4	0.2
M3 x 0.5	0.7
M4 x 0.7	1.6
M5 x 0.8	3.3
M6 x 1.0	5.6
M8 x 1.25	13.5

Torque Rules

- Torque values shown are for steel-to-steel material only.
- Torque all screws and nuts unless otherwise specified.
- Torque table is for reference. See MFE-500-01 for detailed information.

MAN: CERTIFIED OPERATOR, TECHNICIAN

CDU PUMP ASSEMBLY

1. Obtain qty. 1 Pump (607-719-01). This part is heavy. Handle with care.
2. Install Pump Mounting Plate qty. 1 (632-273-01)
3. Orient plate as shown
4. Locate pump on mounting plate by aligning the clearance holes on the pump to the mating holes of the plate.
5. Install qty. 4 M8 Screws (470-417-16) into mounting holes.
6. Torque screws to 13.5 N•m.

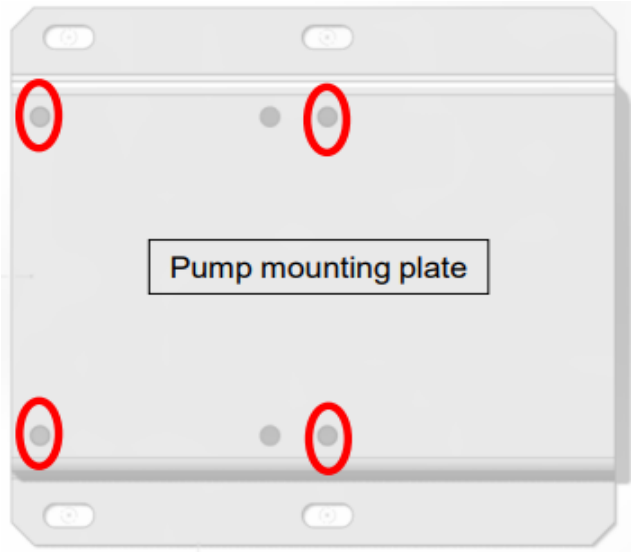

MAN: CERTIFIED OPERATOR, TECHNICIAN

CDU PUMP ASSEMBLY

7. Orient Pump as shown
   a. Remove plug from motor connection port.
   b. Loosen the screws and remove the junction box cover. Do not remove the screws.

8. Install qty. 1 Threaded Adaptor (760-400-31) into the motor connection port. Hand tighten fitting. Mark fitting and then tighten ¼ turn additional

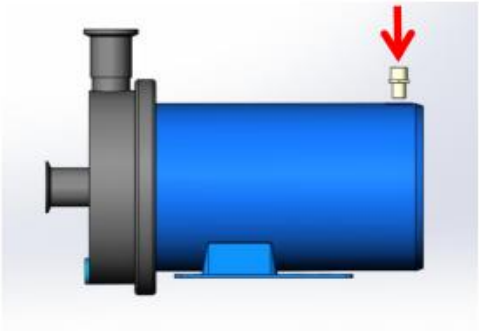

9. Feed Pump Cable (633-269-00) trough Cable Gland (479-308-02) in the direction shown. Place the gland over the shrink wrap nipple on cable. Note the orientation of the gland when feeding cable through gland.

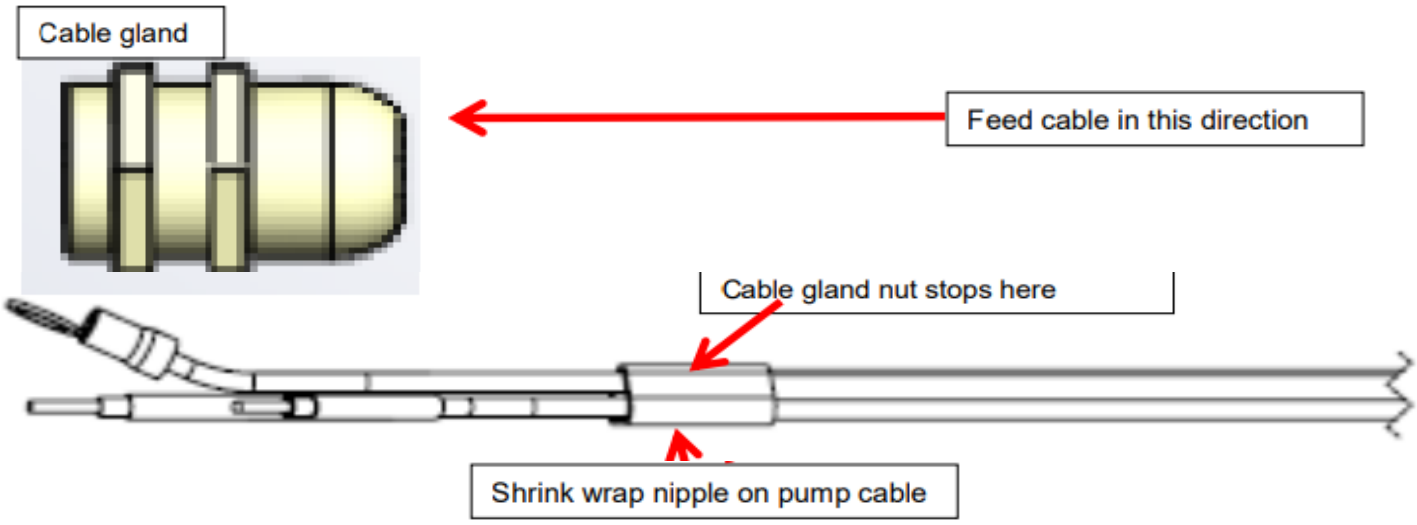

MAN: CERTIFIED OPERATOR, TECHNICIAN

CDU PUMP ASSEMBLY

10. Insert cable into adaptor until motor wire leads are inside the junction box . Make sure that the shrink wrap nipple on the cable is inside the adaptor.

11. Slide down cable gland and attach to the adaptor. Holding the adaptor steady, turn the cable gland three full turn to tighten while supporting the base fitting with a wrench

12. Hand tighten the cap, then make two full turn

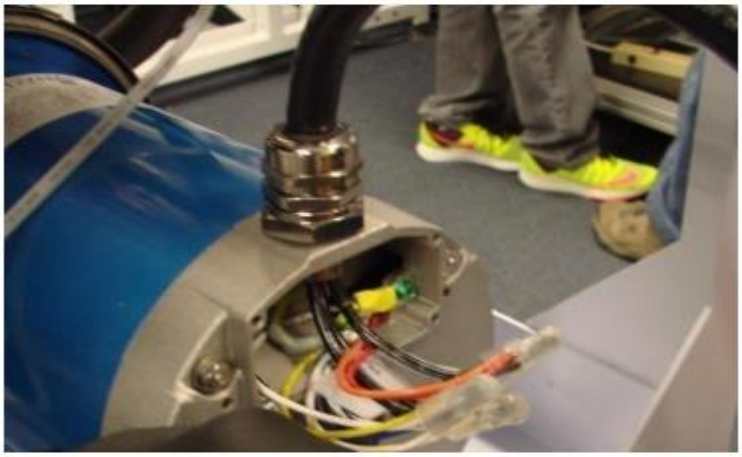

MAN: CERTIFIED OPERATOR, TECHNICIAN

CDU PUMP ASSEMBLY

13. Attach the motor ground cable lug to the ground screw inside the pump with the following stack up:
    Head of Ground Screw
    M5 Split Washer (470-502-05)
    Ground Cable Lug
    M5 Star washer (603-269-02) and torque to 3.3 N•m
14. Connect the cable motor leads to pump as labeled using qty. 3 Crimp Nuts (760-400-17). Use crimp tool T&B WT2130A (Thomas & Betts) **using the front "12-10" gauge opening.**
    a. M1-L1 from cable to T1 & T7 (RED & ORG)
    b. M1-L2 from cable to T2 & T8 (WHITE & YELLOW)
    c. M1-L3 from cable to T3 & T9 (BLACK & BLUE)

15. Join pump wires marked T4, T5 and T6 (White with Red, White with Yellow and White with Black) inside the motor junction box using qty. 1 Crimp Nut (760-400-04). Use crimp tool T&B WT2130A

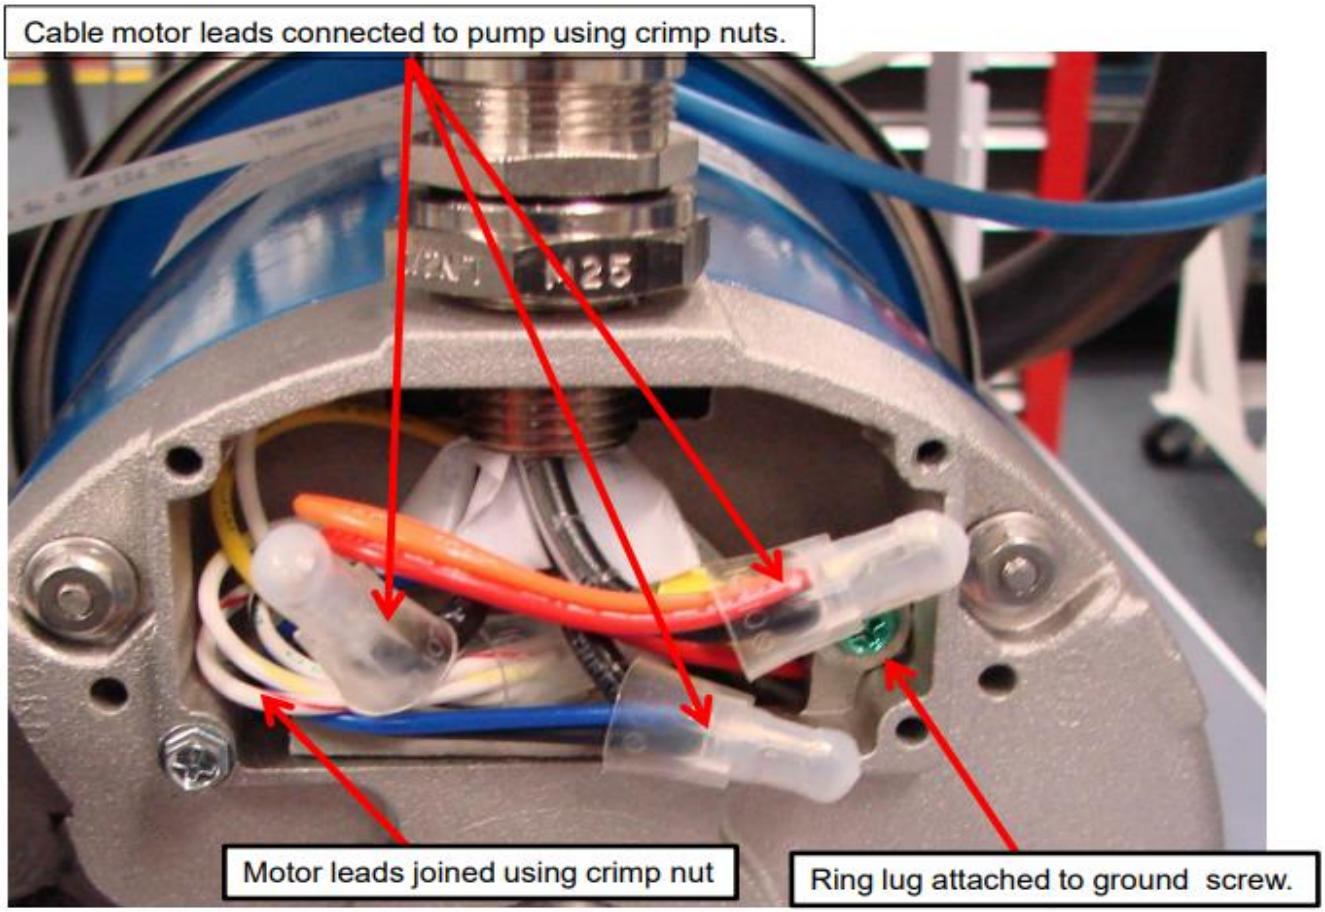

MAN: CERTIFIED OPERATOR, TECHNICIAN

CDU PUMP ASSEMBLY

16. Tuck all wire connections inside the junction box and install cover using screws from before. Torque to 1.6 N•m and make sure that there are no pinched wires.

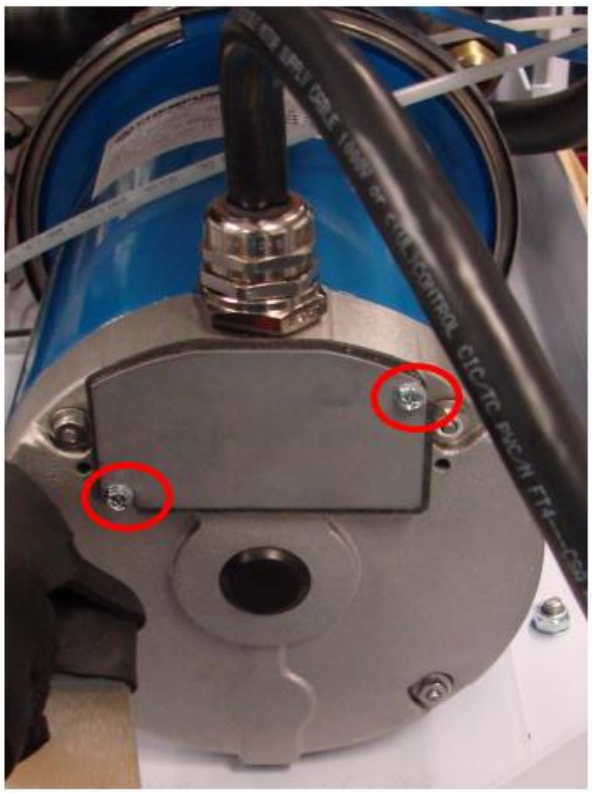

17. Send the pump for electrical test