Build Overview:

MECHANICAL MANUFACTURING INSTRUCTIONS

RTD SENSOR ASSY – CDU HFE SUPPLY TEMP

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by
	1	New Issue	JOSEPH AMAD

Prepared By:
JOSEPH R. AMAD
Manufacturing Engineer

Checked By:
IVAN NOWELL PANIQUE
Team Lead

Approved By:
SHERWIN ARIOSTE
Operations Manager

SPECIAL TOOLS

1. Crimper xxx

METHOD:

Flow chart of operation steps

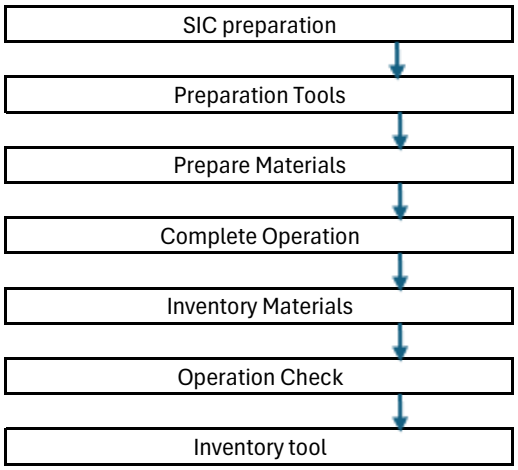

Size Hardware	Newton Meter
M2 x 0.4	0.2
M3 x 0.5	0.7
M4 x 0.7	1.6
M5 x 0.8	3.3
M6 x 1.0	5.6
M8 x 1.25	13.5

Torque Rules

- Torque values shown are for steel-to-steel material only.
- Torque all screws and nuts unless otherwise specified.
- Torque table is for reference. See MFE-500-01 for detailed information.

MAN: CERTIFIED OPERATOR, TECHNICIAN

RTD SENSOR ASSY – CDU HFE SUPPLY TEMP

1. Obtain qty. 1 RTD Sensor (633-665-00).

2. Ensure 20mm of insulation is removed and 5mm of each wire is stripped for crimping purposes
3. Crimp pin connectors qty. 4 (634-075-01) onto wires using a standard crimping tool.

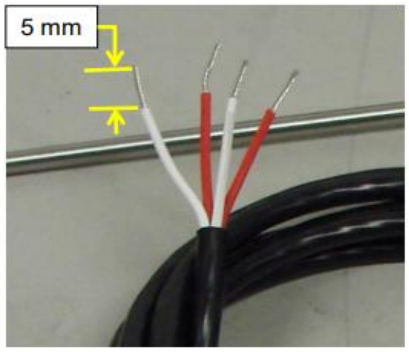

4. Obtain qty. 1 of 4-Position Plug (359-494-04) kit which includes back and front housings.

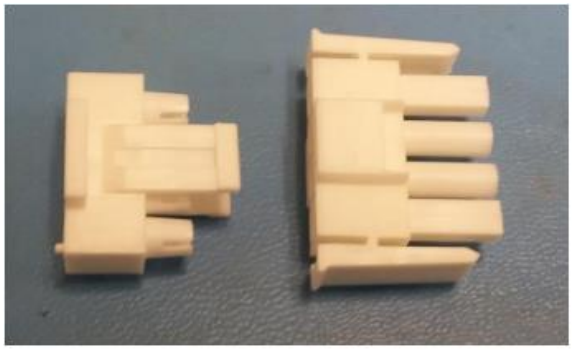

Safety Tips: N/A

TQC: N/A

MAN: CERTIFIED OPERATOR, TECHNICIAN

RTD SENSOR ASSY – CDU HFE SUPPLY TEMP

1. Take the back housing of the plug and Insert the pin connectors into the holes until they fully seated.

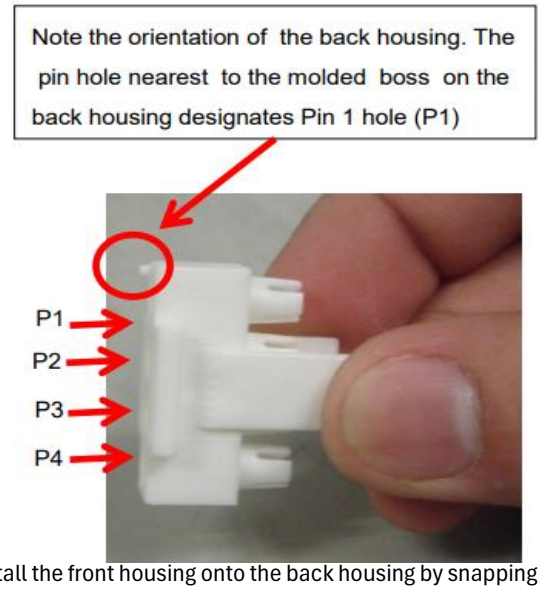

a. Insert Red wire into P1
b. Insert Red wire into P2
c. Insert White wire into P3
d. Insert White wire into P4

2. Install the front housing onto the back housing by snapping in place.

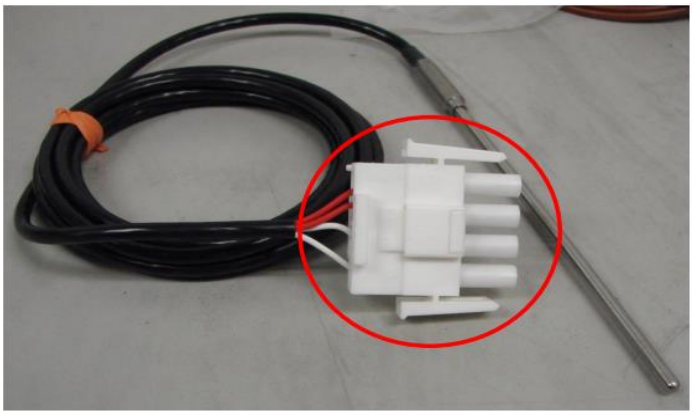

Safety Tips: N/A

MAN: CERTIFIED OPERATOR, TECHNICIAN

RTD SENSOR ASSY – CDU HFE SUPPLY TEMP

1. Create label and mark with location data as shown.

P7 (TE101)
HFE SUPPLY TEMP

2. Create label and mark with part number 633-443-00, Rev * , and date of manufacture **XXYY**
   - Where * is the current revision of the part
   - Where XX defines the year and YY defines the week built

633-443-00 Rev. *
XXYY

3. Install labels on finished assembly as shown

Safety Tips: N/A