Build Overview:

CDU Water Supply Assembly - Part 2

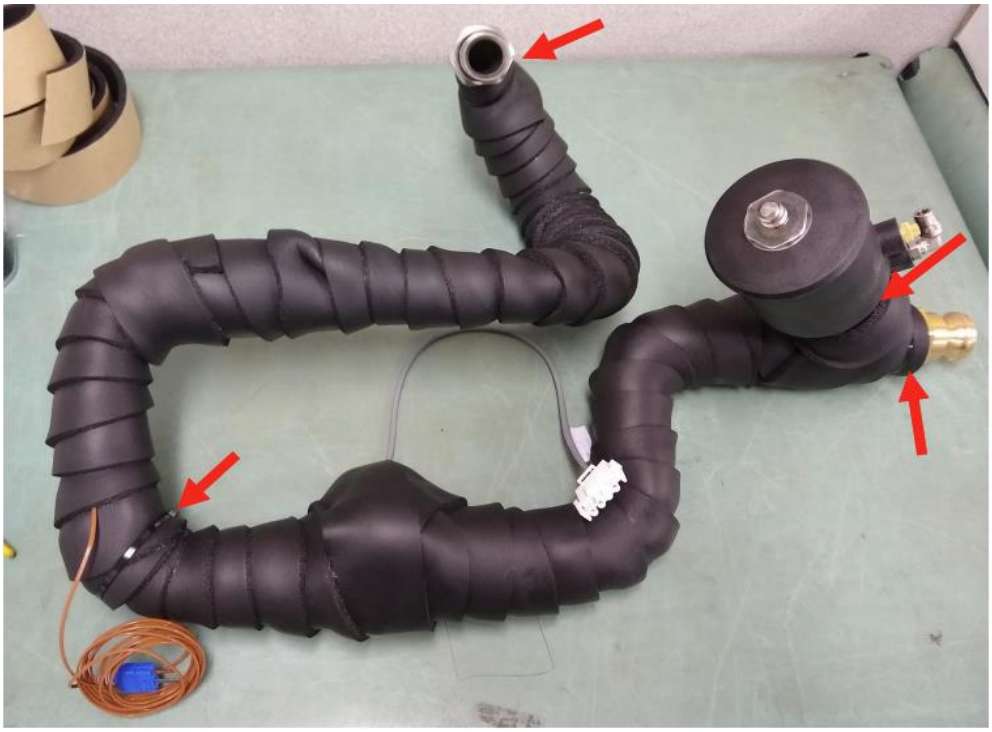

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by
	1	New Issue	JOSEPH AMAD

Prepared By:
JOSEPH R. AMAD
Manufacturing Engineer

Checked By:
IVAN NOWELL PANIQUE
Team Lead

Approved By:
SHERWIN ARIOSTE
Operations Manager

SPECIAL TOOLS

Self-Fusing Tape (McMaster 7643A79 or Grainger GL12B67MCM)

METHOD:

Flow chart of operation steps

SIC preparation
↓
Preparation Tools
↓
Prepare Materials
↓
Complete Operation
↓
Inventory Materials
↓
Operation Check
↓
Inventory tool

Size Hardware	Newton Meter
M2 x 0.4	0.2
M3 x 0.5	0.7
M4 x 0.7	1.6
M5 x 0.8	3.3
M6 x 1.0	5.6
M8 x 1.25	13.5

Torque Rules

- Torque values shown are for steel-to-steel material only.
- Torque all screws and nuts unless otherwise specified.
- Torque table is for reference. See MFE-500-01 for detailed information.

MAN: CERTIFIED OPERATOR, TECHNICIAN

1. Create label with data shown below
2. Place label on thermocouple 666-549-00 25mm from the connector

P9 (TE104)
WATER TEMP

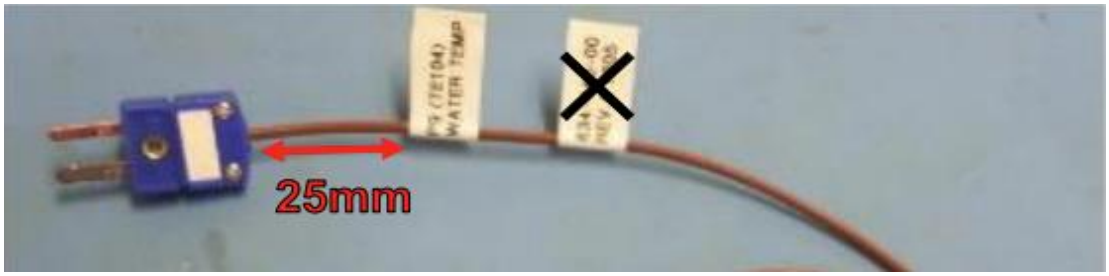

MAN: CERTIFIED OPERATOR, TECHNICIAN

MAKE SURE THE WATER PIPE ASSEMBLY HAS PASSED Leak Test before applying insulation wrap

Installation of insulation wrap

1. Obtain qty. 1 Thermal Insulation Roll (604-659-51).
2. Cut strips of insulation from roll as required to insulate the pipe assembly.
3. Start from the supply side of the pipe assembly.
4. Wrap insulation around the pipes with 50 per cent overlap in insulation.
5. Wrap insulation around the base of the air valve.

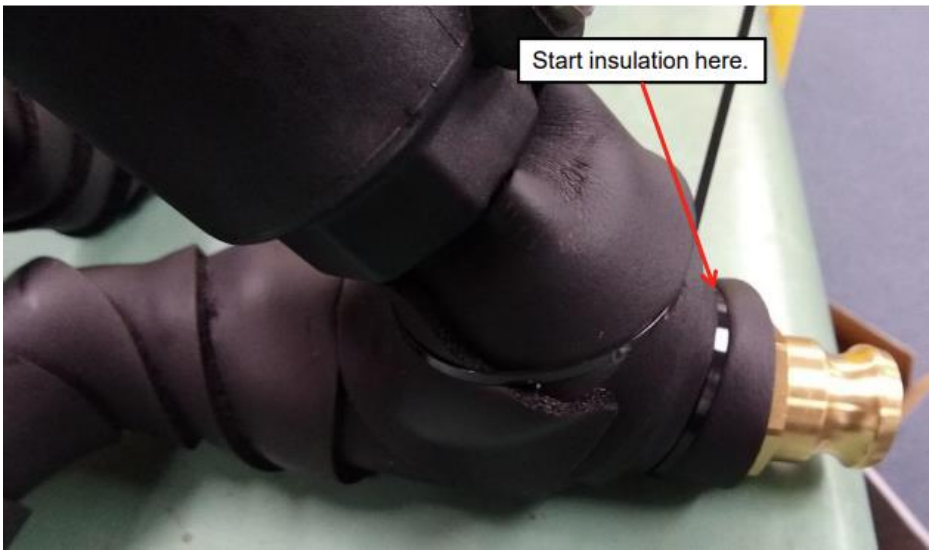

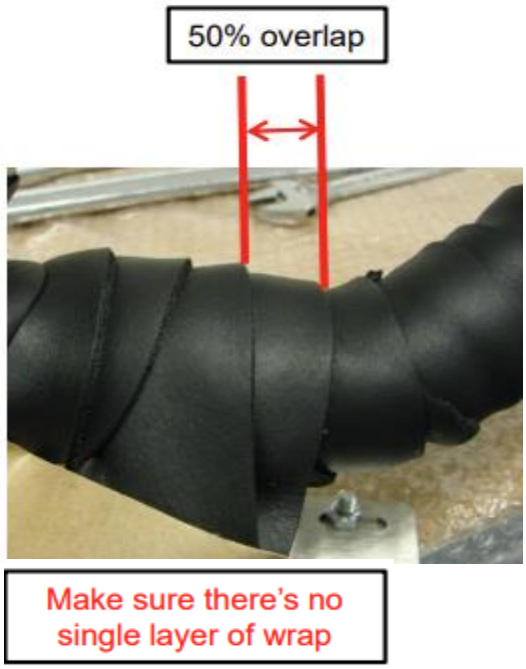

MAN: CERTIFIED OPERATOR, TECHNICIAN

Continue wrapping pipe assembly with insulation
Stop around the point marked in picture below

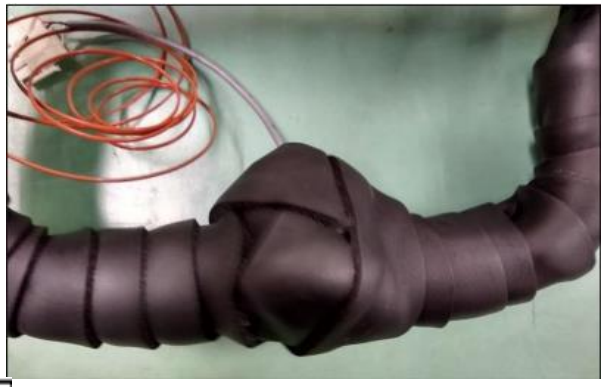

Stop here for thermocouple installation step (next page)

MAN: CERTIFIED OPERATOR, TECHNICIAN

1. Place kapton tape 360-653-11 on pipe where shown
2. Slightly bend end of thermocouple 666-549-00
3. Place thermocouple on pipe centered around the kapton tape with end contacting pipe/tape
4. Secure thermocouple end with zip tie 835-157-00 about 10cm from the thermocouple tip
5. Cut trailing end of zip tie
6. Cut ~12" (~300mm) of self-adhesive tape (McMaster 7643A79 or Grainger GL12B67MCM)
7. Starting at the thermocouple end, wrap 3 rotations of tape tightly around thermocouple end, then cross the tape over zip tie and wrap rest of tape tightly

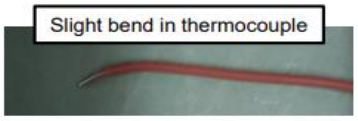

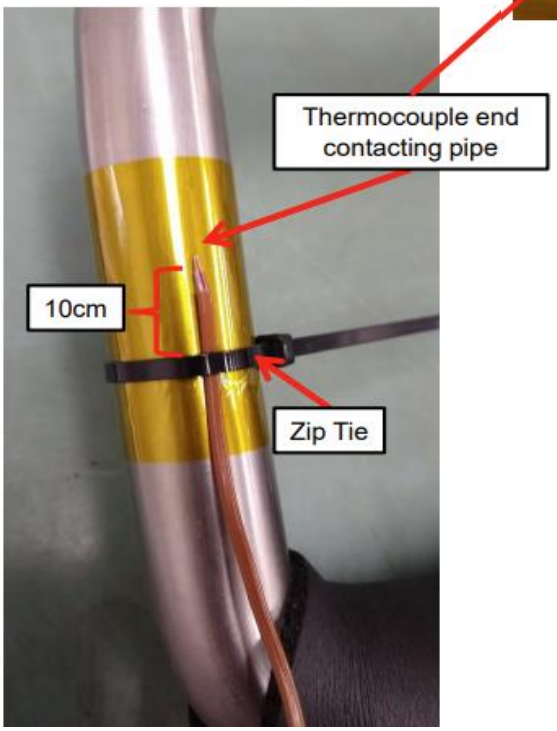

Sa

MAN: CERTIFIED OPERATOR, TECHNICIAN

Start with a new roll of insulation (604-659-51), continue wrapping insulation around pipe assembly
Route thermocouple wire along pipe and out in the same direction as the flow meter cable

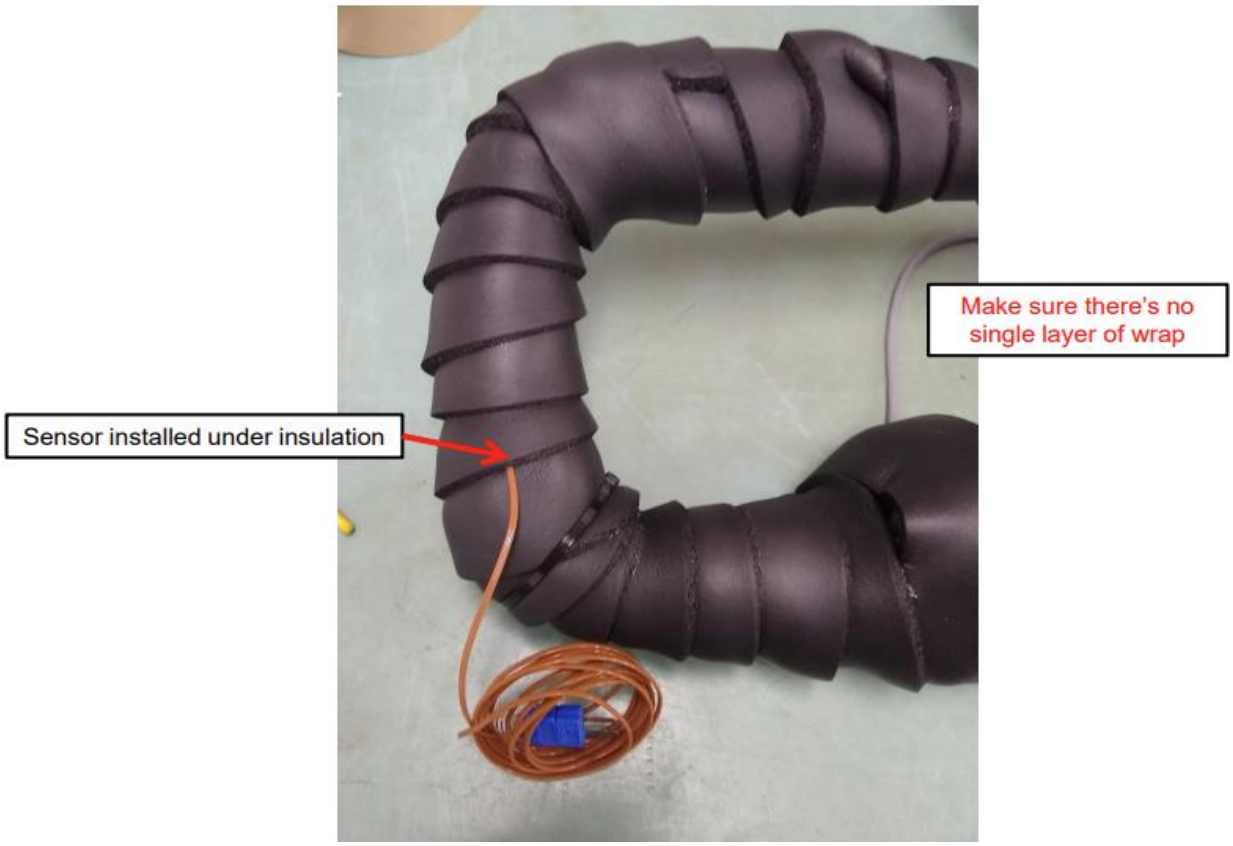

MAN: CERTIFIED OPERATOR, TECHNICIAN

Wrap insulation up to last bend in pipe and leave enough room for the hex nut to travel

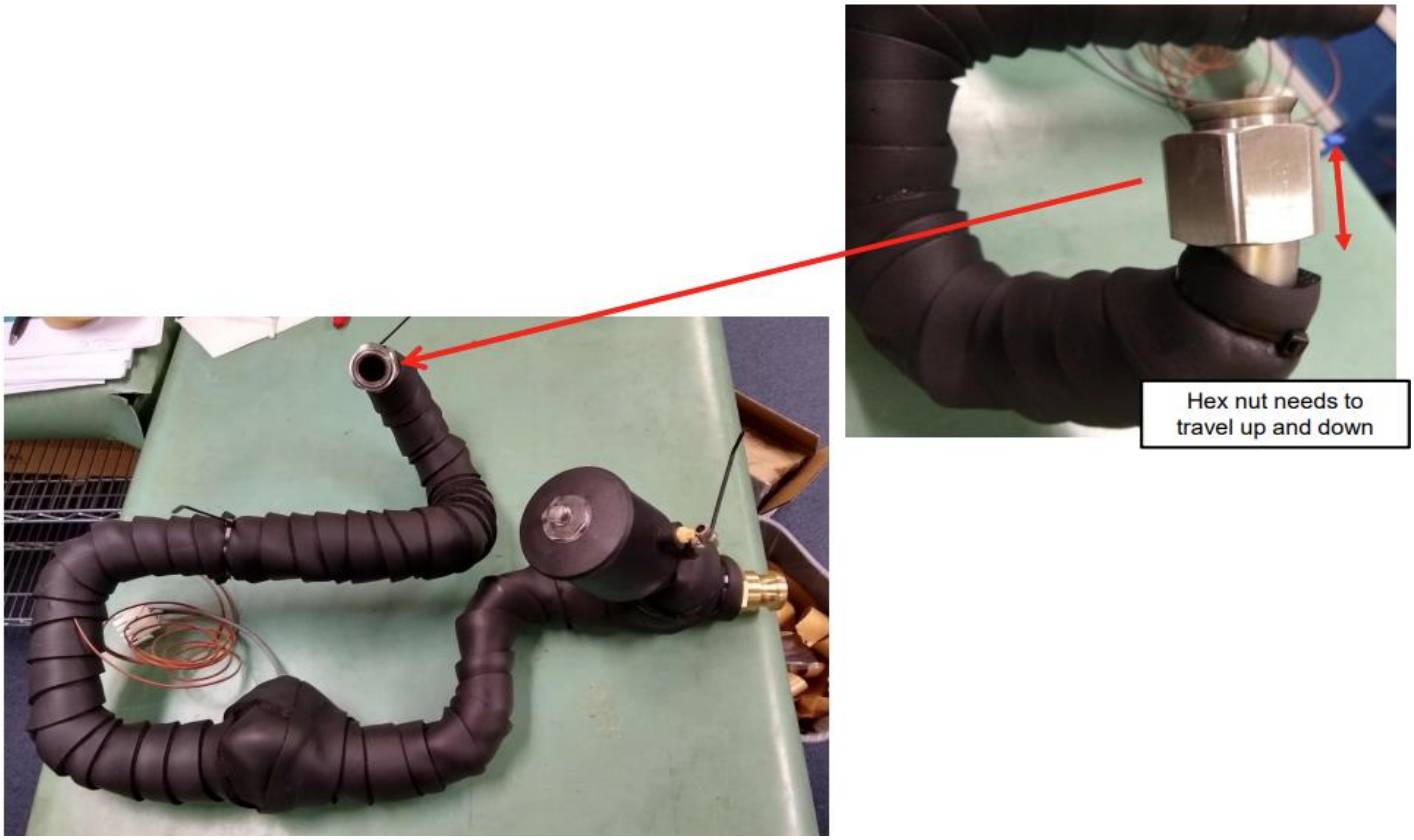

MAN: CERTIFIED OPERATOR, TECHNICIAN

Check wrap around valve for visible pipe assembly

If anything is visible, cover it with a wrap of insulation and secure with a zip tie 835-157-00

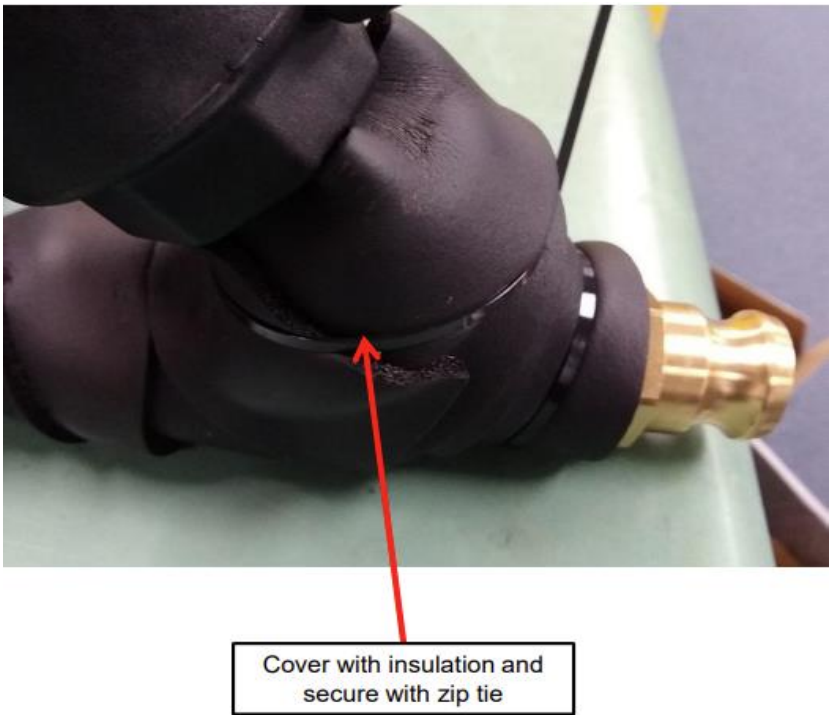

MAN: CERTIFIED OPERATOR, TECHNICIAN

Use Zip ties 835-157-00 at ends of pipe assembly and at location where new insulation wrap was used
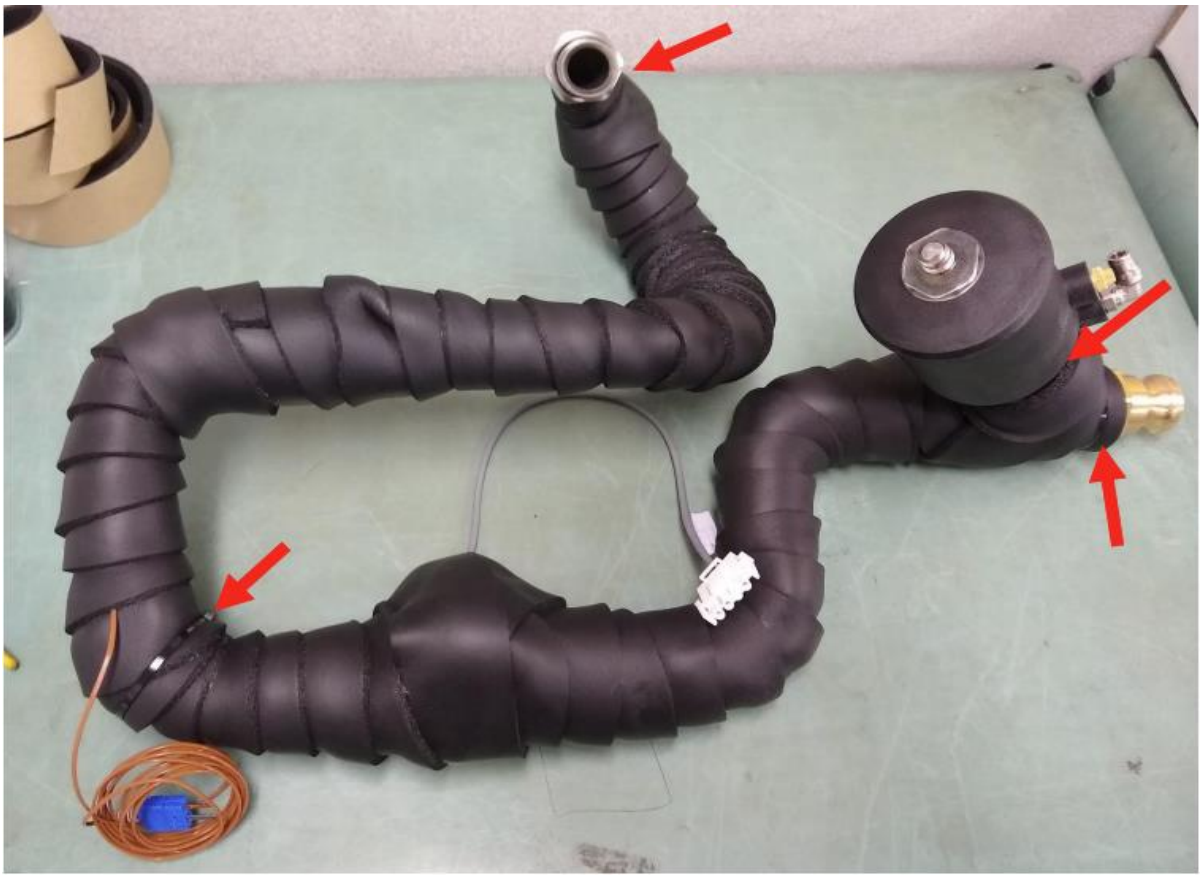
End of process. Assembly ready for integration into CDU HLA