Build Overview:

1. **Install Panel Label**
2. **Cabinet Prep**
3. **SMC Rails Install**
4. **Fan Install**
5. **PSU Shipping Brackets Install**
6. **PSU Supports Install**

Operation surface

Maintenance side

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by	
	1	New Issue	JOSEPH AMAD	**Prepared By:** JOSEPH R. AMAD, Manufacturing Engineer
				Checked By: IVAN NOWELL PANIQUE, Team Lead
				Approved By: SHERWIN ARIOSTE, Operations Manager

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

NO.	PART NUMBER	DESCRIPTION	QTY.
1	360-812-01	Nut	77
2	472-426-12	Screw	12
3	574-777-00	SMC rail	2
4	603-096-00	Nut	44
5	653-631-00	CDU slider	2
6	635-028-00	PSU bracket	1
7	635-029-00	PSU bracket	1
8	653-671-00	Fan	1
9	637-537-00	Bracket	12
10	637-538-00	Bracket	2
11	470-483-04	Screw	10
12	628-453-00	12 cabinets	1
13	637-160-00	Stud	4
14	361-081-50	Flat feet	4

MACHINE:

NO.	PART NUMBER	DESCRIPTION	IMAGE
1	N/A	3mm hex bit 3.3 N.m	N/A
2	N/A	PH2 Phillips Torque Screwdriver 3.3 N.m	N/A
3	N/A	8mm socket wrench 3.3 N.m	N/A

METHOD:

Flow chart of operation steps

BPM preparation	See (1. Scope of application)
↓	
Preparation Tools	See (2. Tools/Materials/Parameters---1. Tools)
↓	
Prepare Materials	See (2. Tools/Materials/Parameters---2. Materials)
↓	
Complete Operation	See (3. Operation Steps)
↓	
Inventory	See (2. Tools/Materials/Parameters---2. Materials)
↓	
Operation Check	See (4. Matters needing attention)
↓	
Inventory collection tools	See (2. Tools/Materials/Parameters---1. Tools)

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD: 3. Operation steps

1.1 The operation surface of the cabinet as shown in the figure-the operating direction of the cabinet panel is also defined as the front of the cabinet.

1.2 The cabinet maintenance surface as shown in the figure-the direction of the cabinet facilities on the bottom panel is also defined as the back of the cabinet.

1.3 The position of the guide rail is defined by numbers, which are printed on the guide rail. The positions of the numbers are U (upper), M (middle), and L (lower).

Operation surface

Maintenance side

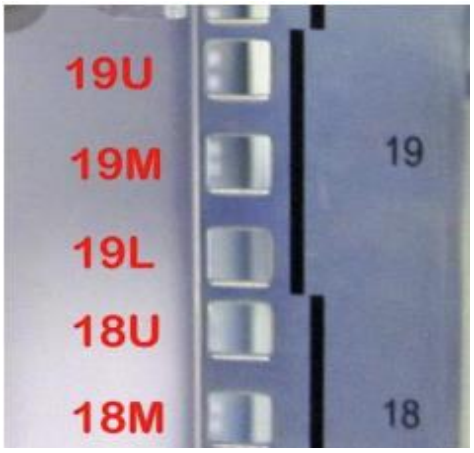

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

2.1 Cabinet (651-600-00) incoming inspection.

i. Whether the cabinet panel has coating defects, scratches, indentations, etc.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

ii. There is a key at the user operating position on the operating surface.

2.2 Take off the key and open the side door.

2.3 Remove the side door panels, front door and rear door and store them carefully.

a. Ensure that all door locks are unlocked clockwise and locked counterclockwise.

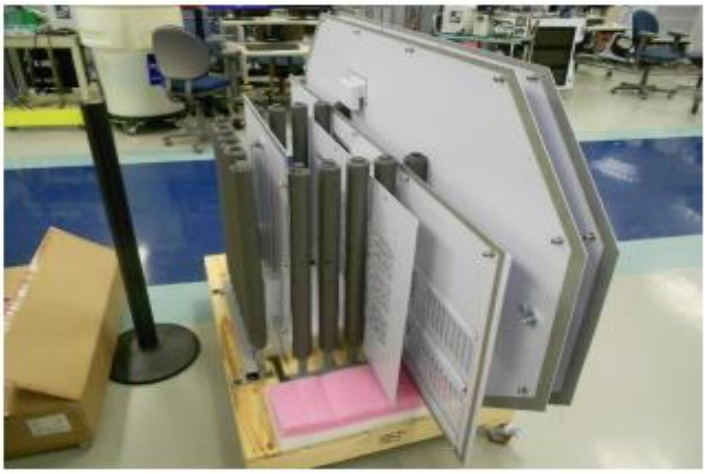

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

b. After removing the door as shown in the figure, tie the key to the mushroom head nail on one of the door panels

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

2.4 Inspection inside the cabinet.

a. Whether there are coating defects, scratches, indentations, guide rails, EMC foam around the T/H frame panel, and studs inside the cabinet.

b. As shown in the figure, the ESD button is at the uppermost position of the panel-one is on the operation surface, and the other is on the maintenance surface.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

2.5 Take 4 637-160-00 (online location OL3 I16) and 4 361-081-50 (online location OL3 H9), and install them in the 4 corners of the cabinet.

Precautions:

i. When removing 361-081-50, keep 4 original packaging bags and 4 plastic screw protection sleeves, and use bubble bags to hang them next to the cabinet.

ii. After installation, screw the foot to the top to confirm whether a piece of iron plate fixture can be inserted under the foot. If not, notify the PE engineer to solve it immediately!

iii. After confirming, lower the feet until they touch the ground, and then slightly raise the cabinet until the cabinet does not move.

iv. Note: Whenever you want to move the cabinet, you must raise 4 flat feet!

2.5

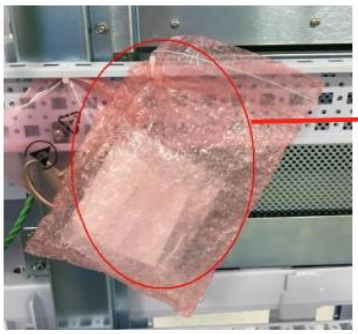

2.5 i

2.5 ii

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

3.1 Install 2 CDU sliding rods (653-631-00) at the bottom of the cabinet, and fix them with 10 M5 screws (470-483-04).
The tool is a 3mm hexagon socket head.
The torque value is 1.6 N·m. The figure shows the operation surface view.

3.2 Install 24 nuts (360-812-01) on the guide rails on both sides of the cabinet maintenance surface, the positions are as follows: 20M, 21M, 22M, 23M, 24L, 25U, 28U, 33L, 36L, 36U, 38U, 39L

3.3 Install 30 nuts (360-812-01) on the guide rails on both sides of the operation surface of the cabinet, the positions are as follows: 3U, 17U, 22M, 23M, 27U, 28M,33U,33M, 36L, 36U, 37L, 37U, 38M, 38U, 39L

3.4 Install 3 nuts (360-812-01) on the right guide rail on the operation surface of the cabinet, the positions are as follows: 26M, 26U, 33L

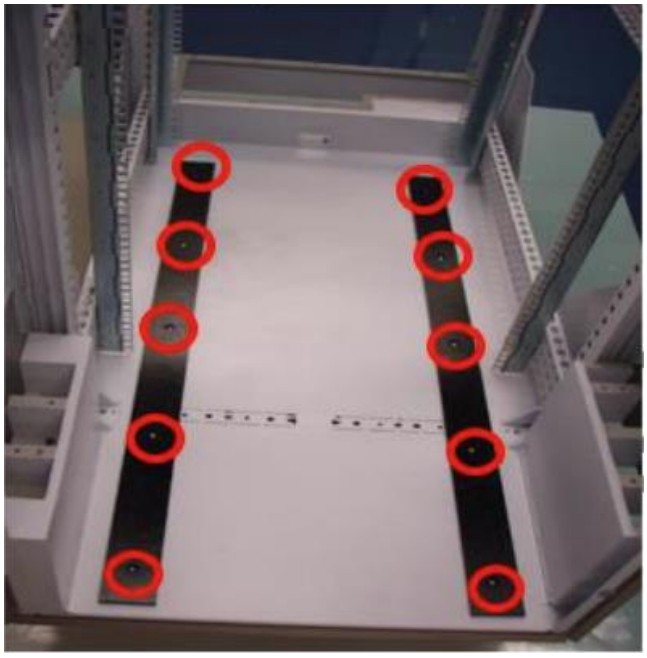

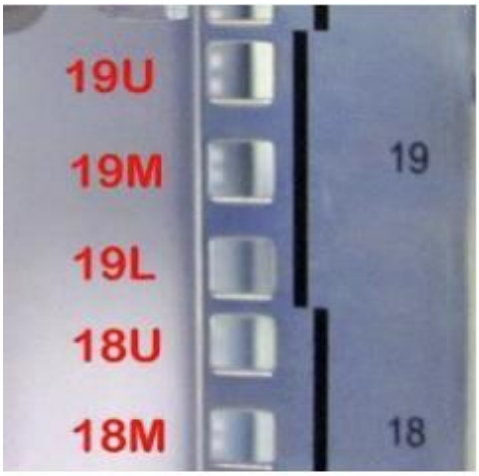

Reference map

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

3.5 Install two SMC guide rails (574-777-00) at the positions of the guide rails 38U and 39L on both sides of the cabinet and fix them with 8 M5 screws (472-426-12).

The tool is a PH2 Phillips torque screwdriver with a torque value of 3.3 N·m. The illustrated view is the operation surface view.

Note: The square hole on the guide rail should face the maintenance surface of the cabinet.

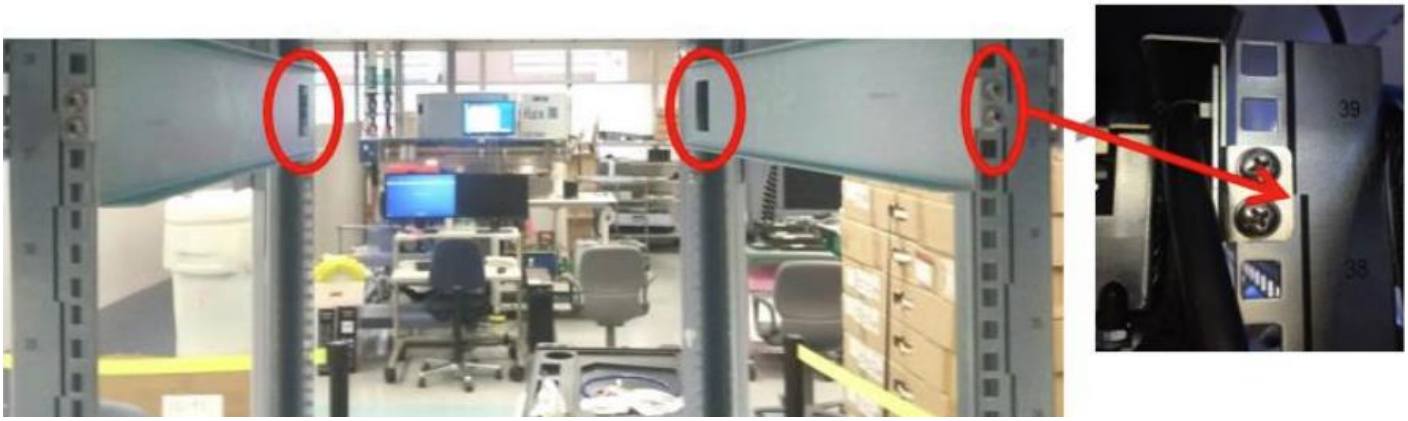

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD: **Install the cabinet fan**

4.1 Remove the nuts from the cabinet and throw them away;

4.2 Install the fan 653-671-00 on the top cover with the fan facing down and the wire bracket facing the right side of the operating surface of the cabinet.

4.3 Use 4 nuts (603-096-00) to tighten. The tool is an 8mm socket wrench with a torque value of 3.3 N·m.

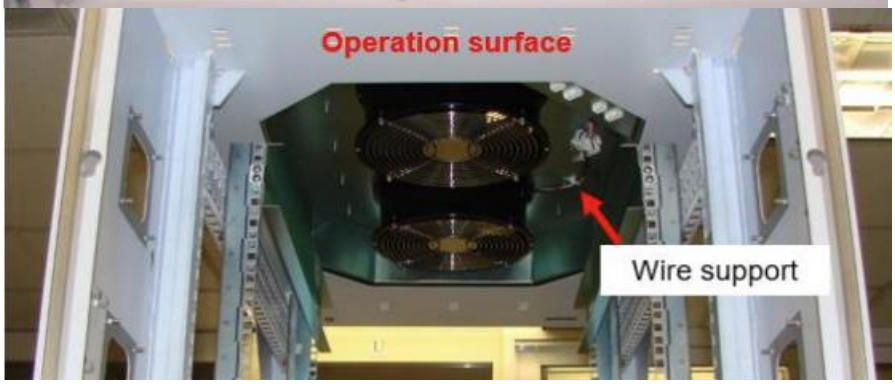

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

5.1 Install 24 M5 nuts (360-812-01) on 12 movable supports (637-537-00), two nuts for each group of supports.

5.2 Install 12 movable brackets on 2 fixed brackets (637-538-00), each fixed bracket has 6 movable brackets, Use 24 M5 fixing nuts (603-096-00) to fix, 12 in each group, and fix it manually.

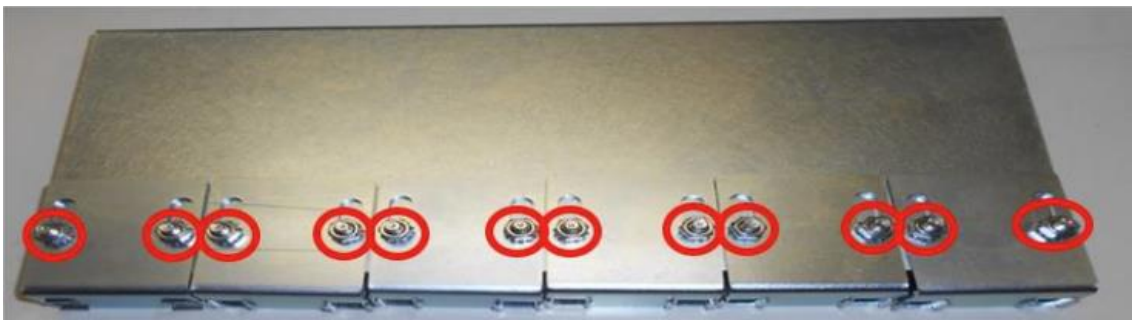

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

5.3 Install the fixed bracket on the guide rail on the maintenance surface of the cabinet at positions 28U and 33L, and fix it with 4 M5 screws (472-426-12).
The tool is a PH2 Phillips torque screwdriver with a torque value of 3.3 N·m.

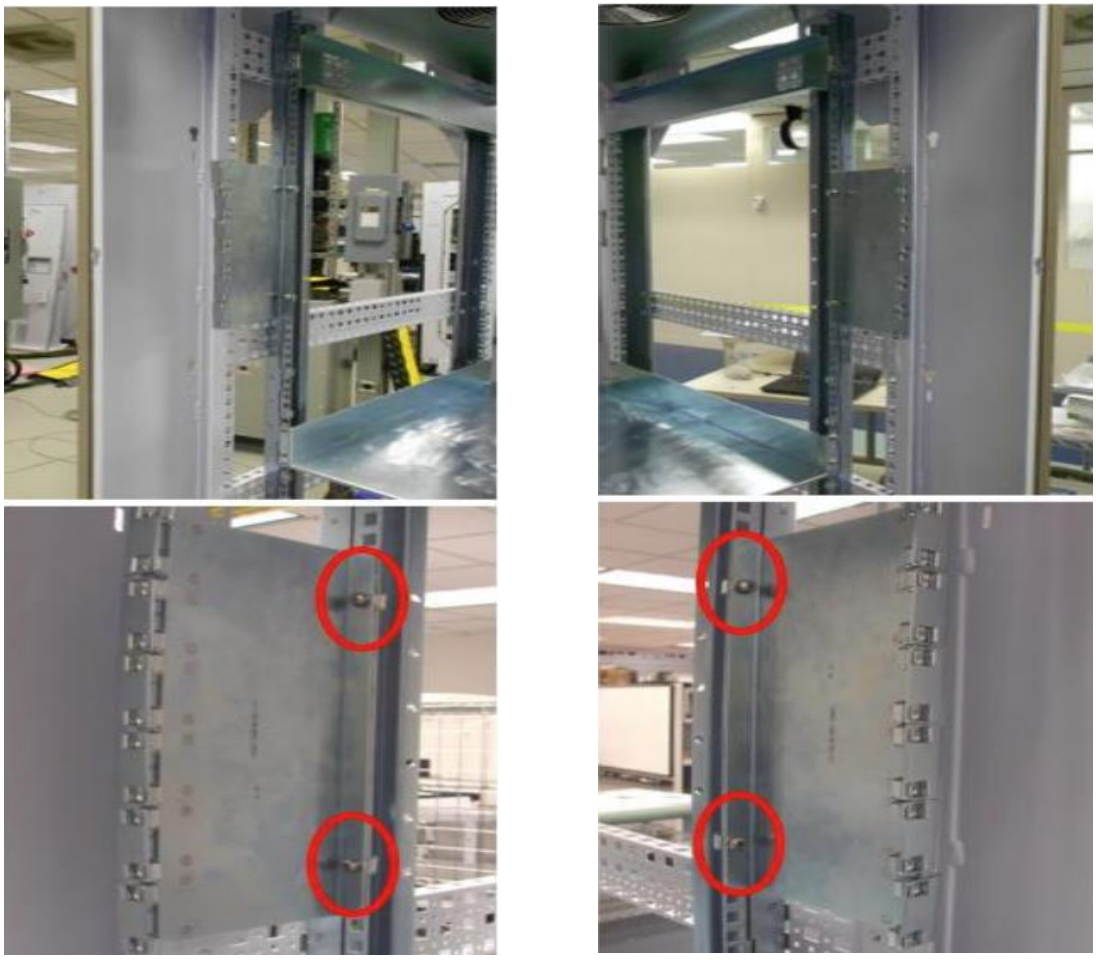

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

6.1 Use an 8mm socket wrench to remove and discard the M5 nuts that come with the PSU left and right brackets (635-028-00, 635-029-00).

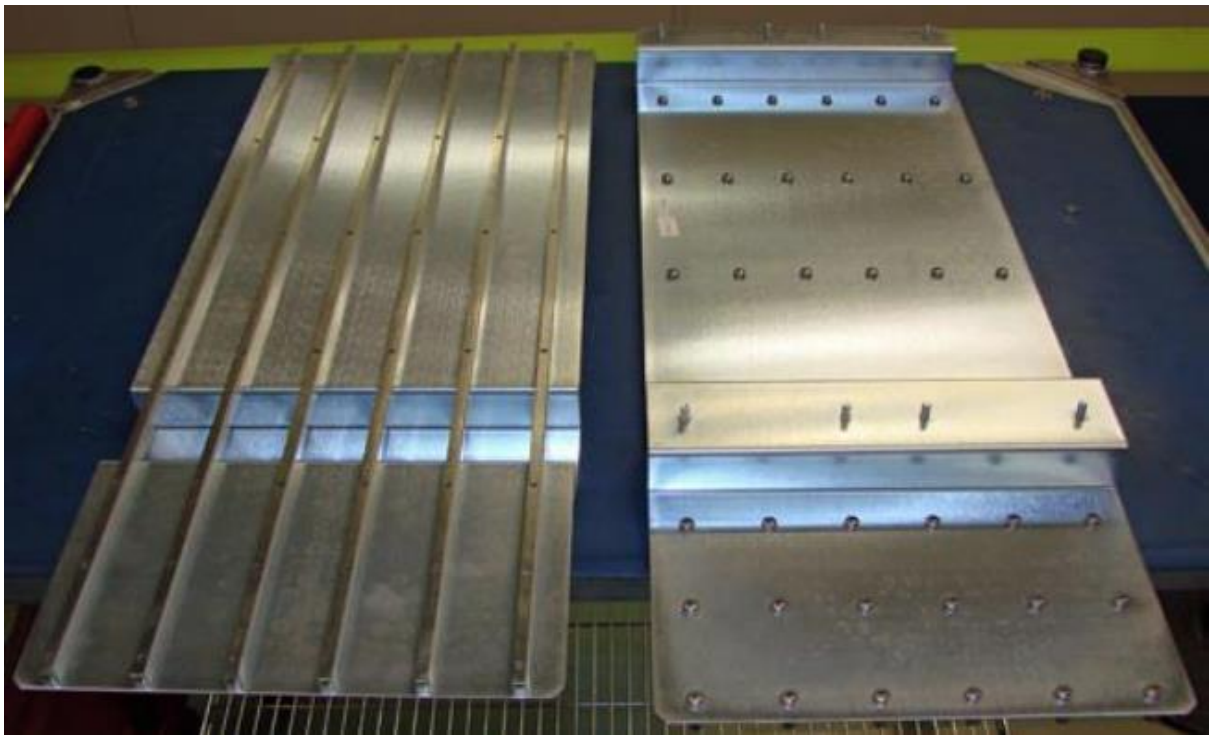

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

6.2 Install the PSU bracket (635-029-00) on the left side of the cabinet, and fix it with 8 M5 nuts (603-096-00). The tool is an 8mm socket wrench, The torque value is 3.3 N·m.

6.3 Install the PSU bracket (635-028-00) on the right side of the cabinet, and fix it with 8 M5 nuts (603-096-00). The tool is an 8mm socket wrench, The torque value is 3.3 N·m.
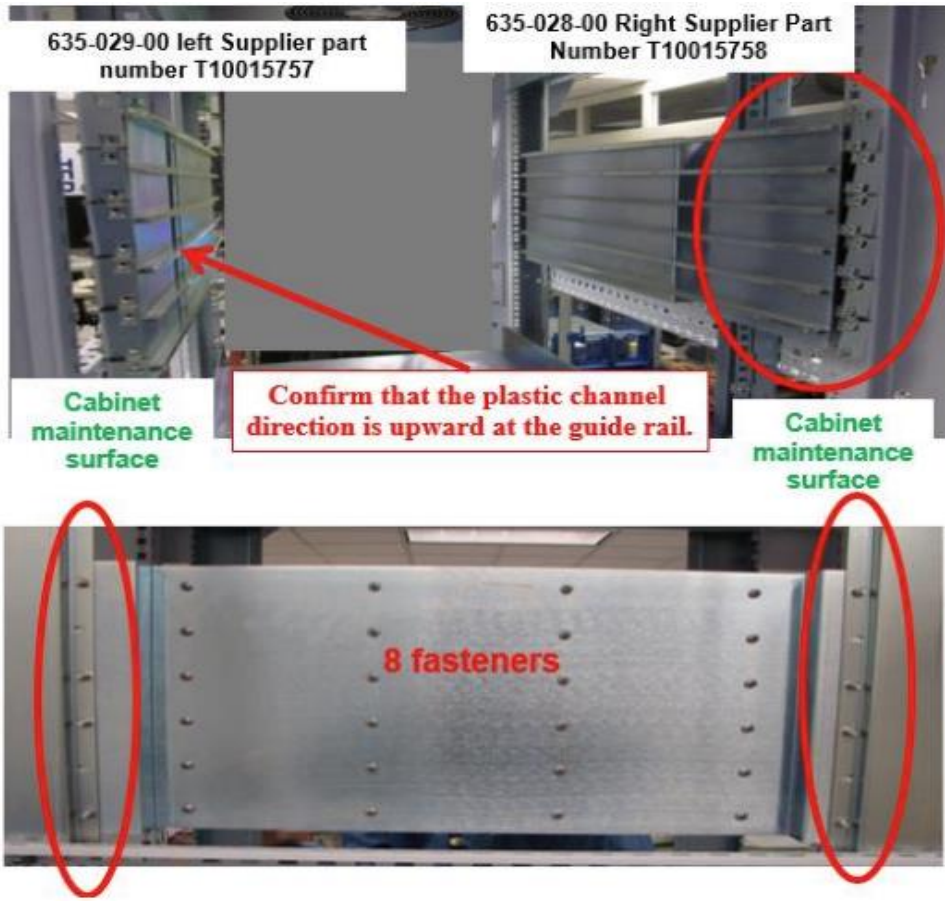
Note: The installation direction of the cabinet as shown in the figure is the cabinet maintenance surface.