Build Process Manual	DOCUMENT CONTROL No.:	REF-016-36
	VERSION No.:	1
UltraflexPlus 12 _ Support Cabinet _ S5	Effectivity Date:	10/10/2025
	Page No.:	1 of 11

Build Overview:

1 **PSU Install**
2 **Dummy PSU Install**
3 **PSU AC Bus Bars Install**
4 **PSU Block Off Panel Install**

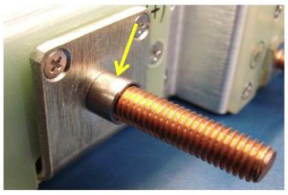

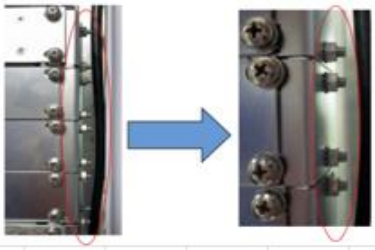

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by
	1	New Issue	JOSEPH AMAD

Prepared By:
JOSEPH R. AMAD
Manufacturing Engineer

Checked By:
IVAN NOWELL PANIQUE
Team Lead

Approved By:
SHERWIN ARIOSTE
Operations Manager

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

NO.	PART NUMBER	DESCRIPTION	QTY.
1	640-343-00	PSU	1
2	657-809-20	Blank PSU	2
3	652-952-00	Threaded Gasket	1
4	630-354-12	AC BUSBAR	4
5	603-096-03	M6 Nut	8
6	470-501-05	M6 Flat Washer	8
7	472-426-12	M5 Screw	24
8	638-040-00	PSU Blank Panel	3

MACHINE:

NO.	PART NUMBER	DESCRIPTION	IMAGE
1	N/A	10mm socket wrench 5.6 N.m	
2	N/A	PH2 Phillips Torque Screwdriver 3.3 N.m	
3	N/A	13mm Socket Wrench 13.5 N.m	
4	N/A	Flat nose plastic pliers	
5	N/A	8mm socket wrench 3.3 N.m	

METHOD:

Flow chart of operation steps

BPM preparation	See (1. Scope of application)
↓	
Preparation Tools	See (2. Tools/Materials/Parameters---1. Tools)
↓	
Prepare Materials	See (2. Tools/Materials/Parameters---2. Materials)
↓	
Complete Operation	See (3. Operation Steps)
↓	
Inventory	See (2. Tools/Materials/Parameters---2. Materials)
↓	
Operation Check	See (4. Matters needing attention)
↓	
Inventory collection tools	See (2. Tools/Materials/Parameters---1. Tools)

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

3. Operation steps
   1. When you see the following icon, it indicates that you must use gloves during this step.

1.1 Remove the outer packaging of 1 PSU (640-343-00) and check the incoming materials.

a. Whether the power stud is bent or damaged.

b. Whether the quick disconnect connector is bent or damaged.

c. Whether the PSU outer packing box is damaged by impact.

1.2 Remove the nuts, washers and other parts on the Busbar of the PSU and save them for subsequent assembly.

a. 1/4 inch parts on AC connector-4 sets of nuts, flat washers and spring washers. The removal tool is a 10mm socket wrench.

b. M8 parts on the DC connector-2 sets of nuts, flat washers and spring washers. The removal tool is a 13mm socket wrench.

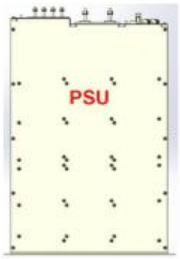

1.3 Remove the oute

a. Whether the power stud is bent or damaged.

b. Whether the PSU outer packing box is damaged by impact.

1.4 Remove the nuts, washers and other parts on the Busbar of the blank PSU and save them for subsequent assembly.

a. 1/4 inch parts on AC connector-4 sets of nuts, flat washers and spring washers. The removal tool is a 10mm socket wrench.

Note: Do not remove the M8 nut and washer on the DC connector!

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

1.5 Install a threaded washer 652-952-00 on the M8 stud with a'+' on the PSU. Note: Use pliers to slightly tighten the washer to the stud.

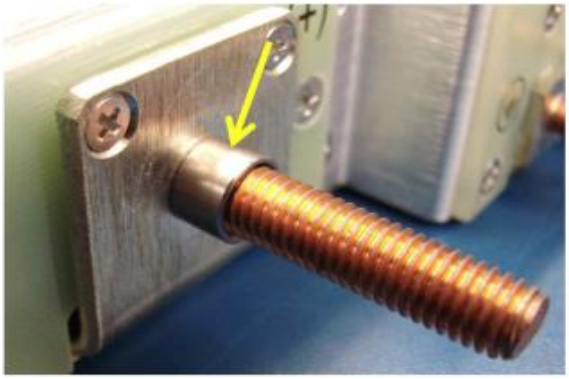

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

1.6 Install the PSU to position 5 (the bottommost position) of the power slider-slide it into the guide rail until the rear of the PSU is aligned with the rear of the ADB.

Warning: The PSU is very heavy and requires two people to lift it at the same time.

Cabinet maintenance surface

Cabinet operation surface

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

1.7 Install 2 blank PSU 657-809-20 to position 3 and position 0-slide into the guide rail until the back of the PSU is flush with the back of the ADB.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

2.1 As shown in the figure, install 4 AC BUSBAR 630-354-12 to ADB.

2.2 First use 8 M6 nuts 603-096-03 and 8 M6 flat washers 470-501-05 to connect 4 BUSBARs to the ADB (two sets for each BUSBAR). Adjust the PSU or ADB according to the installation needs to ensure that BUSBAR is aligned with the ADB and PSU holes. The tool is a 10mm socket wrench with a torque value of 5.6 N·m

2.3 As shown in the figure, use the original 4 sets of nuts, flat washer and spring washer to lock 4 BUSBARs with 4 sets of original PSU that were removed before. The tool is a 10mm socket wrench with a torque value of 5.6 N·m.

2.4 As shown in the figure, use the original 8 sets of nuts on the 2 blank PSUs that were removed before, and lock 4 BUSBARs on the flat washers and spring washers, totaling 8 positions. The tool is a 10mm socket wrench with a torque value of 5.6 N·m.

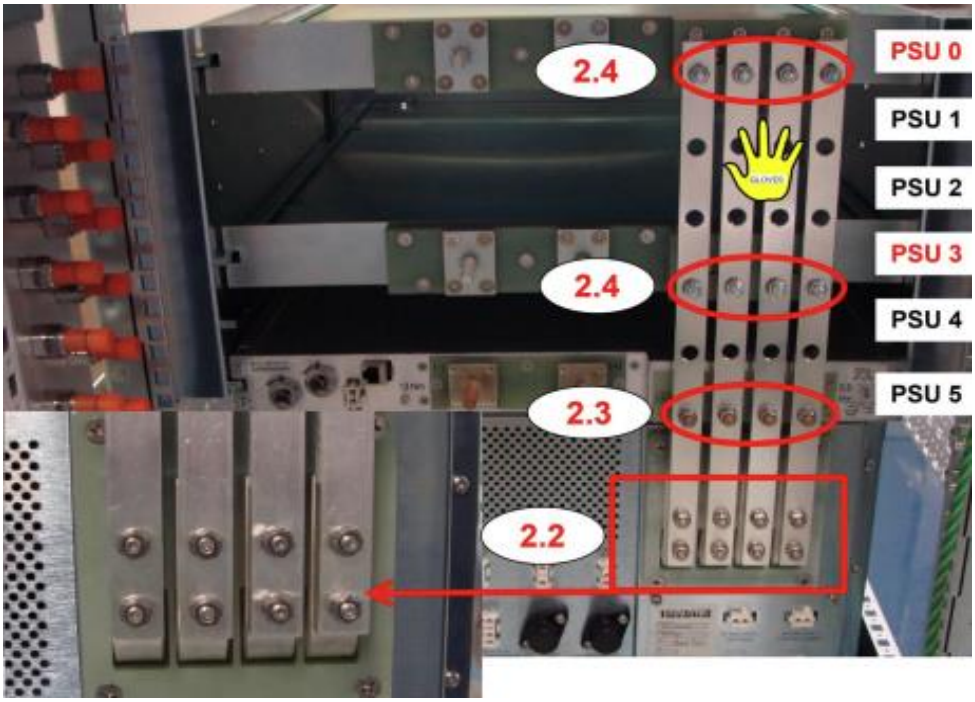

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

3.1 Fix the ADB on the cabinet rail as shown in the figure (the screws have been installed before), the tool is a PH2 Phillips torque screwdriver, and the torque value is 3.3 N·m.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

4.1 Set the DIP switch on the front of the PSU on the maintenance surface of the cabinet as shown in the figure.

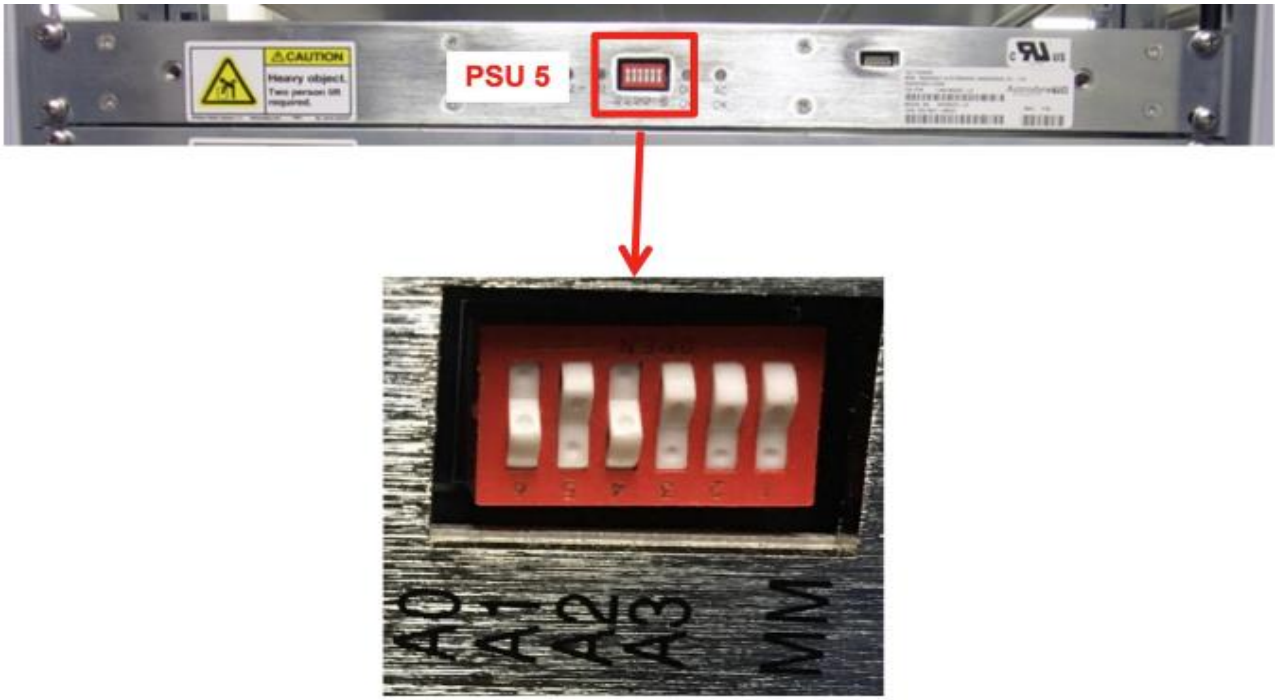

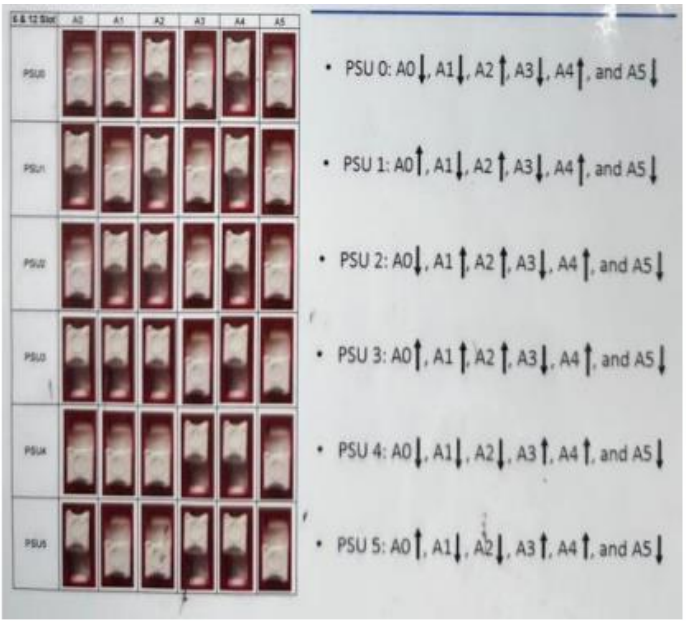

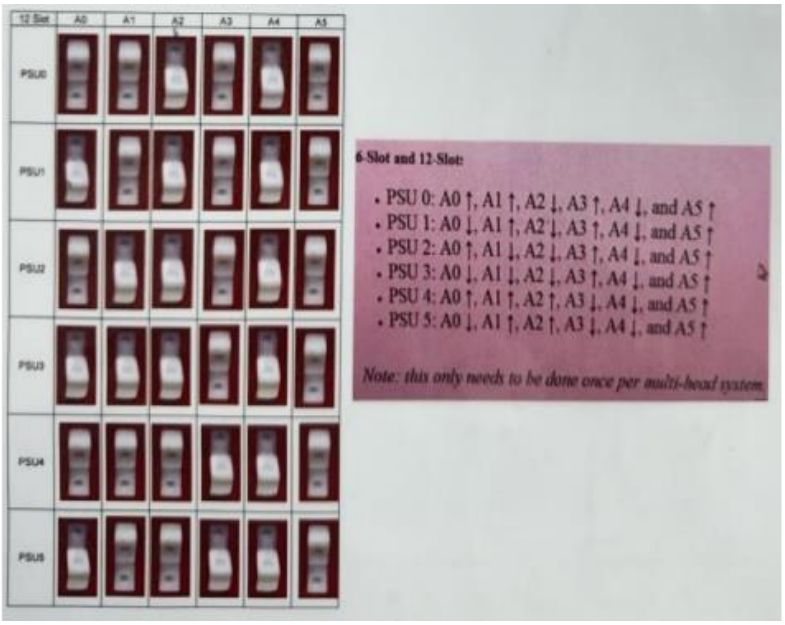

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

5.1 Fix one PSU and two blank PSUs to the rack bracket as shown in the figure.
Use 12 M5 screws (472-426-12) to fix, the tool is a PH2 Phillips torque screwdriver, the torque value is 3.3 N·m.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

5.2 As shown in the figure, install 3 blank PSU panels (638-040-00) to the three positions 1, 2, and 4 in the figure.
Use 12 M5 screws (472-426-12) to fix, the tool is a PH2 Phillips torque screwdriver, the torque value is 3.3 N·m.
Note: Ensure that the side with the part number printed on the panel faces inward to install!
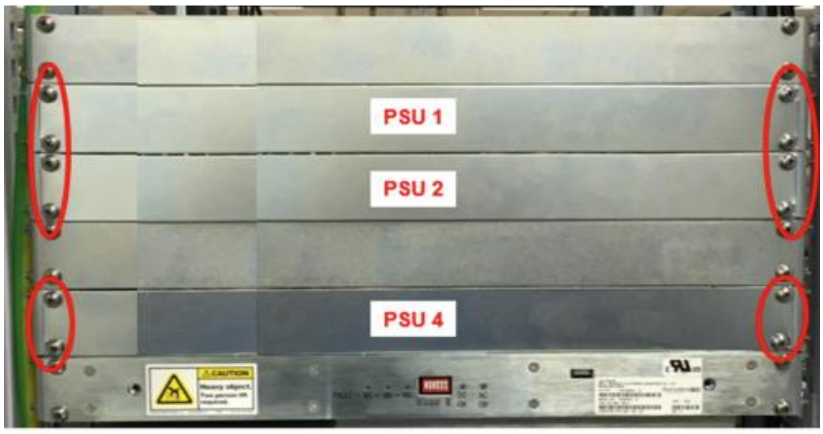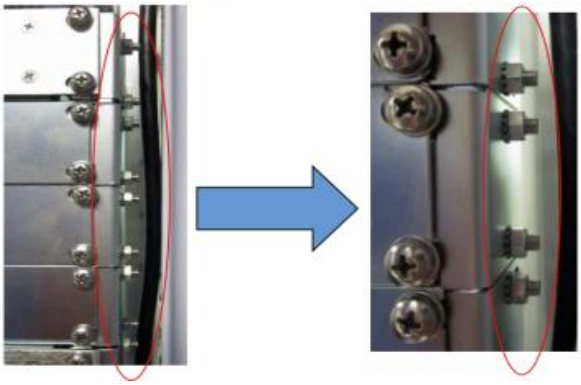
5.3 By adjusting the sliding panel, adjust the panel to the same distance as the front panel of the PSU, and then lock the 24 nuts on both sides.
The tool is an 8mm socket wrench with a torque value of 3.3 N·m.