**Build Overview:**

1. **AC Power Cords Install**
2. **Fan Tray Cabling Install**
3. **Operator Interface Cabling Instal**
4. **Data Cables Install**
5. **Cable Block off Panels Install**
6. **Data Switch Map Bracket Install**

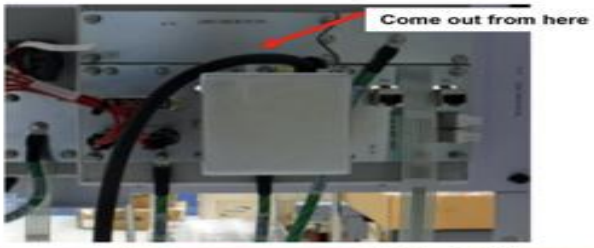

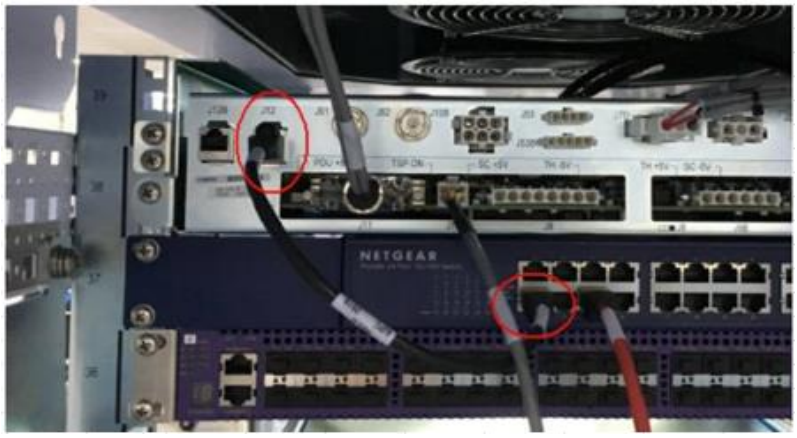


**CHANGE HISTORY**

| Date | BPM Rev | Change Details | Updated by |
|---|---|---|---|
| | 1 | New Issue | JOSEPH AMAD |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

**Prepared By:**
JOSEPH R. AMAD
Manufacturing Engineer

**Checked By:**
IVAN NOWELL PANIQUE
Team Lead

**Approved By:**
SHERWIN ARIOSTE
Operations Manager

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

| ITEM NO. | PART NUMBER | DESCRIPTION | QTY. |
|---|---|---|---|
| 1 | 813-929-00 | Tie | 1 |
| 2 | 918-241-15 | Power Cable | 2 |
| 3 | 813-929-01 | Tie | 7 |
| 4 | 656-793-00 | Speed Monitor Cable | 1 |
| 5 | 661-951-00 | Fan Power Cord | 1 |
| 6 | 657-139-00 | Signal Line | 1 |
| 7 | 656-981-00 | Operation Interface Display line | 1 |
| 8 | 631-559-00 | Cable | 1 |
| 9 | 631-561-00 | Cable | 1 |
| 10 | 650-502-00 | Panel | 1 |
| 11 | 650-499-00 | Panel | 4 |
| 12 | 472-426-12 | M5 Screw | 5 |
| 13 | 658-496-00 | Ethernet Switch Bracket | 1 |
| 14 | 470-933-07 | Screw | 4 |
| 15 | 470-502-07 | Spring Cushion | 4 |
| 16 | 470-501-06 | Flat pad | 4 |

**MACHINE:**

| NO. | PART # / ID | DESCRIPTION | IMAGE |
|---|---|---|---|
| 1 | N/A | 5mm Hexagon Socket Torque Screwdriver 13.5 N.m | |
| 2 | N/A | PH2 Phillips Torque Screwdriver 3.3 N.m | |

**METHOD:**

Flow chart of operation steps

| | |
|---|---|
| BPM preparation | See (1. Scope of application) |
| ↓ | |
| Preparation Tools | See (2. Tools/Materials/Parameters---1. Tools) |
| ↓ | |
| Prepare Materials | See (2. Tools/Materials/Parameters---2. Materials) |
| ↓ | |
| Complete Operation | See (3. Operation Steps) |
| ↓ | |
| Inventory | See (2. Tools/Materials/Parameters---2. Materials) |
| ↓ | |
| Operation Check | See (4. Matters needing attention) |
| ↓ | |
| Inventory collection tools | See (2. Tools/Materials/Parameters---1. Tools) |

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

3. Operation steps

1. When you see the following icon, it indicates that you must use gloves during this step.

1.1 Insert the AC power cord on the AC panel of the Interance panel of the cabinet operation surface into the outlet of "J17A" on the ADB of the cabinet operation surface as shown in the figure.

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

2.1 Pass the power cord of the network switch (installed in part 3) through the maintenance surface of the cabinet to the back of the ADB. Use a 813-929-00 cable tie to tie it through the wire slot.
2.2 Insert the power cord into the ADB "J14B" position as shown in the figure, put the cord into the wire slot, behind the ADB, and then put it down.

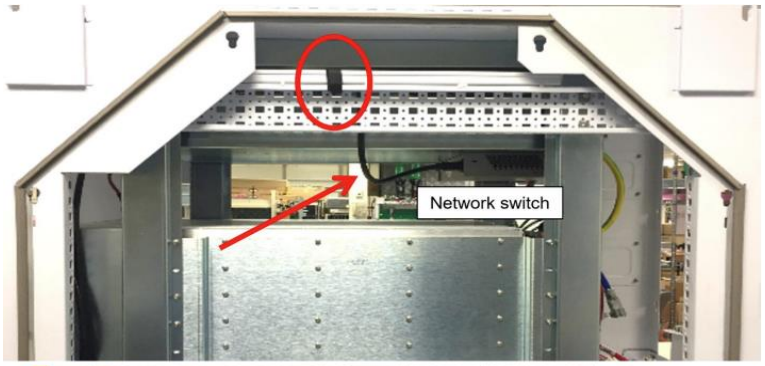

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

2.3 Plug the two power cords 918-241-15 into the two ports on the back of the Test Head network switch. Route the cables through the right-side trunking as shown.

2.4 Route the cables as shown in the figure and insert the power cables into the "J17B" and "J17C" positions of ADB.

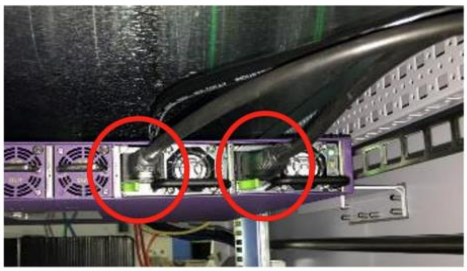

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

2.5 Lay down the SMC AC power cord along the right side of the cabinet as shown in the figure, and then install it to the exit position of "J14A SMC" on the ADB. Use 3
The cable tie (813-929-01) binds the wire to the guide rail.

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

3.1 Install a fan speed monitor cable (656-793-00) to SMC-J11 as shown in the figure.

a. As shown in the figure, insert the connector labeled "1st SC Fan Monitor" into the left socket of the fan, and mark the other Insert the "2nd SC Fan Monitor" connector into the right socket of the fan.

b. Tie the fan cable to the top of the cabinet with two 813-929-01 cable ties as shown in the figure.

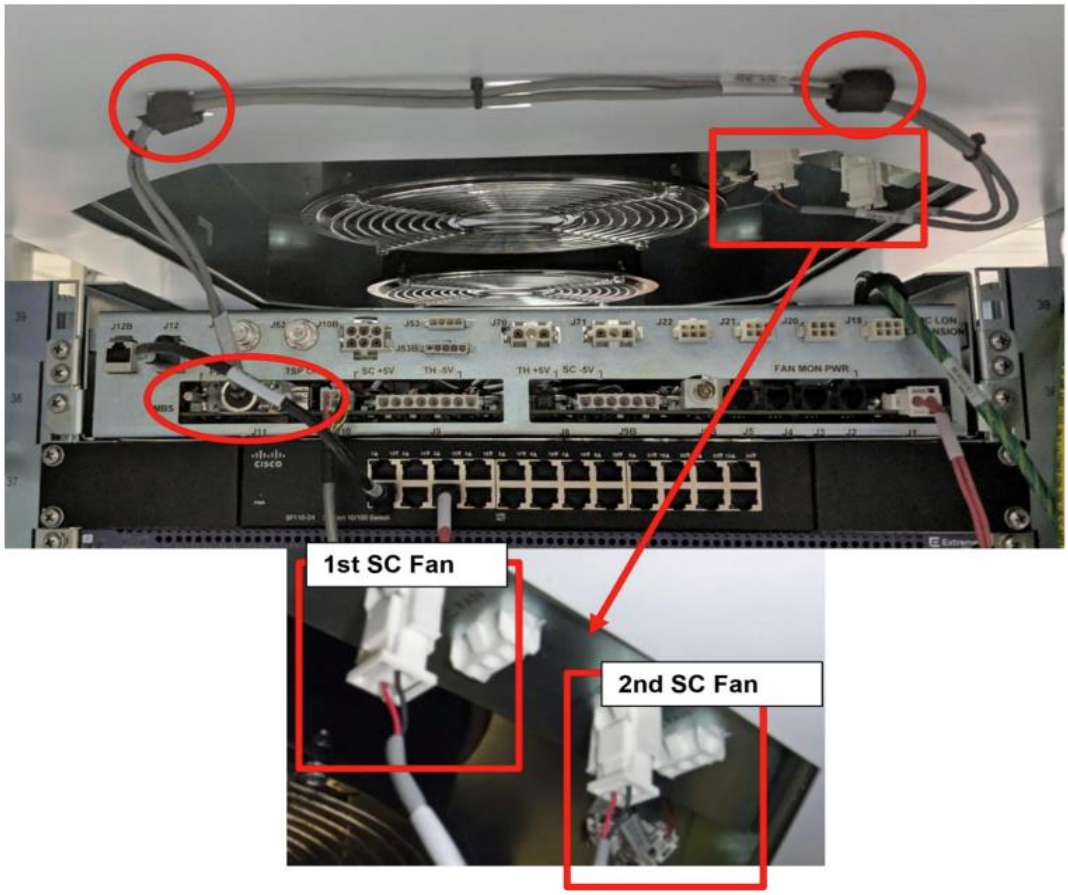

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

3.2 Install a fan power cord (661-951-00) as shown in the figure, connect one end to SMC J70, and connect the two connectors at the other end according to the label:

a. 1st SC FAN is connected to the 1st SC FAN of the fan.

b. 2nd SC FAN is connected to the 2nd SC FAN of the fan.

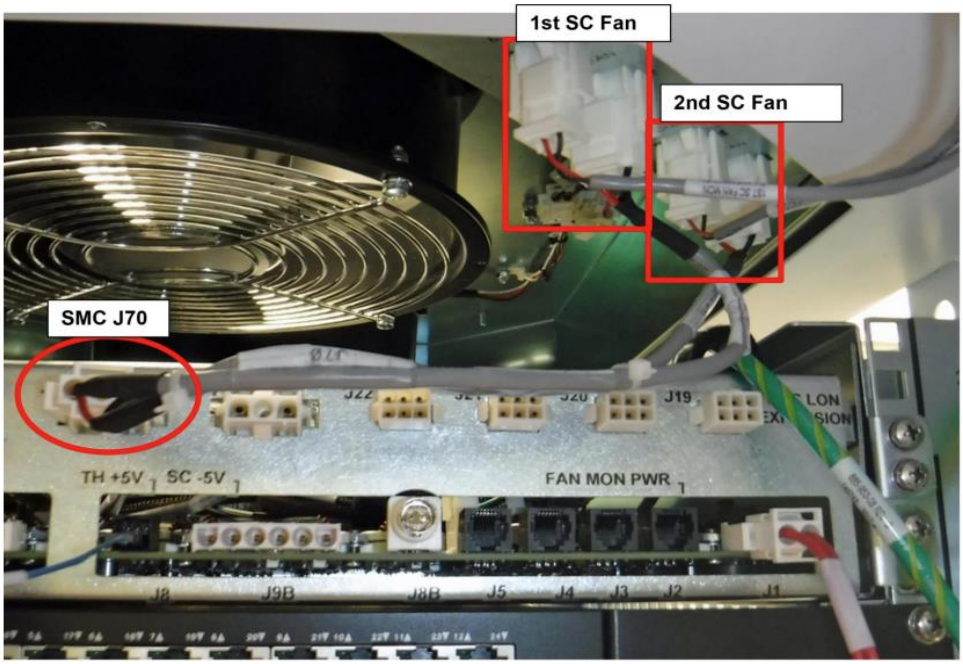

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

3.3 Install one 657-139-00 as shown in the figure, and insert the end marked "SMC-J10" into the SMC J10 port. Run the cable down the left side of the cabinet under the power rack and connect it to the CN1 flat cable of the operator interface panel.

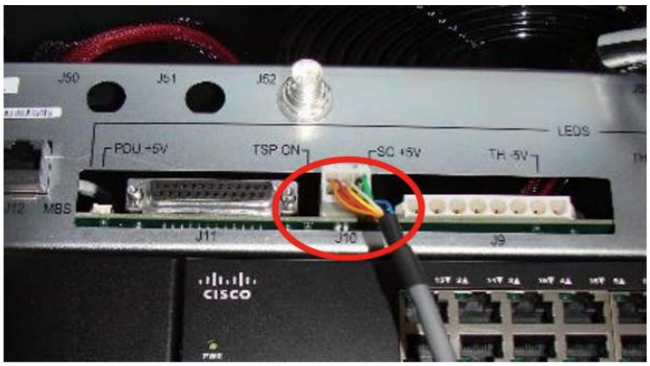


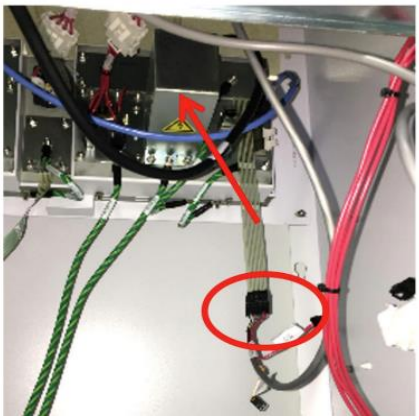

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

4.1 Install 1 operation interface display line (656-981-00) as shown in the figure:

a. Insert the end marked "ADB J71" into ADB J71 (cabinet operation surface).

b. Connect the connector with the line label "POWER_PNL P4" to the flat line "MAIN POWER ON" on the panel.

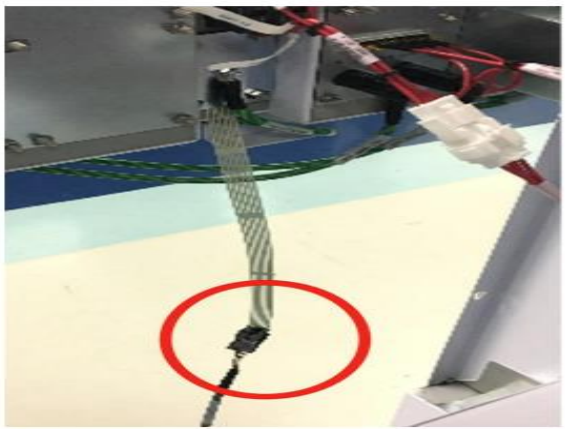

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

4.2 Connect the end of the operation interface display line (656-981-00) marked "SC_OP_INTF_PNL_CN2" to another 657-139-00 line One end marked "SC_OP_INTF_PNL_CN2".

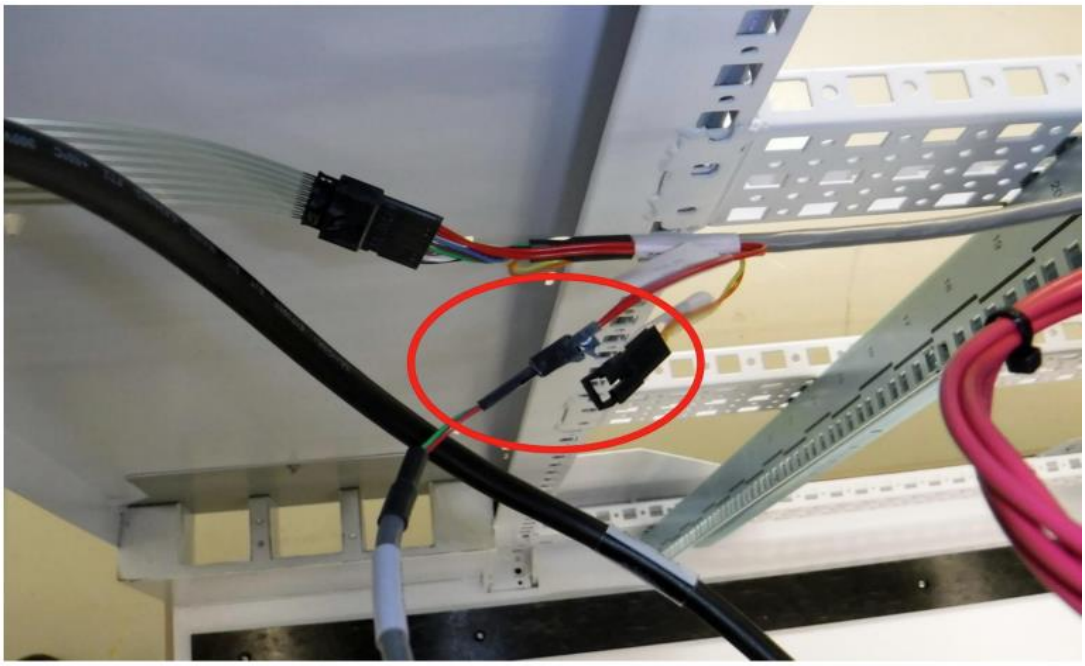

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

5.1 Use the small Velcro strap 813-929-01 to tie the end of the wire to the cabinet according to the label.

a. It is marked SC-CN4 on the left side of the cabinet.

b. Marked SC-CN14 and PNL_CN22 are on the right side of the cabinet.

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

6.1 Take a wire (631-559-00), connect one end to port 15 of the Ethernet switch, and connect the other end to PSU #5.

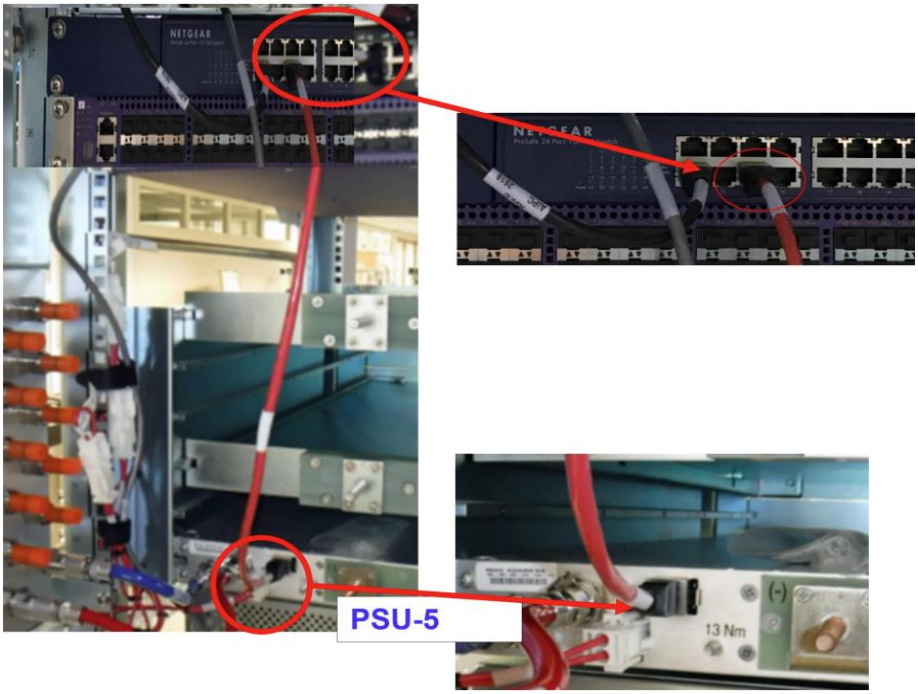

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

7.1 Take a wire (631-561-00), connect one end to the Ethernet switch, and the other end to the SMC.

a. Install the cable, one end is connected to Ethernet switch port 13, and the other end is connected to SMC-J12.

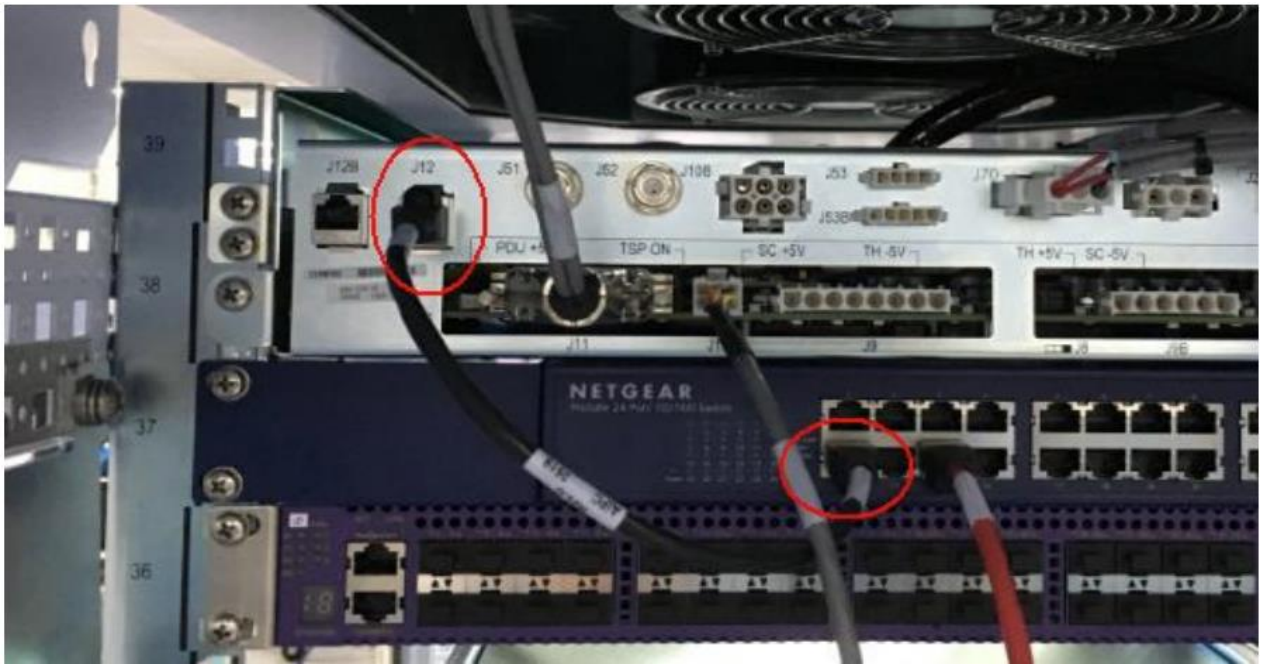

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

8.1 Install 1 panel (650-502-00) and 4 panels (650-499-00) at the opening slot of the operating surface wire, Use 5 M5 screws (472-426-12) to fix, the tool is PH2 Phillips torque screwdriver, the torque value is 3.3 N·m.

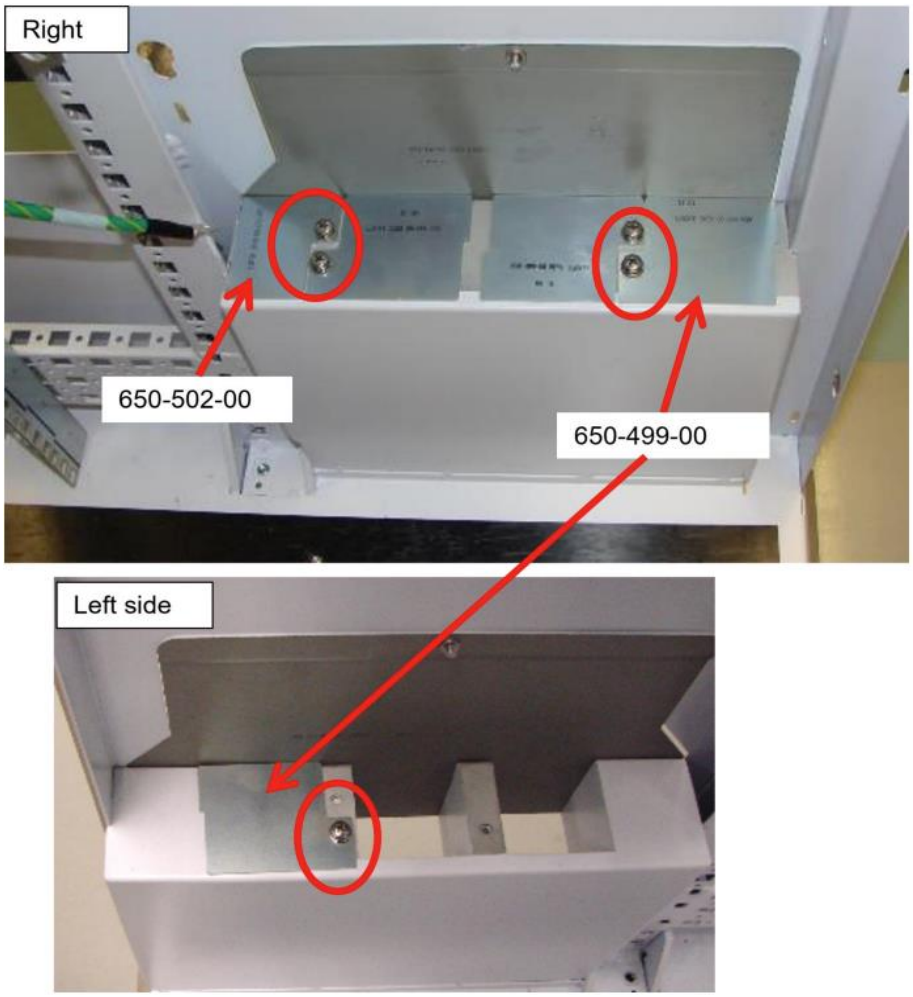

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

Install the Ethernet switch bracket 658-496-00
9.1 Install a set of screws in the third threaded hole from the bottom on the left and right sides of the top of the cabinet:
(Total contains: 2pcs screw 470-933-07 2pcs spring washer 470-502-07 2pcs flat washer 470-501-06)

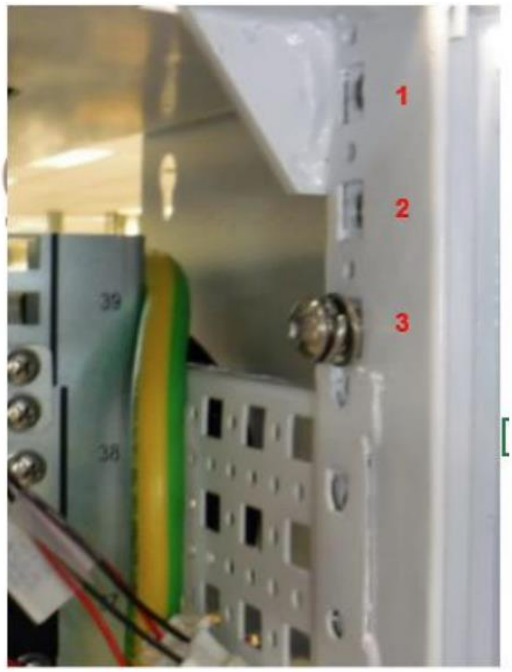

**MAN:** :CERTIFIED OPERATOR, TECHNICIAN

**MATERIAL: N/A**

**MACHINE: N/A**

**METHOD:**

Install the Ethernet switch bracket 658-496-00

9.2 Install the notch of one Ethernet switch bracket 658-496-00 between the cabinet and the washers of the mounting screws. Tilt the panel up.

9.3 Install another set of screws in the second threaded hole from the left and right sides of the top of the cabinet:

(Total contains: 2pcs screw 470-933-07 2pcs spring washer 470-502-07 2pcs flat washer 470-501-06)

9.4 Fix 4 screws (470-933-07),Tool is a 5mm hexagon socket torque screwdriver, The torque value is 13.5 N·m.