Build Overview:

1 **Ethernet Cable Install**
2 **Cable Routing & Connections to CDU**
3 **Cable Holder Install**
4 **PSU Ground Bus Bar Install**
5 **ADB to PSU Sense Cable Install**
6 **Label Install**

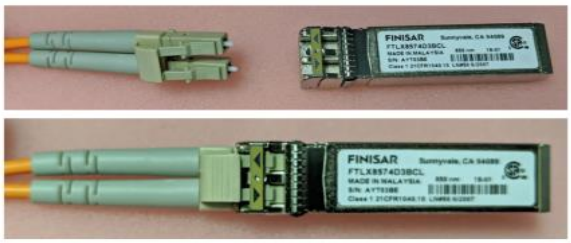

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by
	1	New Issue	JOSEPH AMAD

Prepared By:
JOSEPH R. AMAD
Manufacturing Engineer

Checked By:
IVAN NOWELL PANIQUE
Team Lead

Approved By:
SHERWIN ARIOSTE
Operations Manager

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM NO.	PART NUMBER	DESCRIPTION	QTY.
1	651-219-12	CABLE SOCK UF2 12-SLOT EMI CBL CVR BLACK	2
2	651-816-04	CABLE UF2 12SLOT SB25 SMCPWR INPUT TELECOM WITH CONN	1
3	655-540-03	CABLE UF2_SC_TH_EMO_LED_INTLK_A SM CONN TELECOM WITH	1
4	657-472-03	CABLE UF2 SC TH SMCLON_PRESS_DISCON_THA TELECOM WITH	1
5	651-111-02	CABLE UF2 12SLT LCL ENET TH TO SC TELECOM WITH CONN	1
6	655-233-01	CABLE UF2 12 SLOT LCL EXTERNAL CONTROL TELECOM WITH CONN	1
7	660-546-00	PLASTIC TUBE 6MM ODX1MMX 12MT BLACK HOSE PIPE OR TUBE	1
8	813-929-00	HDW VELCRO STRP 5/8	50
9	655-181-03	CABLE UF2 SUPP BRD FO LONG W TAB OPTICAL FIBER	2
10	655-185-03	CABLE UF2 INST FO TH TO SC W TAB OPTICAL FIBER	12
11	663-760-00	PLASTIC, DRAGON 12 SLOT FIBER OPTIC LABEL INFORMATION (TH	1
12	634-324-04	PLASTIC, UF2 SPLITLOOM TH TO SC .75, HOSE, PIPE OR TUBE	1
13	710-048-10	TRANCEIVERS PIN SFP+ MULTI 10GBS HOT PLUG DUPLEX CN	1
14	650-824-00	CABLE TH SUPPLY 48V WITHOUT CONN	1
15	650-825-00	CABLE TH RETURN 48V WITHOUT CONN	1
16	651-109-04	CABLE T/H 12SLT GROUND WIRE TELECOM WITH CONN	1
17	651-112-03	CABLE, UF2 12SLOT GND SC TO TH TERMBLK, TELECOM, WITH CONN	1
18	603-096-01	NUT HEX SS M8X1.25 WSHR W/TTH 13MM WDH	1
19	813-929-01	HDW VELCRO STRP 5/8	7
20	603-096-00	NUT HEX SS M5X0.8 W/WSHR W/TTH 8MM WDH	3
21	603-093-45	STANDOFF 10MM HEX M-F M5X.8X20MML SS	1

MACHINE:

NO.	PART # / ID	DESCRIPTION	IMAGE
1	N/A	PH2 Phillips Torque Screwdriver 3.3 N.m	N/A
2	N/A	8mm socket wrench 3.3 N.m	N/A
3	N/A	14 mm Socket Wrench 13.5 N.m	N/A
4	N/A	5mm hex bit 13.5 N.m	N/A

METHOD:

Flow chart of operation steps

BPM preparation	See (1. Scope of application)
Preparation Tools	See (2. Tools/Materials/Parameters---1. Tools)
Prepare Materials	See (2. Tools/Materials/Parameters---2. Materials)
Complete Operation	See (3. Operation Steps)
Inventory	See (2. Tools/Materials/Parameters---2. Materials)
Operation Check	See (4. Matters needing attention)
Inventory collection tools	See (2. Tools/Materials/Parameters---1. Tools)

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

3. Operation steps

1.1 Take two optical fiber cables (650-403-00), and mark the two cables with a marker:

The first one is marked "SC COMP INTFPNL P1" and the other end is marked "TH ESW PORT 1"

The second one is marked "SC COMP INTFPNL P2" and the other end is marked "TH ESW PORT 2"

1.2 Unplug the protective cap of the optical fiber cable (650-403-00), and insert the optical fiber cable into the control panel according to the following corresponding relationship:

a. Connect P1 marked SC COMP INTFPNL to the P1 interface on the panel;

b. Connect P2 marked SC COMP INTFPNL to the P2 interface on the panel;

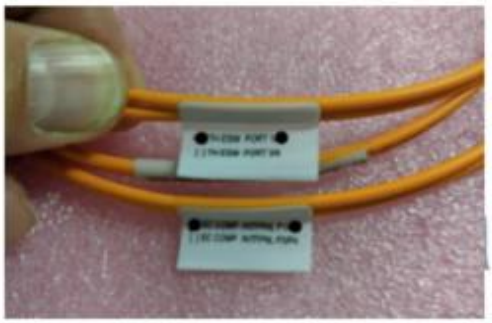

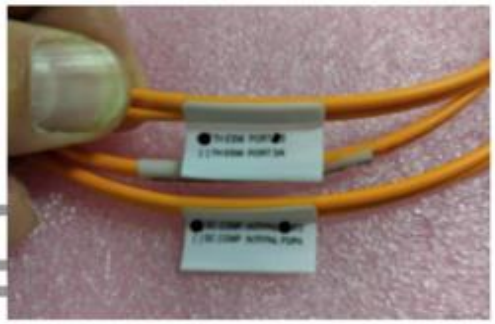

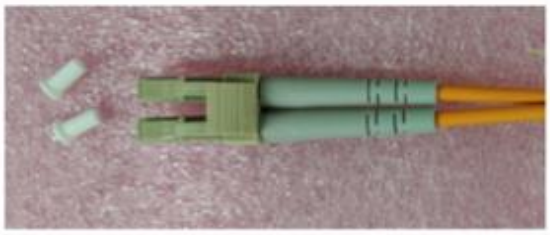

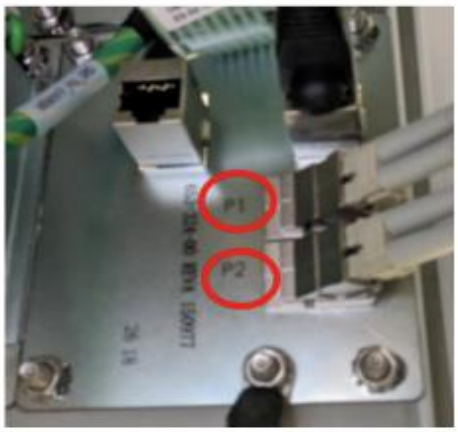

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

1.3 Wind up the optical fiber cable from the left side of the protection panel of the power supply rack to the left side of the Ethernet switch in the direction shown in the figure.

Note: The optical fiber cable does not need to be tied under the protection panel of the power rack, and can be wound to the left side of the switch.

The optical fiber cable is easy to be damaged. Do not bend, twist or squeeze the optical fiber cable.

1.4 Take two 10G transceivers 710-048-10, unplug the protective cover on the other end of the two optical fiber cables, plug them into the transceiver, and hear a "click".

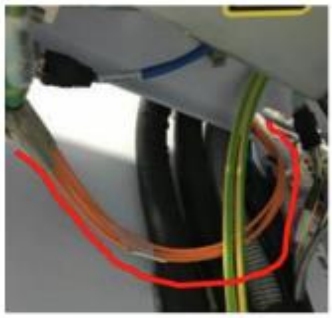

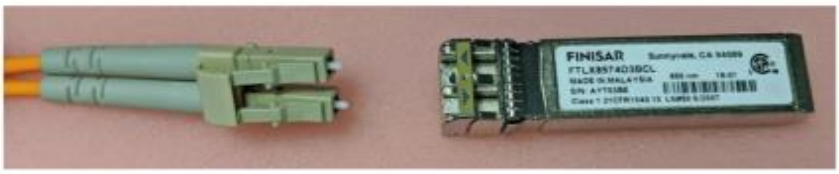

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

1.5 As shown in the figure, insert the end of the optical fiber cable with the transceiver marked "TH ESW PORT 1" into the switch port 1; Insert the end of the optical fiber cable with the transceiver marked "TH ESW PORT 2" into the switch port 2.

Excess optical fiber cables can be formed into an arch shape next to the switch, and they can be tied with a cable tie below!

Note: The optical fiber cable is easy to be damaged. Do not bend, twist or squeeze the optical fiber cable when binding.

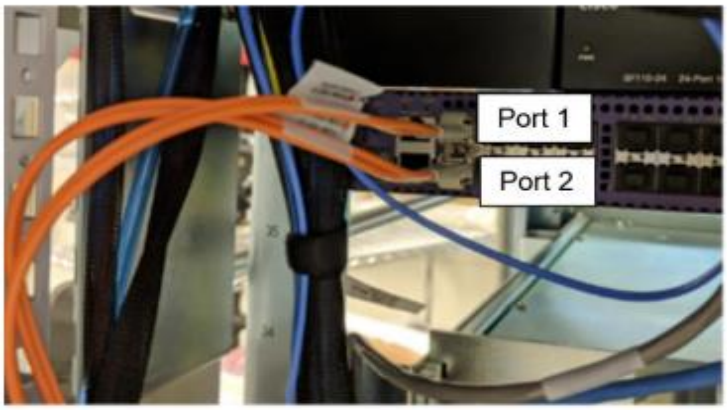

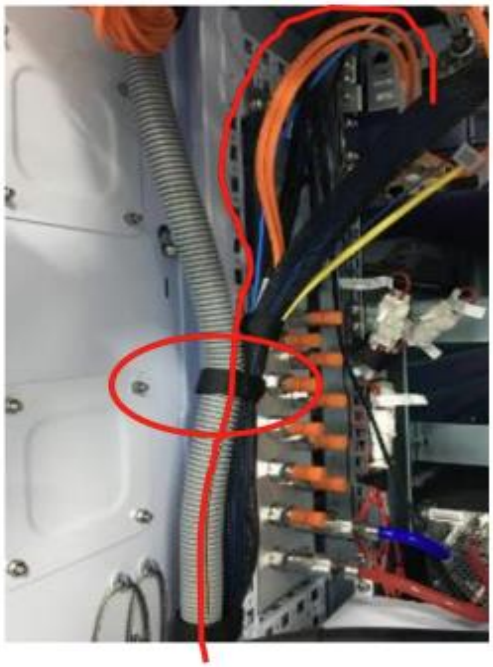

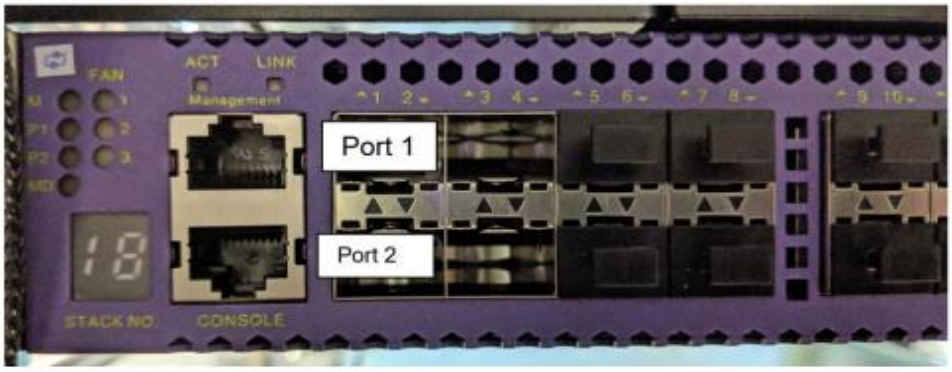

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: **N/A**

MACHINE: **N/A**

METHOD:

Install the AC protective cover
2.1 Use two M5 screws (472-426-12) to fix the AC protective cover 661-429-00
o the right rail of the cabinet as shown in the figure.
The tool is a PH2 Phillips torque screwdriver with a torque value of 3.3 N·m.

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: **N/A**

MACHINE: **N/A**

METHOD:

Install the power supply rack shield

3.1 Take a power supply rack protective cover 660-698-00 and place it on the workbench as shown in the figure, with the bracket and the curved surface facing up,

Install two 835-441-00 flat cable clamps under the protective cover. Remove the protective tape and attach it.

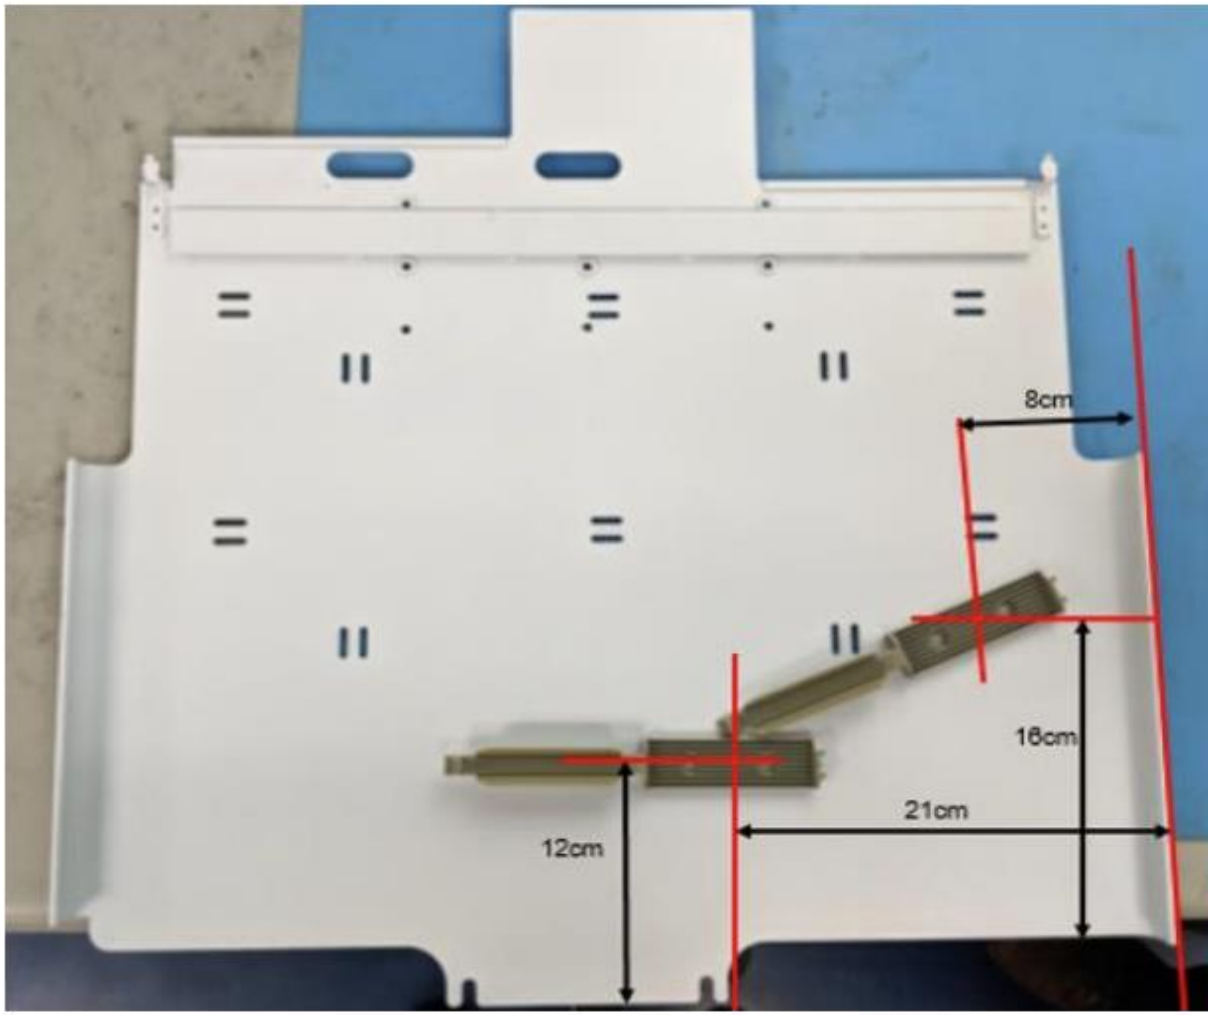

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

3.2 Remove the two nuts and washers on the top center of the operation panel.
Insert the buckle of the power supply rack shield 660-698-00 to the position of the retma rail 27M, and lay it flat.

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: **N/A**

MACHINE: **N/A**

METHOD:

3.3 Use 2 M5 screws 472-426-12 to fix the protective cover to the 27U position of the cabinet rail,
The tool is a PH2 Phillips torque screwdriver with a torque value of 3.3 N·m
3.4 Re-lock and fix the two nuts and washers on the top center of the operation panel that were previously removed as shown in the figure
The tool is an 8mm socket wrench with a torque value of 3.3 N·m

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

4.1 Remove the M8 nut, flat washer and spring washer from the (-) terminal of the blank PSU3.
The removal tool is a 14mm socket wrench.
4.2 Install a piece of BUSBAR 655-277-00 on the (-) terminal of PSU5 and blank PSU3,
re-lock the M8 nut, flat washer and spring washer on the (-) terminal of PSU3,
The tool is a 14mm socket wrench with a torque value of 13.5 N·m

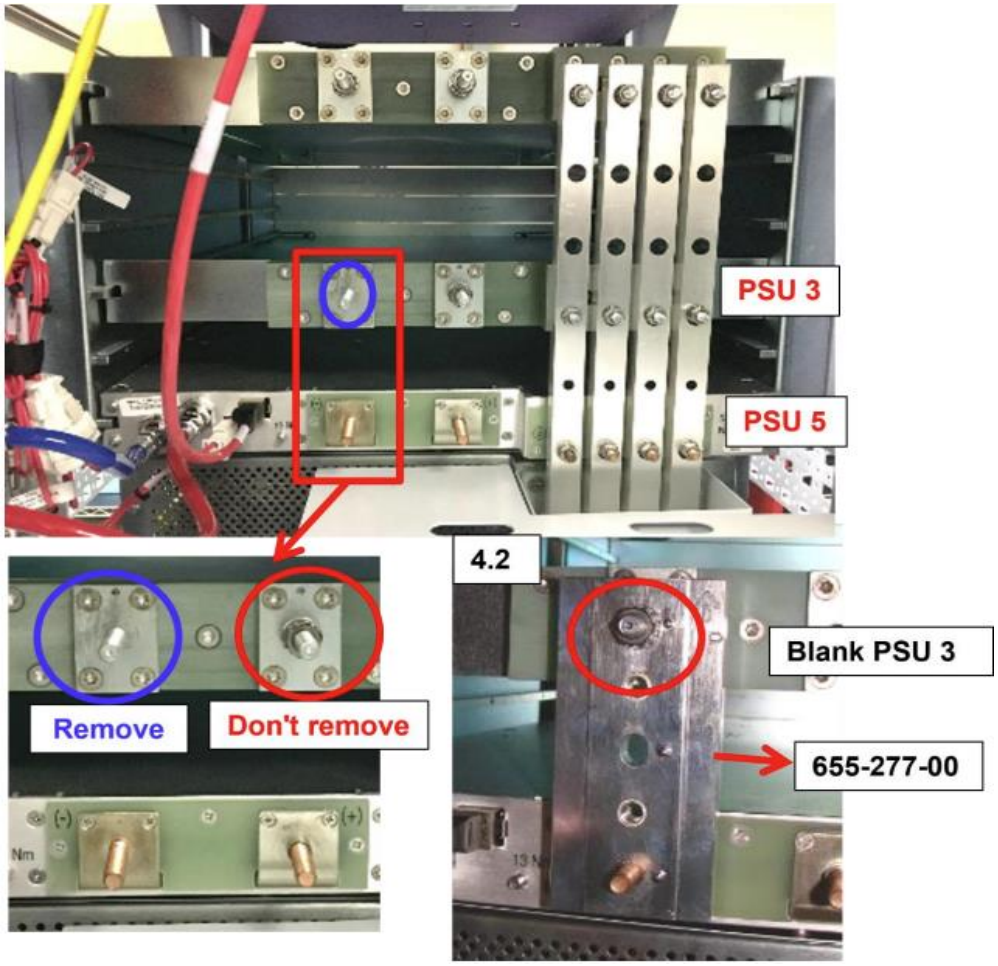

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: **N/A**

MACHINE: **N/A**

METHOD:

4.3 Route the other end "48 VDC GND" of the ground wire 658-444-00 previously connected to G21 from under the protective cover and out of the hole near BUSBAR.

4.4 Use 1 M8 screw 470-958-05 to lock the ground wire into a screw hole on the BUSBAR 655-277-00,
The tool is a 5mm hexagon socket head with a torque value of 13.5 N·m

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

4.5 Take a 48V THA wire 662-402-00, insert one end into ADB J73, and pass the wire through the slot on the AC shield.

4.6 Use one M8 screw 470-958-05 to lock the black end "PSU5 +48vdc RTN" of line 662-402-00 under BUSBAR 655-277-00 In a screw hole, the tool is a 5mm hex bit with a torque value of 13.5 N·m

Note: In this step, the black end "PSU4 +48vdc" of line 662-402-00 should be left blank for the time being, it will be used later!

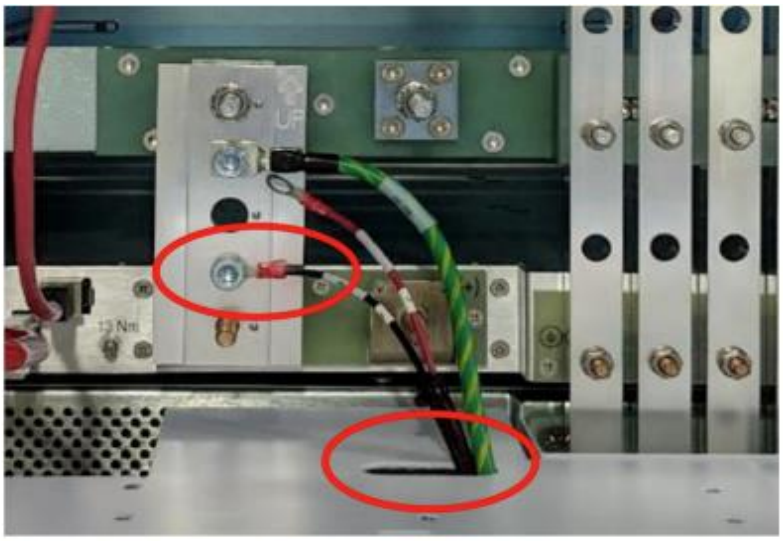

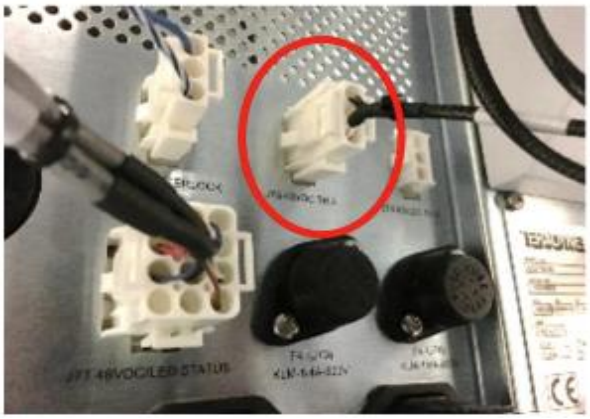

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

4.7 Fix the wire fixing bracket 660-699-10 to the AC protective cover with 4 M5 screws 472-426-12,
The tool is a PH2 Phillips torque screwdriver with a torque value of 3.3 N·m

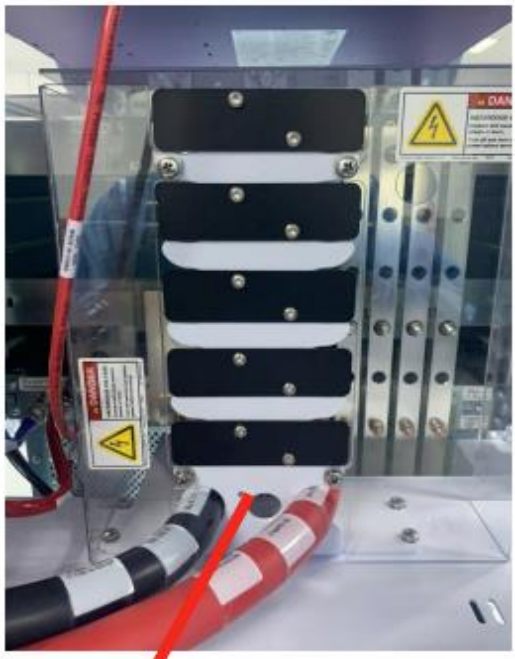

note:
1) Bracket 660-699-10 direction-black panel facing outside
2) The center screw behind the bracket is no longer used

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: **N/A**

MACHINE: **N/A**

METHOD:

Install Support Cabinet network cable 631-556-01
5.1 Take a network cable 631-556-01, and plug the end marked "SC 10/100 ENET SWITCH" into port 24 of the switch.
Pass the network cable from the right side of the cabinet, next to the AC protective cover,
and then plug it in the box marked "SC COMP INTFPNL P3"
The "Enet from Computer" port of the control panel.

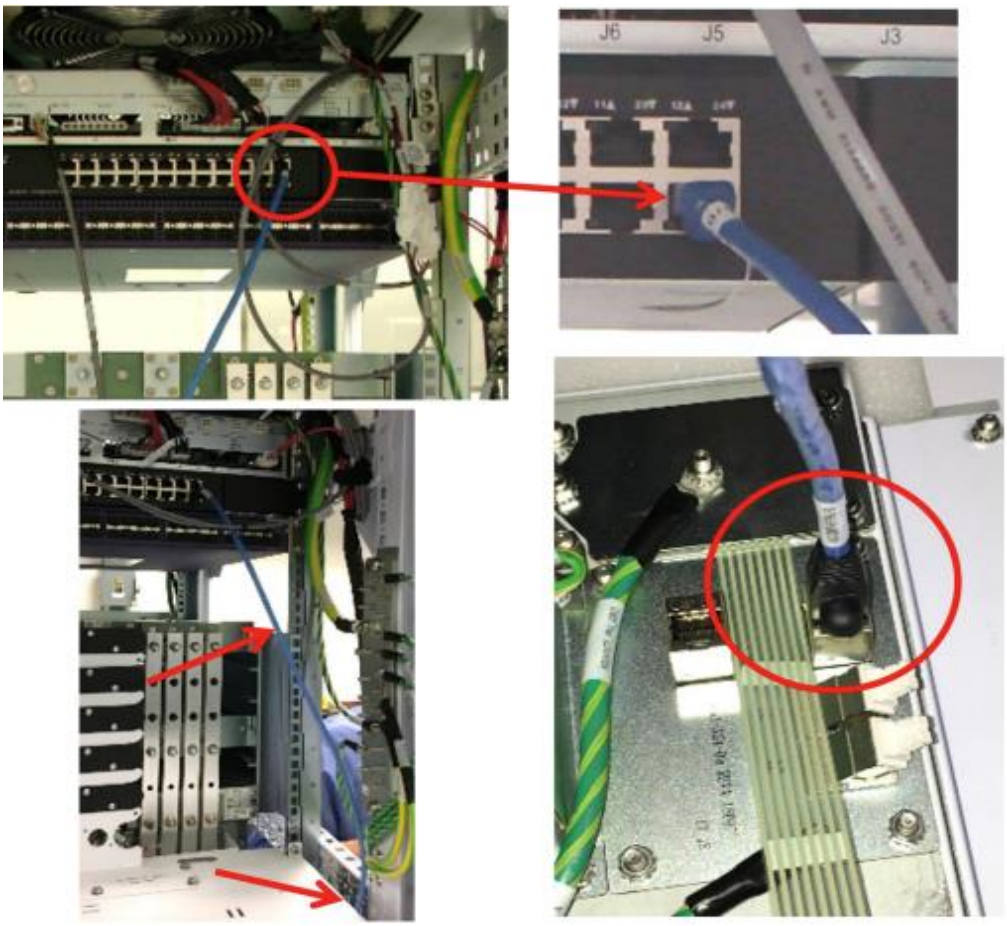

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: **N/A**

MACHINE: **N/A**

METHOD:

Install Support Cabinet network cable 631-560-00
5.2 Take a network cable 631-560-00, and plug the end marked "SC 10/100 ENET SWITCH" into port 23 of the switch
Pass the network cable through the right side of the cabinet next to the AC protective cover,
and then plug the other end into the CDU-J5 port.

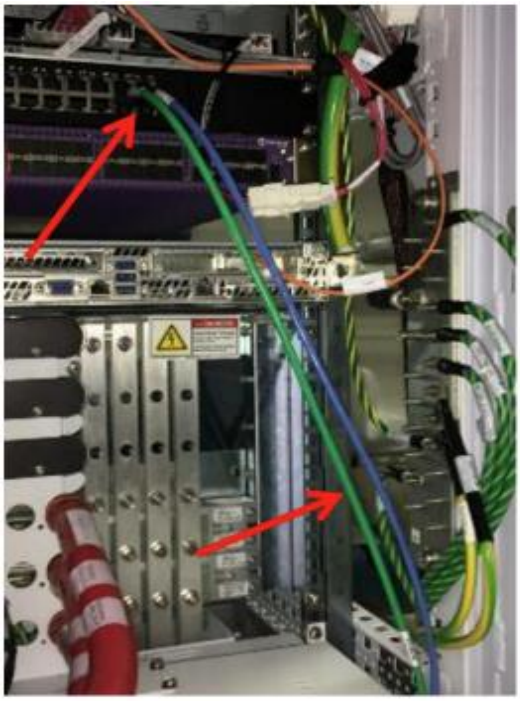

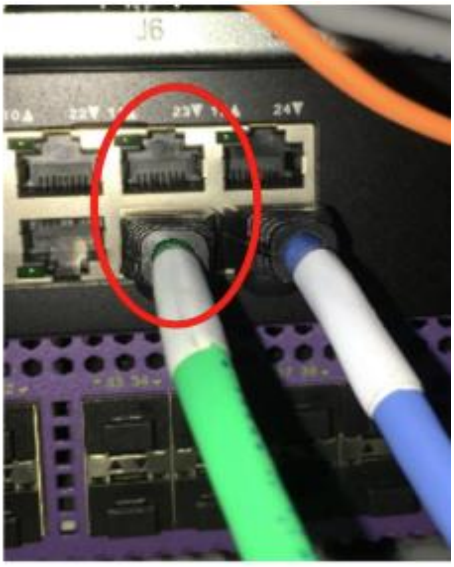

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

Post a label

6.1 Label 638-517-05 and 638-517-07 on the corresponding two positions as shown in the figure.

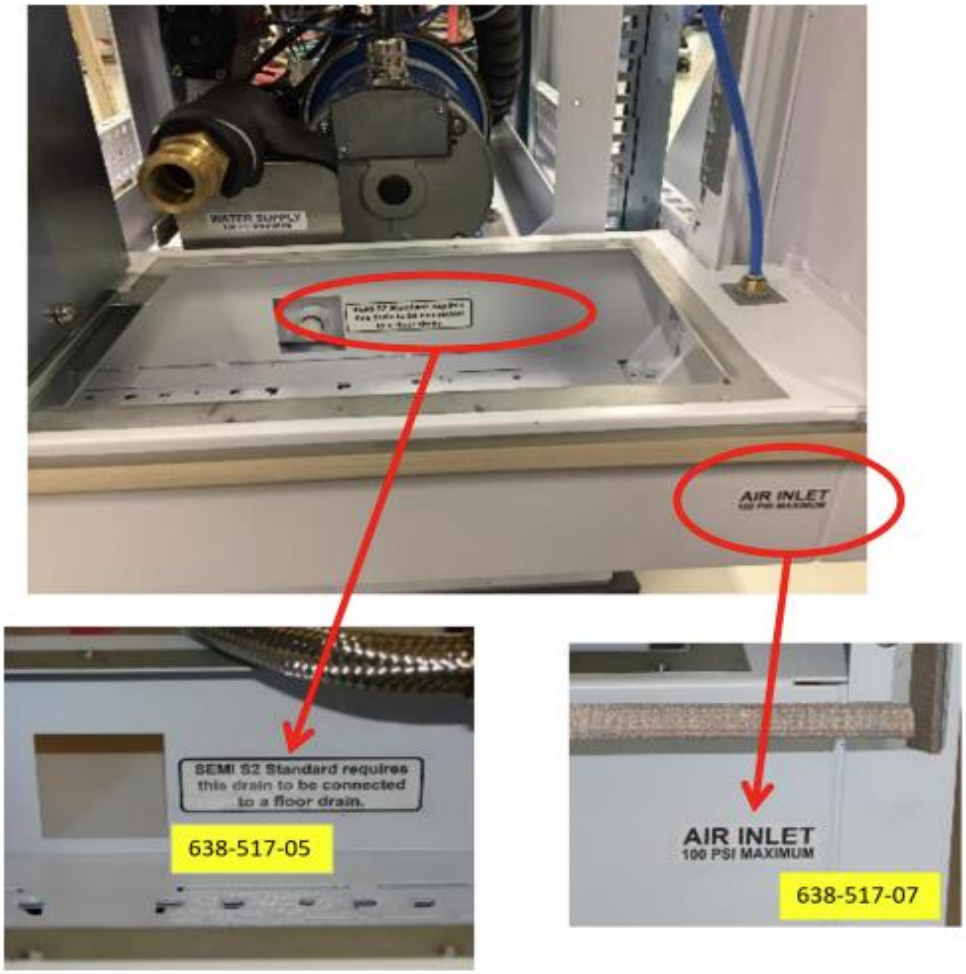

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: **N/A**

MACHINE: **N/A**

METHOD:

6.2 Install a "Line Voltage Present" label (479-133-22) on the main circuit breaker panel as shown in the figure.
Put the top of the label
Keep flush with the top of the circuit breaker and stick to the center of the panel.

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

6.3 Stick 3 grounding labels (479-133-15) on the corresponding positions as shown in the figure.

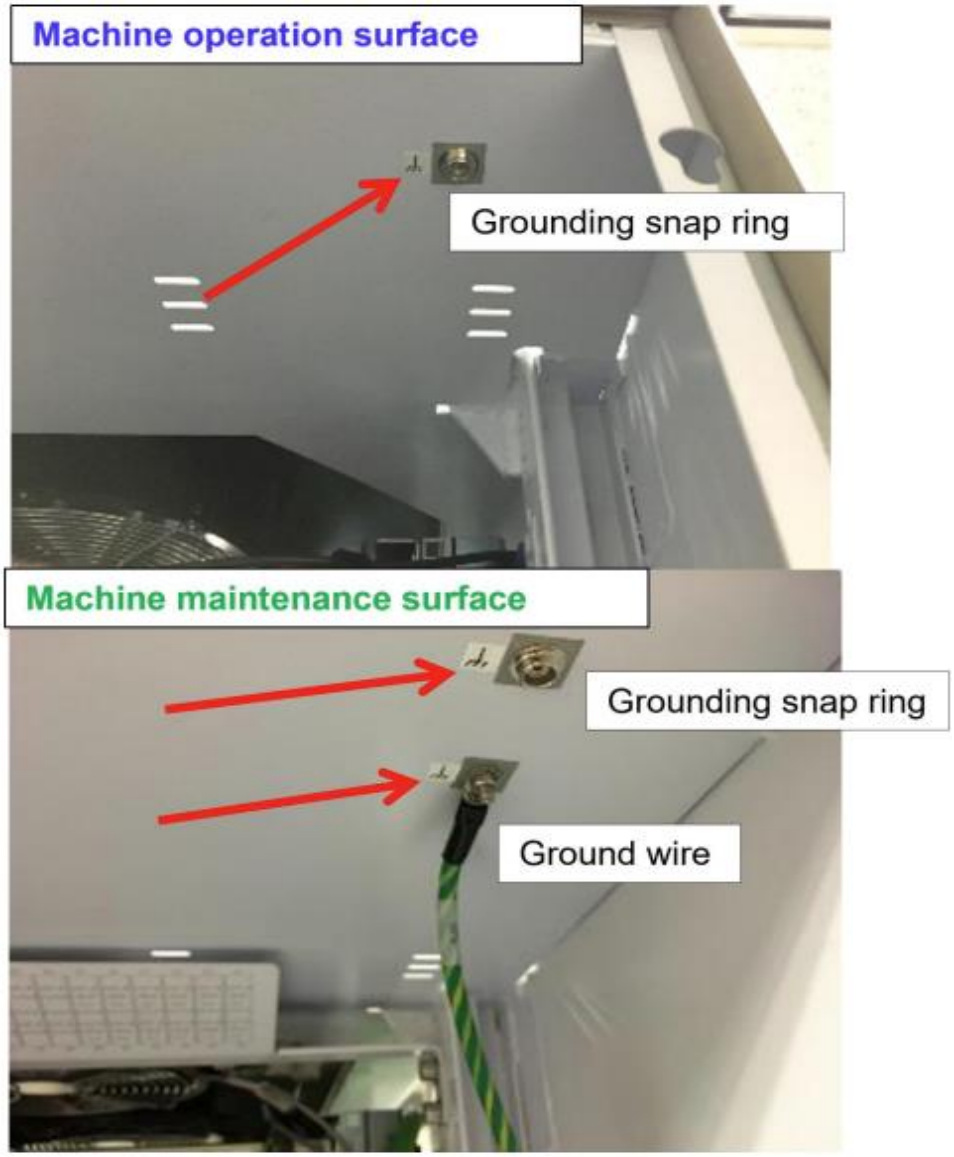

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:
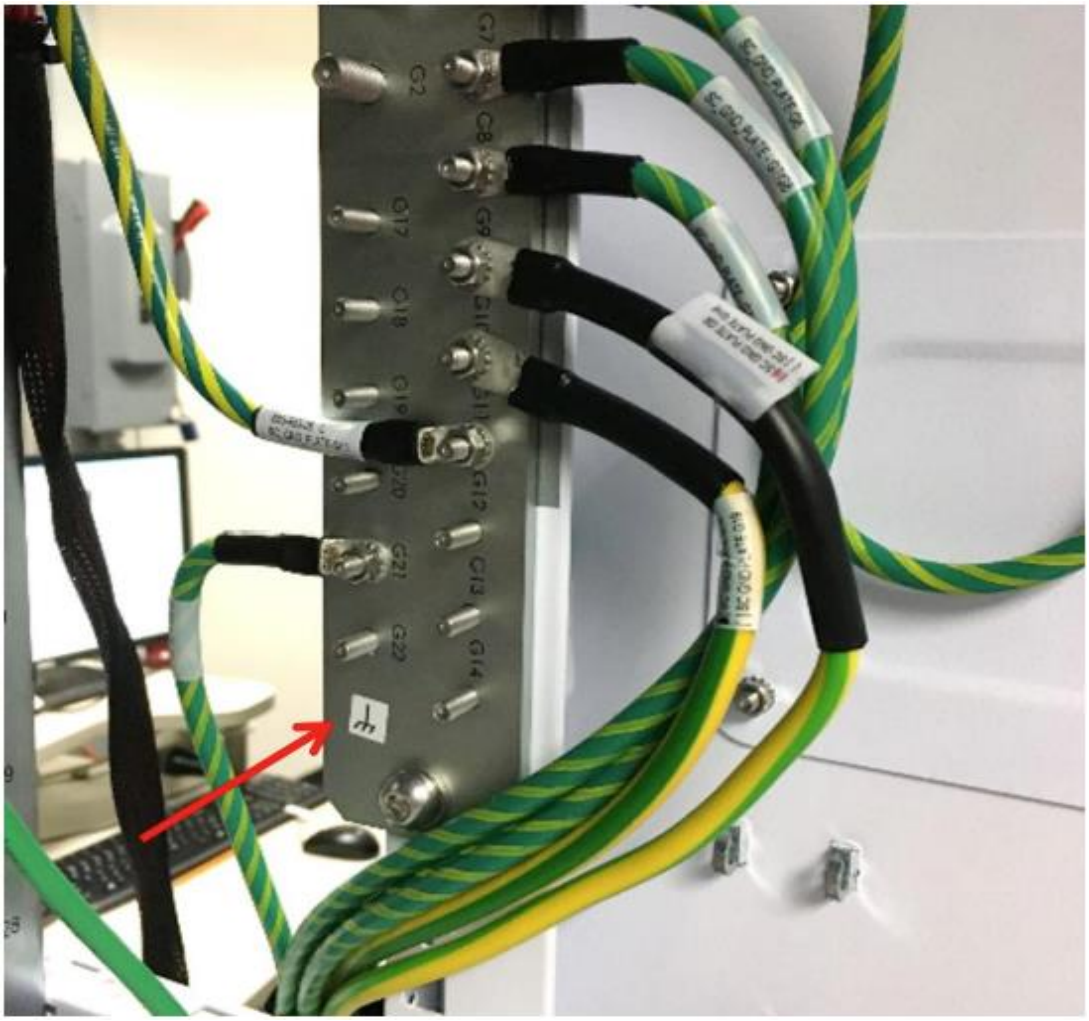
6.4 Place a grounding label (479-133-15) on the bottom of the grounding bar as shown in the figure.