Build Overview:

1 **Ground Wires Install**
2 **ADB Install**

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by
	1	New Issue	JOSEPH AMAD

Prepared By:
JOSEPH R. AMAD
Manufacturing Engineer

Checked By:
IVAN NOWELL PANIQUE
Team Lead

Approved By:
SHERWIN ARIOSTE
Operations Manager

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	633-799-00	ELEC-MECH, UF2 24SLOT SUPPORT CABINET INTEGRATION	1

MACHINE: N/A

METHOD: 1. Scope of application

This BPM is suitable for UF Plus Support Cabinet Assembly
Applicable Support Cabinet Model 633-799-00
The sub-part model in Support Cabinet are 629-502-01 ADB CHASIS SUB ASSY, 653-315-00 CDBU SUB ASSY and 630-945-10 GEMINI SMC TRAY

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	633-276-00	CABLE, ADB MAIN GROUND, W/ CONN	1
2	614-766-90	NUT, HEX, SS M8X1.25, WSHR W/TTH, 13MM WDH	1
3	470-933-01	HDW VELCRO STRP 5/8" #88HK 4"	1
4	470-501-06	CABLE 48VDC(-) TO GROUND W/ CONN	1
5	470-502-07	NUT, HEX, SS M8X1.25, WSHR W/TTH, 13MM WDH	13
6	632-132-00	CABLE , GROUND CABLE CDU, W/ CONN	1
7	603-096-00	CABLE GROUND CABLE SUPPORT CABINET W/ CONN	1
8	938-172-01	CABLE GROUND CABLE INTF PANEL W/ CONN	2
9	631-823-00	CABLE GROUND CABLE 48VDC, W/ CONN	3
10	472-426-12	HDW VELCRO STRP 5/8" #88HK 4"	3
11	653-315-00	ELEC-MECH, ADB CHASSIS SUB ASSY, FOR SEMI TEST	1
12	630-945-10	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L	17
13	472-426-20	FORGED OR STAMPED STEEL FACTORY MAINS GUTTER BASE	1
14	666-796-00	GROMMET, CATERPILLAR, 14.1 INCH	2
15	479-133-23	FORGED OR STAMPED STEEL FACTORY MAINS GUTTER	1

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	13mm Socket Head	13.5 N.m
2	8mm Socket Head	3.3 N.m
3	Lifting Trolley	N/A
4	PH2 Bit	3.3 N.m

METHOD:

Flow chart of operation steps

BPM preparation	See (1. Scope of application)
↓	
Preparation Tools	See (2. Tools/Materials/Parameters---1. Tools)
↓	
Prepare Materials	See (2. Tools/Materials/Parameters---2. Materials)
↓	
Complete Operation	See (3. Operation Steps)
↓	
Inventory	See (2. Tools/Materials/Parameters---2. Materials)
↓	
Operation Check	See (4. Matters needing attention)
↓	
Inventory collection tools	See (2. Tools/Materials/Parameters---1. Tools)
↓	
Inventory collections tools	See (2. Tools/Materials/Parameters---1. Tools)

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	634-677-00	CABLE, ADB MAIN GROUND, W/ CONN	1
2	603-096-01	NUT, HEX, SS M8X1.25, WSHR W/TTH, 13MM WDH	1
3	813-929-01	HDW VELCRO STRP 5/8" #88K 4"	1

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	13mm Socket Head	13.5 N.m

METHOD:

1.1 Install the ground wire according to the following instructions-confirm the "to" and "from" labels on the wire.

Part Number	"From" position	"To" position
634-677-00	Mecca panel G1 position	Place it behind the cabinet, ready to be connected.

Use one M8 hexagon nut (603-096-01) to fix, the tool is a 13mm socket wrench to fix, the torque value is 13.5 N·m.

Use a cable tie (813-929-01) to tie the cable to the rack rail as shown in the figure

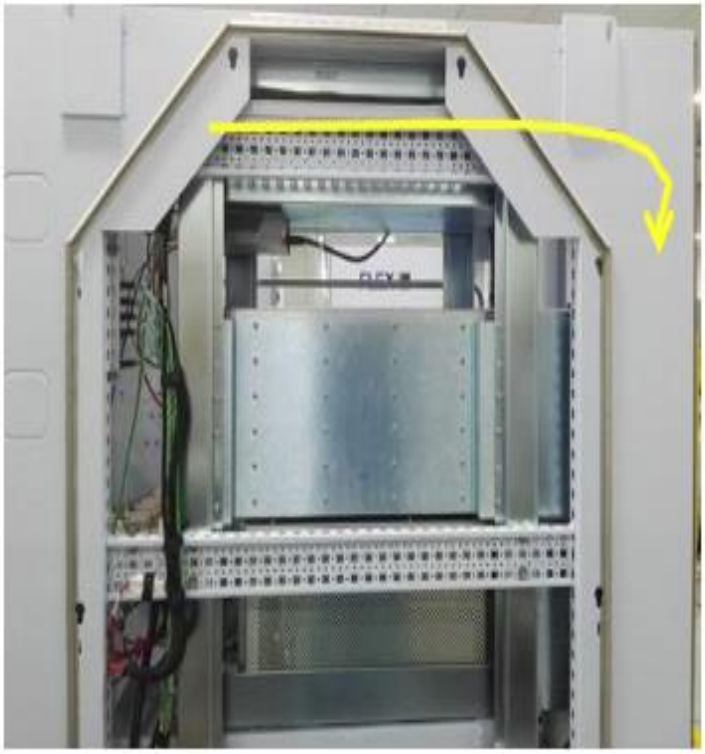

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	634-677-00	CABLE, ADB MAIN GROUND, W/ CONN	1
2	603-096-01	NUT, HEX, SS M8X1.25, WSHR W/TTH, 13MM WDH	1

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	13mm Socket Head	13.5 N.m

METHOD:

Part Number	"From" position	"To" position
634-678-00	Mecca panel G5 position	To be connected to the 48V Busbar, all ground wires are on the side of the rail as shown in the figure.

Use one M5 hexagon nut (603-096-00) to fix, the tool is 8mm socket wrench to fix, the torque value is 3.3 N·m.

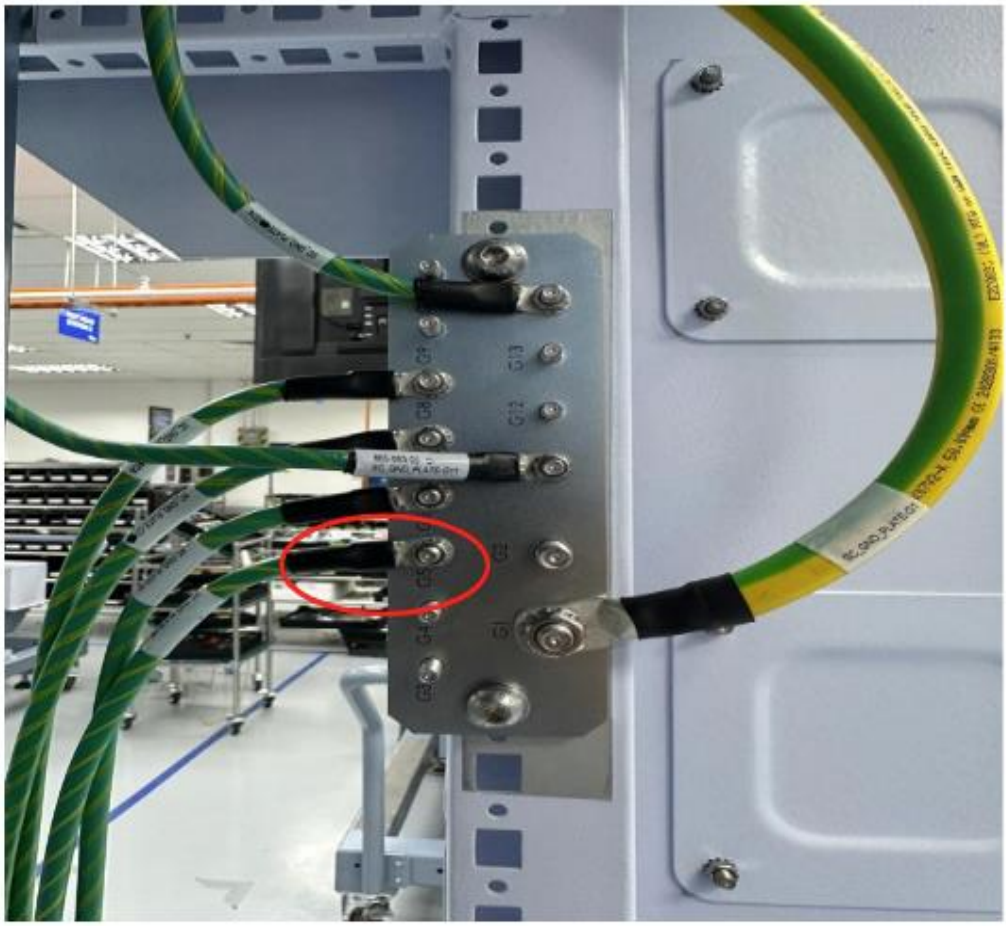

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	634-437-00	CABLE, GROUND CABLE CDU, W/ CONN	1
2	603-096-00	NUT, HEX, SS M8X1.25, WSHR W/TTH, 13MM WDH	1

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	8mm Socket Head	3.3 N.m

METHOD:

Part Number	"From" position	"To" position
634-437-00	Mecca panel G6 position	To be connected to the CDU ground, all ground wires are on the side of the rail as shown in the figure.

Use one M5 hexagon nut (603-096-00) to fix, the tool is 8mm socket wrench to fix, the torque value is 3.3 N·m.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	634-437-02	CABLE, GROUND CABLE SUPPORT CABINET, W/ CONN	1
2	603-096-00	NUT, HEX, SS M8X1.25, WSHR W/TTH, 13MM WDH	1

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	8mm Socket Head	3.3 N.m

METHOD:

Part Number	"From" position	"To" position
634-437-02	Mecca panel G14 position	Connect it to the top of the operation surface of the cabinet near the grounding position of the ESD button.

Use one M5 hex nut (603-096-00) to fix the position of the panel where the wire is located, and use one M5 hex nut (603-096-00) on the other end
Fix the grounding position on the top of the cabinet with an 8mm socket wrench with a torque value of 3.3 N·m.

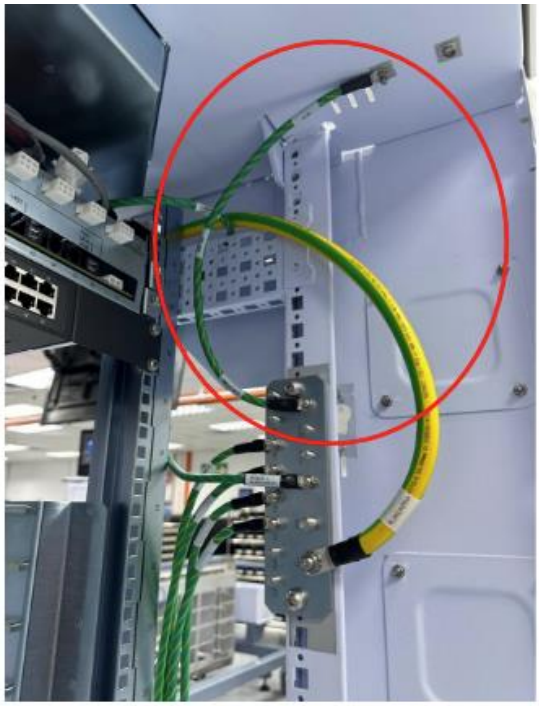

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	634-437-01	CABLE GROUND CABLE INTF PANEL W/ CONN	1
2	603-096-00	NUT, HEX, SS M8X1.25, WSHR W/TTH, 13MM WDH	1

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	8mm Socket Head	3.3 N.m

METHOD:

Part Number	"From" position	"To" position
634-437-01	Mecca panel G7 position	Connect to the AC power board position in the Interface area of the cabinet operation surface.

1.1 Install the ground wire according to the following instructions-confirm the "to" and "from" labels on the wire

Use one M5 hex nut (603-096-00) to fix the position of the panel where the wire is located, and use one M5 hex nut (603-096-00) on the other end It is fixed on the AC power board, and the tool is fixed by an 8mm socket wrench, and the torque value is 3.3 N·m.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	634-437-01	CABLE GROUND CABLE INTF PANEL W/ CONN	1
2	603-096-00	NUT, HEX, SS M8X1.25, WSHR W/TTH, 13MM WDH	2

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	8mm Socket Head	3.3 N.m

METHOD:

Part Number	"From" position	"To" position
634-437-01	Mecca panel G8 position	Connect it to the EMO panel outside the Interface area of the cabinet operation surface.

Use one M5 hex nut (603-096-00) to fix the position of the panel where the wire is located, and use one M5 hex nut (603-096-00) on the other end It is fixed on the external EMO panel, the tool is fixed by an 8mm socket wrench, and the torque value is 3.3 N·m.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	634-437-03	CABLE, GROUND CABLE 48VDC, W/ CONN	1
2	603-096-00	NUT, HEX, SS M8X1.25, WSHR W/TTH, 13MM WDH	2

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	8mm Socket Head	3.3 N.m

METHOD:

Part Number	"From" position	"To" position
634-437-03	Cabinet operating surface power sheet	Connect to the frame position of the Interface area of the cabinet operation surface.

Use one M5 hex nut (603-096-00) to fix the position of the power supply plate on the operation surface of the cabinet, and use one M5 hex nut (603-096-00) (603-096-00) on the other end

It is fixed at the frame position of the Interface area of the cabinet operation surface. The tool is fixed by an 8mm socket wrench and the torque value is 3.3 N·m.

Note : Make sure the INTF_Panel Side goes to panel and the SC_GND goes to the support cabinet end.

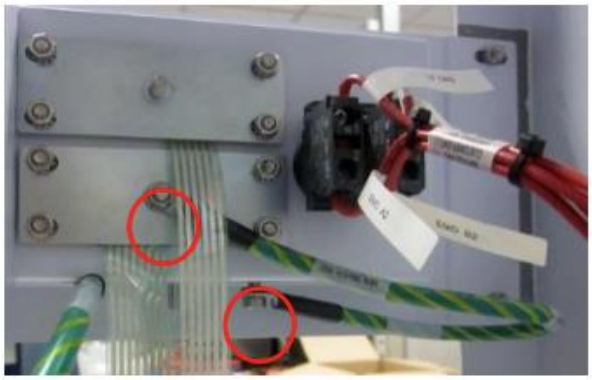

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	634-437-03	CABLE, GROUND CABLE 48VDC, W/ CONN	1
2	603-096-00	NUT, HEX, SS M8X1.25, WSHR W/TTH, 13MM WDH	2

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	8mm Socket Head	3.3 N.m

METHOD:

Part Number	"From" position	"To" position
634-437-03	Cabinet operating surface power sheet	Connect to the frame position of the Interface area of the cabinet operation surface.

Use one M5 hex nut (603-096-00) to fix the position of the power supply plate on the operation surface of the cabinet, and use one M5 hex nut (603-096-00) on the other end.

It is fixed at the frame position of the Interface area of the cabinet operation surface. The tool is fixed by an 8mm socket wrench and the torque value is 3.3 N·m.

Note : Make sure the INTF_Panel Side goes to panel and the SC_GND goes to the support cabinet end.

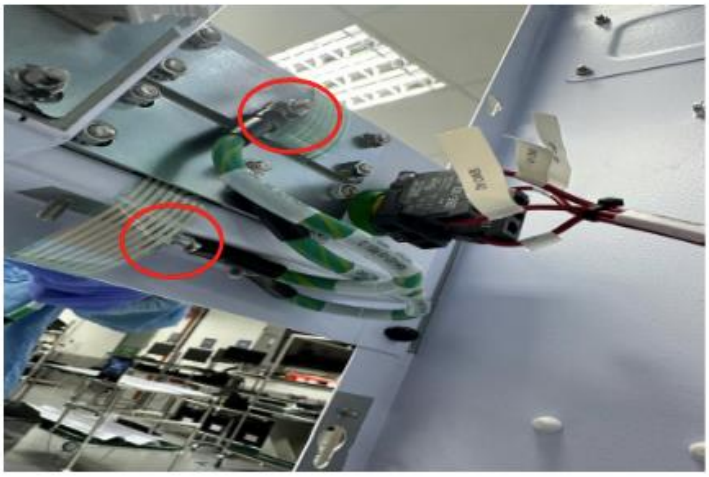

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	634-437-03	CABLE, GROUND CABLE 48VDC, W/ CONN	1
2	603-096-00	NUT, HEX, SS M8X1.25, WSHR W/TTH, 13MM WDH	2

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	8mm Socket Head	3.3 N.m

METHOD:

Part Number	"From" position	"To" position
634-437-03	Cabinet operation surface E-net panel	Connect to the frame position of the Interface area of the cabinet operation surface.

Use one M5 hex nut (603-096-00) to fix the position of the power supply plate on the operation surface of the cabinet, and use one M5 hex nut (603-096-00) on the other end.

It is fixed at the frame position of the Interface area of the cabinet operation surface. The tool is fixed by an 8mm socket wrench and the torque value is 3.3 N·m.

Note : Make sure the INTF_Panel Side goes to panel and the SC_GND goes to the support cabinet end.

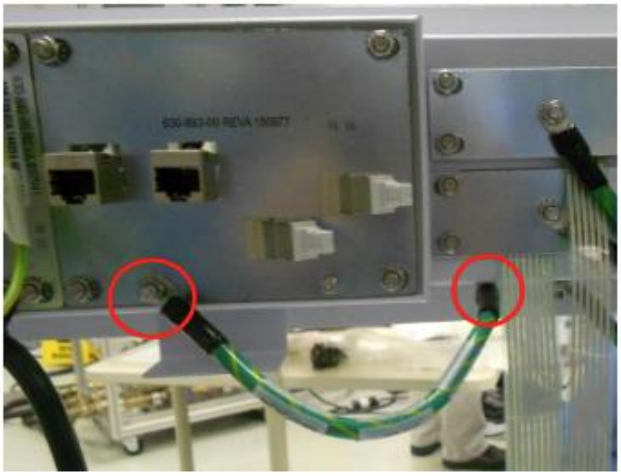

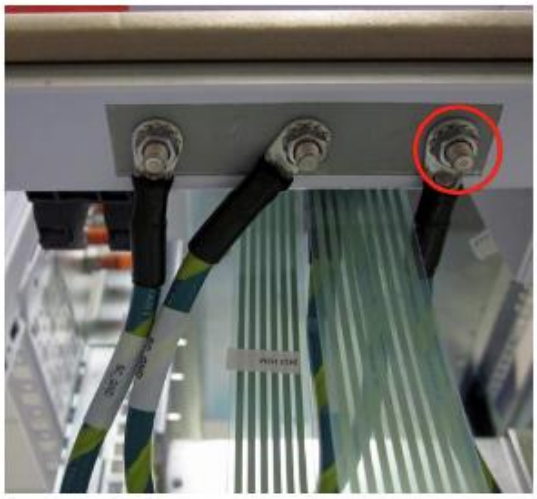

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	813-929-01	HDW VELCRO STRP 5/8" #88HK 4"	3

MACHINE: N/A

METHOD:

1.5 The wiring method of the grounding wire is shown in the figure.
1.6 Use three cable ties (813-929-01) to bind the grounding wire as shown in the figure.
1.7 Place all wires on the outside of the rack rail as shown in the figure.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	629-502-01	ELEC-MECH, ADB CHASSIS SUB ASSY, FOR SEMI TEST	1

MACHINE:

ITEM	DESCRIPTION	PARAMETER
1	LIFTING TROLLEY	N/A

METHOD:

2.1 Prepare the lift truck for ADB assembly (629-502-01). Lift the Pin on the lift truck and expand the feet to ensure that at least one hole is visible. Both feet are to be done.

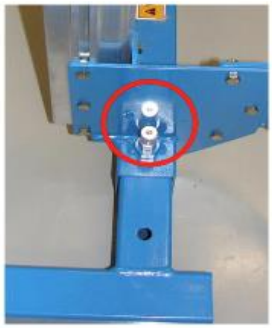

2.2 Install the lifting plate (650-325-00 tool) and rotate it to the fork arm.

Note: ADB is very heavy and requires a lift truck and two people to operate it.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

2.5 Fix the rope (650-326-00 tool) in the two mounting holes of the cabinet as shown in the figure, and surround the lift truck, and then pull the rope closer until the lift truck Securely lock the cabinet to prevent the lift truck from moving backward.

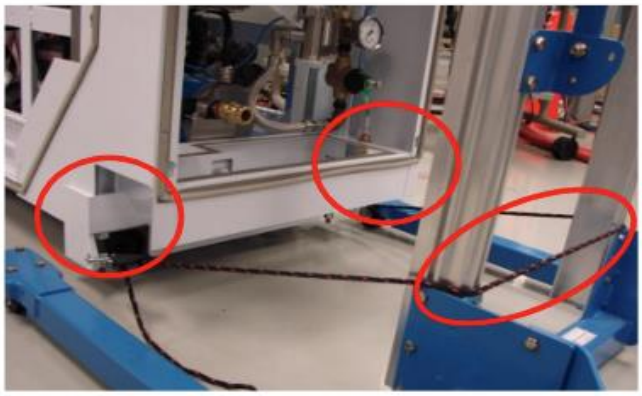

2.6 Lower the lift truck carefully as shown in the figure until the height of the lift truck is level with the height of the ADB shelf on the cabinet, and ADB just touches the shelf. Push ADB into the cabinet until the bottom of the bracket on the side of ADB touches the guide rails on both sides of the cabinet.

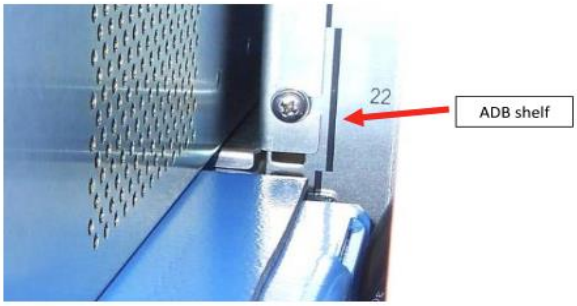

Note: ADB is very heavy and requires a lift truck and two people to operate it.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM	4

MACHINE: N/A

METHOD:

2.7 Reduce the height of the lift truck by 25mm, remove the ropes (650-326-00 tool) from the cabinet and the lift truck, and then gently pull the lift truck away from the cabinet.

2.8 Use 4 M5 screws (472-426-12) to fix the ADB on the rack rail as shown in the figure-two screws on each side, do not tighten the screws.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	DESCRIPTION	PARAMETER
1	13MM SOCKET HEAD	13.5 N.m

MACHINE: N/A

METHOD:

5.1 Connect the other end of the ground wire at the G1 position of the ground panel MECCA to ADB as shown in the figure. Use the existing nut to fix, the tool is a 13mm socket wrench, The torque value is 13.5 N·m.

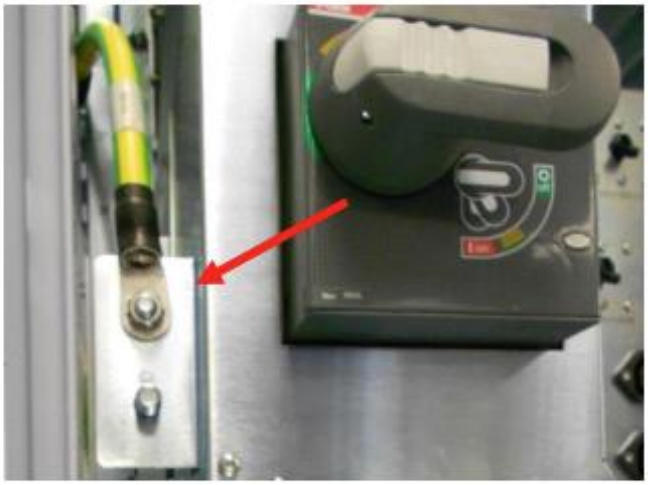

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	631-313-00	FORGED OR STAMPED STEEL FACTORY MAINS GUTTER BASE	1
2	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L	4

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	PH2 BIT	3.3 N.m

METHOD:

4.1 Remove the ground terminal on the front of ADB.

4.2 As shown in the figure, install an AC input circuit wire rack (631-313-00) between the bottom plate of the cabinet maintenance surface and ADB. If necessary, lift slightly ADB then puts the wire holder in the right position.

4.3 Use 4 M5 screws (472-426-12) to fix the bottom of the cabinet as shown in the figure. The tool is a PH2 Phillips torque screwdriver with a torque value of 3.3 N·m.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	470-302-00	CABLE, ADB MAIN GROUND, W/ CONN	2
2	631-314-00	FORGED OR STAMPED STEEL FACTORY MAINS GUTTER	1
3	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L	9

MACHINE: N/A

METHOD:

5.3 Cut the two grommets (470-302-00) into two parts the size of the power supply conduit as shown in the figure. If there is too much material, trim it.
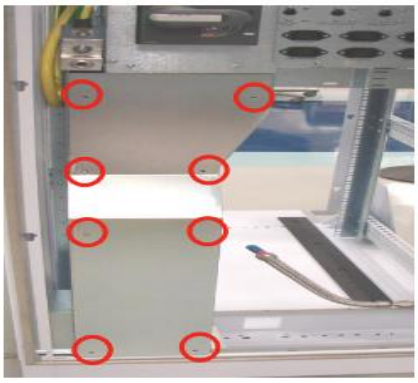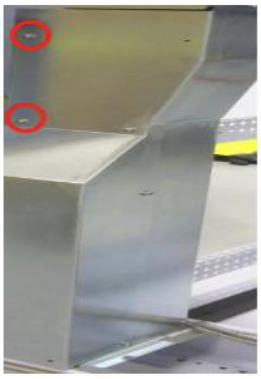
5.4 Use 9 M5 (472-426-12) screws to fix the cover of the power supply conduit (631-314-00) as shown in the figure, do not tighten it.