Build Overview:

1 **EMO Cable Install**
2 **PSU HFE Hose Install**
3 **Main AC EMO Panel & Switch Install**

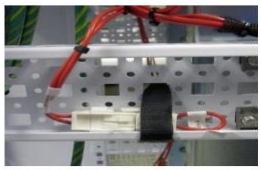

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by
	1	New Issue	JOSEPH AMAD

Prepared By:
JOSEPH R. AMAD
Manufacturing Engineer

Checked By:
IVAN NOWELL PANIQUE
Team Lead

Approved By:
SHERWIN ARIOSTE
Operations Manager

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	633-799-00	ELEC-MECH, UF2 24SLOT SUPPORT CABINET INTEGRATION	1

MACHINE: N/A

METHOD: 1. Scope of application

This BPM is suitable for UF Plus Support Cabinet Assembly
Applicable Support Cabinet Model 633-799-00
The sub-part model in Support Cabinet are 629-502-01 ADB CHASIS SUB ASSY, 653-315-00 CDBU SUB ASSY and 630-945-10 GEMINI SMC TRAY

METHOD:

Flow chart of operation steps

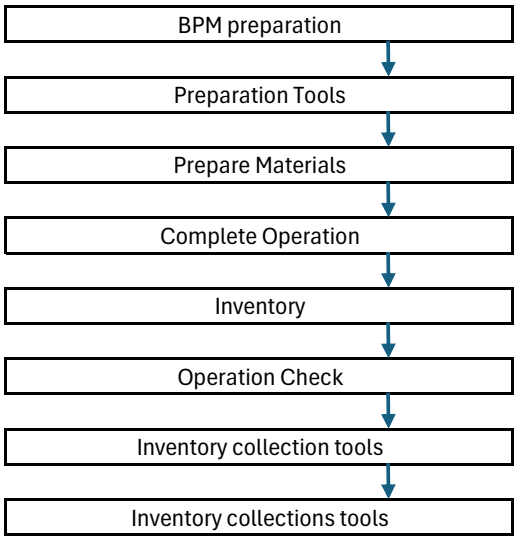

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	634-439-01	EMO CABLE	1
2	813-929-01	HDW VELCRO STRP 5/8" #88HK 4"	2

MACHINE: N/A

METHOD:

1.1 Install the EMO cable (634-439-01) on the operating surface of the cabinet as shown in the figure, and route the cable to the left position, under the power rack-the red wire harness.

a. Connect the connectors labeled "PSU0 EMO" and "PSU4 EMO" to PSU0 and PSU4, respectively. Guarantee PSU1, PSU3 and PSU5 connectors on the DC shelf.

b. Place the remaining wire on the lower left of the DC shelf.

c. As shown in the figure, except for the connectors labeled "CUSTOMER EMO" and "TH EMO", place the other wires on the right side and use 2 Cable tie (813-929-01)

The cable tie (813-929-01) fixes the wire on the shelf at the bottom of the upper groove.

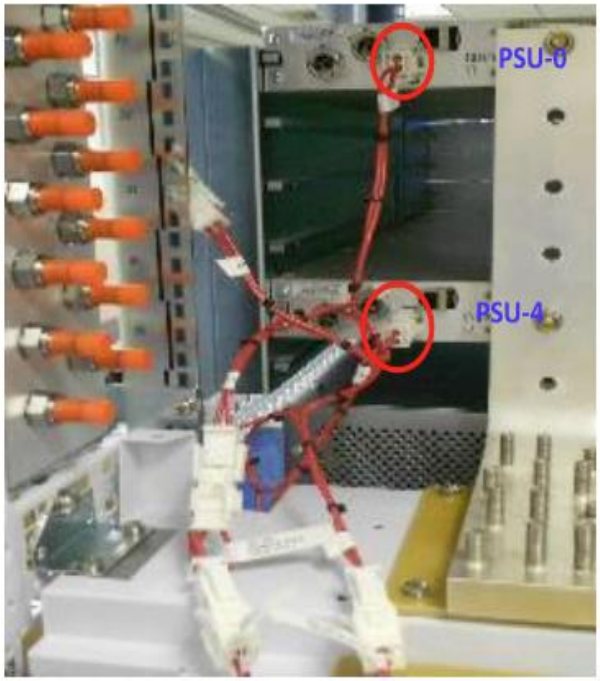

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

1.2 Connect the connectors labeled "J67", "J68" and "J70" on the EMO line to the back area of the ADB on the right side of the cabinet operation surface as shown in the figure.

1.3 Place the EMO cable connected to the SMC on the right outside of the cabinet as shown in the figure, and put it on the SMC shelf along the grounding cable. Connect the connector labeled "SMC-EMO" of the EMO cable to the J1 port on the front of the SMC shelf.

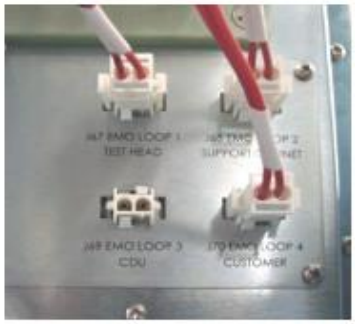

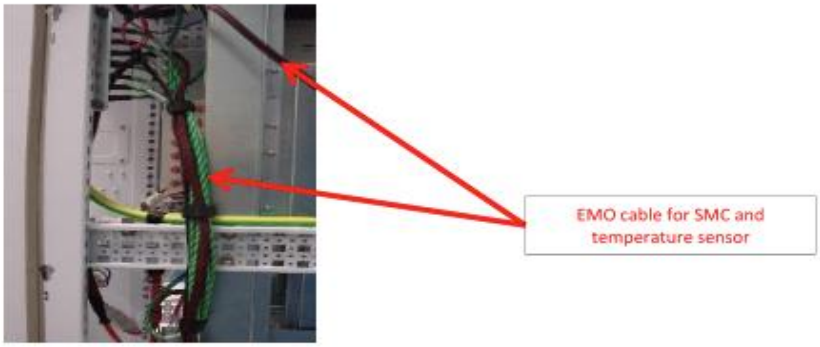

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

1.4 Connect the EMO cable connector labeled "Customer EMO" to the EMO button on the operation panel of the cabinet as shown in the figure.

1.5 Connect the EMO cable connector labeled "External EMO" to the front of the External EMO panel as shown in the picture.

Rear view of the Interface panel of the cabinet operation surface

Looking from the bottom up on the power shelf

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	634-440-00	CABLE EMO CABINET JUMPER W/CONN	1
2	813-929-01	HDW VELCRO STRP 5/8" #88K 4"	1

MACHINE: N/A

METHOD:

1.6 As shown in the figure, install an EMO jumper (634-440-00) on the EMO cable labeled "EXPANSION EMO" on the right side of the operation panel of the cabinet and tie the cables with a small cable tie (813-929-01) onto the rail.

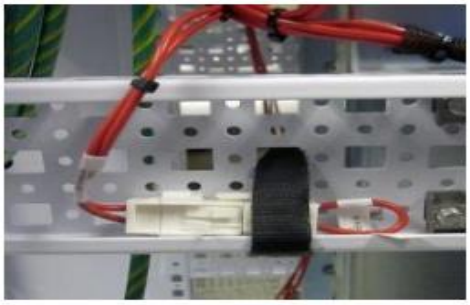

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	634-440-00	CABLE EMO CABINET JUMPER W/CONN	1

MACHINE: N/A

METHOD:

1.7 Place the line "Temp.EMO" and the line "Service EMO" on the maintenance surface of the cabinet along the guide rail as shown in the figure. Use 4 short cable ties (813-929-00) tied to the rack rail.

Cabinet Temp. EMO
Service EMO

Cabinet maintenance surface

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	634-443-00	CABLE 2ND SUPPORT CABINET EMO JUMPET W/CONN	1
2	961-286-04	ASSY EMO TEMP SW BRACKET	1
3	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 X 12MM L	1

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	PH2 BIT	3.3 N.m

METHOD:

1.8 Install an EMO jumper (634-443-00) on "J73 EMO Cabinet #2" on ADB as shown in the figure.

2.1 As shown in the figure, install an EMO temperature sensor (961-286-04) above the maintenance surface of the cabinet, and fix it with two M5 screws (472-426-12). The tool is a PH2 Phillips torque screwdriver with a torque value of 3.3 N·m.

2.2 Connect the EMO harness to the temperature sensor on the left as shown in the figure.

a. Connect Temp 1 to the left side of the sensor.

b. Connect Temp 2 to the right side of the sensor.

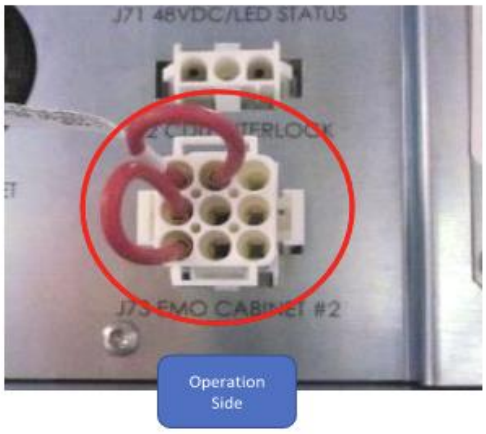

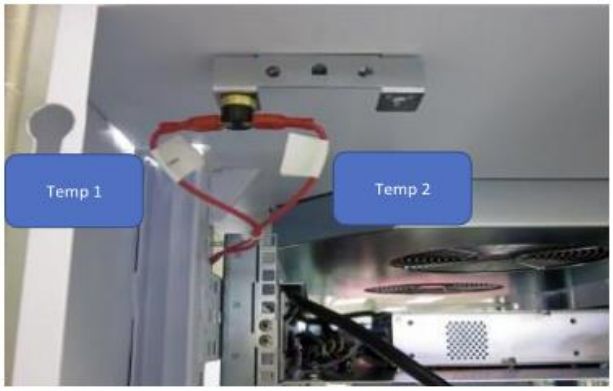

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	631-794-00	ELECTRO MECHANICAL HOSE ASSEMBLY PSU COOLING SUPPLY	2
2	631-794-01	ELECTRO MECHANICAL HOSE ASSEMBLY PSU COOLING RETURN	2

MACHINE: N/A

METHOD:

3.1 Install the PSU cooling pipe on the cooling manifold to the PSU as shown in the figure.

a. Install two supply pipes (short pipes) (631-794-00) on the inside of Manifold as shown in the figure and connect to the left connector of PSU.

b. As shown in the figure, on the outside of Manifold, near the cabinet door, install 2 return pipes (long pipes) (631-794-01) to the right connectorof the PSU.

Note: The position of the connector on the Manifold relative to the PSU. Connect PSU0 to the top position of the Manifold. The second-to- last position of the Manifold is connected to PSU4.

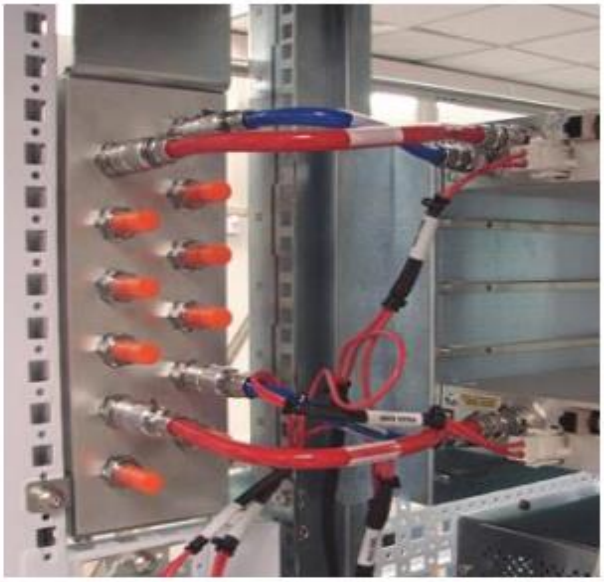

PSU-0

PSU-4

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	479-133-23	LABEL, EMERGENCY OFF	1
2	629-384-00	ALUMINUM INTERFACE PANEL SERVICE SIDE BRACKET	1
3	801-643-01	HDWR SW OPERATOR TU	1

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	EMO SOCKET WRENCH	2 N.m

METHOD:

4.1 Attach an EMO warning label 479-133-23 to the circuit breaker panel (629-384-00) as shown in the figure.

4.2 Install an EMO switch (801-643-01) on the circuit breaker panel as shown in the figure.

a. Place the large gap of the switch downward and use a large plastic nut to fix the switch. The tool is an EMO socket wrench with a torque value of 2 N.m.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	603-096-00	NUT, HEX, SS M8X1.25, WSHR W/TTH,13MM WDH	4

MACHINE:

ITEM	DESCRIPTION	PARAMETER
1	8MM SOCKET HEAD	0.7 N.m

METHOD:

4.3 Install the circuit breaker panel to the back of the ADB as shown in the figure, and fix it with 4 M5 nuts (603-096-00), the tool is an 8mm socket wrench, and the torque value is 0.7 N·m. (This panel will be removed when installing the power cord.)

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	801-541-02	SW CONTACT BLOCK, NO	1
2	801-515-02	SW CONTACT BLOCK 1F	1
3	634-438-00	CABLE EMO BUTTON CABLE W/CONN	1

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	FLAT HEAD SCREWDRIVER	0.7 N.m

METHOD:

4.4 Insert the switch contact block (801-541-02) into another switch contact block (801-515-02) as shown in the figure.

4.5 Install the wire (634-438-00) on the switch as shown in the figure, use a flat-blade screwdriver to fix it, and the torque value is 0.7 N·m.

4.6 As shown in the figure, the buckle of the switch faces upwards, and the EMO contact switch is installed on the back of the EMO button.

a. Push the button gently to ensure that the EMO switch can be pressed in and unscrewed normally without obstacles.

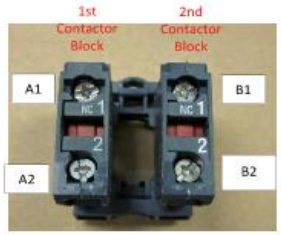

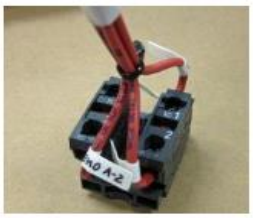

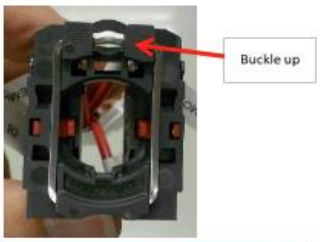

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

MACHINE:

METHOD:
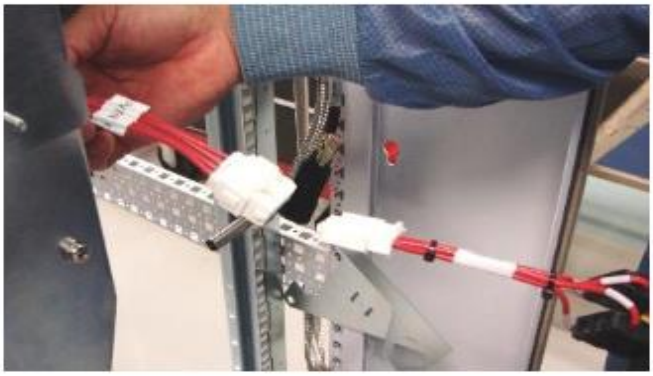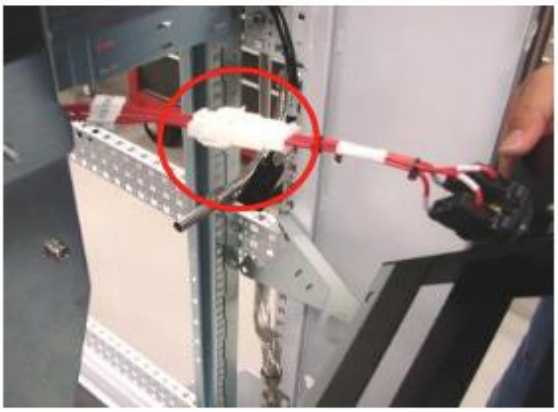
4.7 Connect the wire of the EMO knob to the EMO harness of the main system as shown in the figure.