Build Overview:

1. **AC Power Cords Install**
2. **Fan Tray Cabling Install**
3. **Operator Interface Cabling Install**
4. **Data Cables Install**
5. **72kW Block off Panels Install**
6. **AC Protective Cover Install**
7. **Labels Install**

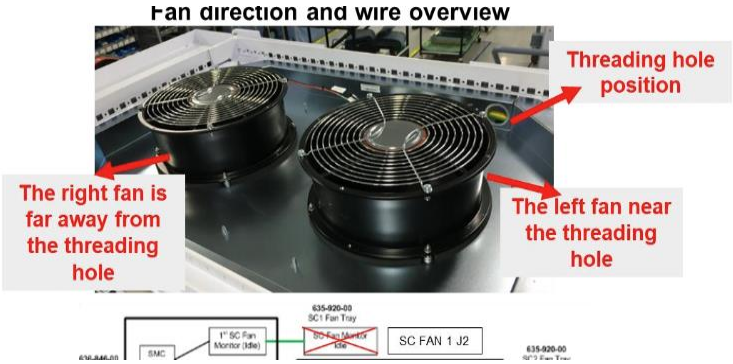

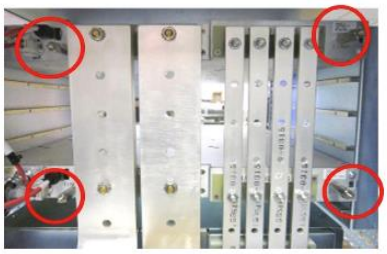

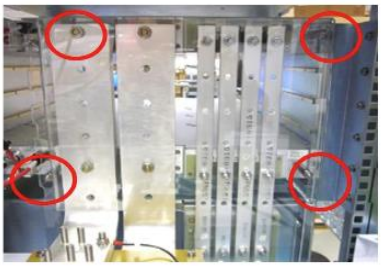

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by	
	1	New Issue	JOSEPH AMAD	**Prepared By:** JOSEPH R. AMAD, Manufacturing Engineer
				Checked By: IVAN NOWELL PANIQUE, Team Lead
				Approved By: SHERWIN ARIOSTE, Operations Manager

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	633-799-00	ELEC-MECH, UF2 24SLOT SUPPORT CABINET INTEGRATION	1

MACHINE: N/A

METHOD: 1. Scope of application

This BPM is suitable for UF Plus Support Cabinet Assembly
Applicable Support Cabinet Model 633-799-00
The sub-part model in Support Cabinet are 629-502-01 ADB CHASIS SUB ASSY, 653-315-00 CDBU SUB ASSY and 630-945-10 GEMINI SMC TRAY

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	710-502-55	CBL/ASSY 6-FT. HEAVY-DUTY 14AWG POWER CORD	1
2	813-929-00	HDW VELCRO STRP 5/8" VBS#88 8"	2
3	662-445-00	CABLE, FAN SPEED MONITOR, 5 V, TELECOM, WITH CONN	1
4	631-550-00	CABLE UF2 SMC FAN MON TELECOM WITH CONN	1
5	634-436-00	CABLE SUPPORT CABINET FAN POWER W/ CONN	1
6	603-096-01	NUT HEX SS M8X1.25 WSHR W/TTH 13MM WDH	2
7	636-845-00	CABLE, FAN POWER, IDLE, 48 V, W/ CONN	1
8	813-929-01	HDW VELCRO STRP 5/8" VBS#88 4"	3
9	835-610-00	HDW CLAMP CBL .312	2
10	603-096-00	NUT HEX SS M5X0.8 W/WSHR W/TTH 8MM WDH	2
11	631-552-00	CABLE UF2 OPER DISP PNL LED SW TELECOM WITH CONN	1
12	640-402-00	INTERFACE DISPLAY WIRE	1
13	470-501-06	WASHER FLAT 8.4MM ID 16MM OD SS	2
14	835-441-00	HDW CLIP FLT CBL 3" ADHESIV NY	1
15	631-556-01	CABLE UF2 SMC ENET PNL TO SW SMC TELECOM WITH CONN	1
16	631-559-00	CABLE UF2 ENET SW TO PSU TELECOM WITH CONN	2
17	631-561-00	CABLE UF2 ENET SW TO SMC TELECOM WITH CONN	1
18	650-502-00	FORGED OR STAMPED STEEL SC SOCK FILLER PANEL 2 MISC	1
19	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L	1
20	603-093-23	STANDOFF 10MM HEX M-F M5.8X40MML SS	4
21	470-502-05	WASHER LK SPLIT M5, 9.2MM OD, S	4
22	632-303-00	PLASTIC PSU COVER OTHER ARTICLES	1
23	603-096-00	NUT,HEX,SS M8X1.25, WSHR W/TTH, 13MM WDH	4
24	638-517-05	PLASTIC CDU DRIP PAN DRAIN LABEL	1
25	638-517-07	PLASTIC CDU AIR INLET LABEL	1

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	13MM SOCKET HEAD	13.5 N.m
2	8MM SOCKET HEAD	1.6 N.m
3	FLAT HEAD SCREWDRIVER	0.7 N.m
4	PH2 BIT	3.3 N.m
5	10MM SOCKET HEAD	1.6 N.m

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	13MM SOCKET HEAD	13.5 N.m
2	8MM SOCKET HEAD	1.6 N.m
3	FLAT HEAD SCREWDRIVER	0.7 N.m
4	PH2 BIT	3.3 N.m
5	10MM SOCKET HEAD	1.6 N.m

METHOD:

Flow chart of operation steps

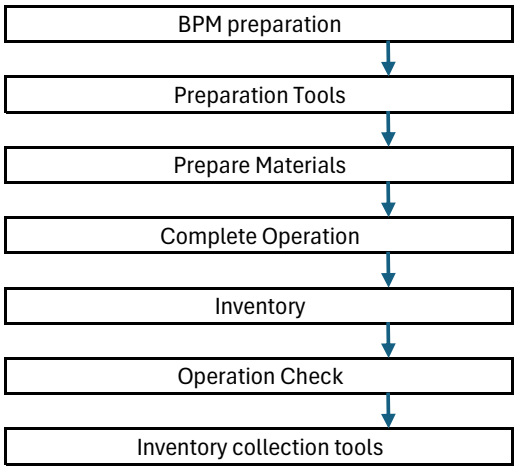

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

1.1 Insert the AC power cord on the AC panel of the Interance panel of the cabinet operation surface into the outlet of "J17A" on the ADB of the cabinet operation surface as shown in the figure.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	813-929-00	HDW VELCRO STRP 5/8" VBS#88 8"	2

MACHINE: N/A

METHOD:

2.3 Lay down the SMC AC power cord along the right side of the cabinet as shown in the figure, and then install it to the exit position of "J14A SMC" on the ADB. Use 2 The cable tie (813-929-00) binds the wire to the guide rail.

2.3

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHODS:

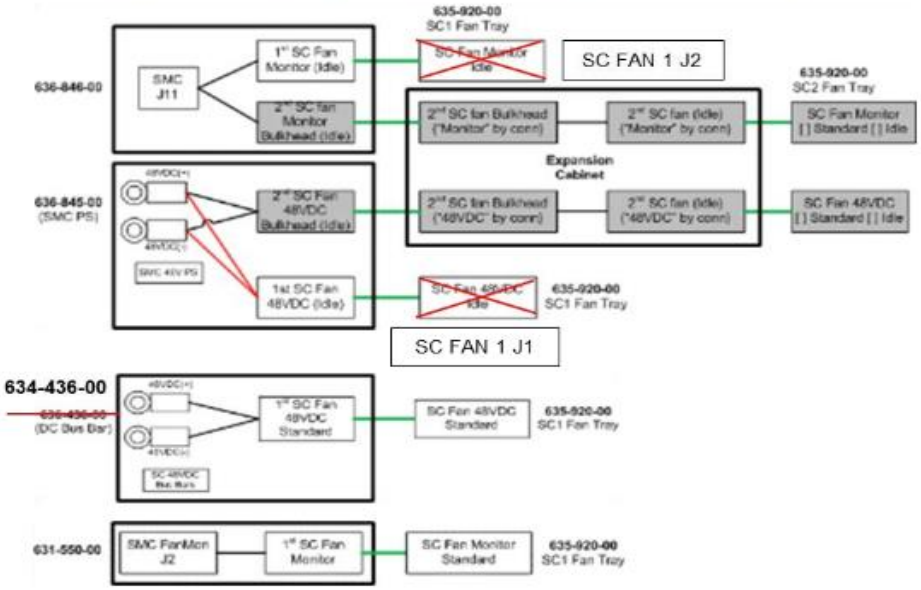

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	662-445-00	CABLE, FAN SPEED MONITOR, 5 V, TELECOM, WITH CONN	1

MACHINE:

ITEM	DESCRIPTION	PARAMETER
1	FLAT HEAD SCREWDRIVER	0.19 N.m

METHOD:

3.1 Install a fan speed monitor cable (662-445-00) to SMC-J11 and torque to 0.19Nm with flat blade bit as shown in the figure.

a. Place the end connector of the cable on the right side of the SMC and pass the connector labeled "1ST SC FAN MONITOR (Idle)" through the fan hole. Place the other connector labeled "2nd SC Fan Idle" outside the fan.

b. Connect the connector labeled "1ST SC FAN MONITOR (Idle)" to the "SC_FAN#1_J2" connector of the left fan near the cable hole.

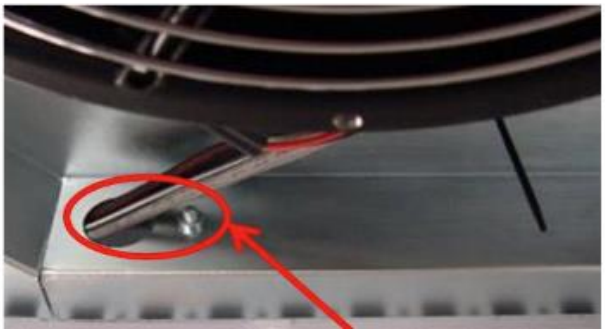

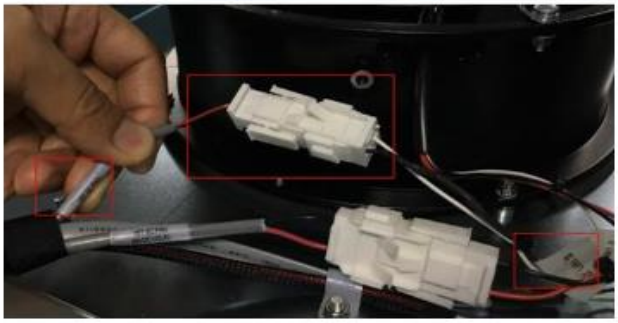

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	631-550-00	CABLE UF2 SMC FAN MON TELECOM WITH CONN	1

MACHINE: N/A

METHOD:

3.2 Install a fan speed monitor cable (631-550-00) as shown in the figure, connect one end to SMC J2, and one end to SC1 FAN 2 J2 monitor.

a. Remove the short plug from the SMC-J2 port.

b. Mark "[X] SMC FANMON J2" and "[X] FAN CAB1" online.

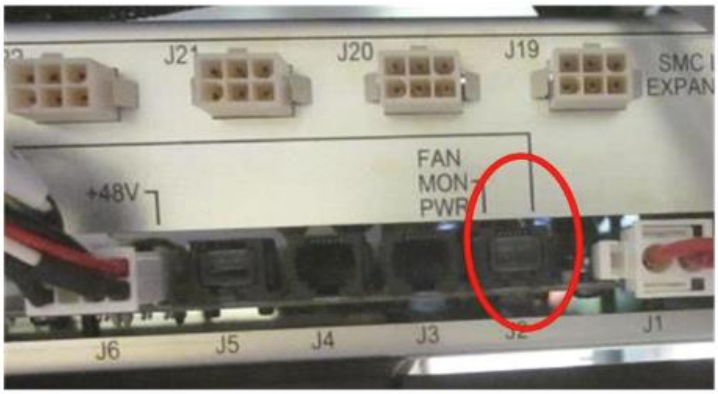

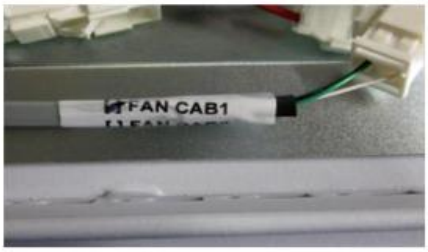

MAN: :CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHODS:

3.4 Pass the end connector marked "[X] FAN CAB1" through the fan port as shown in the figure.

3.5 Connect the connector marked "FAN CAB1" to the right fan "SC_FAN#2_J2" connector away from the cable hole as shown in the figure.

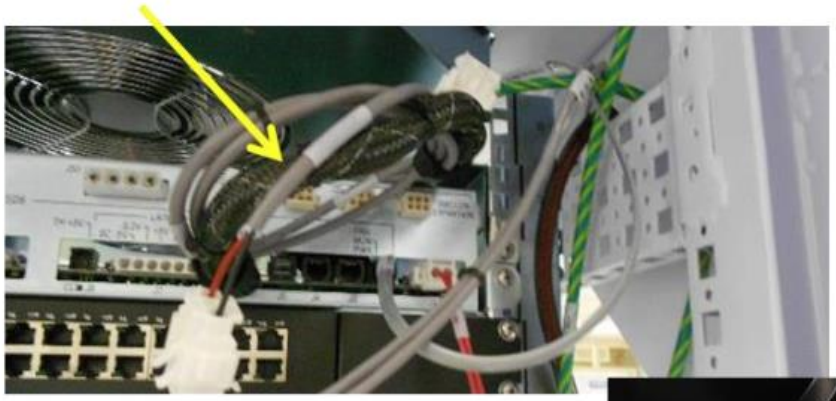

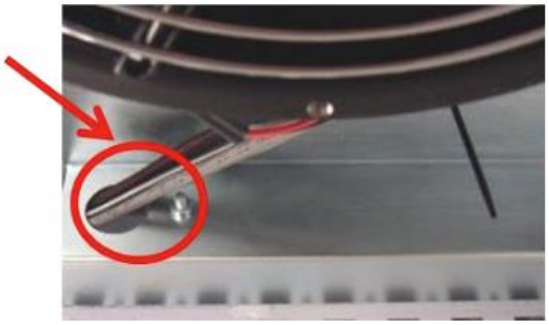

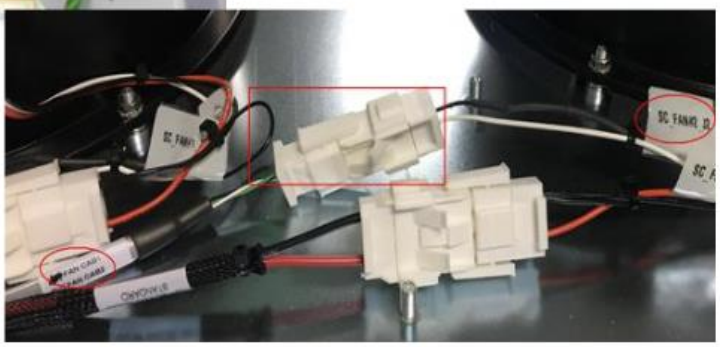

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	634-436-00	CABLE SUPPORT CABINET FAN POWER W/CONN	1
2	470-501-06	WASHER FLAT 8.4MM ID 16MM OD SS	1
3	603-096-01	NUT HEX SS M8X1.25 WSHR W/TTH 13MM WDH	1

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	13MM SOCKET HEAD	13.5 N.m

METHOD:

4.1 Install a power cord (634-436-00) as shown in the figure, one end to "SC1 Fan 2 Standard", one end to "48v power bus bars".

a. Pass the end connector of the wire label "1ST Fan 48VDC STANDARD" through the fan hole.

b. Connect the connector with the cable label "1ST Fan 48VDC STANDARD" to the right fan "SC_FAN#2_J1" connector away from the cable hole.

c. Place the wire on the Busbar down and along the ground wire under the power frame of the cabinet.

d. Connect the red wire to the right port of the 48V fuse on the 48V busbar as shown in the figure. Use the existing screws to fix, the tool is a flat-blade screwdriver, The torque value is 0.7 N·m.

e. Connect the black wire to the 48V busbar as shown in the picture, and fix it with 1 M8 flat washer (470-501-06) and 1 M8 nut (603-096-01), The tool is a 13mm socket wrench with a torque value of 13.5 N·m.

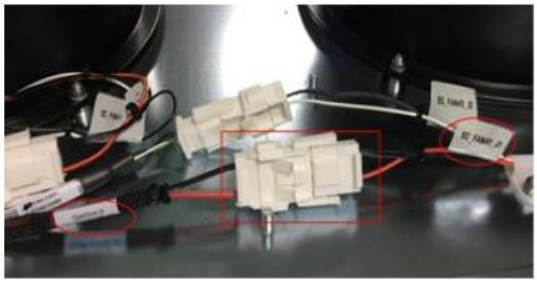

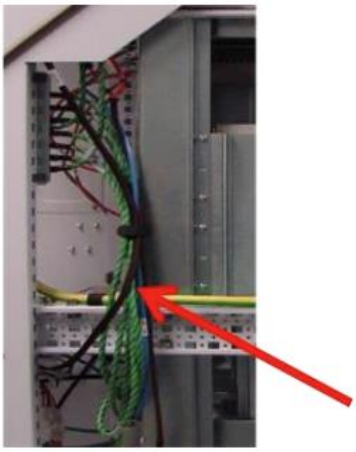

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	636-845-00	CABLE, FAN POWER, IDLE, 48 V, W/CONN	1

MACHINE: N/A

METHOD:

4.2 Install the fan power cord 636-845-00, connect one end to the SMC power supply, and the other end to "SC1 Fan 2 Idle".

a. Take the SMC cable and pass the end connector labeled "1ST FAN 48VDC (Idle)" through the fan hole. Mark another the connector of "2nd SC Fan 48VDC BULKHEAD" is placed outside the fan.

b. Connect the connector labeled "1ST FAN 48VDC (Idle)" to the "SC_FAN#1_J1" connector of the left fan near the cable hole.

4.3 Wind the fan wire in a circle as shown in the figure, then tie it with a tie and place it on the upper right corner of the cabinet.

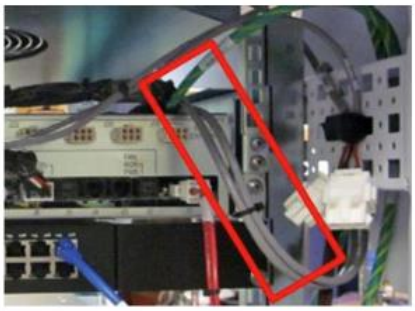

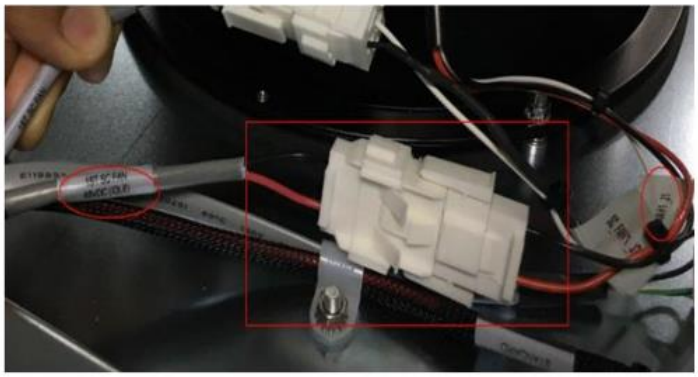

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	813-929-01	HDW VELCRO STRP 5/8" #88K 4"	2
2	835-610-00	HDW CLAMP CBL .312	2
3	603-096-00	NUT HEX SS M5X0.8 W/WSHR W/TTH 8MM WDH	2

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	8MM SOCKET HEAD	1.6 N.m

METHOD:

4.4 As shown in the figure, use a short cable tie (813-929-01) to pass through the cabinet frame guide rail to tie the two unused connectors of the 2nd SC fan. (This will be used on the expansion cabinet.)

4.5 Use 2 wire clips (835-610-00) to fix the "SC Fan 2" wire on the top of the fan assembly, and fix it with 2 M5 nuts (603-096-00), The tool is an 8mm socket wrench with a torque value of 1.6 N·m.

4.6 Use a short cable tie (813-929-01) to tie the "SC Fan 1" line to the previous line.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	631-552-00	CABLE UF2 OPER DISP PNL LED SW TELECOM WITH CONN	1

MACHINE: N/A

METHOD:

5.1 Install one operation surface Interface Display wire (631-552-00) as shown in the figure, one end is connected to the operation surface Interface Display, The other end is connected to SMC-J10.

a. Insert the connector labeled "SMC-J10" at the end of the line into the SMC J10 interface.

b. Place the cable along the left end of the cabinet under the power supply rack and connect it to the CN1 port on the Interface panel of the cabinet operation surface.

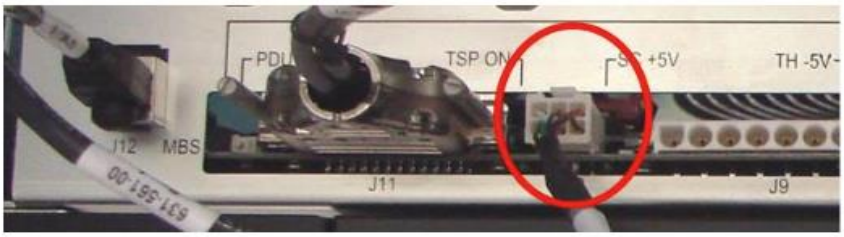

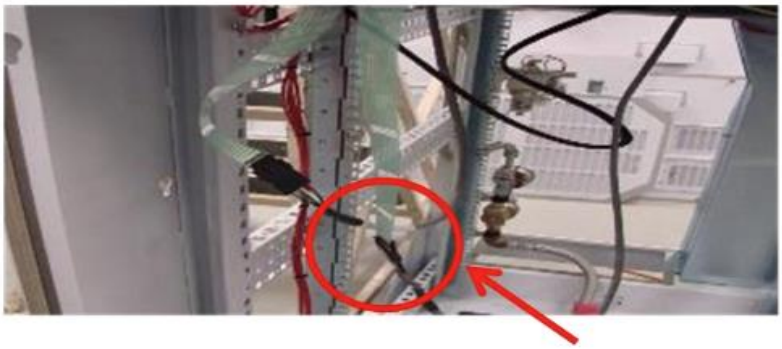

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	640-402-00	INTERFACE DISPLAY WIRE	1

MACHINE: N/A

METHOD:

6.1 Install one interface Display wire (640-402-00) on the operation surface as shown in the figure.

a. Install the connector of the terminal line label "ADB J71" under the power supply rack of the operation surface of the cabinet and connect it to the position of ADB J71.

b. Pass the connector of the terminal line label "CN2" through the underside of the power supply rack and connect it to the CN2 position on the Interface panel of the cabinet operation surface.

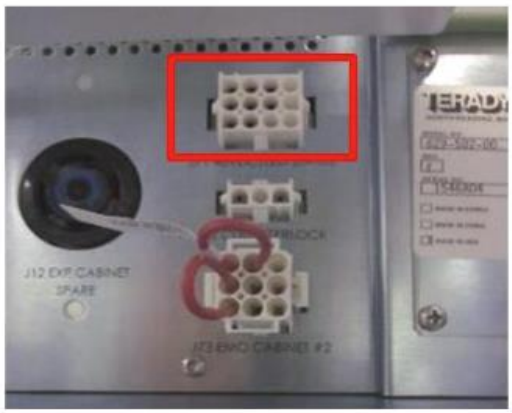

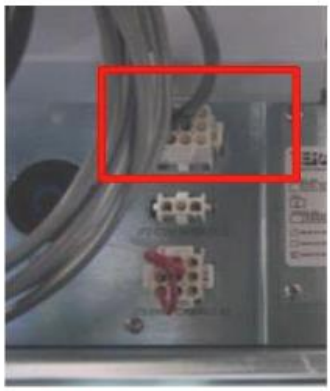

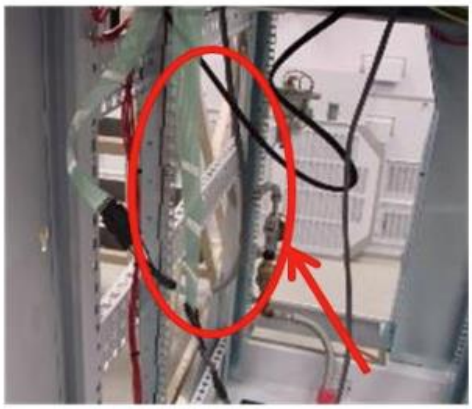

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	813-929-01	HDW VELCRO STRP 5/8" #88HK 4"	1
2	603-096-01	NUT HEX SS M8X1.25 WSHR W/TTH 13MM WDH	1
3	470-501-06	WASHER FLAT 8.4MM ID 16MM OD SS	1
4	835-441-00	HDW CLIP FLT CBL 3" ADHESIV NY	1

MACHINE:

ITEM	DESCRIPTION	PARAMETER
1	FLAT HEAD SCREWDRIVER	0.7 N.m
2	13 MM SOCKET HEAD	13.5 N.m

METHOD:

c. Wind the wire connected to CN4 as shown in the figure, and use a small cable tie (813-929-01) to tie the wire to the upper groove position under the power supply rack.

d. Pass the wire through the opening slot on the left side of the power frame to the Busbar and the fuse:

①Connect the wire to the 48V fuse as shown in the figure, and use the existing screws to fix the wire on the fuse frame. The tool is a flat-blade screwdriver. The torque value is 0.7 N·m.

②Connect the wire to the 48V grounded Busbar as shown in the figure, use 1 M8 nut (603-096-01) and 1 M8 flat washer (470-501- 06) to fix the wire, The tool is a 13mm socket wrench with a torque value of 13.5 N·m.

6.2 Install a flat wire clamp (835-441-00) at the lower left position of the power supply rack as shown in the figure. Remove the protective film and paste it on. Put the flat wires in and close the shelf to secure the wires.

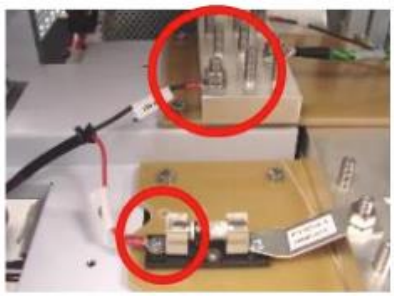

Look from below

Front of the interface panel

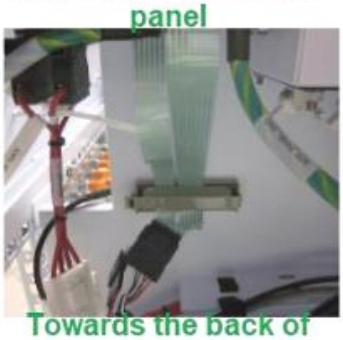

Towards the back of the ADB/ cabinet

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	650-502-00	FORGED OR STAMPED STEEL SC SOCK FILLER PANEL 2 MISC	1
2	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L	1

MACHINE:

NO.	DESCRIPTION	PARAMETER
1	PH2 BIT	3.3 N.m

METHOD:

8.1 Install the panel (650-502-00) at the wire opening slot, and fix it with 1 M5 screw (472-426-12), The tool is a PH2 Phillips torque screwdriver with a torque value of 3.3 N·m.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	603-093-23	STANDOFF 10MM HEX M-F M5X.8X40MML SS	4
2	470-502-05	WASHER LK SPLT M5, 9.2MM OD, S	4
3	632-303-00	PLASTIC PSU COVER OTHER ARTICLES	1
4	603-096-00	NUT, HEX, SS M8X1.25, WSHR W/TTH, 13MM WDH	4

MACHINE:

ITEM	DESCRIPTION	PARAMETER
1	10MM SOCKET HEAD	3.3 N.m
2	8MM SOCKET HEAD	1.6 N.m
3	TEMPLATE STICKER	N/A

METHOD:

9.1 Install 4 10mm hexagonal studs (603-093-23) as shown in the picture, and 4 M5 spring washers (470-502-05) on the back of the 2 PSUs, The tool is a 10mm long socket wrench with a torque value of 3.3 N·m.

9.2 As shown in the picture, install a protective cover (632-303-00) on the 4 studs, fix it with 4 M5 nuts (603-096-00), the tool is an 8mm socket wrench, The torque value is 1.6 N·m.

9.3 Install warning sticker (479-133-18) using sticker template as shown in diagram.

Note: Remove the protective film on both sides of the cover before installing the protective cover.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	P/N	DESCRIPTION	QTY
1	638-517-05	PLASTIC CDU DRIP PAN DRAIN LABEL	1
2	638-517-07	PLASTIC CDU AIR INLET LABEL	1

MACHINE: N/A

METHOD:

10.1 Stick a label (638-517-05) on the center of the panel as shown in the figure.
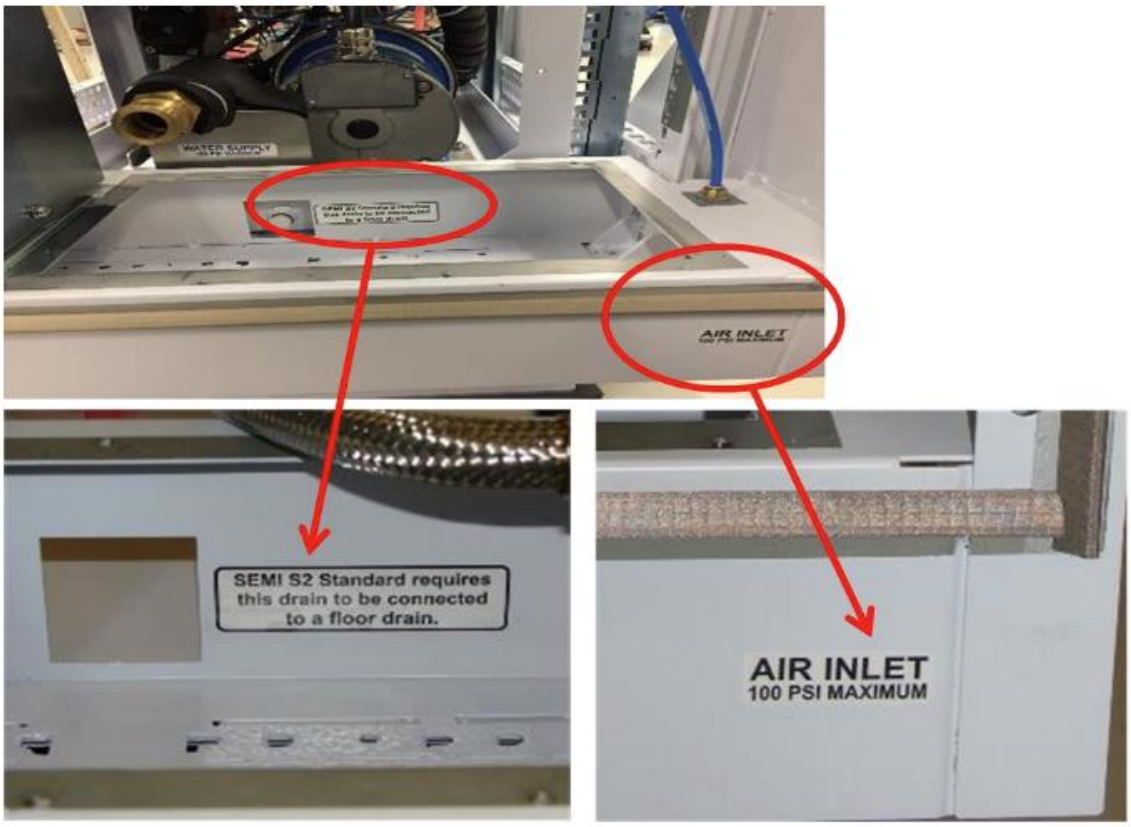
10.2 Install a CDU air intake label (638-517-07) on the lower right corner of the outside of the cabinet as shown in the figure.