Build Overview:

1 **Bus Bar Install**
2 **Bus Bar Cover install**

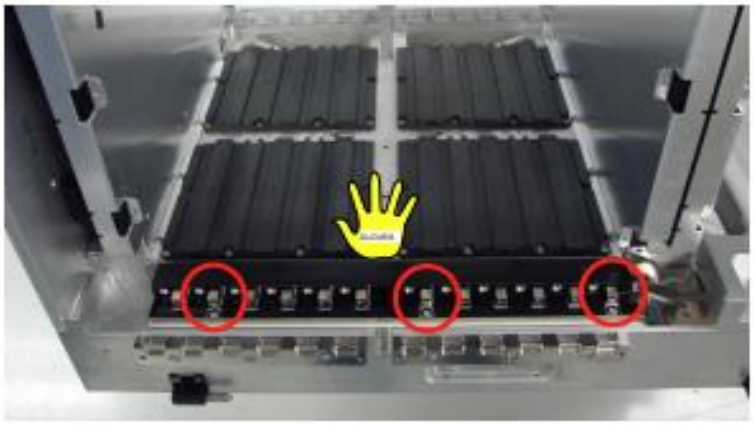

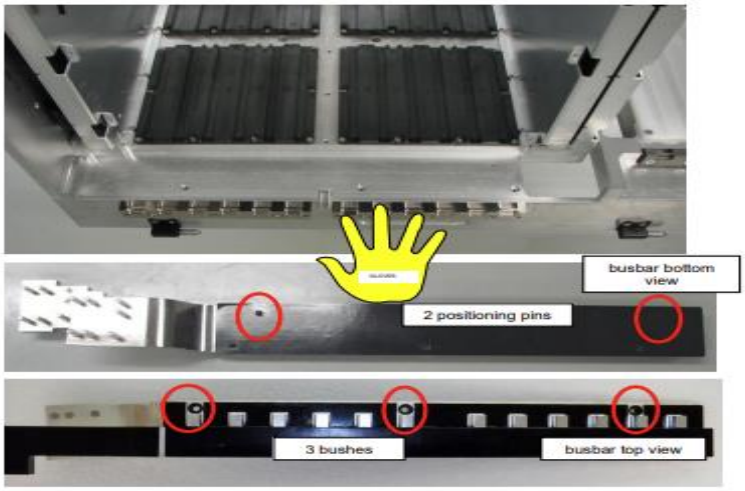

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by
	1	New Issue	JOSEPH AMAD

Prepared By:
JOSEPH R. AMAD
Manufacturing Engineer

Checked By:
IVAN NOWELL PANIQUE
Team Lead

Approved By:
SHERWIN ARIOSTE
Operations Manager

MAN:

CERTIFIED TECHNICIANS.

MATERIAL:

NO.	PART NO.	DESCRIPTION	QTY.
1	651-940-00	COPPER OR BRASS TH BUS BAR 48V PLATES	1
2	406-502-20	SCRW PAN HEAD TORX M5X.8P/20MM SS W/NYLOK	3
3	660-299-00	PLASTIC, BUSBAR COVER, BOX OR CASE	1
4	835-129-00	HDW FSTNR SNAP M ST	3
5	606-359-12	SCRW FLAT HEAD TORX M4X.7P/12MM SS W/NYLOK	3
6	479-133-15	LABEL,CHASSIS GROUN	3

METHOD:

Flow chart of operation steps

BPM preparation

Preparation Tools

Prepare Materials

Complete Operation

Inventory Materials

Operation Check

Inventory tool

TOOL NAME	TORQUE VALUE
T25 Torx wrench	1.1N.m
PH2 Phillips torque screwdriver	1.6N·m.
T20 Torx wrench	1.6N·m.
Multimeter	

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

1. Scope of application

This document applies to UF PLUS Test Head Build Section 2 assembly

Operation steps

1. When you see the following icon, you must use gloves to perform this step.

Matters needing attention

1. Do ESD and protective safety measures.
2. Be careful during the assembly process so as not to scratch the surface of the parts.
3. After assembly, check the assembled parts for defects and leak-free operation.

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
1	651-940-00	COPPER OR BRASS TH BUS BAR 48V PLATES	1

MACHINE:

Glove

METHOD:

1.1 Rotate the T/H to a vertical position as shown in the figure to maintain the surface.
1.2 Take one BusBar 651-940-00 and confirm that there are three plastic bushes in the three mounting holes of Busbar.
Also confirm that there are two positioning pins on the Busbar.

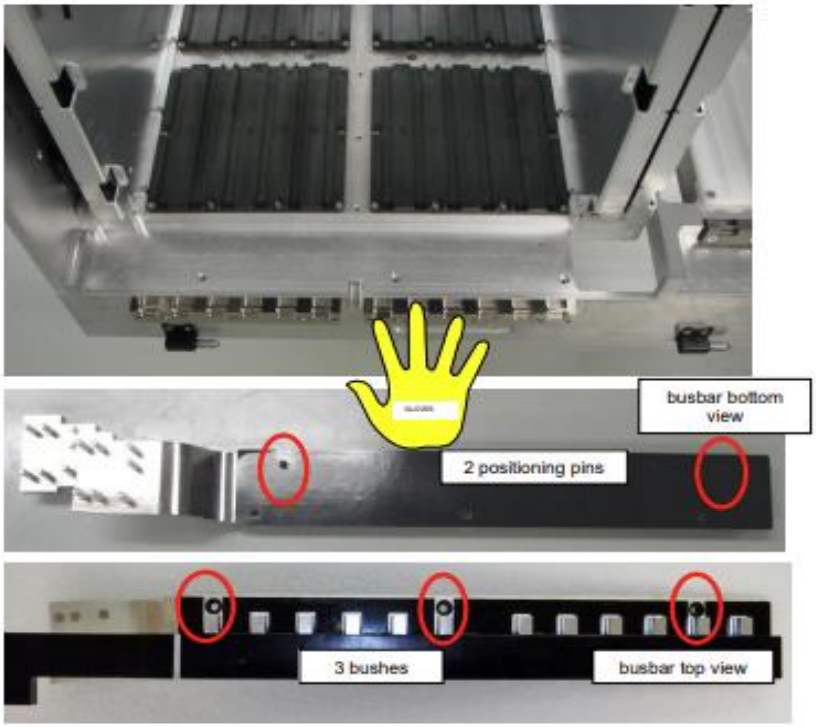

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

Glove

METHOD:

2.1 Take the Busbar as shown in the figure and install it to the TH frame, and insert it from the TH opening. Pay attention to alignment.

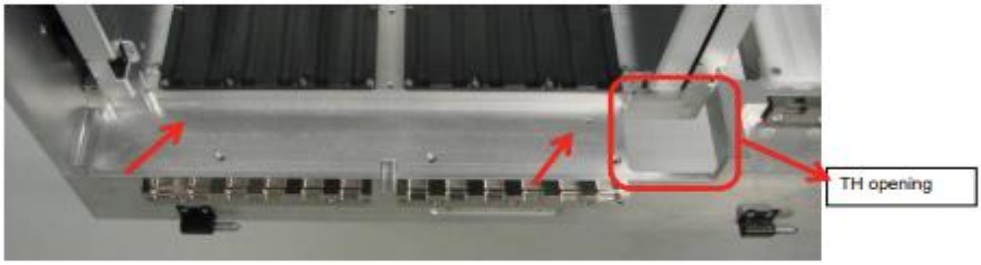

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
2	406-502-20	SCRW PAN HEAD TORX M5X.8P/20MM SS W/NYLOK	3

MACHINE:

Glove, T25 Torx wrench 1.1 N·m, multimeter

METHOD:

2.2 Install 3 M5 screws (406-502-20) as shown to fix Busbar to the T/H frame,
The tool is a T25 torx wrench and the torque of the fixing screw is 1.1 N·m.

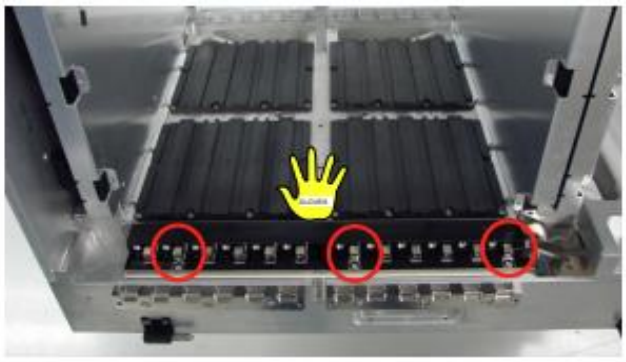

2.3 Confirm that Busbar is not short-circuited with the T/H frame. Use a multimeter to measure according to the position shown in the figure. A test pen touches the metal surface in the Busbar hole.
The other test pen touches the surface of the T/H frame to ensure that the tested impedance is infinite or open.

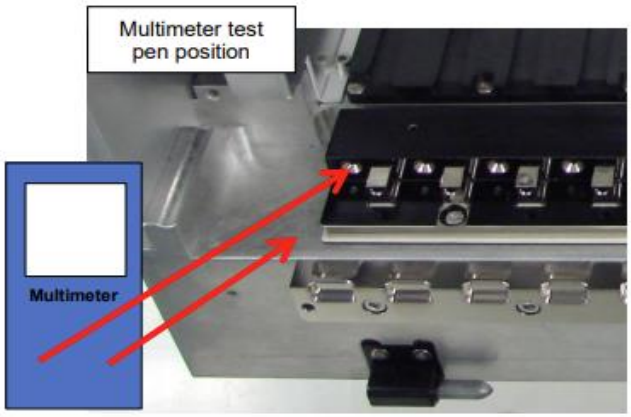

Multimeter test pen measurement

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
3	660-299-00	PLASTIC, BUSBAR COVER, BOX OR CASE	1

MACHINE:

PH2 Phillips torque screwdriver 1.6 N·m.

METHOD:

3.1 Take one Busbar cover 660-299-00 as shown in the picture and use two M5 screws 472-426-12 to lock the cover to the frame.
The tool is a PH2 Phillips torque screwdriver with a torque value of 1.6 N·m.

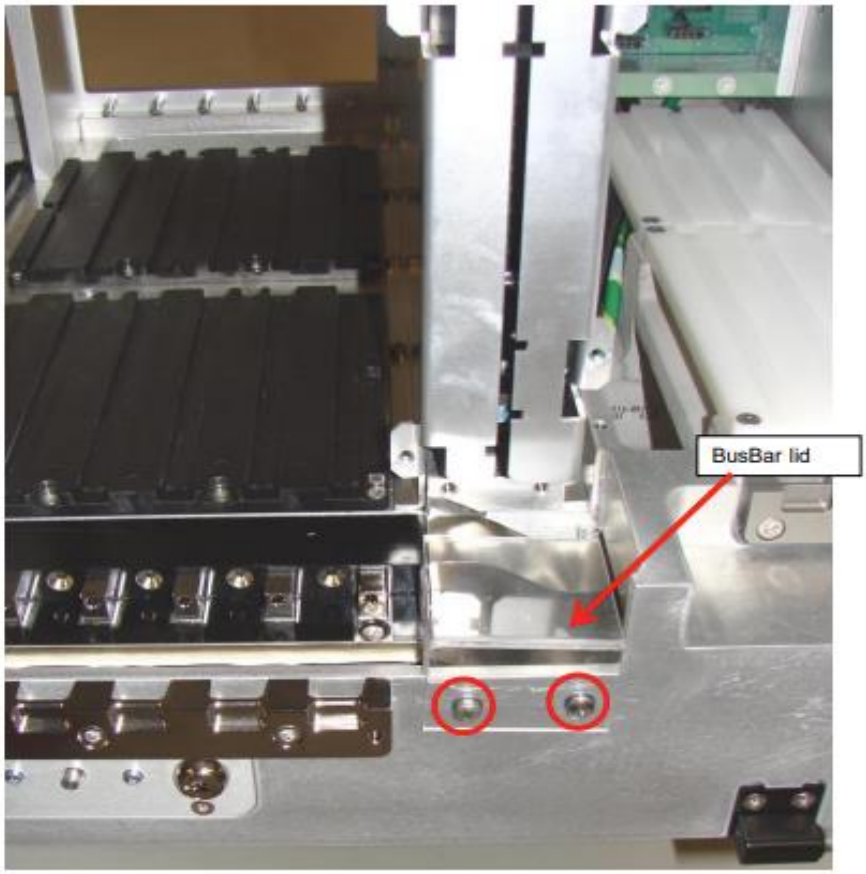

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
4	835-129-00	HDW FSTNR SNAP M ST	2
5	606-359-12	SCRW FLAT HEAD TORX M4X.7P/12MM SS W/NYLOK	2
6	479-133-15	LABEL,CHASSIS GROUN	2

MACHINE:

N/A

METHOD:

4.1 Take two ESD snap rings 835-129-00 as shown in the figure, and use two M4 flat head screws 606-359-12 to lock the snap rings to the frame positions shown in the figure.
The tool is a T20 Torx wrench and the torque of the fixing screw is 1.6 N·m.
4.2 Attach one grounding label 479-133-15 to each of the ESD snap rings, a total of two.

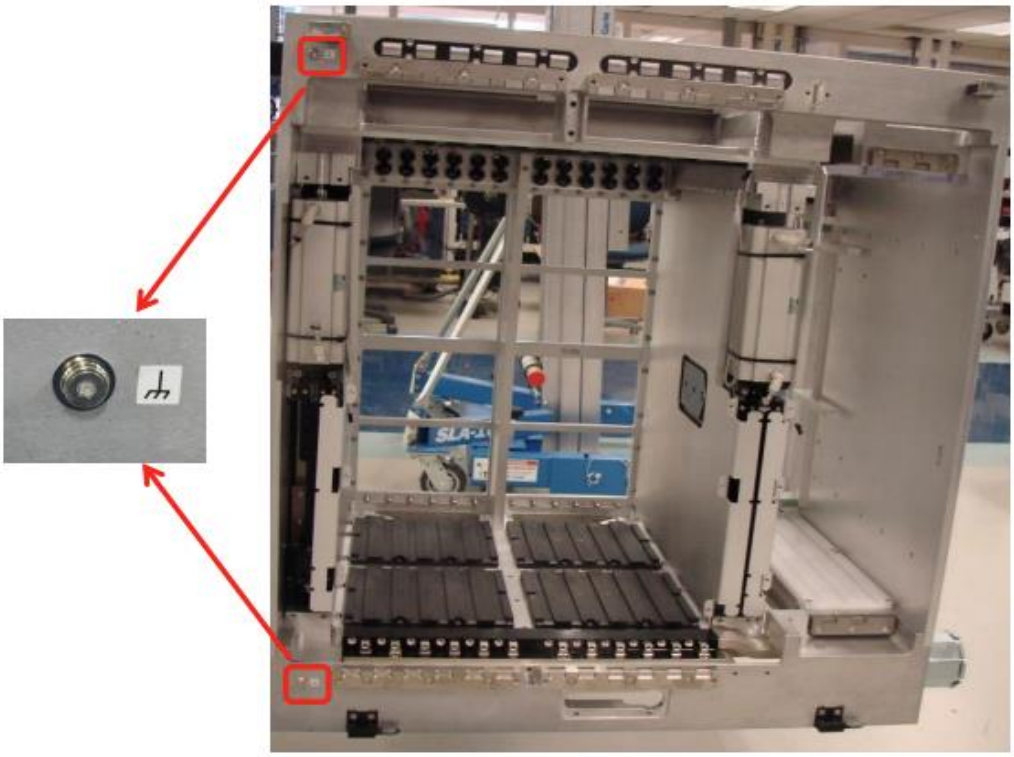

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
7	835-129-00	HDW FSTNR SNAP M ST	1
8	606-359-12	SCRW FLAT HEAD TORX M4X.7P/12MM SS W/NYLOK	1
9	479-133-15	LABEL,CHASSIS GROUN	1

MACHINE:

N/A

METHOD:
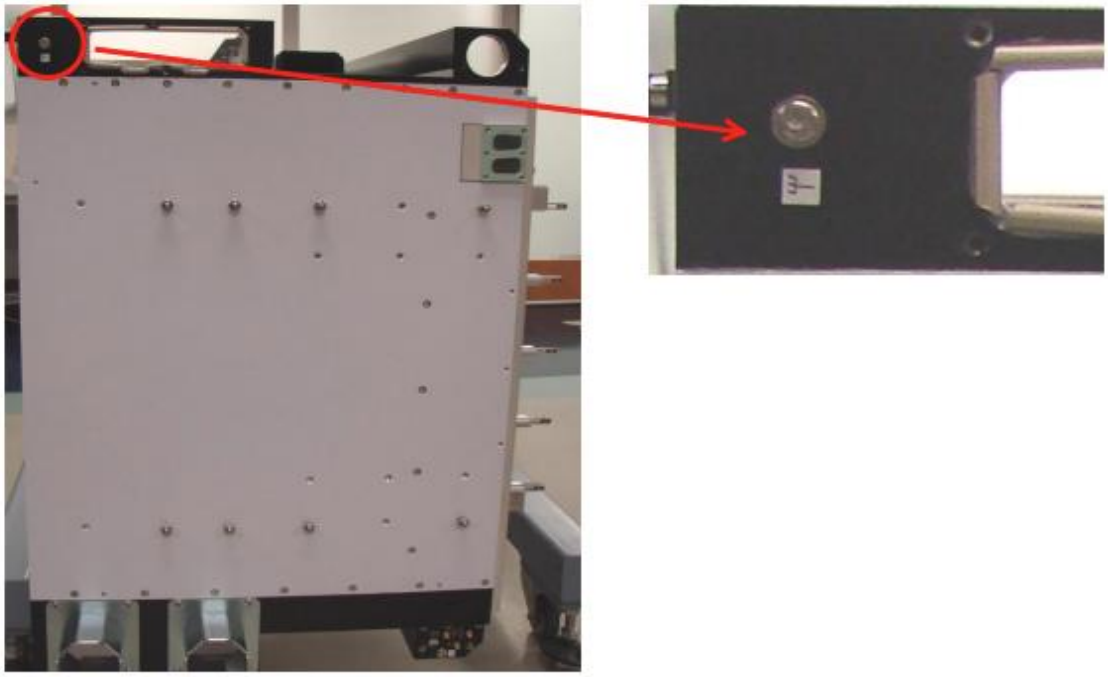
5.1 Take one ESD snap ring 835-129-00 as shown, and lock the snap ring to the position shown in the figure with one M4 flat head screw 606-359- 12.
The tool is a T20 Torx wrench and the torque of the fixing screw is 1.6 N·m.
5.2 Attach a ground label 479-133-15 next to the ESD snap ring.