Build Overview:

1 **TDR Panel Sub-Assembly Build & Install**
2 **Interlock Panel Sub-Assembly Build & Install**

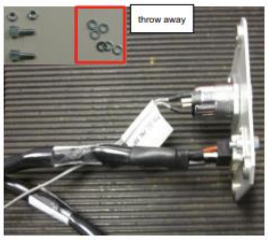

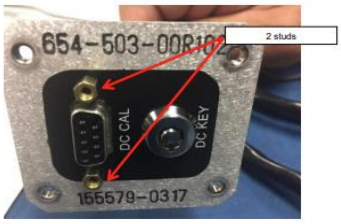

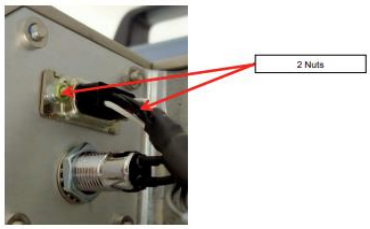

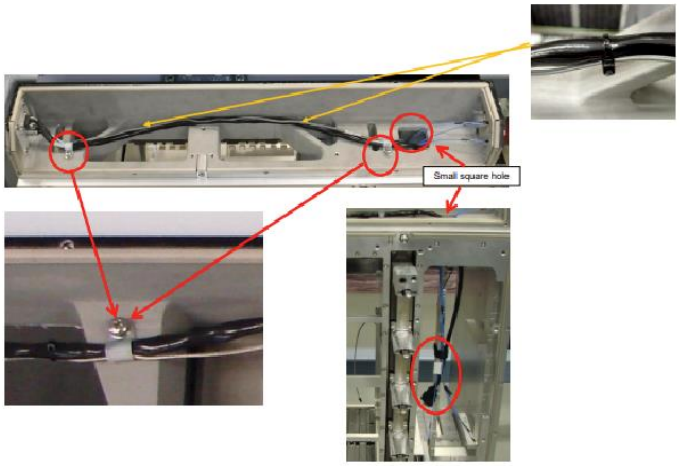

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by
	1	New Issue	JOSEPH AMAD

Prepared By:
JOSEPH R. AMAD
Manufacturing Engineer

Checked By:
IVAN NOWELL PANIQUE
Team Lead

Approved By:
SHERWIN ARIOSTE
Operations Manager

MAN:

CERTIFIED TECHNICIANS.

MATERIAL:

NO.	PART NO.	DESCRIPTION	QTY.
1	627-084-01	CABLE UF2 TDR COAX PANEL TELECOM WITH CONN	3
2	632-204-00	PLASTIC INSULATOR TDR PANEL SEAL OR GASKET	1
3	631-669-00	ALUMINUM PANEL TDR BRACKET OR MISC ARTICLE	1
4	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L W/ CONE WAS	7
5	835-129-00	HDW FSTNR SNAP M ST	1
6	606-359-12	SCRW FLAT HEAD TORX M4X.7P/12MM SS W/NYLOK	1
7	813-929-00	HDW VELCRO STRP 5/8	1
8	479-133-15	LABEL,CHASSIS GROUN	2
9	654-447-01	CABLE UF2 DC CAL SAFETY SWITCH TELECOM WITH CONN	1
10	652-811-00	CABLE UF2 DC CAL PANEL 12 SLOT TELECOM WITH CON	1
11	654-503-00	ALUMINUM, DC CAL PANEL, BRACKET OR MISC ARTICLE	1
12	938-104-01	4 INCH TIE WRAP BLA	3
13	606-359-20	SCRW FLAT HEAD TORX M4X.7P/20MM SS W/NYLOK	4
14	835-610-00	HDW CLAMP CBL .312	2

METHOD:

Flow chart of operation steps

BPM preparation
↓
Preparation Tools
↓
Prepare Materials
↓
Complete Operation
↓
Inventory Materials
↓
Operation Check
↓
Inventory tool

TOOL NAME	TORQUE VALUE
8mm socket wrench	0.7N.m
PH2 Cross Head	3.3 N·m
T20 torx wrench	1.6N·m.
19mm open-end wrench	NA
5mm socket wrench	0.19 N•m
PH2 cross head	1.6N·m.
15mm open-end	2.0 N.M

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
1	627-084-01	CABLE UF2 TDR COAX PANEL TELECOM WITH CONN	3
2	632-204-00	PLASTIC INSULATOR TDR PANEL SEAL OR GASKET	1

MACHINE:

N/A

METHOD:

Operation steps

1.1 Take 3 TDR cables (627-084-01).

a. Remove 3 shoulder washers from 3 wires and save them for later assembly.

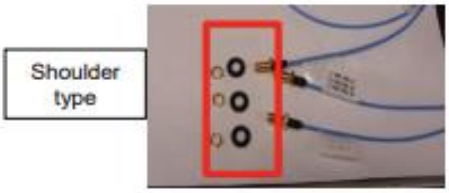

b. Remove 3 copper hexagon nut preservation tapes from 3 wires for subsequent assembly and use.

1.2 Take one small insulating board (632-204-00).

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
3	631-669-00	ALUMINUM PANEL TDR BRACKET OR MISC ARTICLE	1

MACHINE:

N/A

METHOD:

1.3 Take one TDR panel (631-669-00).

1.4 Turn the TDR panel upside down as shown in the figure and place the small insulating plate face up to ensure that the plane of the small insulating plate faces downward and the through holes are consistent with the panel holes.

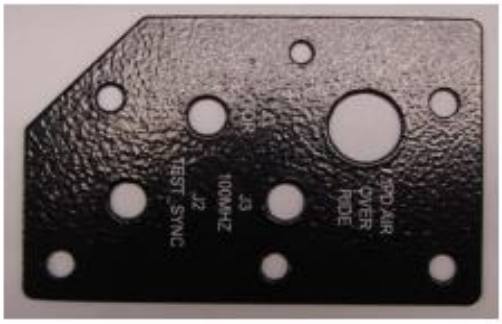

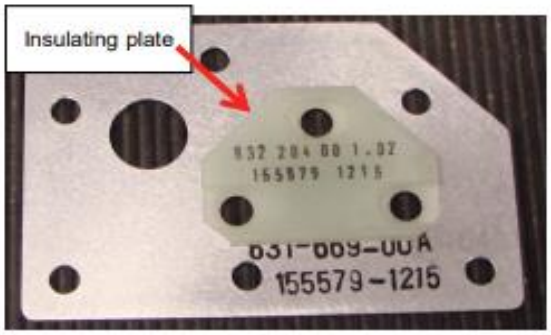

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

1.5 Take 3 TDR wires (627-084-01) and mark them.

a. Mark “TDR_PANEL_J1” on one end of the cable's panel, and mark “SUPPLN J50” on the back of the cable.

b. Mark “TDR_PANEL_J2” on one end of the cable's panel, and mark “SUPPLN J49” on the back of the cable.

c. Mark “TDR_PANEL_J3” on one end of the wire panel, and mark “SUPPLN J48” on the back end of the wire.

1.6 Thread the wire from the surface of the small insulating board. The wire penetrates into the corresponding hole of the panel according to the mark. The wire needs to be completely inserted into the slot of the small insulating board.

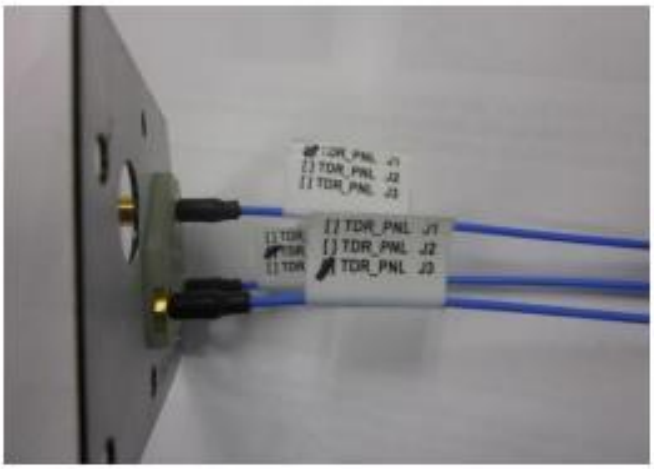

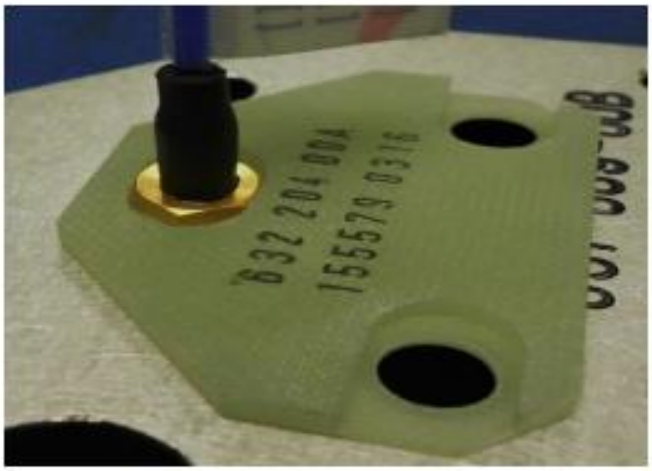

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

8mm socket wrench 0.7 N•m.

METHOD:

1.7 Install a shoulder washer in the connector hole of the panel surface, with the shoulder facing downward into the hole, then install the brass hexagon nut fixing wire, the tool is an 8mm socket wrench, The torque value is 0.7 N•m.

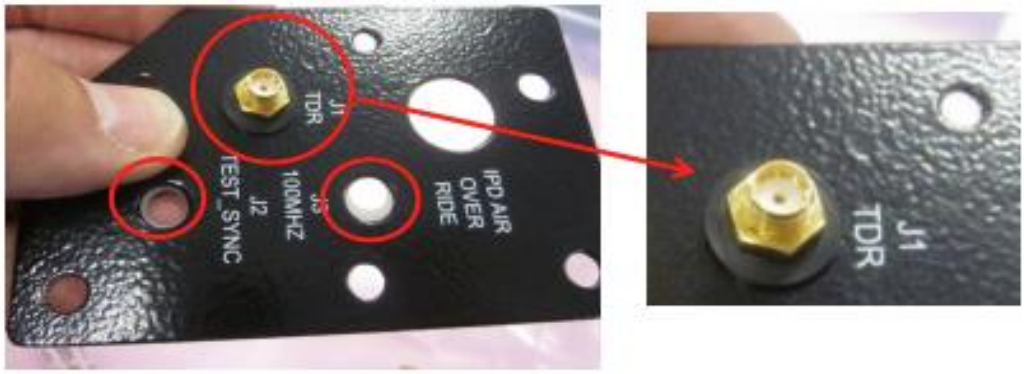

1.8 Repeat the above actions to install the other two wires.

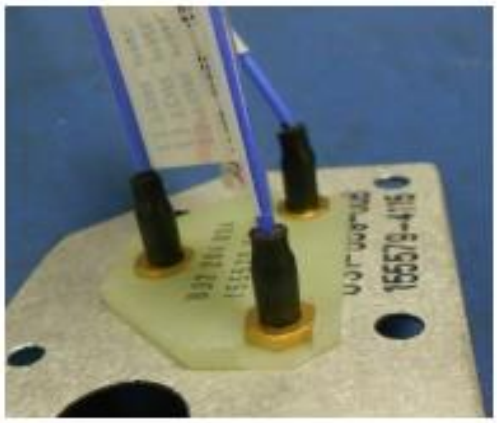

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
4	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L W/ CONE	5
5	835-129-00	HDW FSTNR SNAP M ST	1
6	606-359-12	SCRW FLAT HEAD TORX M4X.7P/12MM SS W/NYLOK	1
7	813-929-00	HDW VELCRO STRP 5/8	1

MACHINE:

PH2 Cross Head 3.3 N·m, T20 torx bit 1.6 N·m.

METHOD:

2.1 Fix the TDR panel on the T/H with 5 M5 screws (472-426-12) as shown in the figure. The tool is a PH2 cross head, the torque value is 3.3 N·m.

2.2 Install one knob (835-129-00) on the TDR panel as shown, and then install one M4 flat head screw (606-359-12), The tool is a T20 torx bit with a torque value of 1.6 N·m.

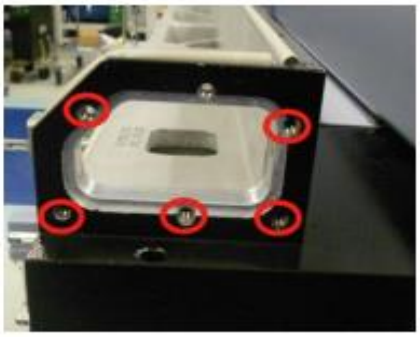

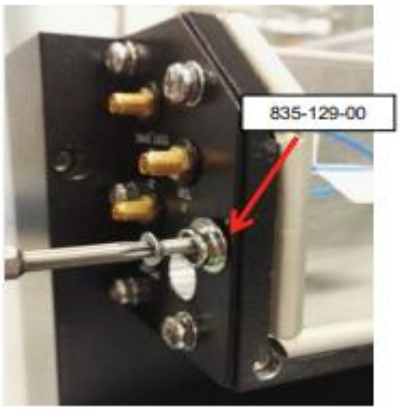

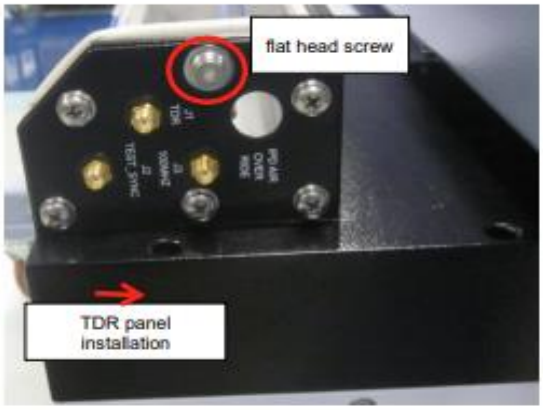

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
8	813-929-00	HDW VELCRO STRP 5/8	1

MACHINE:

N/A

METHOD:

2.3 Pass the other end of the wire through the small square hole as shown, and the wire is perpendicular to the backplane.
Use a black cable tie (813-929-00) to temporarily tie the wire to the T/H frame.

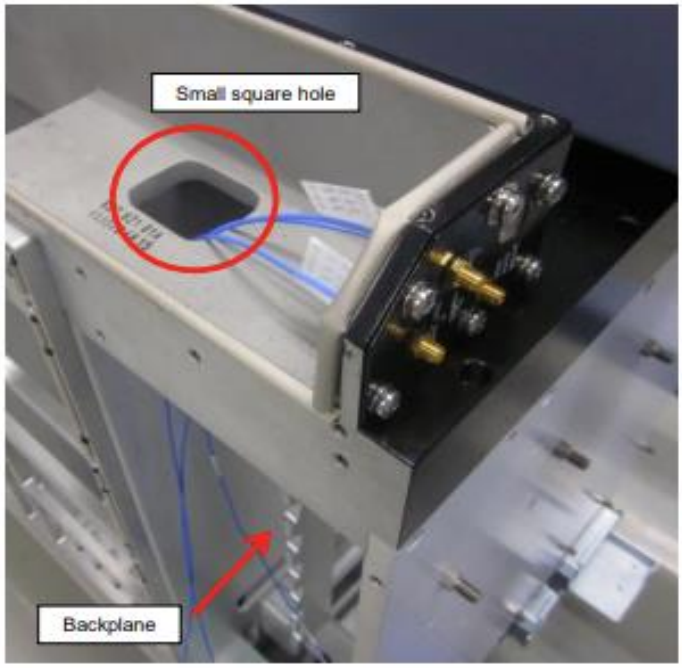

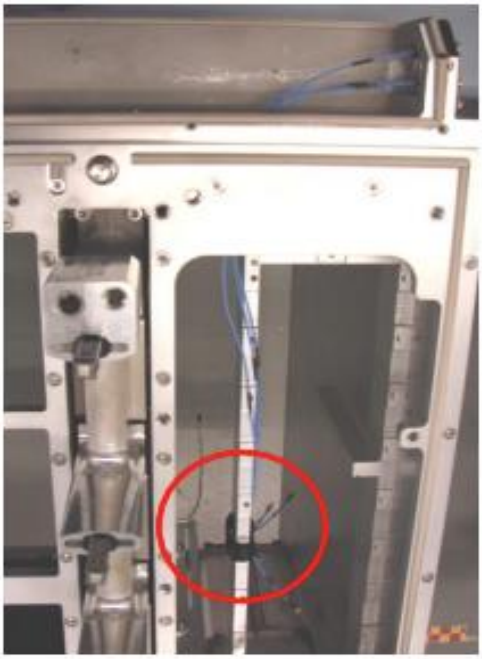

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
9	479-133-15	LABEL,CHASSIS GROUN	1

MACHINE:

N/A

METHOD:

2.4 Install 1pcs grounding labels (479-133-15) as shown in the figure.

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
10	654-447-01	CABLE UF2 DC CAL SAFETY SWITCH TELECOM WITH CONN	1
11	652-811-00	CABLE UF2 DC CAL PANEL 12 SLOT TELECOM WITH CONN	1
12	654-503-00	ALUMINUM, DC CAL PANEL, BRACKET OR MISC ARTICLE	1
13	938-104-01	4 INCH TIE WRAP BLA	1

MACHINE:

N/A

METHOD:

3.1 Take one key switch wire (654-447-01) as shown in the figure.
3.2 Take 1 line (652-811-00).
3.3 Take the DC panel (654-503-00).
3.4 Take a set of keys from the 652-811-00 line package, and tie a cable tie 938-104-01 to the handle as shown in the figure.

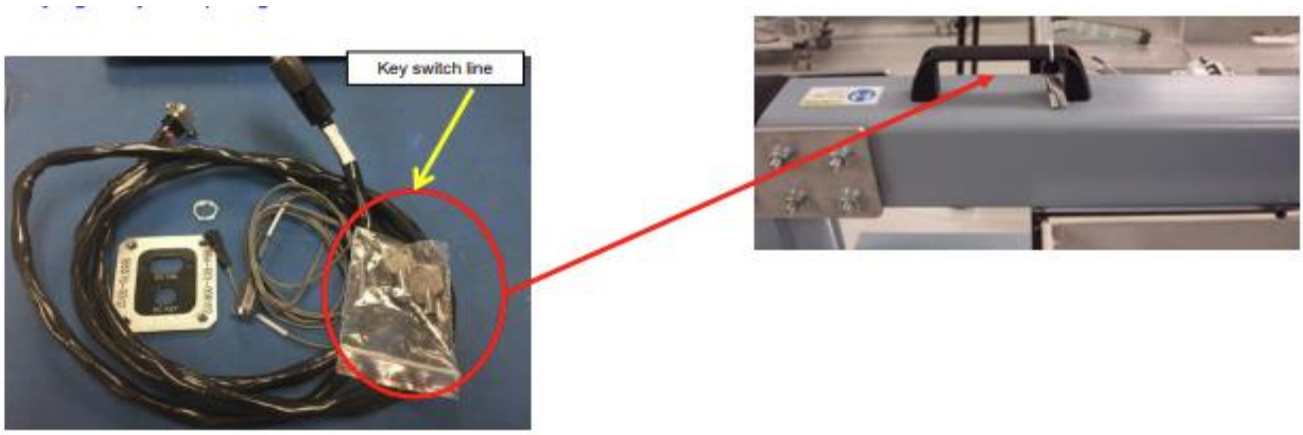

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

15mm open-end, 2.0 N.M

METHOD:

3.5 Install the key switch wire (654-447-01) on the panel, first tighten the nut manually, then use a 15mm open-end wrench to turn the nut. Use torx 2.0 N.M

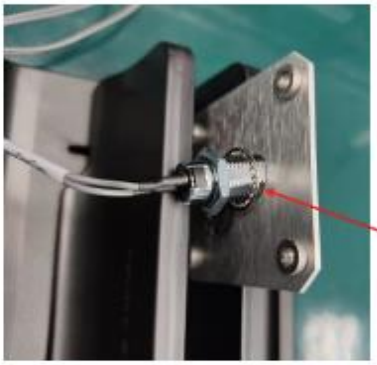

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

5mm socket wrench 0.19 N•m

METHOD:

3.6 Remove the gasket at the rear of the wire (652-811-00) connector as shown and discard.

3.7 Remove the stud on the front of the wire (652-811-00) and save the hex nut.

3.8 Install the cable connector from the rear of the panel and reinstall the stud,
use a 5mm sleeve to fix the nut to 0.19 N·m.

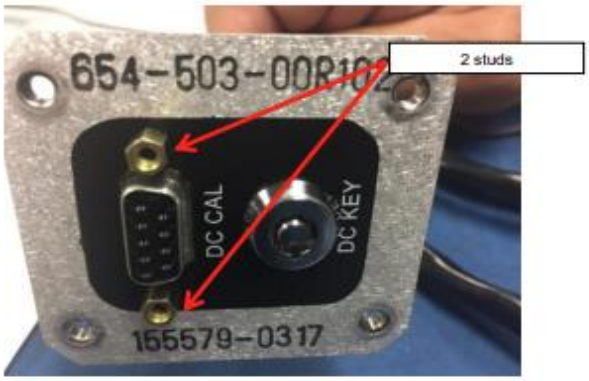

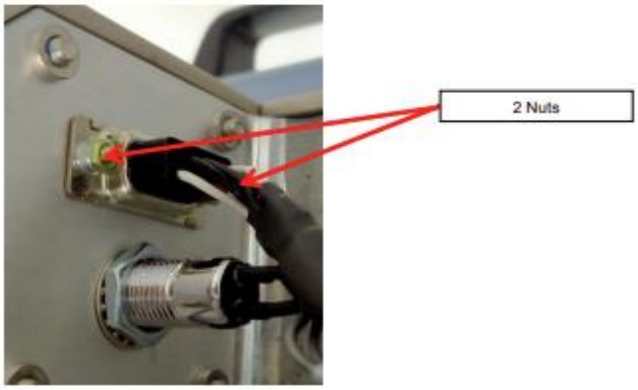

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
14	606-359-20	SCRW FLAT HEAD TORX M4X.7P/20MM SS W/NYLOK	4

MACHINE:

T20 Torx wrench 1.6 N•m

METHOD:

3.9 Install the panel from the inside of the T/H to the T/H frame as shown in the figure,
and fix it with four M4 screws (606-359-20).
The tool is a T20 Torx wrench. 1.6 N•m
After locking, use a marker to make a mark on the nut and lock lever on the back.

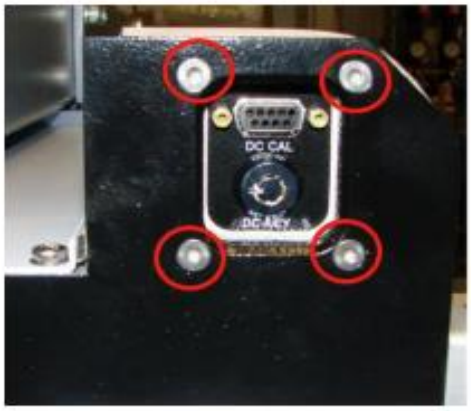

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
15	835-610-00	HDW CLAMP CBL .312	2
16	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L W/ CONE W	2
17	938-104-01	4 INCH TIE WRAP BLA	2

MACHINE:

PH2 cross head 1.6 N·m.

METHOD:

3.10 Install 2 plastic clips (835-610-00) as shown in the figure, thread through the plastic clips, and then fix them with M5 screws (472-426-12),
This tool is a cross -headed PH2 torque value of 1.6 N · m.
3.11 Pass the wire through the small square hole to the backplane as shown in the figure.
3.12 Use two cable ties (938-104-01) to tie the switch wire and the black wire to the positions shown in the figure.
3.13 Use the original cable ties to tie the wires on the back panel together.

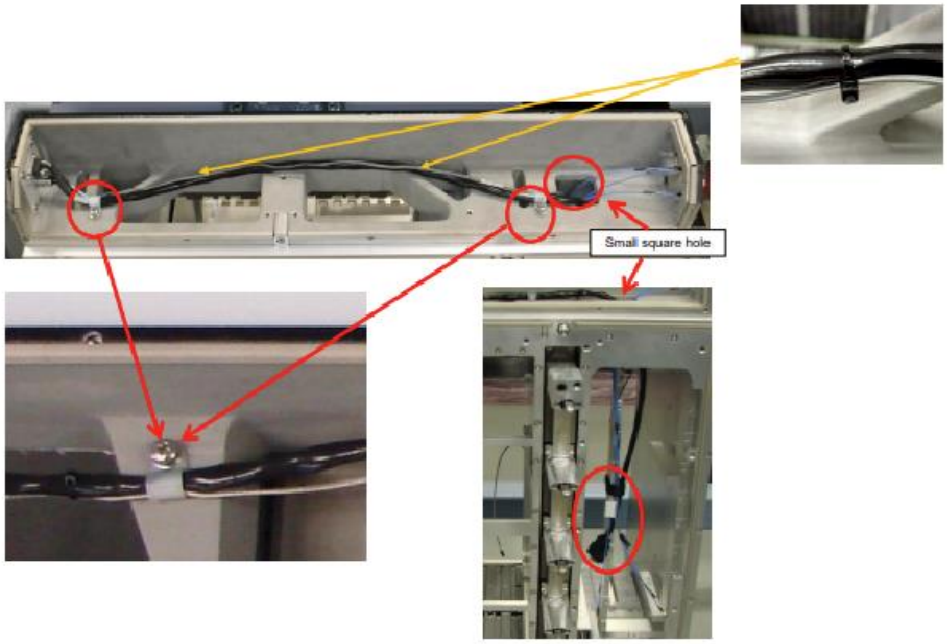

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

Matters needing attention

1. Do ESD and protective safety measures.
2. Be careful during the assembly process so as not to scratch the surface of the parts.
3. After assembly, check the assembled parts for defects and leak-free operation.