Build Overview:

1. **Circuit Breaker Sub Assembly Build & Install**
2. **Scope Panel Sub Assembly Build & Install**
3. **Cable Install & Routing - Signal cables**
4. **EMO Button Install**
5. **Door Switch Install**
6. **Thermal EMO Switch Install**
7. **Thermal switch Cable Install**

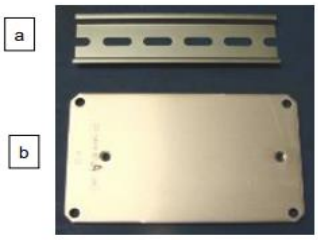

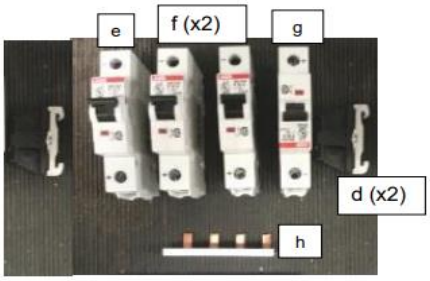

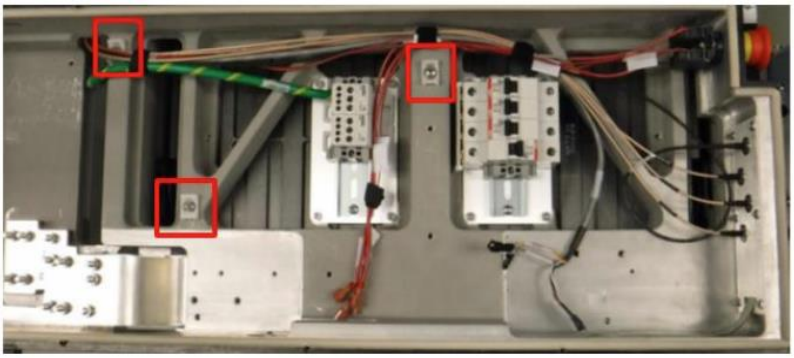

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by
	1	New Issue	JOSEPH AMAD

Prepared By:
JOSEPH R. AMAD
Manufacturing Engineer

Checked By:
IVAN NOWELL PANIQUE
Team Lead

Approved By:
SHERWIN ARIOSTE
Operations Manager

MAN: CERTIFIED TECHNICIANS.

MATERIAL:

NO.	PART NO.	DESCRIPTION	QTY.
1	632-066-04	FORGED OR STAMPED STEEL DIN RAIL 35MM X 7.5MM X 125MM LONG	1
2	650-468-00	ALUMINUM UF2 12 SLT CIRCULT BREAKER PLATE BRACKET	1
3	406-502-06	SCRW PAN HEAD TORX M5X.8P/6MM SS W/NYLOK	4
4	603-393-40	END BRACKET TERMBLOCK 9.5MM GRAY	4
5	653-415-01	CIRCPROTCT MINIATURE BREAKER 40A 3 POLE 500VDC Z CURVE DIN RAIL	1
6	653-525-00	CIRCTPROT MINIATURE CIRCUIT BREAKER -S200-1P-C-20 A	2
7	653-540-00	CIRCTPROT MINIATURE CIRCUIT BREAKER -S200-1P-C-63 A	1
8	601-673-50	CN BUSBAR 4 PINS F/ 4X1 POLE LENGTH 68MM	1
9	632-066-04	FORGED OR STAMPED STEEL DIN RAIL 35MM X 7.5MM X 125MM LONG	1
10	650-468-00	ALUMINUM UF2 12 SLT CIRCULT BREAKER PLATE BRACKET	1
11	357-887-00	CN ONE PHASE POWER DISTRIBUTION BLOCK 1 IN / 6 OUT 80A 600V DIN RAIL	2
12	406-502-12	SCRW PAN HEAD TORX M5X.8P/12MM SS W/NYLOKB	8
13	631-668-03	ALUMINUM PANEL POWER BRACKET OR MISC ARTICLE	1
14	627-090-02	CABLE UF2 SCOPESYNC PANEL TELECOM WITH CONN	3
15	606-359-35	SCRW FLAT HEAD TORX M4X.7P/35MM SS W/NYLO	6
16	813-929-00	HDW VELCRO STRP 5/8	2
17	659-051-00	PLASTIC, LABEL EMERGENCY OFF, EMO PANEL, LABEL	1
18	801-643-01	HDWR SW OPERATOR TU	1
19	801-515-02	SW CONTACT BLOCK 1F	1
20	801-541-02	SW CONTACT BLOCK,NO	1
21	629-677-00	CABLE UF2 EMO T/H THERM BRKR LINK TELECOM WITH CONN	2
22	655-542-02	CABLE UF2 TH INT EMO_LEDS_INTLK SM CONN TELECOM WITH CONN	1
23	813-929-01	HDW VELCRO STRP 5/8	3
24	652-809-00	CABLE UF2 GROUND JUMPER SP6 TO TERMBLK TELECOM WITH CONN	1
25	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L W/ CONN	5
26	938-195-01	CABLE TIE MOUNT 1/4	3
27	652-810-00	CABLE UF2 BUS TO TERMBLK 48VRET SOLID PIN TELECOM	1
28	938-102-00	TIE WRAP 6.5 X 3/16"	1
29	652-441-02	CABLE UF2 BUS TO CB 48V SINGLE SOLID PIN TELECOM	1
30	655-789-00	SW SWITCH SNAP ACT SPDTX2 15A 125V	1
31	659-629-00	CABLE UF2 12SLT_DOOR_INTLK_SMC ALT KEY TELECOM W CONN	1
32	659-797-00	ALUMINUM INTERLOCK SWITCH PLATE BRACKET OR MISC ARTICLE	1
33	470-708-06	SCRW W/WSHR 6-32X3/8" STL/	2
34	671-989-00	MECHANICAL, TH DOOR STOP PLATE, FOR SEMI TEST	1
35	702-331-02	RED OPTO.LED.	1
36	650-157-00	CABLE UF2 LED TH POWER JUMPER TELECOM WITH CONN	1
37	470-626-12	SCRW FLAT HEAD TORX M5X.8P/12MM SS W/NYLOK	4
38	812-117-00	SW THERMO 70C OPEN	2
39	470-353-01	NUT KEPS 6-32FL RIM CONL W	2
40	652-515-00	ALUMINUM PLATE THERMAL SWITCH BRACKET OR MISC ARTICLE	1

METHOD:

Flow chart of operation steps

BPM preparation

Preparation Tools

Prepare Materials

Complete Operation

Inventory Materials

Operation Check

Inventory tool

MACHINE:

TOOL NAME	TORQUE VALUE
T20 Torx wrench	1.6 N.m
T20 Torx wrench	3.3 N.m
T15 Torx wrench	0.7 N.m
Flate-blade screwdriver	0.7 N.m
Flate-blade screwdriver	1.1 N.m
8mm socket wrench	0.5 N.m
8mm socket wrench	0.19 N.m
10mm socket wrench	5.6 N.m
16mm socket wrench	1.05 N.m
22mm socket wrench	2.2 N.m
PH2 Phillips screwdriver	0.7 N.m
PH2 Phillips screwdriver	1.1 N.m
PH2 Phillips screwdriver	1.6 N.m
PH2 Phillips screwdriver	2.8 N.m
PH2 Phillips screwdriver	3.3 N.m
T25 Torx wrench	3.3 N.m

SCOPE

1. Scope of application

This document applies to UF PLUS Test Head Build Section 4 assembly

Caution:

1. When you see the following icon, you must use gloves to perform this step.

MAN:

CERTIFIED OPERATOR, TECHNICIAN

ITEM	PART NUMBER	DESCRIPTION	QTY
1	632-066-04	FORGED OR STAMPED STEEL DIN RAIL 35MM X 7.5MM X 125MM LONG	1
2	650-468-00	ALUMINUM UF2 12 SLT CIRCULT BREAKER PLATE BRACKET OR MISC AR	1
3	406-502-06	SCRW PAN HEAD TORX M5X.8P/6MM SS W/NYLOK	2

MACHINE:

N/A

METHOD:

1.1 Take the following materials:

a. Take 1 slide rail (632-066-04).

b. Take one bracket (650-468-00).

c. Take two M5 screws (406-502-06).

d. Take two tailstock wiring boards (603-393-40).

e. Take one CB 40A (653-415-01).

f. Take 2 CB 20A (653-525-00).

g. Take one CB 63A (653-540-00).

h. Take one Busbar (601-673-50).

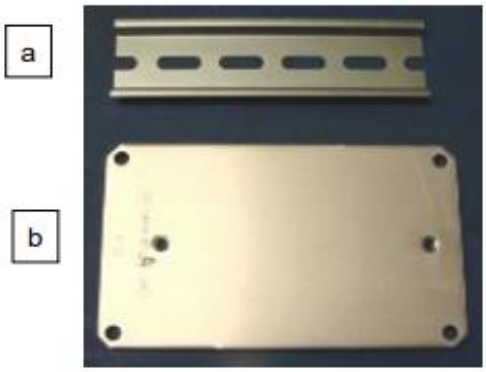

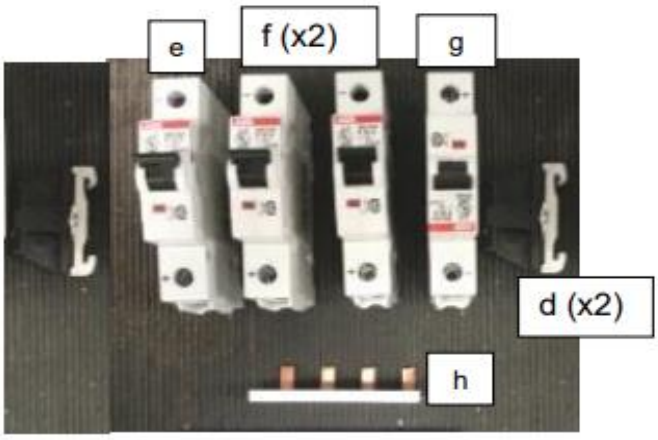

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

T20 Torx wrench 3.3 N·m

METHOD:

1.2 Install the slide rail (632-066-04) on the bracket (650-468-00), fix it with 2 M5 screws (406-502-06), the tool is T20 Torx wrench,The torque value is 3.3 N·m. Ensure that the edge of the slide rail is flush with the edge of the bracket.

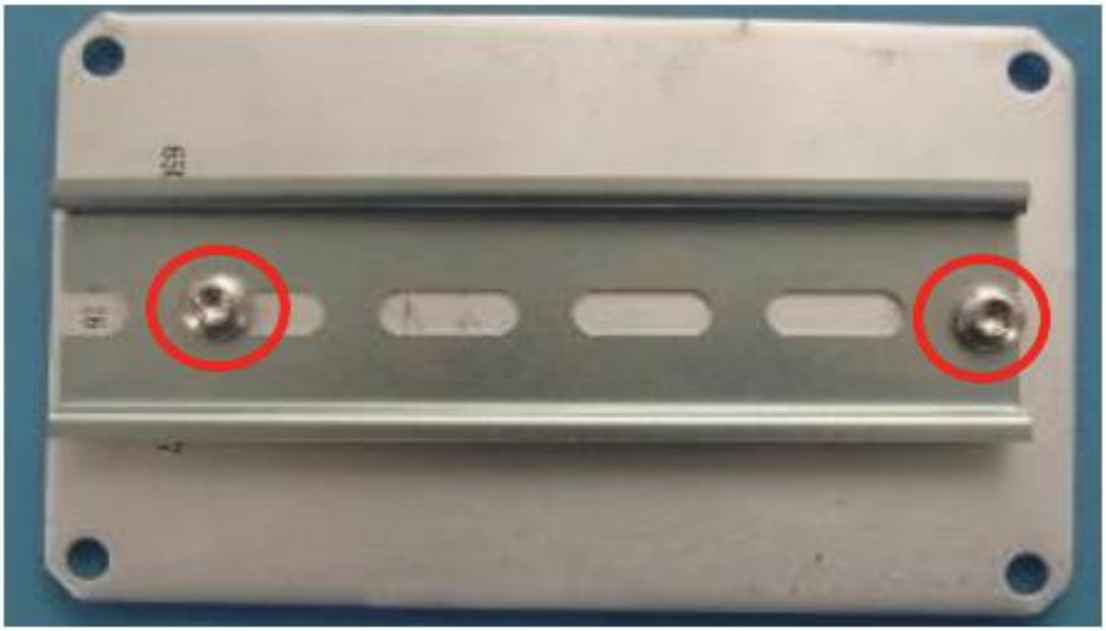

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
4	603-393-40	END BRACKET TERMBLOCK 9.5MM GRAY	2

MACHINE:

Flat-blade screwdriver 0.7 N·m

METHOD:

1.3 At a distance of 2 mm from the flush end of the bracket and the slide rail,
install a tailstock wiring board (603-393-40),the fixing screw tool is a flat-blade screwdriver,
The torque value is 0.7 N·m.

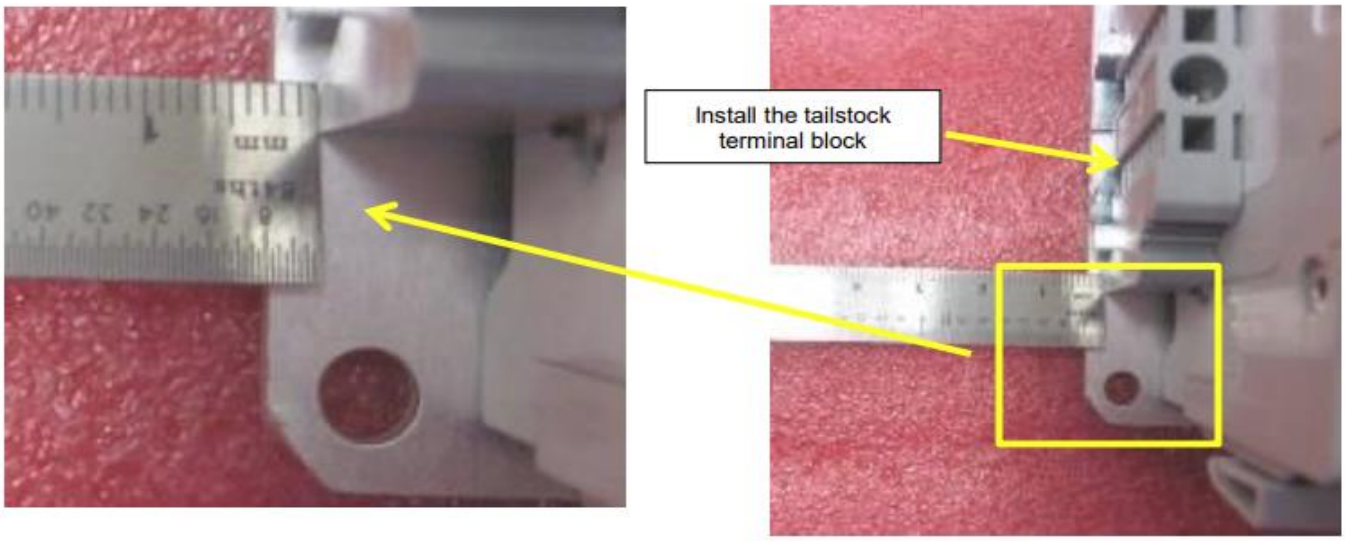

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
5	653-415-01	CIRCPROTCT MINIATURE BREAKER 40A 3 POLE 500VDC Z CURVE DIN R	1
6	653-525-00	CIRCTPROT MINIATURE CIRCUIT BREAKER - S200 - 1P - C - 20 A	2
7	653-540-00	CIRCPROCT MINIATURE CIRCUIT BREAKER - S200 - 1P - C - 63 A	1

MACHINE:

Flat-blade screwdriver 0.7 N·m

METHOD:

1.4 Install the circuit breaker on the right side of the tail connector, follow the following assembly sequence as shown in the figure and pay attention to the direction of assembly.

a. Install one CB 16A (653-415-01) on the right end of the tailstock wiring board.

b. Install two CB 20A (653-525-00) on the right side of the circuit breaker 40A.

c. Install a reverse CB 63A (653-540-00) on the right side of the circuit breaker 20A.

Note: Make sure that all circuit breakers are in the "ON" state. As shown in the figure, the red area indicates that the circuit breaker is in the "ON" state.

1.5 Install a tailstock wiring board (603-393-40) next to the rightmost circuit breaker.

The fixing screw tool is a flat-blade screwdriver with a torque value of 0.7 N·m.

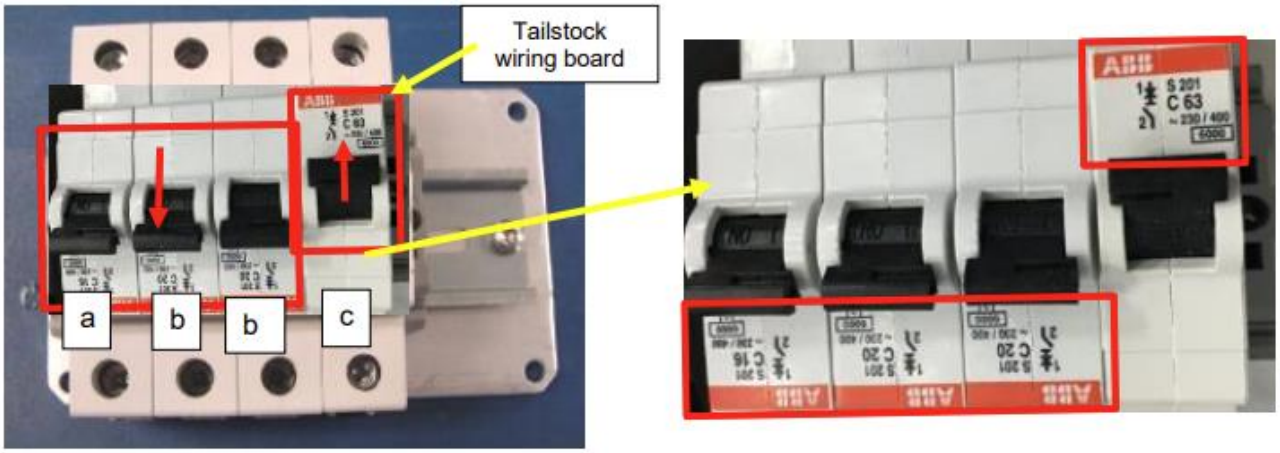

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
8	601-673-50	CN BUSBAR 4 PINS F/ 4X1 POLE LENGTH 68MM	1

MACHINE:

PH2 Phillips screwdriver 2.8 N·m

METHOD:

1.6 Install a Busbar (601-673-50) at the CB port as shown in the figure, and use a PH2 Phillips screwdriver to fix the screw to 2.8 N·m. A total of four locations. The three on the left are inserted into the upper hole, and the rightmost one is inserted into the lower hole.

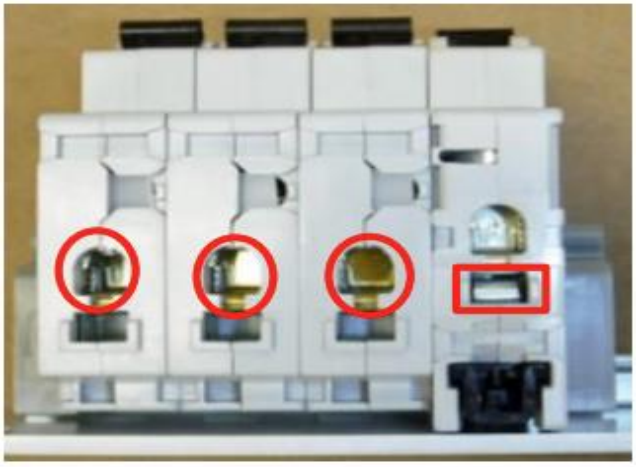

1.7 The components of the circuit breaker are assembled as shown.

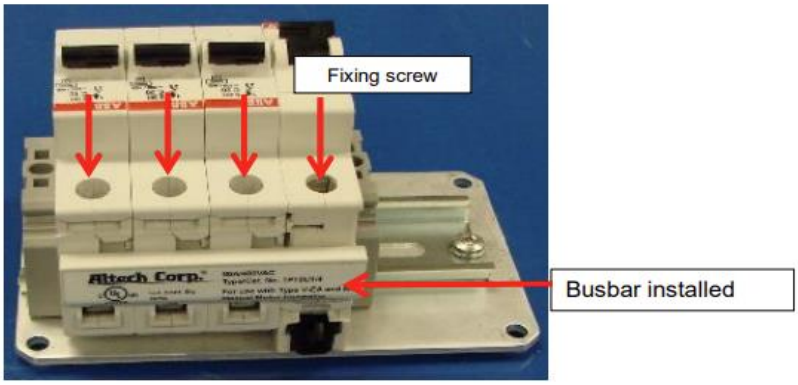

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
9	632-066-04	CIRCPROTCT MINIATURE BREAKER 40A 3 POLE 500VDC Z CURVE DIN R	1
10	650-468-00	CIRCTPROT MINIATURE CIRCUIT BREAKER - S200 - 1P - C - 20 A	1
11	406-502-06	CIRCPROCT MINIATURE CIRCUIT BREAKER - S200 - 1P - C - 63 A	2

MACHINE:

N/A

METHOD:

1.8 Take the following materials:

a. Take 1 slide rail (632-066-04).

b. Take one bracket (650-468-00).

c. Take two M5 screws (406-502-06).

d. Take two tailstock wiring boards (603-393-40).

e. Take 2 power distribution modules (357-887-00).

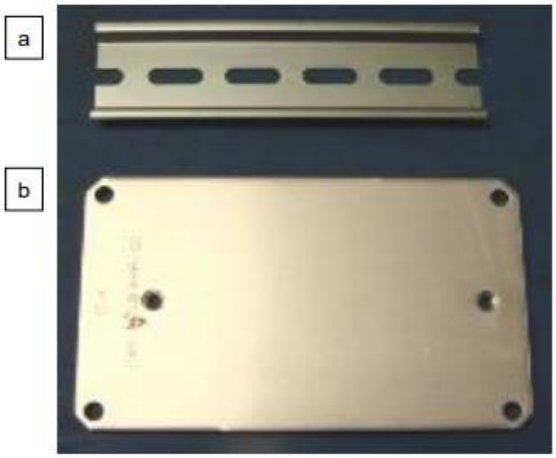

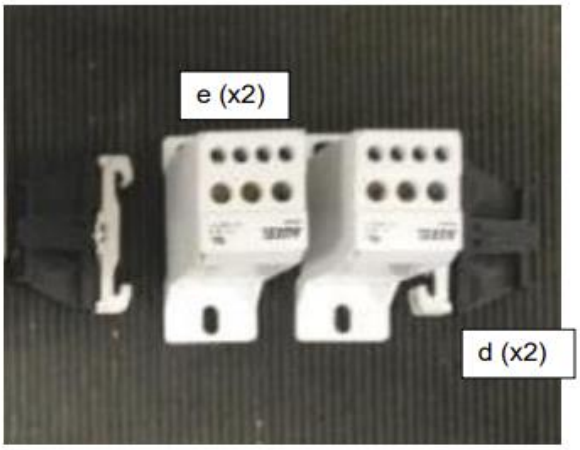

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

T20 Torx wrench 3.3 N·m

METHOD:

1.9 Install the slide rail (632-066-04) on the bracket (650-468-00), fix it with 2 M5 screws (406-502-06), the tool is T20 Torx wrench, The torque value is 3.3 N·m.
Ensure that the edge of the slide rail is flush with the edge of the bracket.

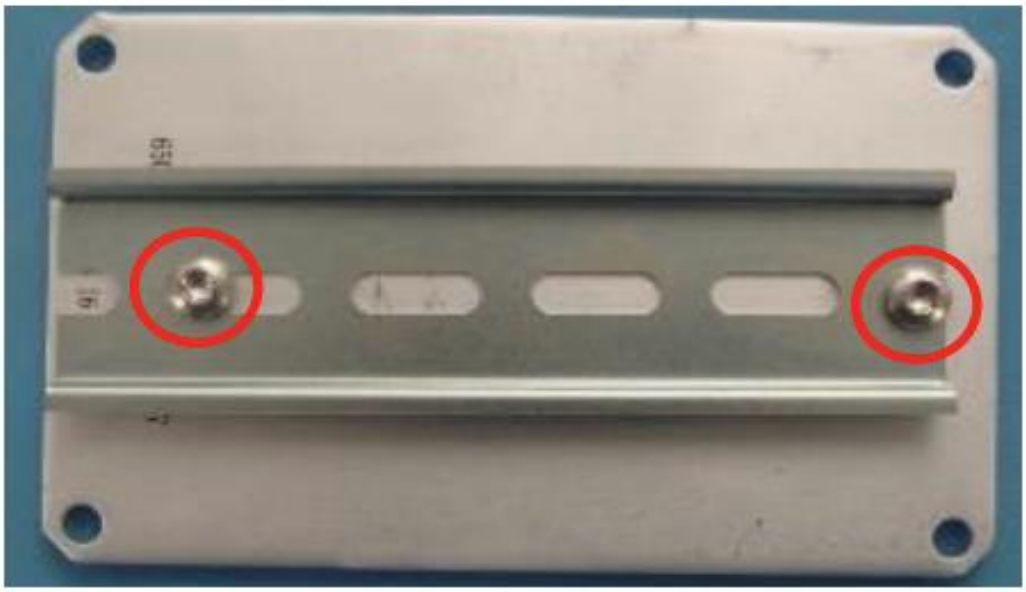

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
12	603-393-40	END BRACKET TERMBLOCK 9.5MM GRAY	2

MACHINE:

Flat-blade screwdriver 0.7 N·m

METHOD:

1.10 At a distance of 2mm from the flush end of the bracket and the slide rail,
install a tailstock wiring board (603-393-40), the fixing screw tool is a flat-blade screwdriver,
The torque value is 0.7 N·m.

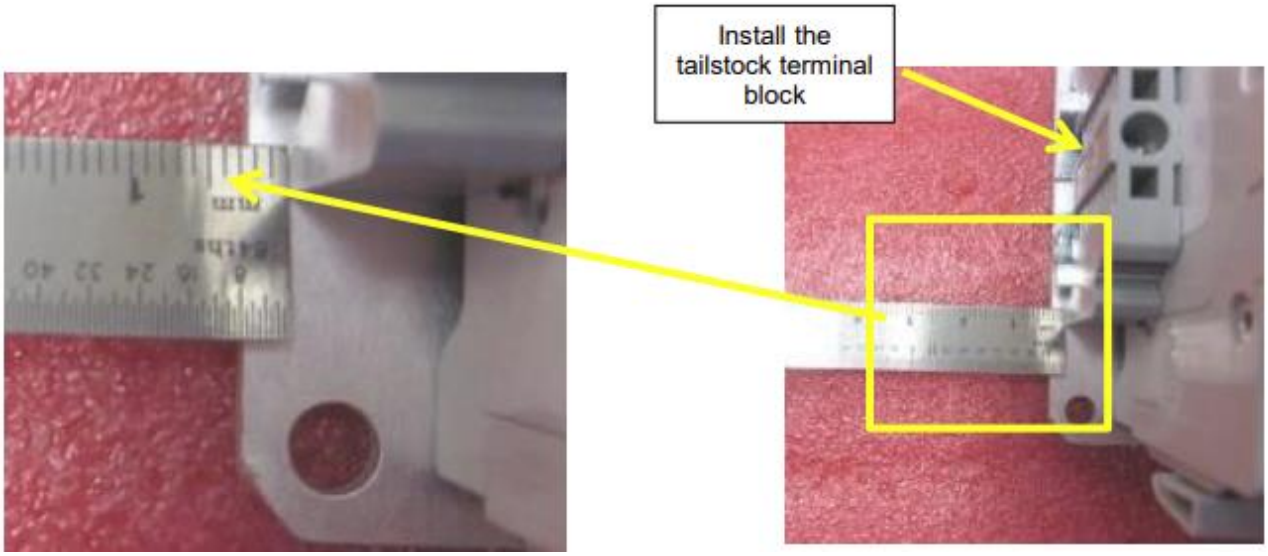

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
13	357-887-0	CN ONE PHASE POWER DISTRIBUTION BLOCK 1 IN /6 OUT 80A 600V DI	2

MACHINE:

Flat-blade screwdriver 0.7 N·m

METHOD:

1.11 Install two power distribution modules (357-887-00) on the right side of the tailstock connector, pay attention to the direction of the power distribution module as shown in the figure.

1.12 Install a tailstock wiring board (603-393-40) next to the rightmost power distribution module.

The fixing screw tool is a flat-blade screwdriver, and the torque value is 0.7 N·m.

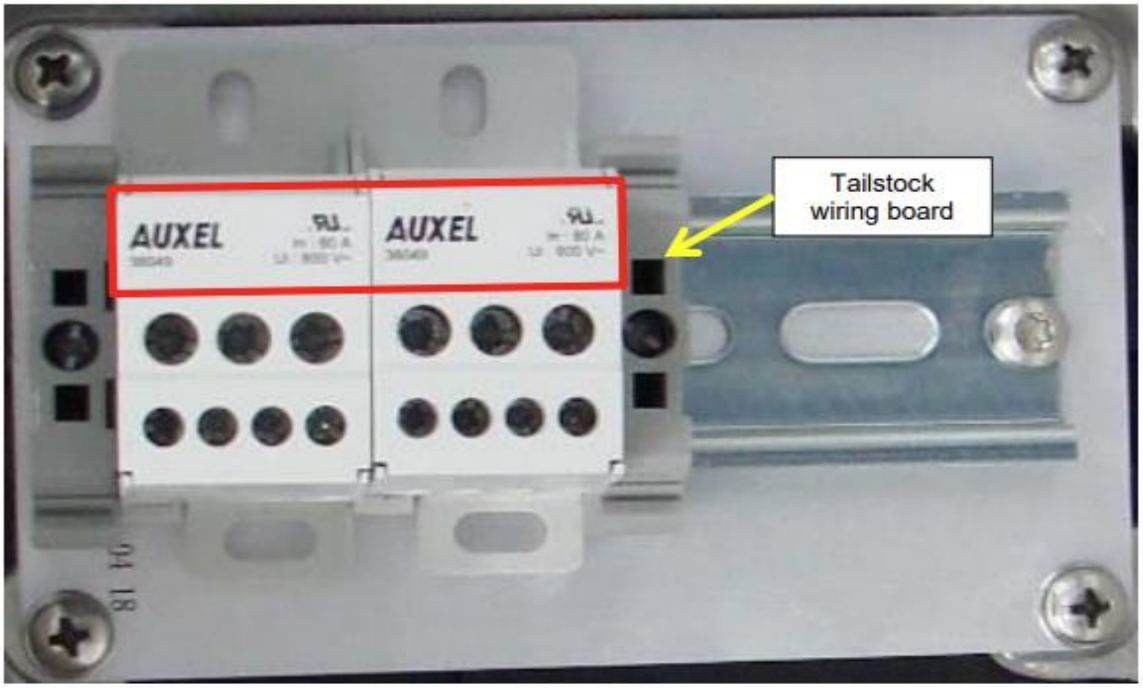

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
14	406-502-12	SCRW PAN HEAD TORX M5X.8P/12MM SS W/NYLOK	8

MACHINE:

T20 Torx with 3.3 N·m

METHOD:

1.13 Rotate the T/H direction as shown.
1.14 Install the power distribution module components as shown in the figure,
pay attention to the direction when installing.
Use four M5 screws (406-502-12) to lock onto the T/H frame.
Use the T20 Torx to fix the screw with a torque value of 3.3 N·m.

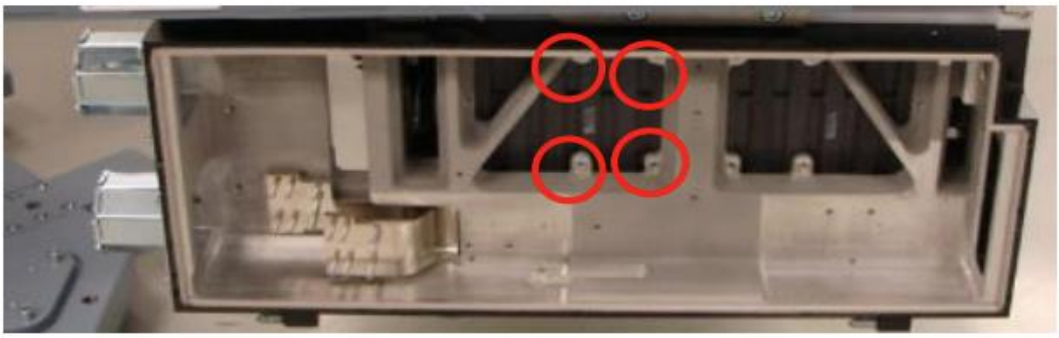

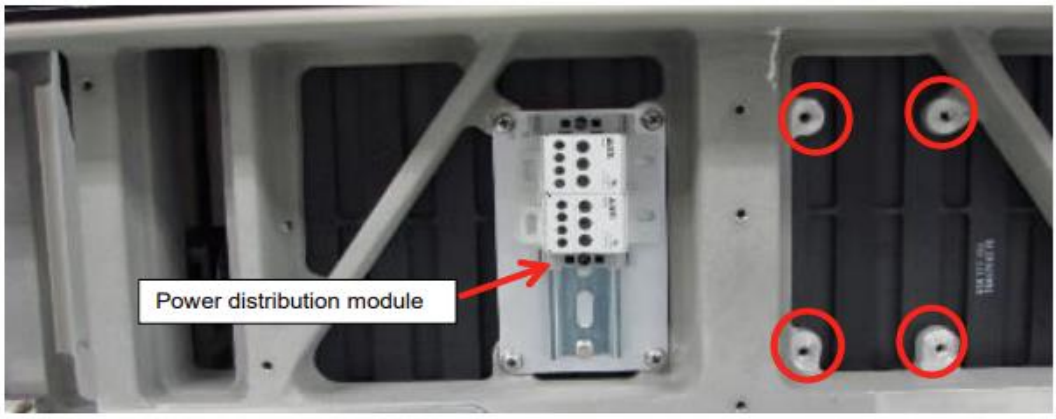

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

T20 Torx with 3.3 N·m

METHOD:

1.15 Install the circuit breaker components as shown in the figure, please pay attention to the direction when installing.
Use four M5 screws (406-502-12) to lock onto the T/H frame.
Use the T20 Torx to fix the screw with a torque value of 3.3 N·m.

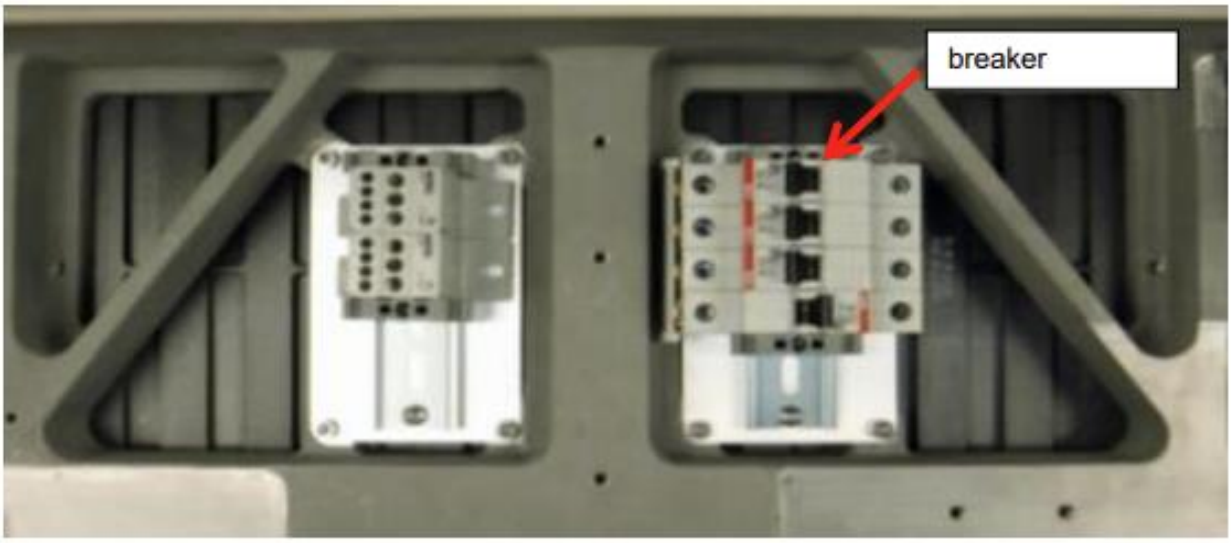

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
15	631-668-03	ALUMINUM PANEL POWER BRACKET OR MISC ARTICLE	1
16	627-090-02	CABLE UF2 SCOPESYNC PANEL TELECOM WITH CONN	3

MACHINE:

N/A

METHOD:

2.1 Take the following materials as shown:

a. Take one panel (631-668-03).

b. Take 3 wires (627-090-02).

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

2.2 Mark the labels of the lines in the following order as shown:

a. Mark "J4" on one end of the line and "J64" on the other end.

b. Mark "J3" on one end of the line and "J63" on the other end.

c. Mark "J2" at one end of the line and "J62" at the other end.

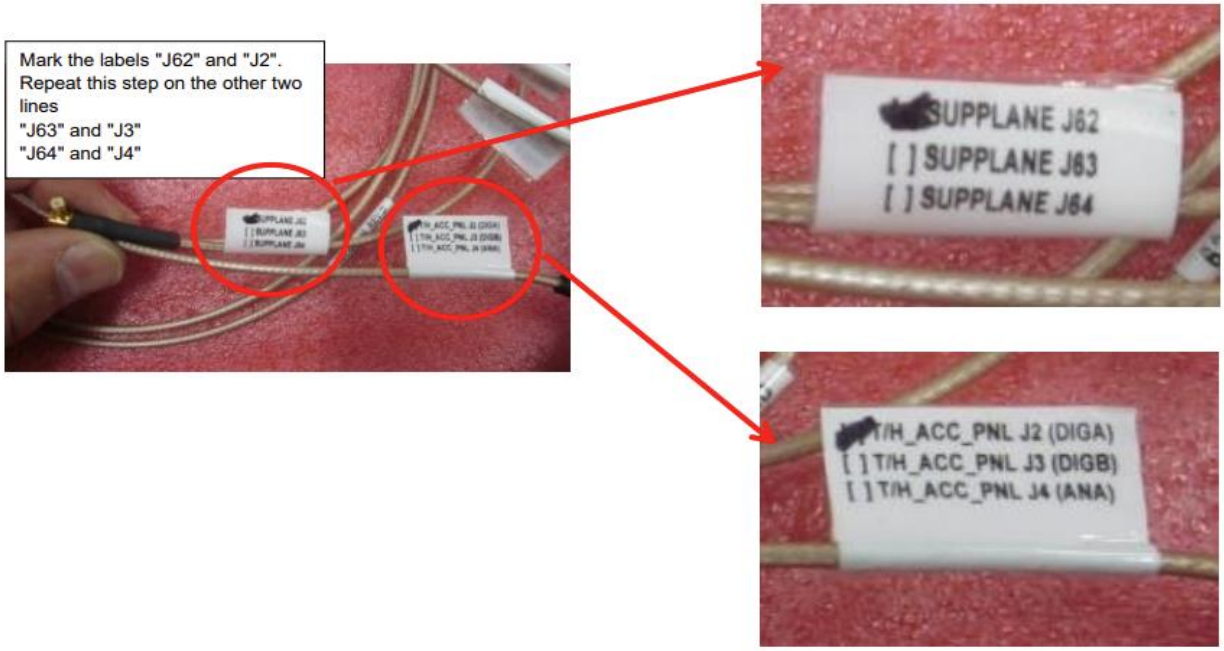

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

16mm socket wrench 1.05 N·m

METHOD:

2.3 Remove the nut and star washer from the connector.

2.4 Insert 3 wires (627-090-02) into the panel (631-668-03) according to the label

Note: When inserting the wire, make sure that the sleeve of the connector is flush with the panel surface.

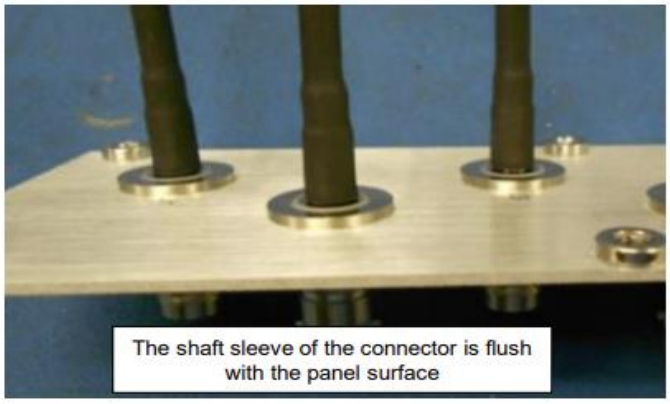

2.5 Put a star washer between the nut and the panel, use a 16mm socket wrench to fix the connector, and the torque value is 1.0 N·m (9.3 in-lbs). There are three connectors in total.

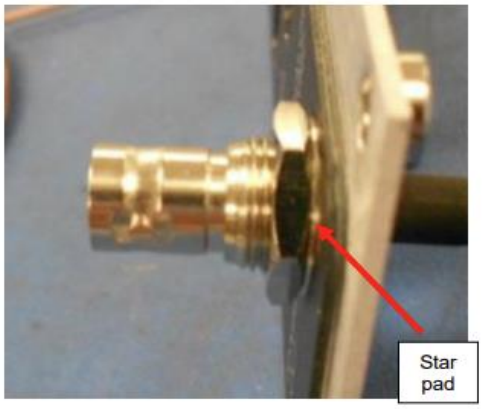

Safety Tips: N/A

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

2.6 The panel is assembled as shown.

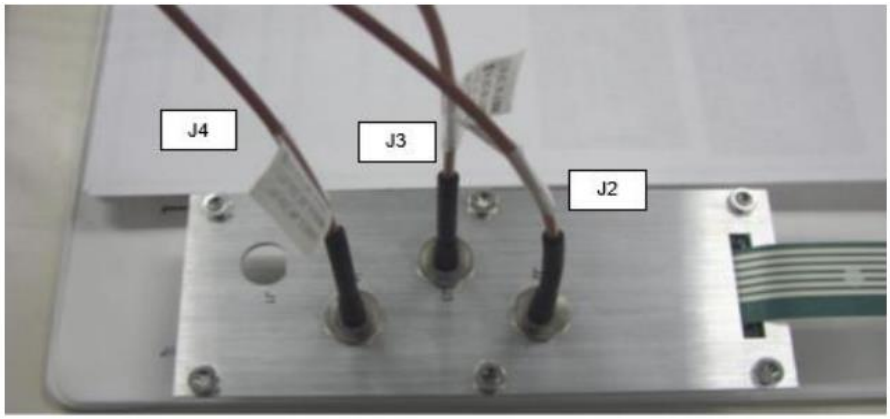

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
17	606-359-35	SCRW FLAT HEAD TORX M4X.7P/35MM SS W/NYLOK	6
18	813-929-00	HDW VELCRO STRP 5/8	3

MACHINE:

T20 Torx wrench 1.6 N·m

METHOD:

3.1 Install the panel to the T/H frame as shown in the figure, install 6 M4 screws (606-359-35), and fix it with the T20 Torx wrench, The torque value is 1.6 N·m.

3.2 Carefully route the wire around the circuit breaker as shown in the figure, and place the wire along the T/H frame without bending the wire. Tie it with 1 tie (813-929-00).

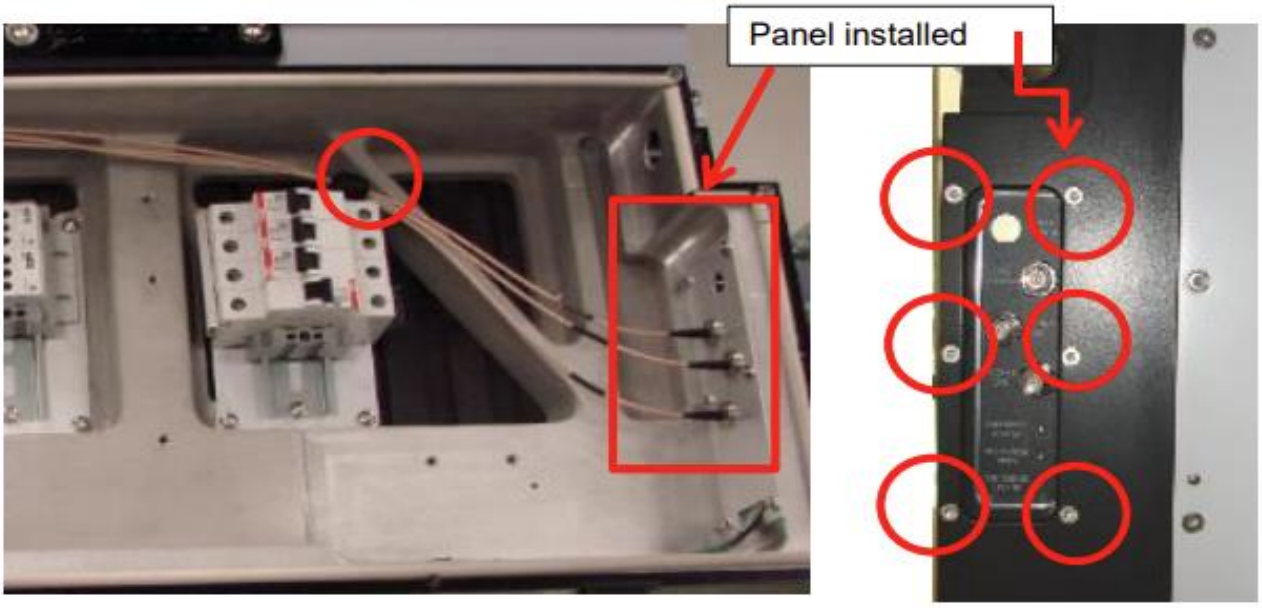

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

3.3 Carefully place the wire along the T/H frame as shown in the figure on the far left, and place the cable in the first opening below.

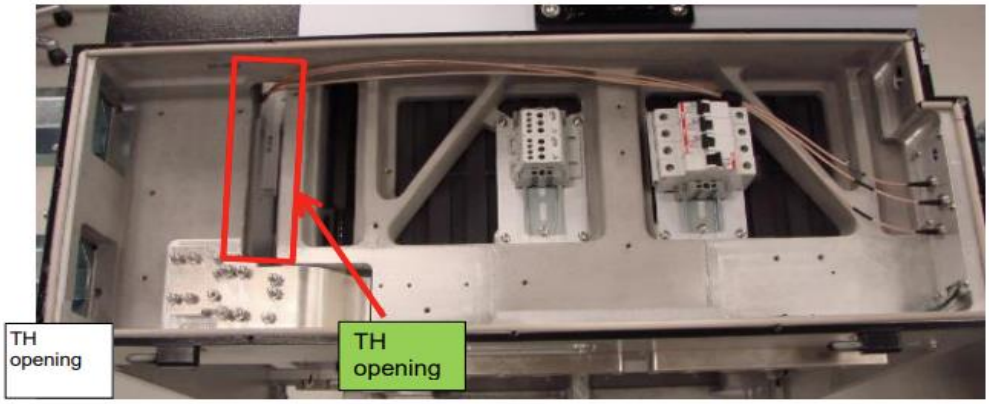

3.4 Pass the wire through the opening of the T/H frame and face the backplane as shown in the figure, and tie the wire harness to the original place with the existing black wire tie.

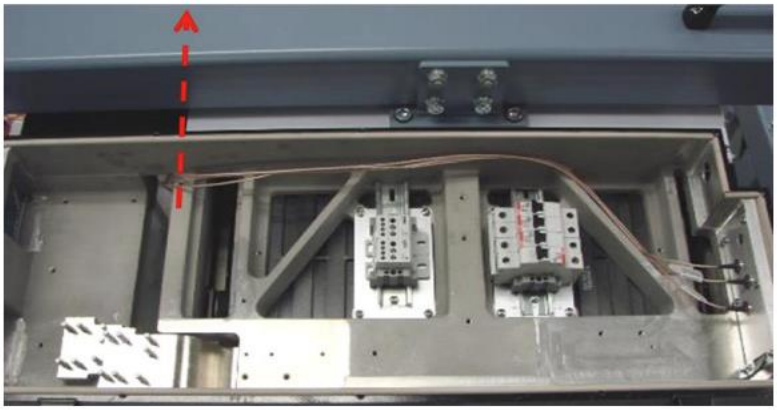

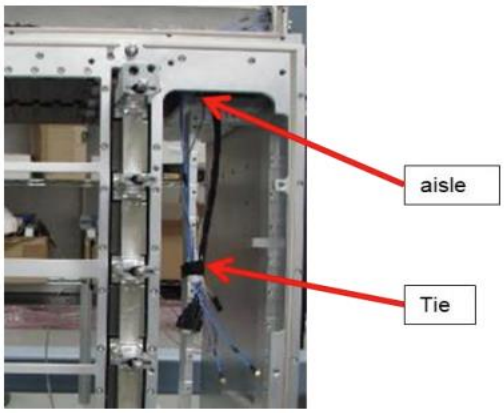

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
19	659-051-00	PLASTIC, LABEL EMERGENCY OFF, EMO PANEL, LABEL	1

MACHINE:

N/A

METHOD:

3.5 Do check that EMO label (659-051-00) have been installed on the T/H as shown in the figure and the label is correctly affixed. Q

The EMO label (659-051-00) completed on TH cart conversion.

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
20	801-643-01	HDWR SW OPERATOR TU	1

MACHINE:

N/A

METHOD:

4.1 Take the following materials as shown:

a. Take an operation switch (801-643-01).

b. Take a switch contact block (801-515-02).

c. Take a switch contact block (801-541-02).

d. Take a LED EMO cable (655-542-02).

e. Take two EMO lines (629-677-00).

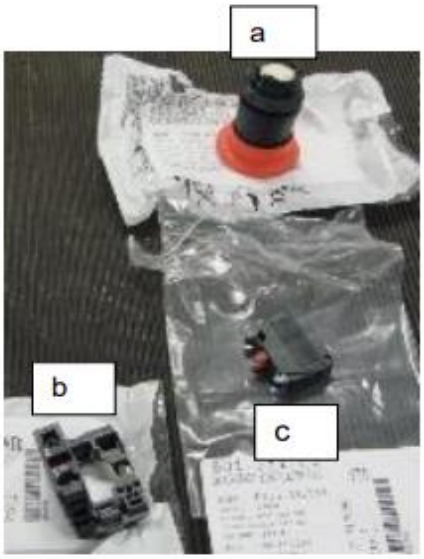

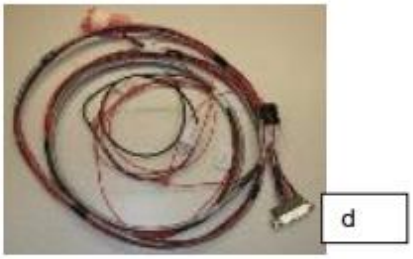

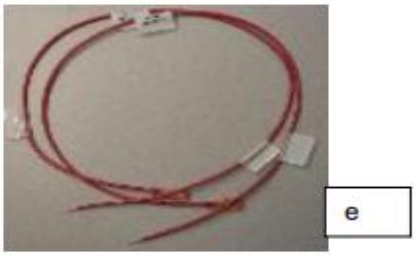

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

EMO nut tool 2.0 N·m.

METHOD:

4.2 Install the switch knob to the T/H frame as shown in the figure.

a. Remove the nut on the switch knob.

b. Install the switch knob into the T/H frame hole near the circuit breaker, and fix it with the nut removed before.

Use EMO nut tool to fix the nut,

The torque value is 2.0 N·m (17.7 in-lbs).

c. Note that the notch of the EMO knob switch faces downward as shown.

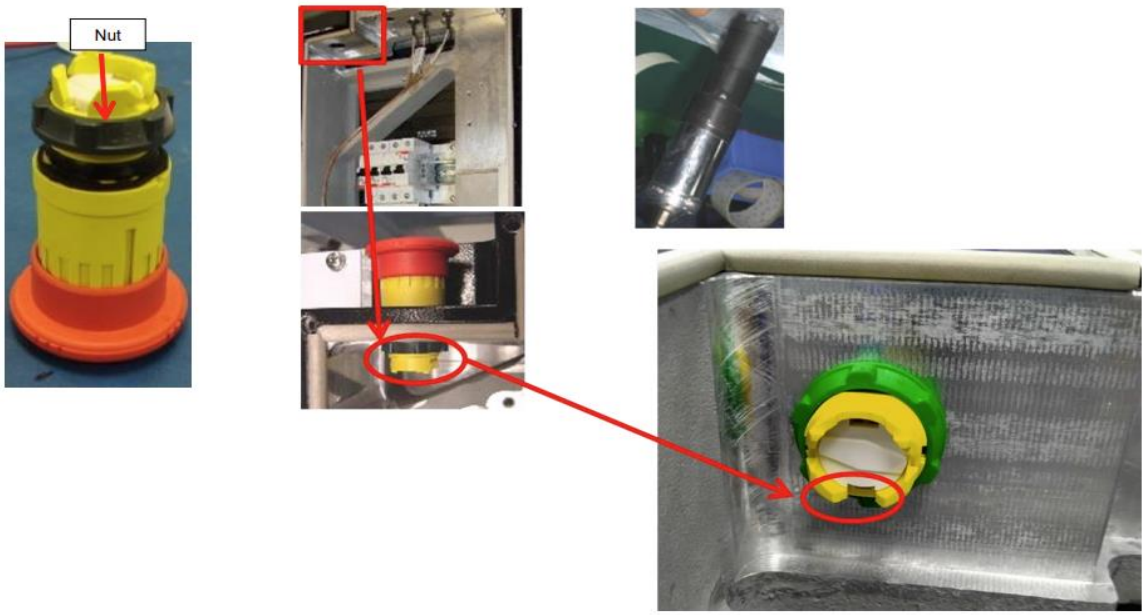

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
21	801-515-02	SW CONTACT BLOCK 1F	1
22	801-541-02	SW CONTACT BLOCK,NO	1
23	629-677-00	CABLE UF2 EMO T/H THERM BRKR LINK TELECOM WITH CONN	2

MACHINE:

N/A

METHOD:

4.3 Insert the switch contact block (801-515-02) into another switch contact block (801-541-02) as shown.

4.4 Take 2 EMO lines (629-677-00) as shown in the figure and mark them according to the following requirements.

a. A line (629-677-00) is marked "TH_EMO – T1" at one end. The other end is marked "TH_EMO – TS1B".

b. A line (629-677-00) is marked "TH_EMO – T2" at one end. The other end is marked "TH_EMO – TS2B".

Mark the labels "TH_EMO-T2" and "TH_EMO -TS2B"
Repeat the mark "TH_EMO – T1" and "TH_EMO – TS1B" on the other line

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

Flat blade screwdriver 0.7 N·m

METHOD:

4.5 Install the wire according to the label as shown in the figure.

a. Install the line "TH_EMO – T1" at position 1 and fix it with a flat-blade screwdriver with a torque value of 0.7 N·m.

b. Install the line "TH_EMO – T2" in position 2 and fix it with a flat-blade screwdriver. The torque value is 0.7 N·m.

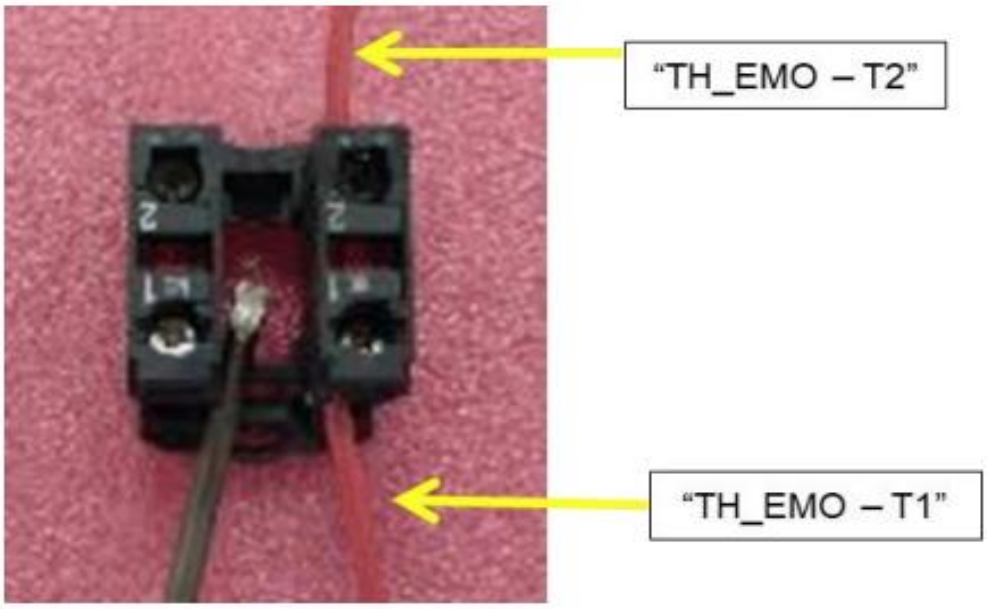

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
24	655-542-02	HDWR SW OPERATOR TU	1

MACHINE:

Flat blade screwdriver 0.7 N·m.

METHOD:

5.1 Install an LED EMO cable (655-542-02) as shown.

a. Install the switch terminals "1" and "2" according to the line labels "TH_EMO-T3" and "TH_EMO-T4", use Flat blade screwdriver, the torque value is 0.7 N·m.

b. The buckle should face upward as shown in the picture

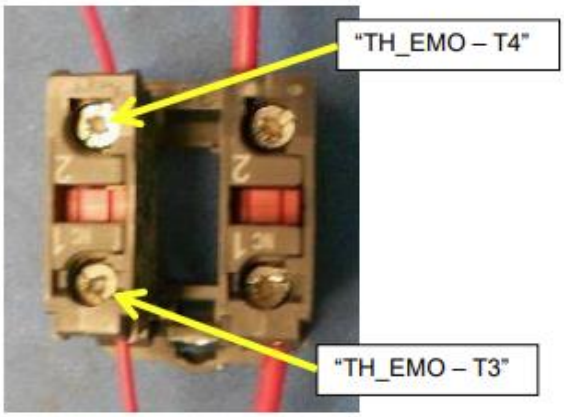

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

5.2 Install the switch contact block to the EMO switch on the T/H as shown in the figure. Make sure that the bayonet is facing upwards during installation and the switch contact block is fully engaged with the EMO switch.

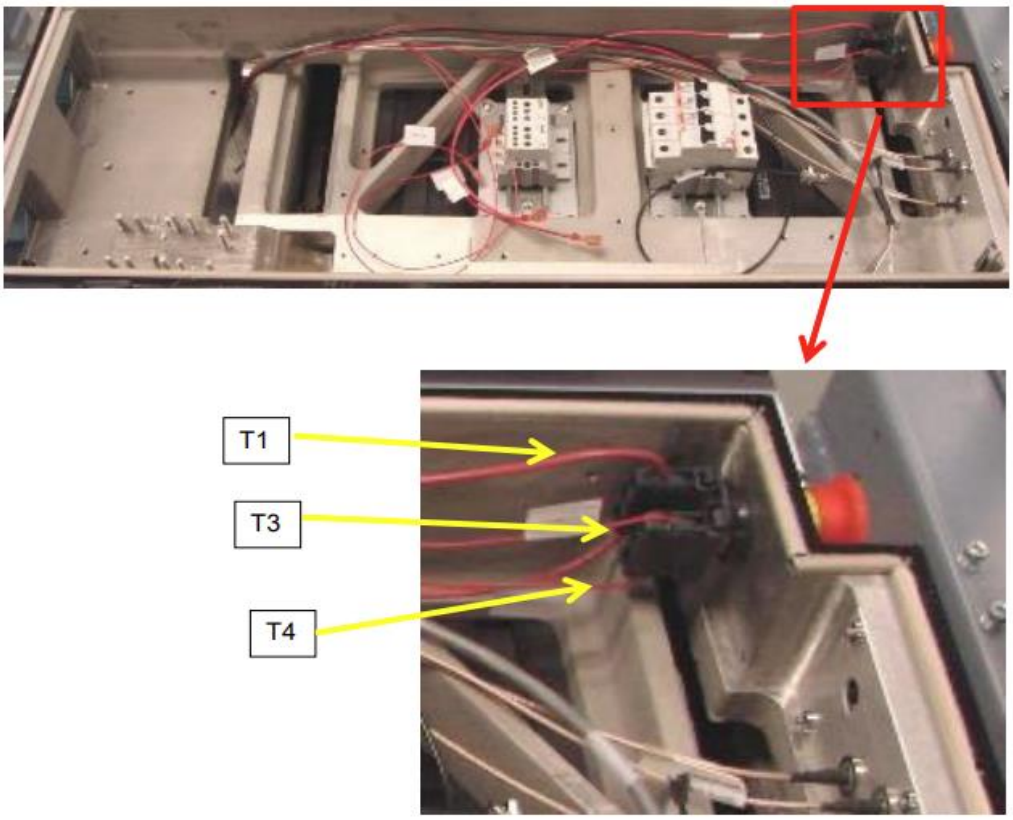

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

16mm socket wrench 1.05 N·m.

METHOD:

5.3 Connect the end of the label “T/H LEDPNL CN1” on the LED EMO line to the harness connector on the upper panel as shown in the figure.

5.4 Install the 10M signal cable label marked "T/H _ACC_PNL J1 to J1" as shown in the figure.

Use a 16mm socket wrench at J1 of the panel.Make a roundabout at the bottom of the other signal measurement cables.

Secure the nut to 1.05 N·m (9.3 in-lbs).

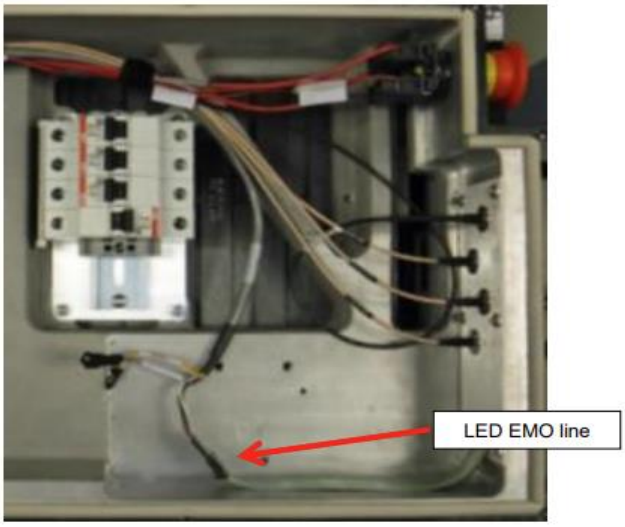

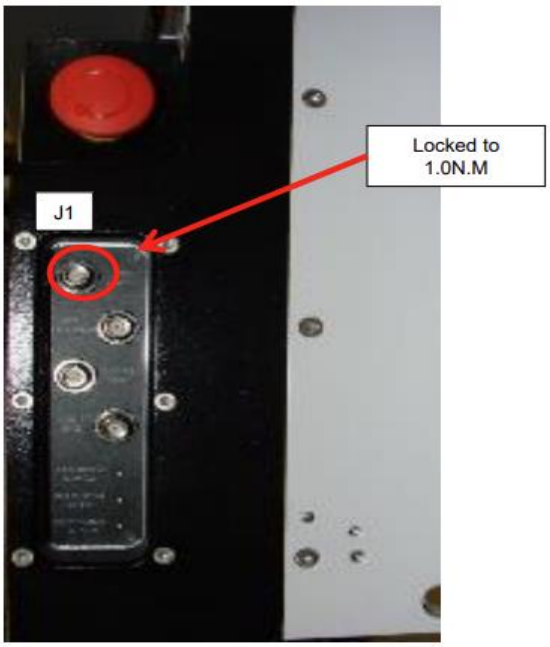

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
25	813-929-01	HDW VELCRO STRP 5/8	3

MACHINE:

N/A

METHOD:

5.5 Route the wire around the circuit breaker as shown in the figure and place it along the T/H frame.
Use three cable ties (813-929-01) to tighten the thread.

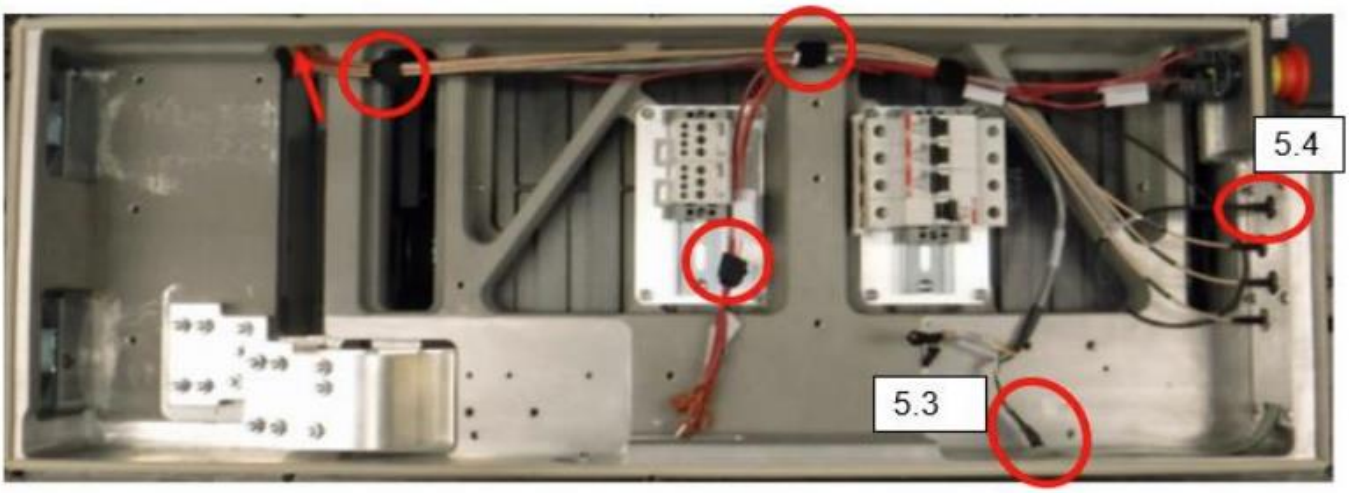

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
26	652-809-00	CABLE UF2 GROUND JUMPER SP6 TO TERMBLK TELECOM WITH CONN	1
27	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L W/ CONE	3
28	938-195-01	CABLE TIE MOUNT 1/4	3

MACHINE:

Flate-blade screwdriver 1.6 N·m, PH2 Philips screwdriver 3.3 N·m.

METHOD:

5.6 Install a ground wire (652-809-00) on the power distribution block as shown in the figure.
Use a flat-blade screwdriver to secure the torque value is 1.6 N·m.

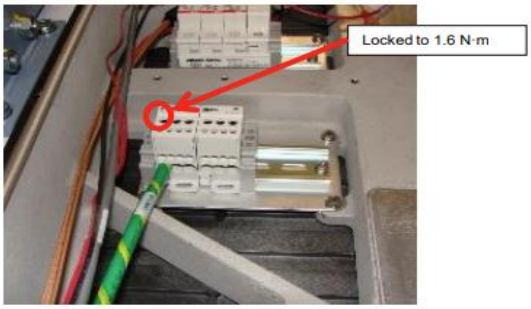

5.7 Pass the ground wire through the opening of the T/H frame and lay the wire perpendicular to the backplane.
Use three M5 screws (472-426-12) to fix the three wire buckles (938-195-01).
Use PH2 Phillips head with a torque value of 3.3 N·m.

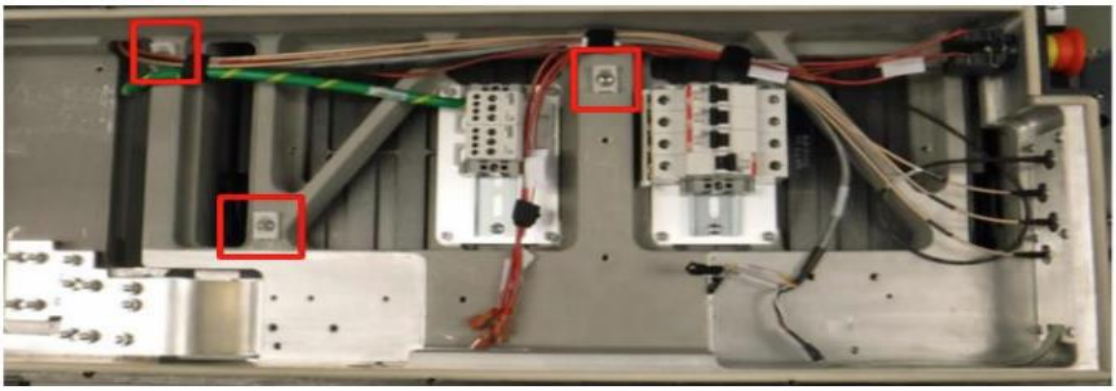

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
29	813-929-00	HDW VELCRO STRP 5/8	1

MACHINE:

N/A

METHOD:

5.8 Place the wire harness along the T/H frame as shown in the figure,
and secure the wire harness with 1 cable tie (813-929-00).
5.9 Pass all cables through the large opening of the T/H, through the channel to the side of the backplane,
and down to the Manifold area.

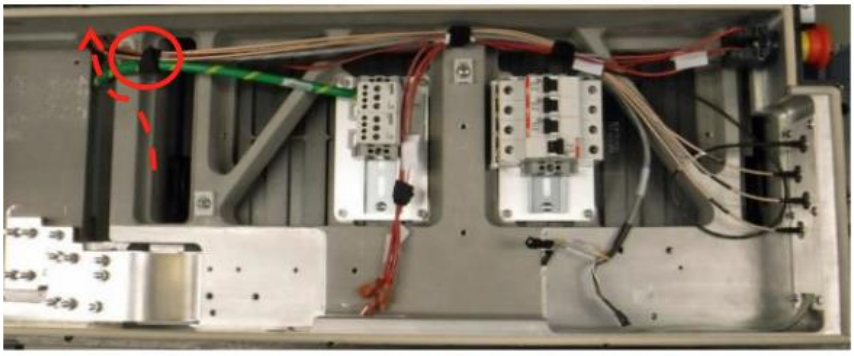

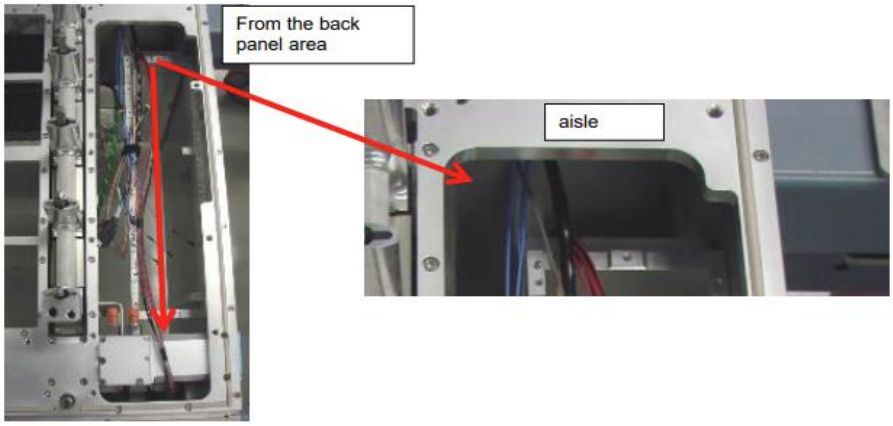

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

5.10 As shown in the figure, by pass the EMO line through the Manifold module and enter the channel to the DB side.
Place the EMO line on the frame.

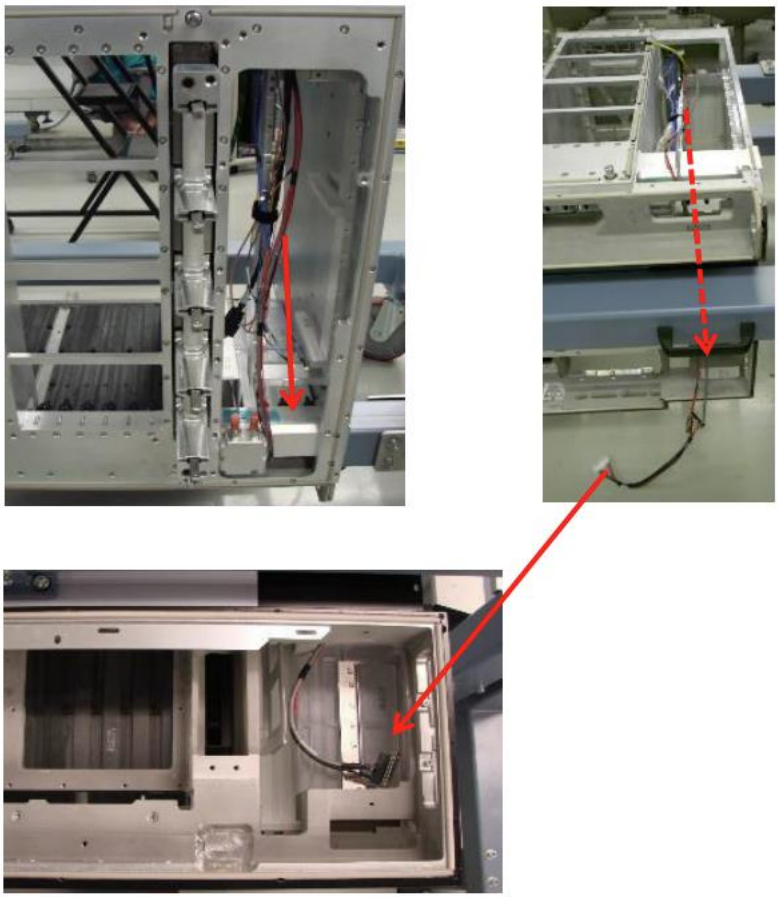

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
30	652-810-00	CABLE UF2 BUS TO TERMBLK 48VRET SOLID PIN TELECOM WITH CONN	1

MACHINE:

PH2 Philips screwdriver 1.6 N·m.

METHOD:

6.1 Take the wires (652-810-00) as shown.
6.2 Insert the black end wire "GND BLOCK" into the rightmost position of the lower layer of the power distribution block,make sure that it is fully inserted into the opening of the housing, Use the PH2 Phillips tool bit with a torque value of 1.6 N·m.

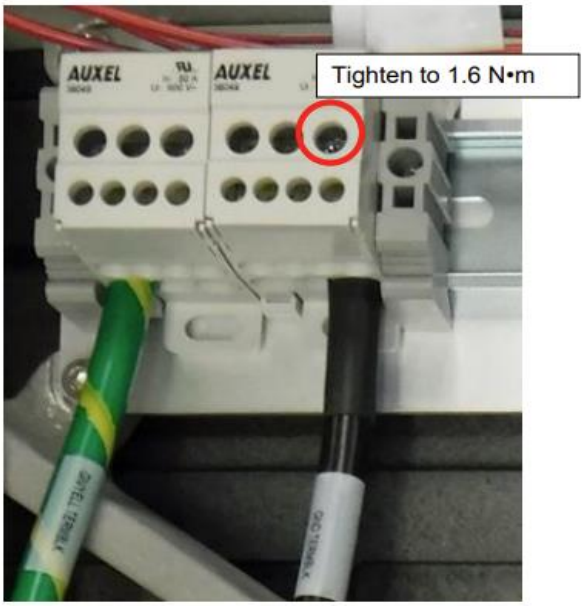

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
31	938-102-00	TIE WRAP 6.5 X 3/16"	1

MACHINE:

Glove, 10mm socket wrench 5.6 N·m.

METHOD:

6.1 As shown in the figure, use Busbar's own M6 screw kit to install the other end of the 652-810-00 wire on the shortest stud of Busbar, Using a tool 10mm socket wrench, the torque value is 5.6 N·m.

6.2 Route the cable as shown in the figure, and then use a cable tie 938-102-00 to fasten the cable to the frame.

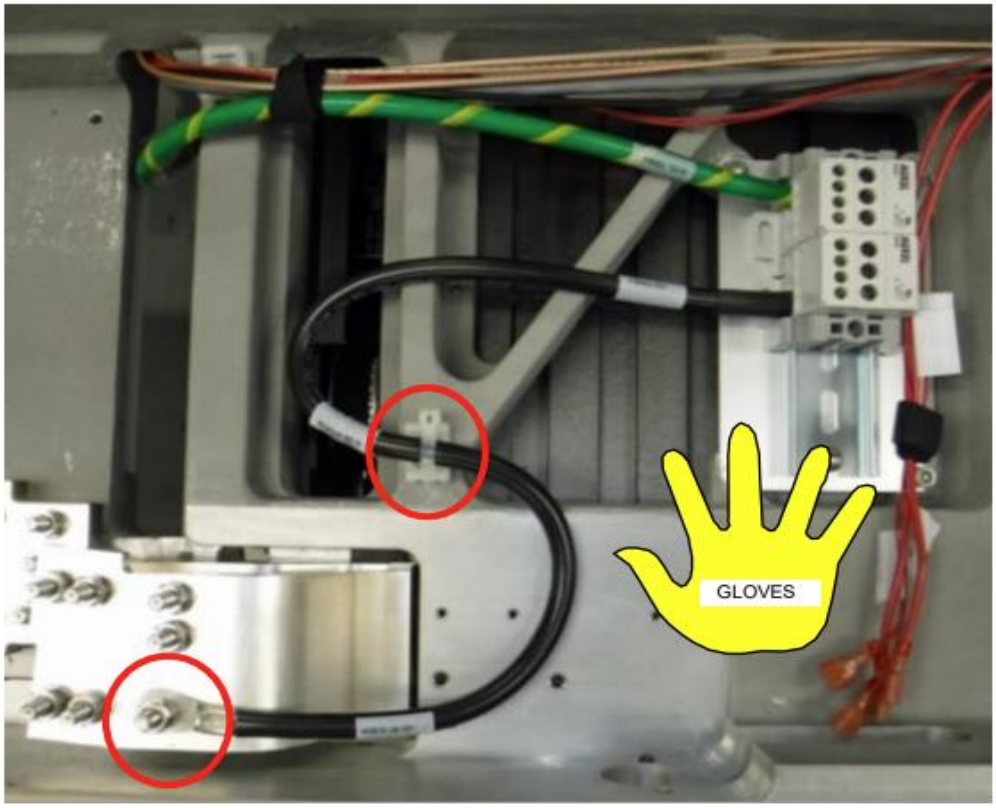

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
32	652-441-02	CABLE UF2 BUS TO CB 48V SINGLE SOLID PIN TELECOM WITH CONN	1

MACHINE:

PH2 phillips screwdriver 2.8 N·m.

METHOD:

6.3 Take the wires (652-441-02) as shown.

6.4 Insert the red terminal "CB1_1 INPUT" into the upper left hole of the circuit breaker as shown in the figure.

Use tool PH2 cross head to lock,

The torque value is 2.8 N·m.

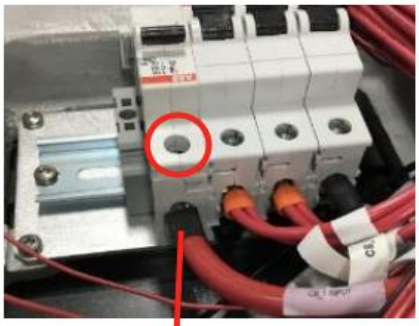

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

Glove, 10mm socket wrench 5.6 N

METHOD:

6.5 As shown in the figure, wind the red Busbar wire wound circuit breaker to the Busbar area.

6.6 As shown in the figure, use Busbar's own M6 screw kit to install the other end of the 652-810-00 wire on the shortest stud of Busbar, Using a tool 10mm socket wrench, the torque value is 5.6 N·m.

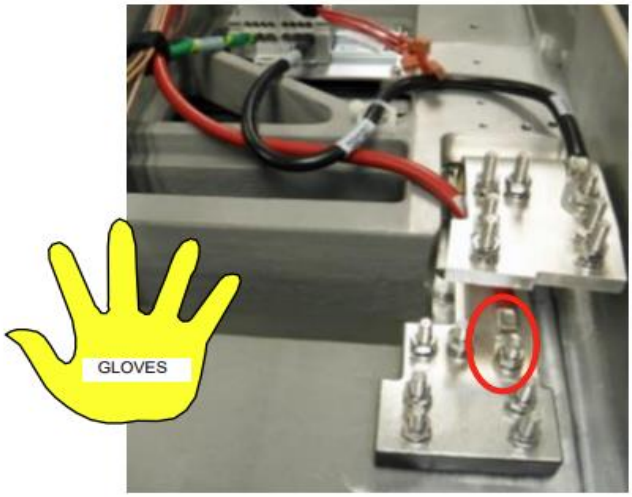

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
33	655-789-00	SW SWITCH SNAP ACT SPDTX2 15A 125V	1
34	659-629-00	CABLE UF2 BUS TO CB 48V SINGLE SOLID PIN TELECOM WITH CONN	1
35	659-797-00	ALUMINUM INTERLOCK SWITCH PLATE BRACKET OR MISC ARTICLE	1
36	470-708-06	SCRW W/WSHR 6-32X3/8" STL/	2

MACHINE:

22mm open end wrench 1.05 N·m.

METHOD:

7.1 Take the following materials as shown:

a. Take one door lock switch (655-789-00).

b. Take one door lock switch wire (659-629-00).

c. Take one bracket (659-797-00).

d. Take two 6-32 screws (470-708-06).

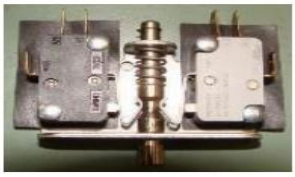

a

b

c

7.2 Install the door lock wire (659-629-00) to the door lock bracket (659-797-00) according to the label as shown:
Using a tool 22mm open end wrench, the torque value is 1.05 N.M (9.3 in-lbs).

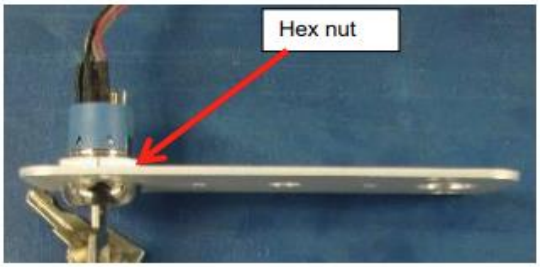

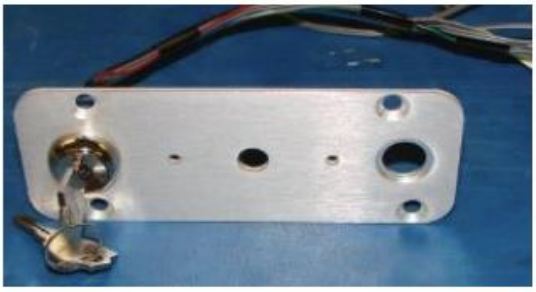

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
37	671-989-00	MECHANICAL, TH DOOR STOP PLATE, FOR SEMI TEST	1

MACHINE:

PH2 Phillips screwdriver 1.1 N·m.

METHOD:

7.3 Install the door lock switch and a piece of iron (671-989-00) to the bracket (659-797-00) as shown in the figure, Place door lock switch (655-789-00) at the back.

Fix with two 6-32 screws (470-708-06), the tool is a PH2 Phillips screwdriver, and the torque value is 1.1 N·m.

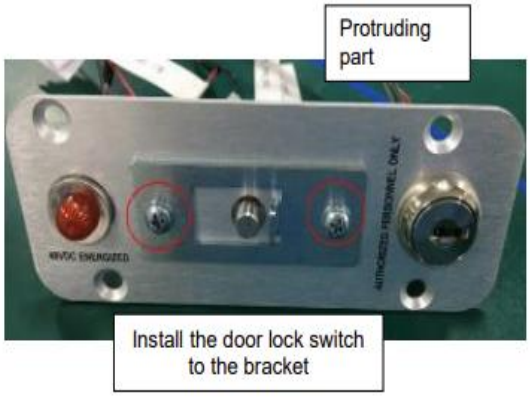

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

7.4 Install the door lock wire (659-629-00) to the door lock switch (801-646-00) according to the label as shown:

a. Install the line "BLK_SW_COM" to the black switch COM terminal.

b. Install the line "BLK_SW_NO" to the black switch NO terminal.

c. Install the line "GRY_SW_COM" to the gray switch COM terminal.

d. Install the wire "GRY_SW_NC" to the gray switch NC end.

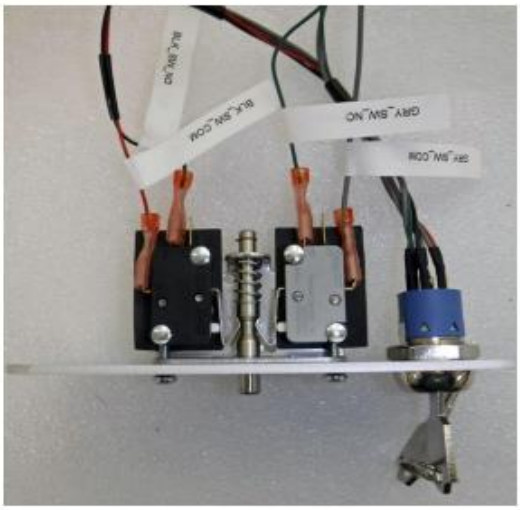

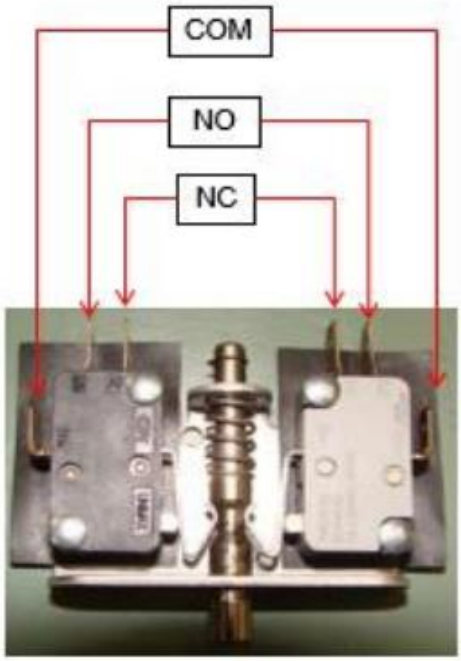

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
38	702-331-02	RED OPTO.LED.	6
39	650-157-00	CABLE UF2 LED TH POWER JUMPER TELECOM WITH CONN	3

MACHINE:

N/A

METHOD:

7.5 Take 1 LED lamp (702-331-02) and 1 LED cable (650-157-00).

7.6 Install the LED light to the bracket as shown in the figure.

7.7 Insert the LED cable into the LED light according to the corresponding label as shown in the figure.

A.LED line + Plug into the LED light+ ;

B.LED line - Plug into the LED light - ;

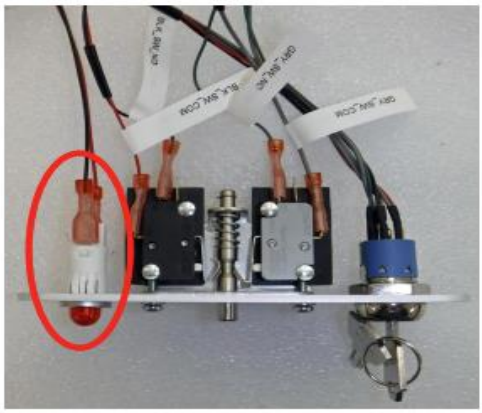

LED lights

The state after the door switch is installed

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

7.10 Lead the LED wire to the right as shown, and insert it into the cable labeled "P6 SFLED".
7.11 Insert "DOOR_COM2" marked on the switch wire into the cable marked "DOOR_COM2-P5" as shown in the figure.
7.12 Send the remaining switch wires to the opening of the frame along the side of the outgoing harness, and reach the backplane area through the channel. Use cable ties to fix on the cable harness.

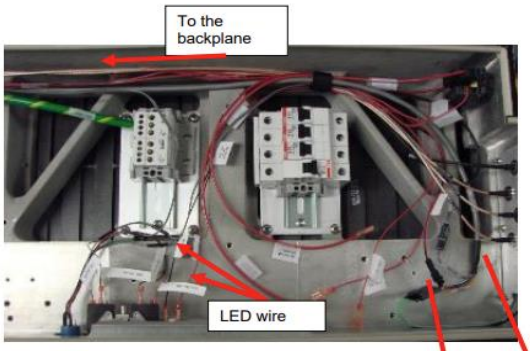

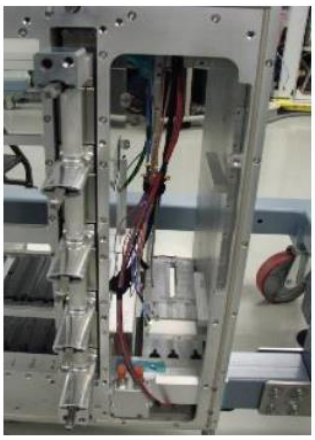

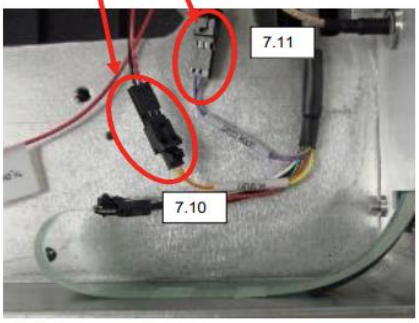

Safety Tips: N/A

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
41	812-117-00	SW THERMO 70C OPEN	2
42	470-353-01	NUT KEPS 6-32FL RIM CONL W	2
43	652-515-00	ALUMINUM PLATE THERMAL SWITCH BRACKET OR MISC ARTICLE	1

MACHINE:

N/A

METHOD:

8.1 Take the following materials as shown:

a. Take 2 temperature control switches (812-117-00).

b. Take two 6-32 nuts (470-353-01).

c. Take one bracket (652-515-00).

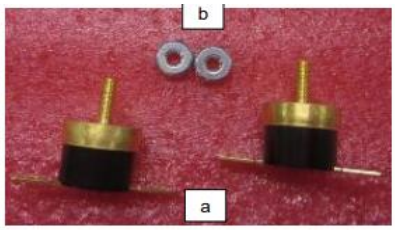

8.2 Install two temperature control switches (812-117-00) on the bracket (652-515-00) as shown in the figure, and fix them with two nuts (470-353-01).

The direction of the temperature control switch is shown in the figure. Manually tighten the nut but do not tighten it.

Safety Tips: N/A

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

8mm socket wrench 0.5 N·m

METHOD:

8.3 Install the EMO line on the as shown:

a. Insert the line label "TH_EMO-TS1A" into TS1A, and the line label "TH_EMO-TS2A" into TS2A.

b. Insert the line label "TH_EMO-TS1B" into TS1B, and the line label "TH_EMO-TS2B" into TS2B.

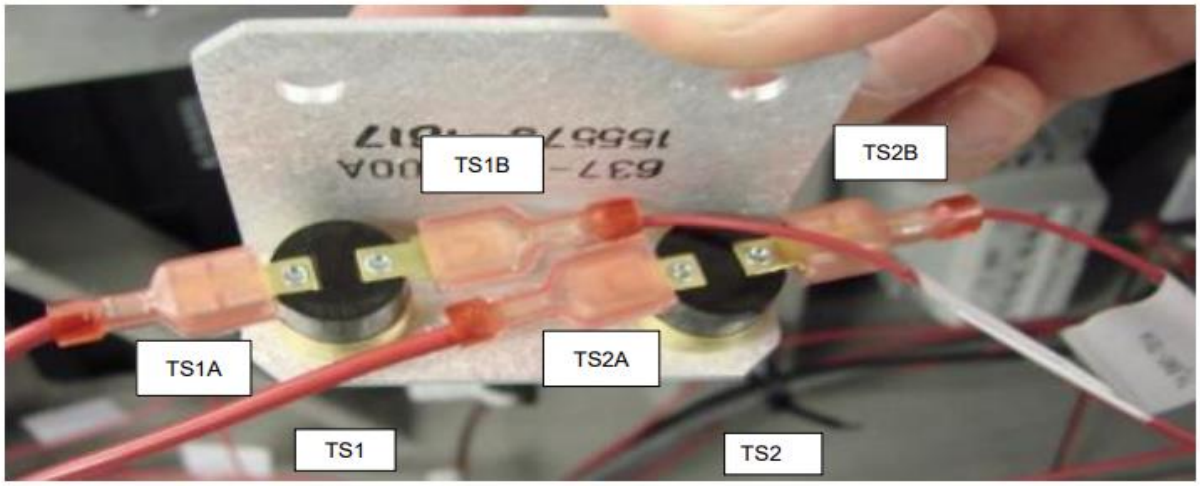

8.4 Rotate the direction of the temperature control switch as shown in the figure,
and place the two Keps nuts to fix the torque value to 0.5 N•m. wires in the middle as close as possible.
Use a tool 8mm sleeve. There are two places.

MAN:

CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
44	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L W/ CONE	2

MACHINE:

PH2 phillips screwdriver 3.3 N·m.

METHOD:
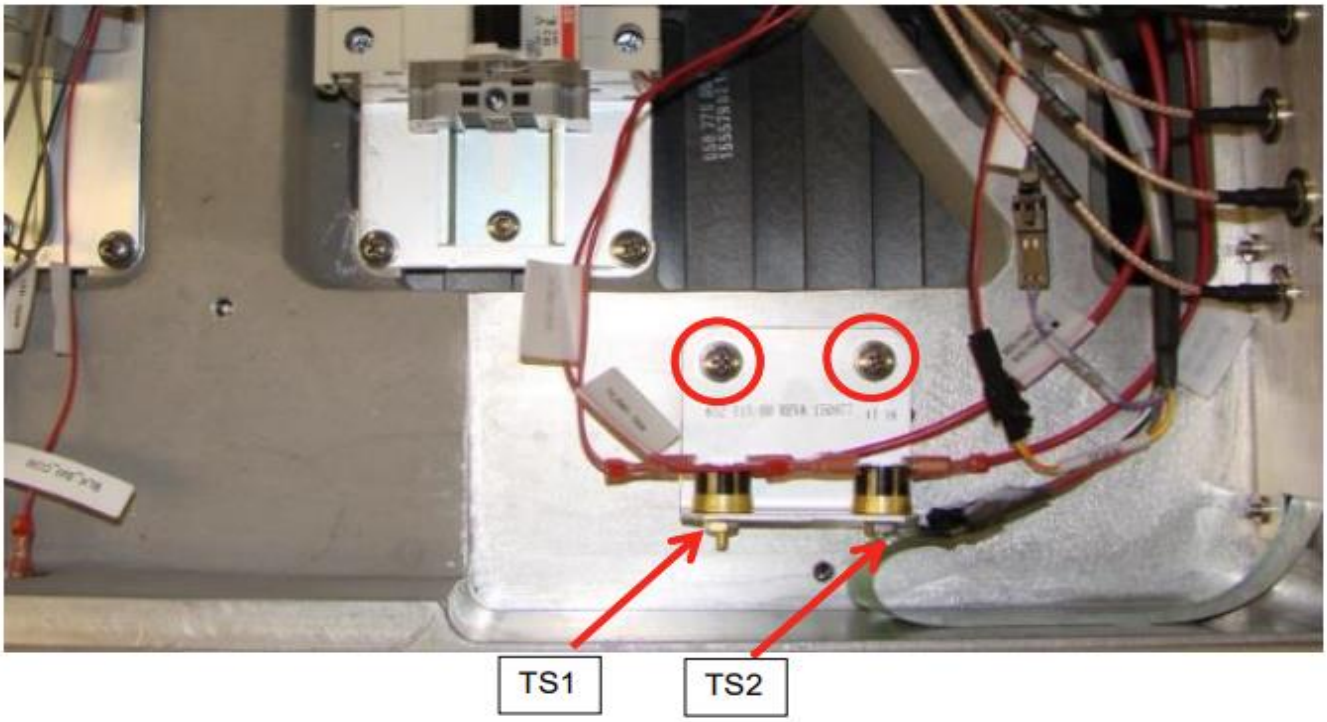
8.5 Install the temperature control switch on the T/H frame as shown in the figure,
fix it with 2 M5 screws (472-426-12), the tool is PH2 cross cutter head,
The torque value is 3.3 N·m.