Build Overview:

1 **Distribution Board Install**
2 **Standoff Install**
3 **Route and Install Cables**
4 **Install the following cables:**
   a.QSFP
   b.Midplane Power

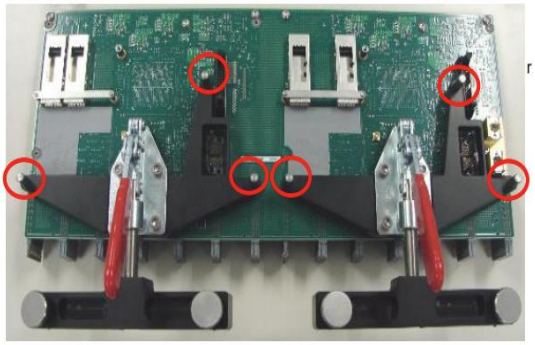

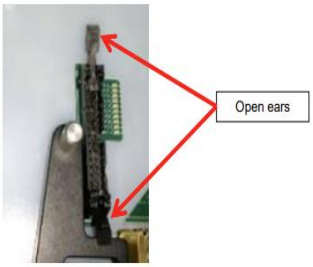

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by
	1	New Issue	JOSEPH AMAD

Prepared By:
JOSEPH R. AMAD
Manufacturing Engineer

Checked By:
IVAN NOWELL PANIQUE
Team Lead

Approved By:
SHERWIN ARIOSTE
Operations Manager

MAN: CERTIFIED TECHNICIANS.

MATERIAL:

NO.	PART NO.	DESCRIPTION	QTY.
1	630-926-00	ELEC-MECH, INSTR HLA, UFII DB12 DISTRIBUTION BOARD	1
2	651-093-00	PLASTIC DB6/DB12 STANDOFF W/ HOLDER OTHER ARTIC	2
3	470-483-04	SCRW CP BUT HD M5X	2
4	813-929-00	HDW VELCRO STRP 5/8	2
5	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L	4
6	938-195-01	CABLE TIE MOUNT 1/4	4
7	626-644-01	CABLE QSFP1 PCIE SR CU TELECOM WITH CONN	1
8	626-644-03	CABLE QSFP3 PCIE SR CU TELECOM WITH CONN	1
9	938-102-00	TIE WRAP 6.5 X 3/16"	4
10	650-699-00	CABLE CABLE UF2 12SLOT MIDPLANE POWER TELECOM	1
11	650-699-01	CABLE CABLE UF2 12SLOT MIDPLANE POWER TELECOM	1
12	813-929-01	HDW VELCRO STRP 5/8	7

METHOD:

Flow chart of operation steps

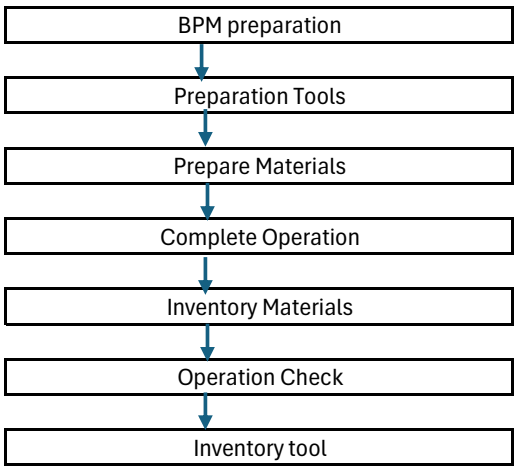

TOOL NAME	TORQUE VALUE
3mm hexagon socket	0.7 N·m
PH2 Phillips torque screwdriver	1.6 N·m

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

1.1 Rotate the T/H direction as shown in the figure, and reposition the line area according to the line label. Reserve enough space to install the DB board.

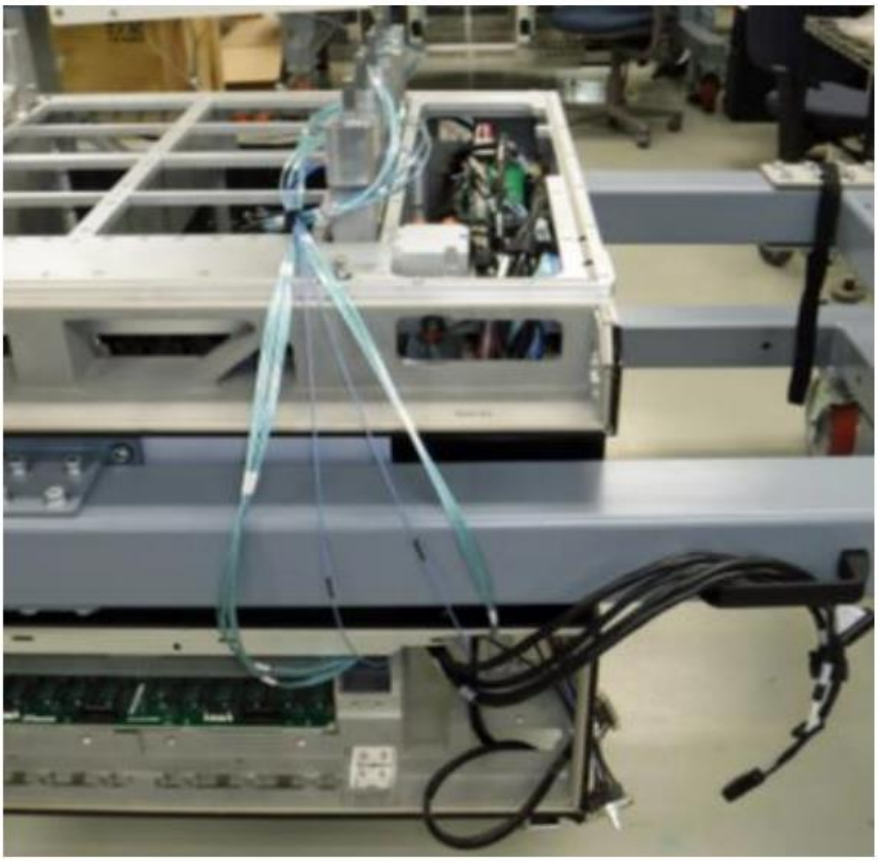

MAN: CERTIFIED OPERATOR, TECHNICIAN

ITEM	PART NUMBER	DESCRIPTION	QTY
1	630-926-00	ELEC-MECH,INSTR HLA,UFII DB12 DISTRIBUTION BOARD,FOR SE	1

MACHINE:

N/A

METHOD:

2.1 Install the DB12 power distribution board.

a. Take 1 switchboard (630-926-00).

Note: ESD protection measures must be taken when removing and handling the distribution board.

b. Take two distribution board insertion tools 651-040-00 for the power distribution board, use the 6pcs studs on the clamps to install on the power distribution board (DB12)

c. Open the upper ears of the ribbon connector, a total of 4 ears

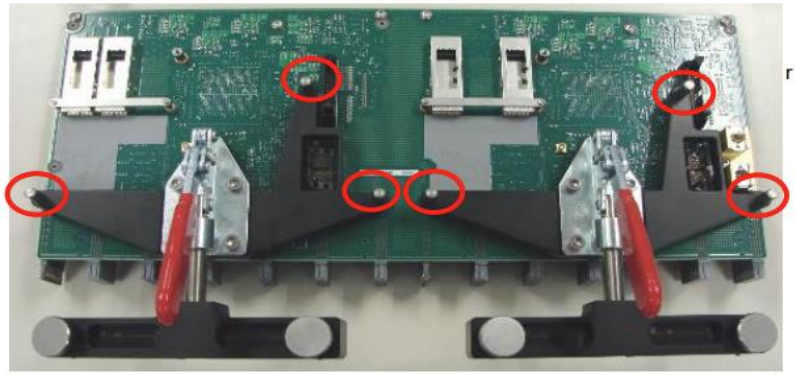

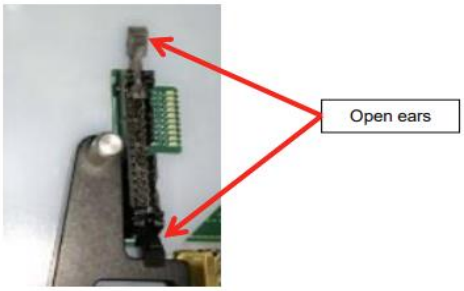

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

d. Rotate the T/H direction as shown in the figure to free the area of DB1_2 to install the DB12 distribution board.

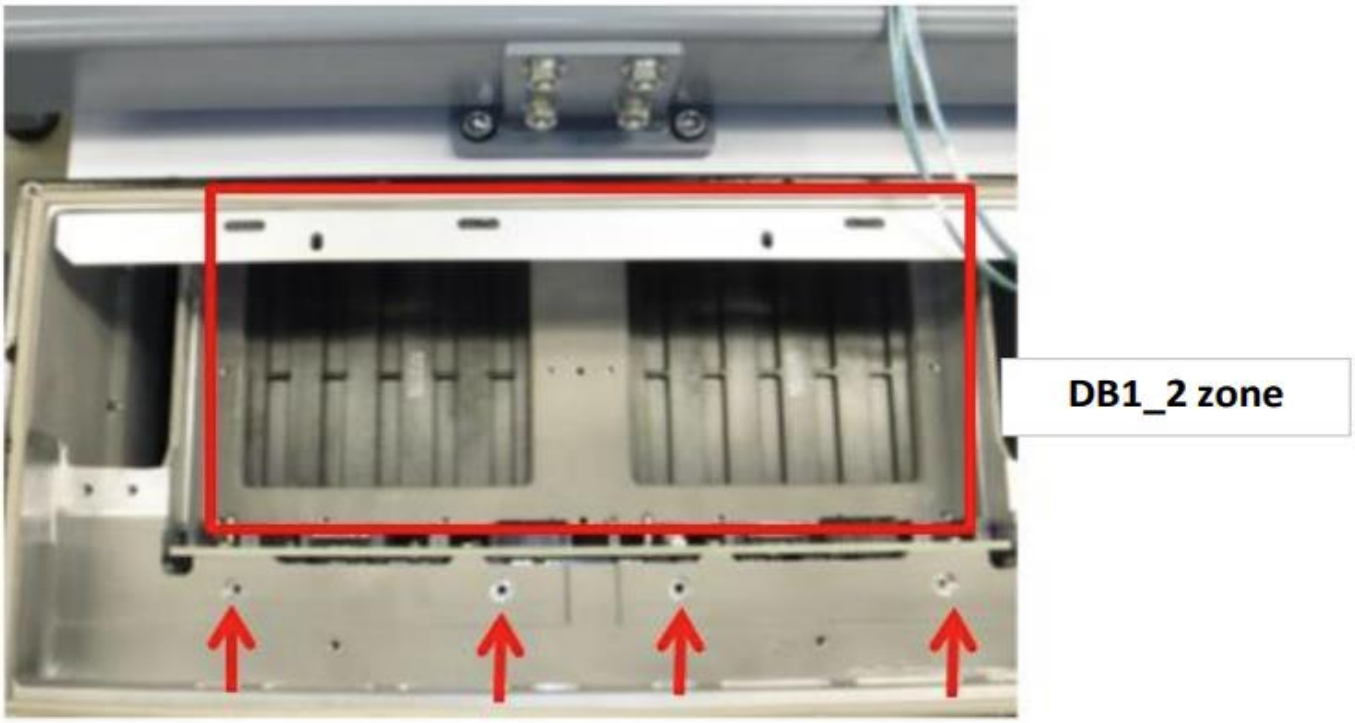

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

e. Put the special tools for the power distribution board into the T/H frame as shown in the figure, and keep the screw on the fixture consistent with the hole on the T/H frame. Tighten the screws on the fixture manually to fix the fixture on the T/H.

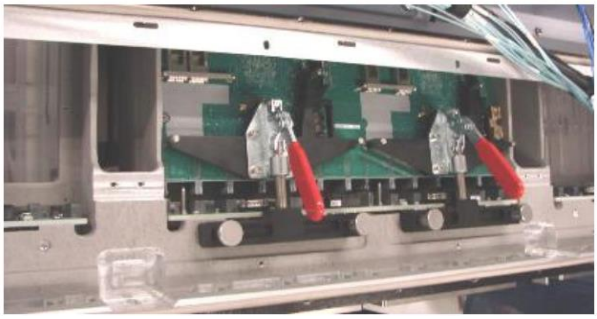

f. Align the DB12 connector with the previously installed MP12 connector to keep the same position.

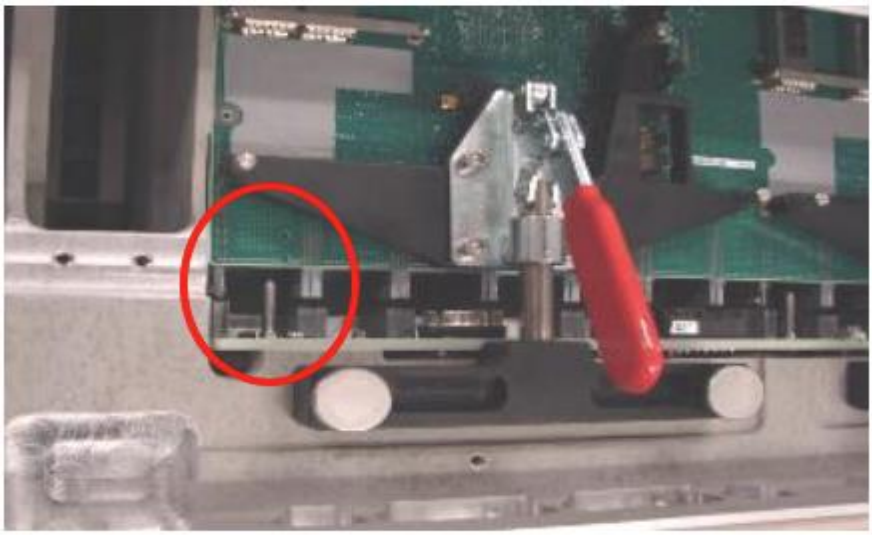

Safety Tips: N/A

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

g. As shown in the figure, push the slide bar away from people to install the DB12 board.

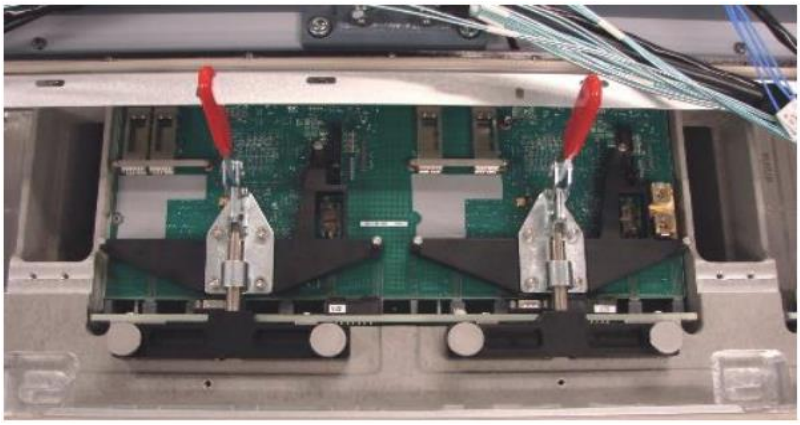

h. Remove the stud on the fixture, then remove the large nut on the fixture, and then remove the fixture.

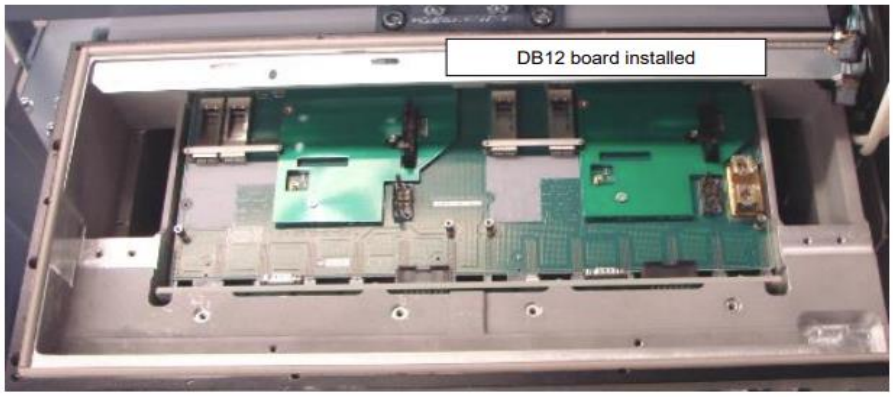

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE:

N/A

METHOD:

i. Confirm that the PCBA board is fully inserted into the connector as shown in the figure.

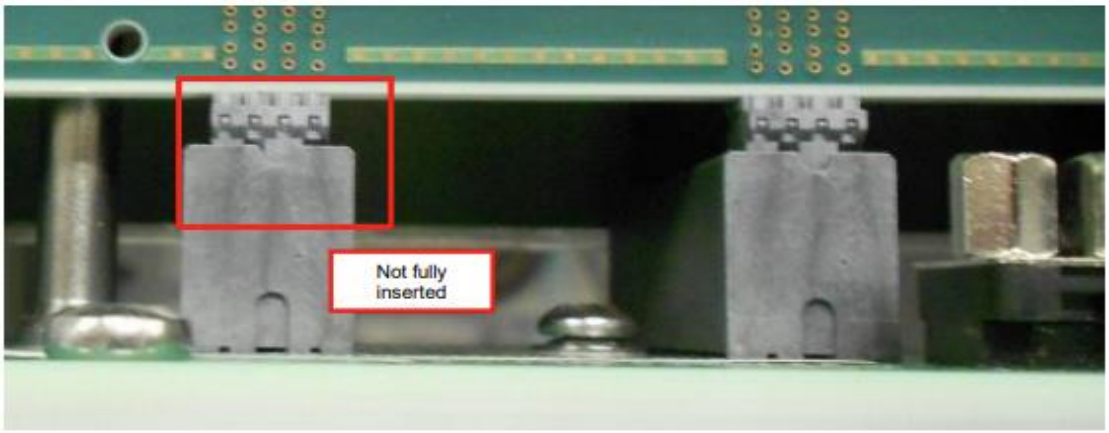

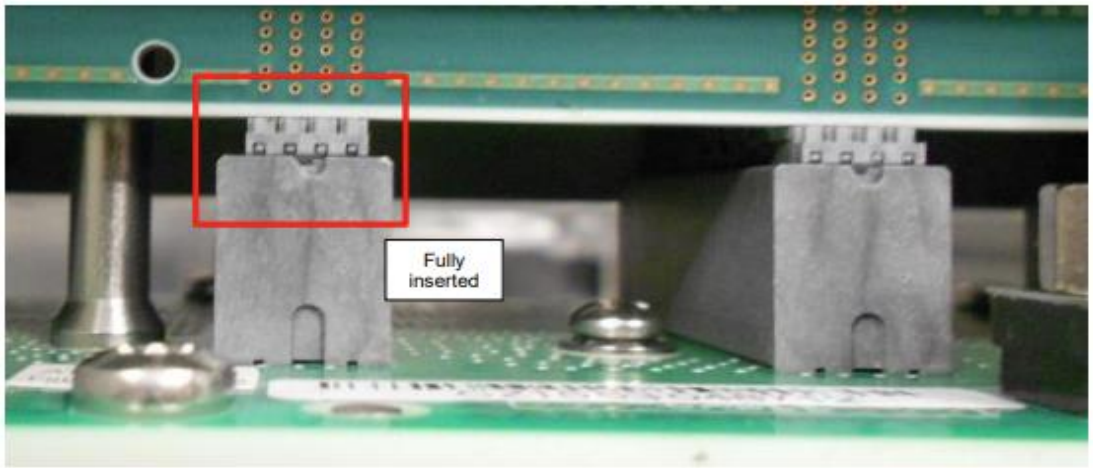

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

j. The wiring method is as shown in the figure, reserve enough long wires to insert into the MP12 and DB12 PCBA boards.

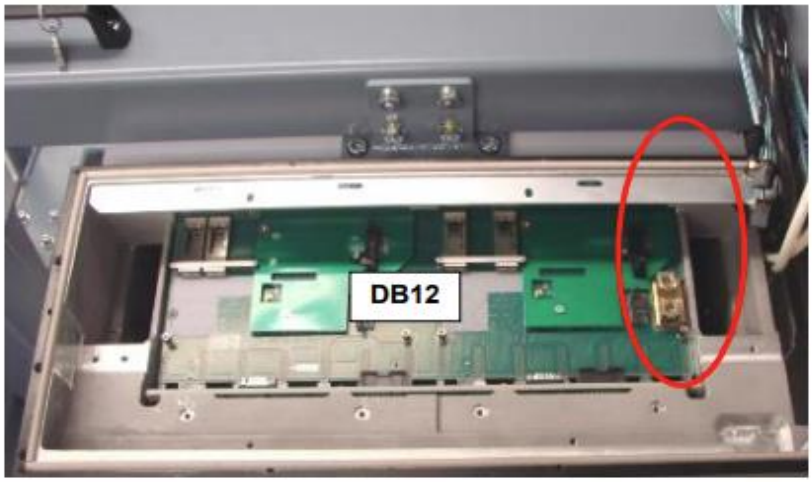

MAN: CERTIFIED OPERATOR, TECHNICIAN

ITEM	PART NUMBER	DESCRIPTION	QTY
2	651-093-00	PLASTIC DB6/DB12 STANDOFF W/ HOLDER OTHER ARTICLES	2

MACHINE:

3mm hexagon socket 0.7 N·m

METHOD:

3.1 Install the studs.

a. Take 2 studs (651-093-00).

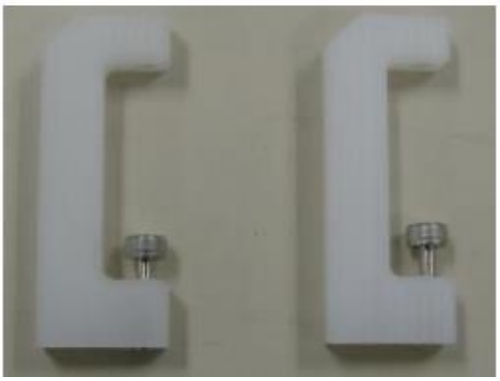

b. Install a stud between the board stud and the T/H frame.

c. Use a long 3mm hexagon socket bit to fix the screw with a torque value of 0.7 N·m.

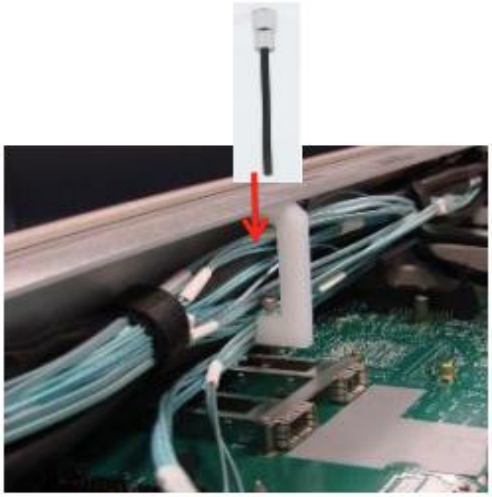

Safety Tips: N/A

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
3	470-483-04	SCRW CP BUT HD M5X	2

MACHINE:

3mm hexagon socket bit 0.7 N·m

METHOD:

d. Use 1 M5 screw (470-483-04) to fix the top of the stud on the T/H frame. The tool is a 3mm hexagon socket head and the torque value is 0.7 N.m.

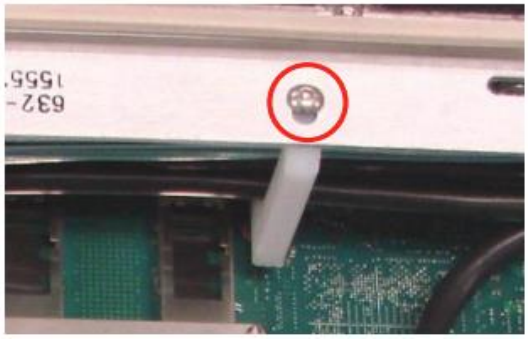

e. Repeat the above actions to install another stud in the DB12 area. Ensure that all wires are placed inside the studs.

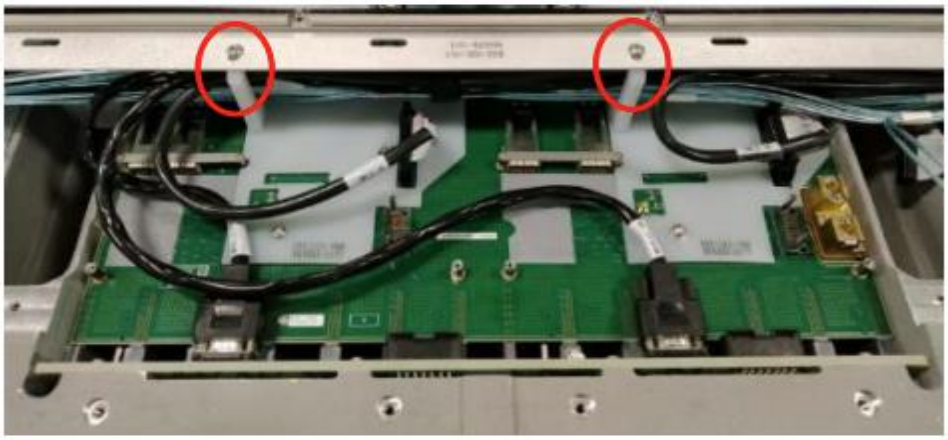

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

flat blade screwdriver and torque value 0.19 N·M.

METHOD:

4.1 As shown in the figure, install the connector on the MP12 and DB12 according to the online label.

Use Milwaukee 90 degree to tighten the MPLN_1_2 J25 and MPLN_1_2 J26 with flat blade screwdriver and torque value 0.19 N·M.

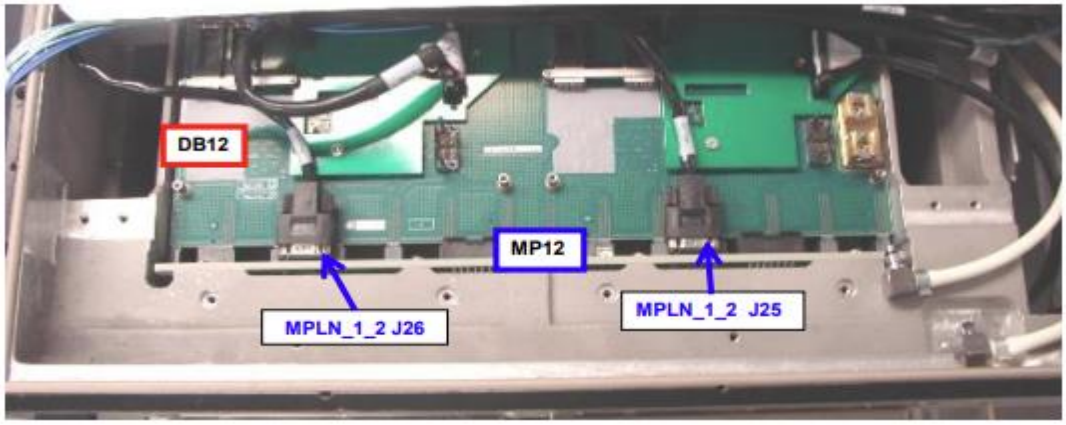

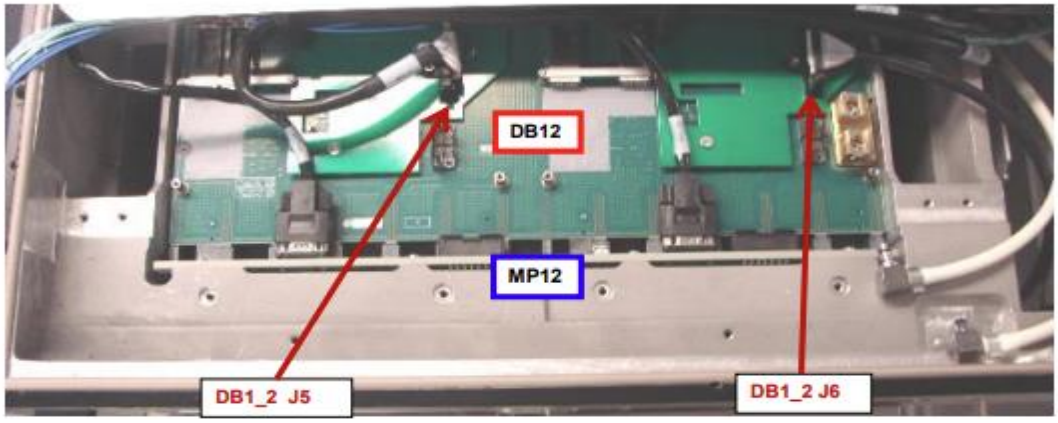

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

4.2 As shown in the figure, install the connector on the MP12 and DB12 according to the online label.

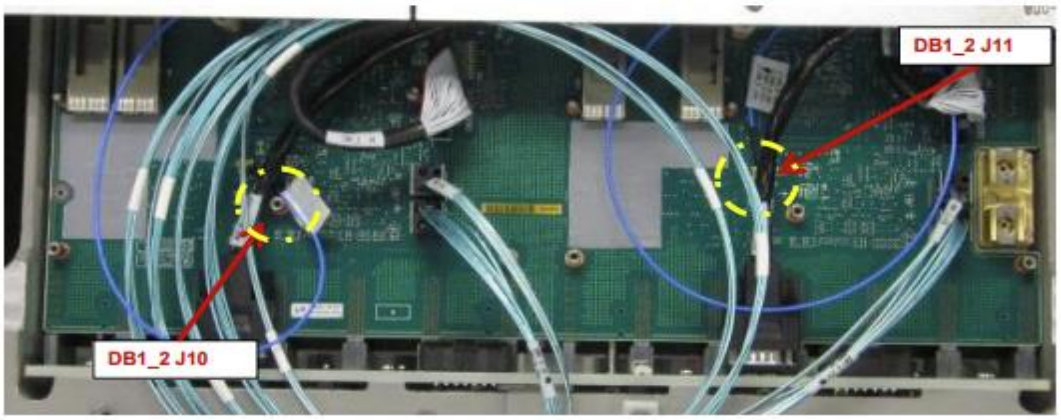

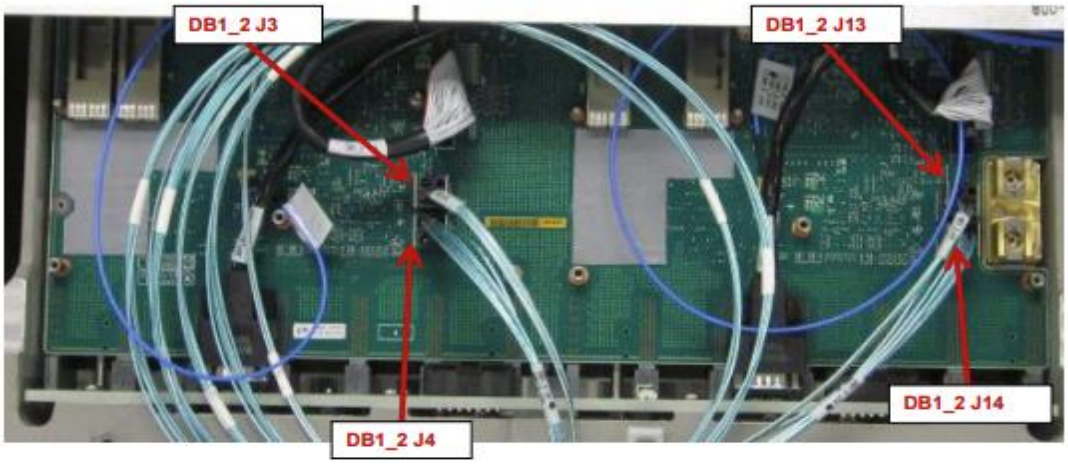

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
4	813-929-00	HDW VELCRO STRP 5/8	1
5	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8x12MM L W/CONE	4
6	938-195-01	CABLE TIE MOUNT 1/4	4

MACHINE:

PH2 Phillips torque screwdriver 1.6 N·m

METHOD:

4.3 Put the excess coils up under the cover bracket as shown in the figure, and tie the wires with a cable tie (813-929-00).
4.4 Use 4 M5 screws (472-426-12) to fix the 4 wire clamps/tie mount (938-195-01) as shown in the figure. The tool is a PH2 Phillips torque screwdriver with a torque value of 1.6 N·m

Note: Do not twist the cable, as this will damage the performance!

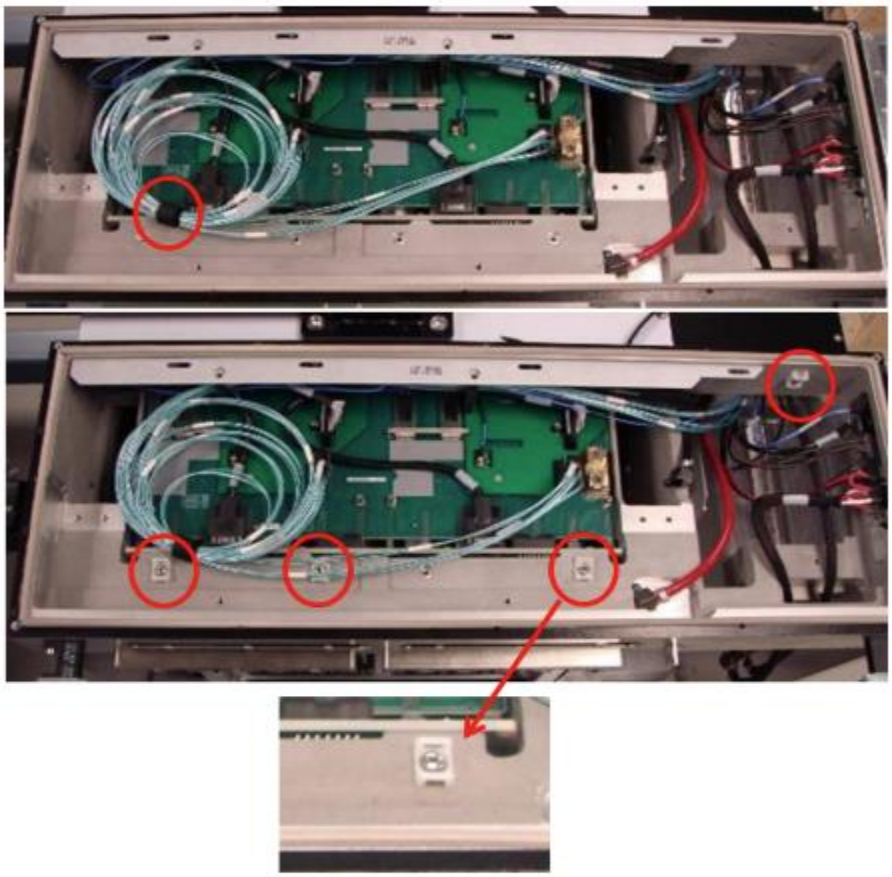

Safety Tips: N/A

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
7	626-644-01	CABLE QSFP1 PCIE SR CU TELECOM WITH CONN	1
8	626-644-03	CABLE QSFP3 PCIE SR CU TELECOM WITH CONN	1
9	938-102-00	TIE WRAP 6.5 X 3/16"	3

MACHINE:

N/A

METHOD:

5.1 Install QSFP1 PCIE cable (626-644-01),QSFP3 PCIE cable (626-644-03).

a. Install the cable (626-644-01) as shown in the figure. Connect one end to "DB1_2_J9" and the other end to "SB25_J5" according to the label.

b. Install the cable (626-644-03) as shown in the figure, connect one end to "DB1_2_J12" and the other end to "SB25_J6" according to the label.

c. As shown in the figure, part of the coil is placed along the T/H frame, ensuring that enough length is left to reach the SB25 position.

d. Use 3 cable ties (938-102-00) to tie the cable to the previously installed cable clamp.

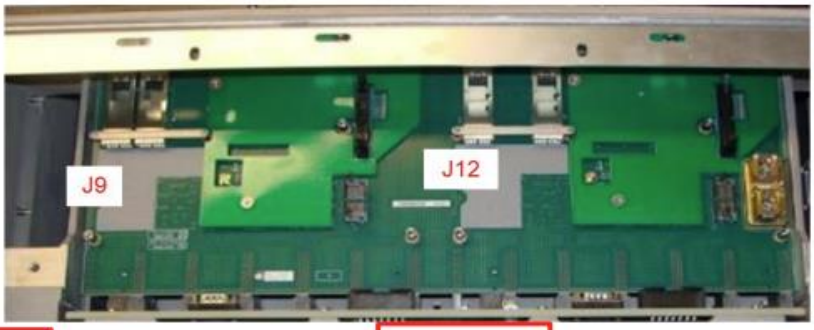

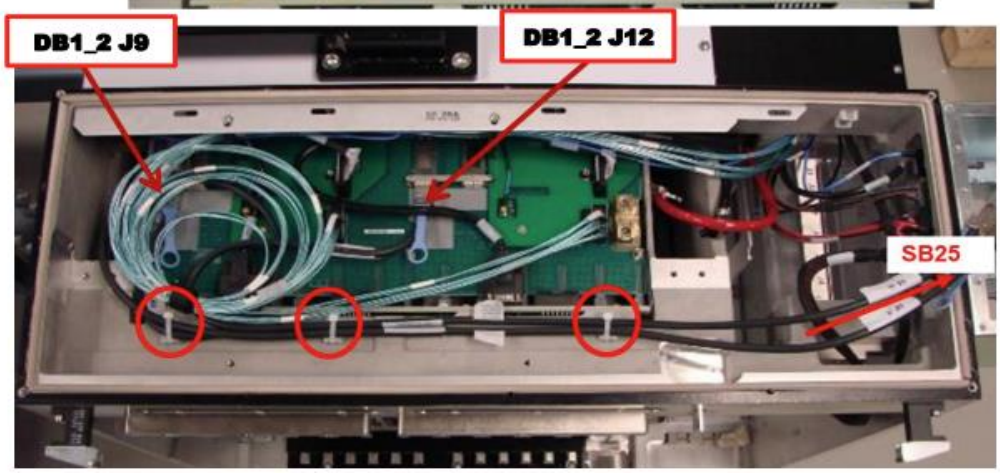

Safety Tips: N/A

TQC: N/A

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
10	650-699-00	CABLE CABLE UF2 12SLOT MIDPLANE POWER TELECOM WITH CO	1
11	650-699-01	CABLE CABLE UF2 12SLOT MIDPLANE POWER TELECOM WITH CO	1

MACHINE:

N/A

METHOD:

6.1 Take 1pcs 650-699-00 and 1pcs 650-699-01 MP12 power supply cord, and mark the corresponding labels according to the following method.

650-699-00: One end is marked MP12_J27 and the other end is marked SB25_J9;

650-699-01: One end is marked MP12_J28 and the other end is marked SB25_J10;

650-699-00

650-699-01

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

METHOD:

6.2 Install the wire (650-699-01), and route the wire connector (MPL12_J28) along the wire bracket as shown in the figure, and the wire is outside the stud. Install the connector in the "MPL12_J28" position, and the other end of the line SB 25 J10 goes through the T/H opening to the SB25 area.

6.3 Install the wire (650-699-00), and route the wire connector (MPL12_J27) along the wire bracket as shown in the figure, and the wire is outside the stud. Install the connector in the "MPL12_J27" position, and the other end of the line SB 25 J9 goes through the T/H opening to the SB25 area.

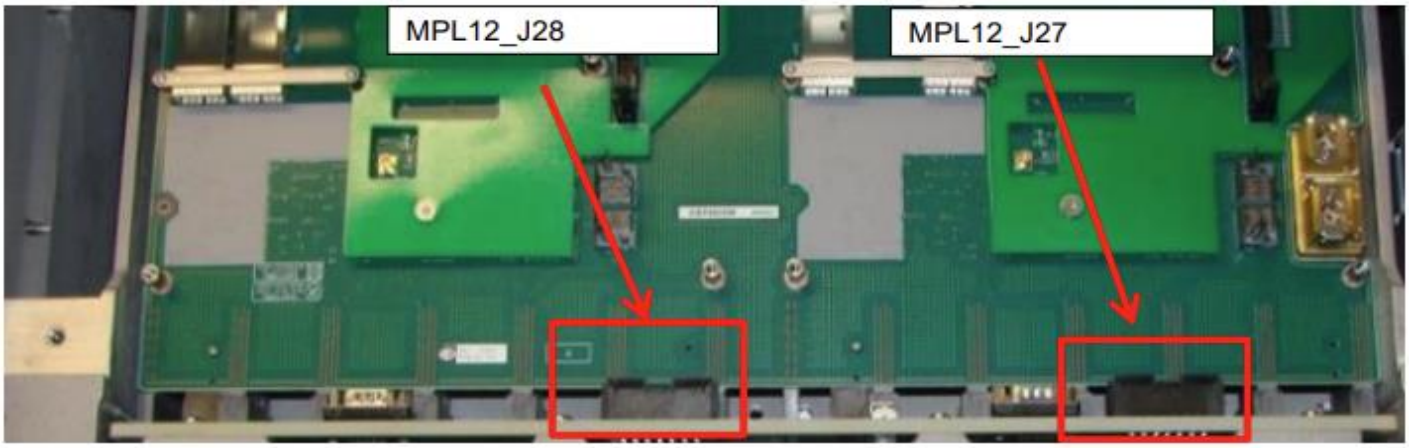

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
12	813-929-01	HDW VELCRO STRP 5/8HDW VELCRO STRP 5/8	7

MACHINE:

N/A

METHOD:

6.4. Fix the wire on the wire support with 7 cable ties (813-929-01) as shown in the figure.

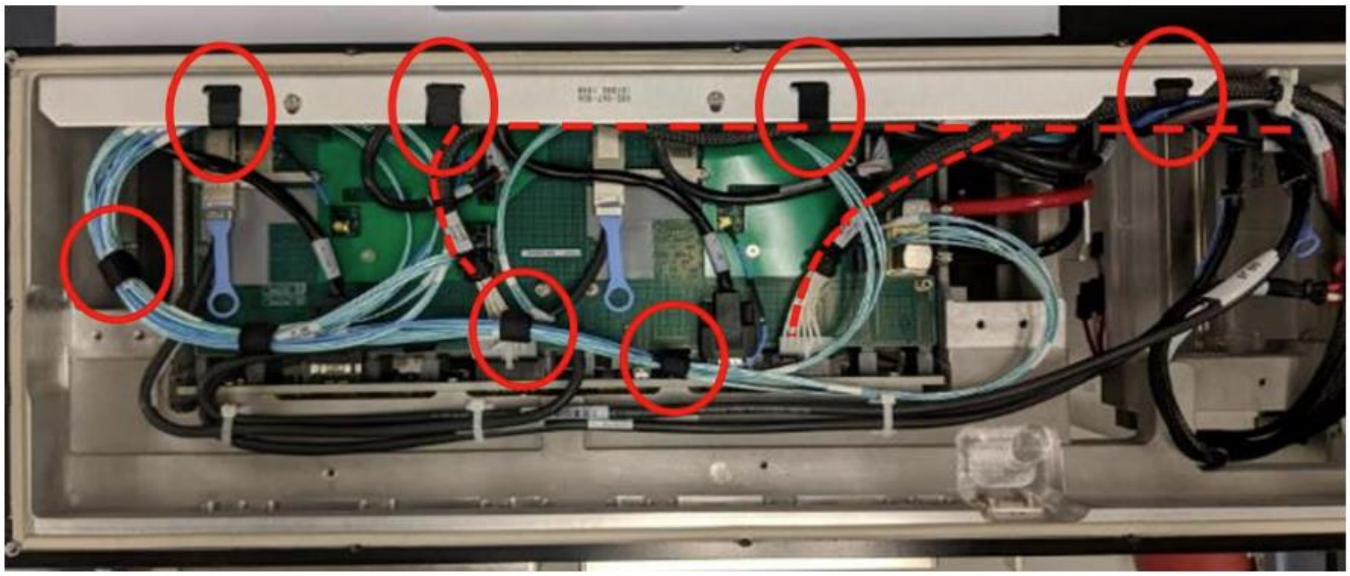

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
13	813-929-01	HDW VELCRO STRP 5/8HDW VELCRO STRP 5/8	7

MACHINE:

N/A

METHOD:

6.5 After passing the wire through the T/H opening as shown in the figure, reserve a length of 14 inches and tie it with a cable tie (813-929-00).

6.6 After finishing the MP12 , tie them with the existing cable tie.

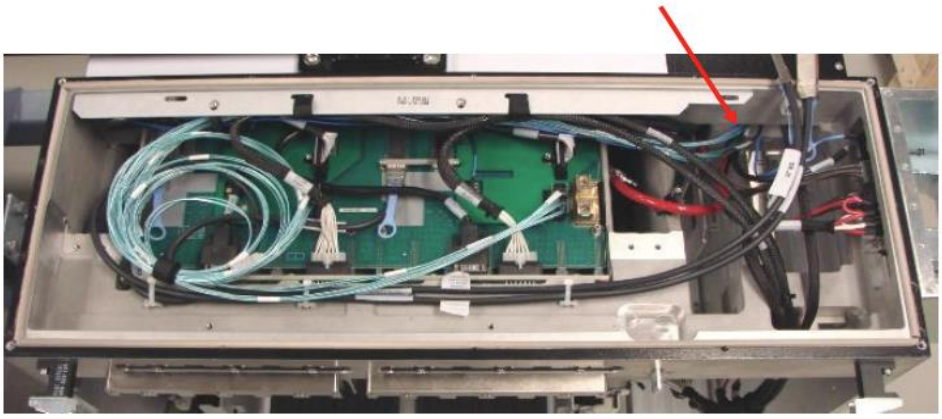

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

7.1 Install the return HFE hose (red) on the HFE return port of DB12 as shown in the figure.

7.2 Install the imported HFE hose (black) on the HFE inlet port of DB12.

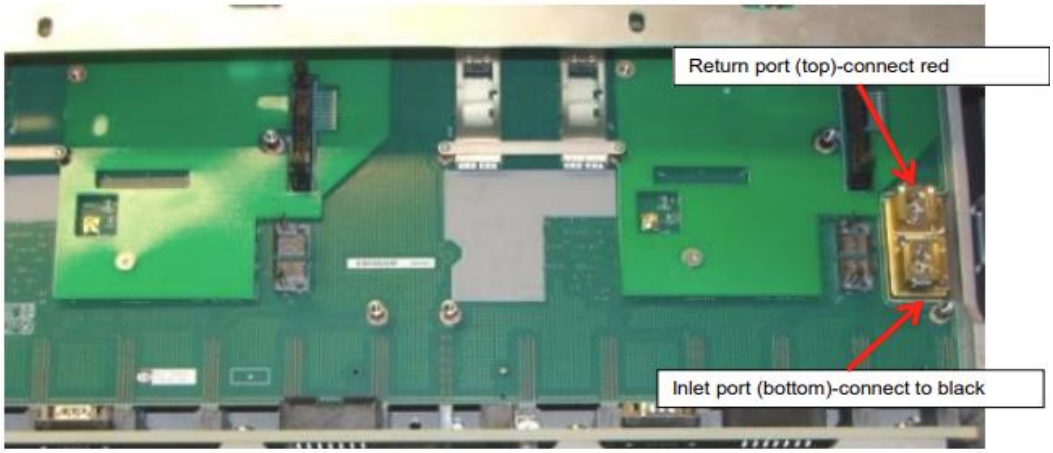

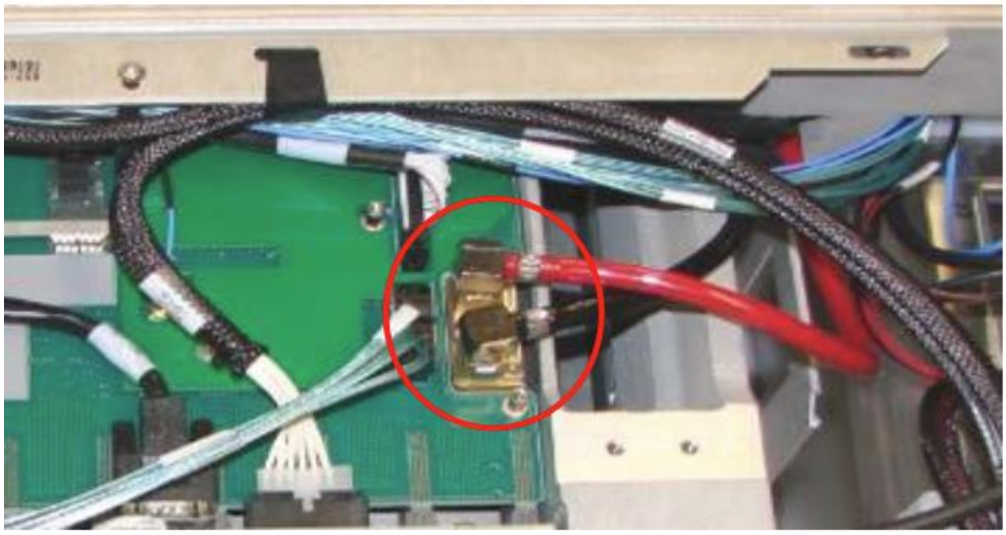

Safety Tips: N/A

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

8.1 Roll up the excess signal wires as shown in the figure and tie them together with a existing cable tie 813-929-01.

Note: Do not twist the cable, as this will damage the performance!

8.2 As shown in the figure, confirm that all the wires are arranged within the height of the cover studs, and re-tie them with the existing cable ties to ensure that there is no interference when covering the cover.

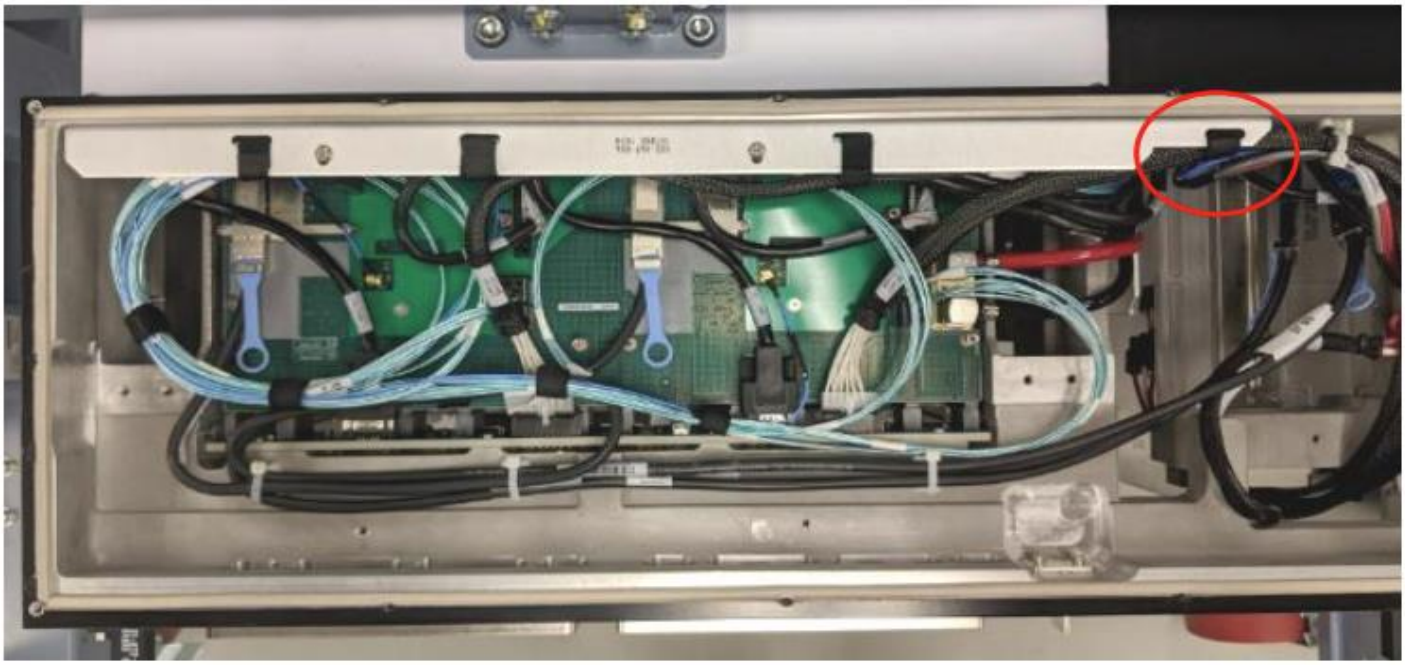

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
15	938-102-00	TIE WRAP 6.5 X 3/16"	1

MACHINE:

N/A

METHOD:

8.3 Arrange the QSFP PCIE cable as shown in the figure and route it to the backplane area.

8.4 Arrange the Midplane power supply line as shown in the figure and tie it to the wire support without touching the cover stud.

8.5 Bundle the wires in the backplane area as shown in the figure, and use a tie 938-102-00 to fix the wires to the wire clamp (tie mount) previously installed on the TH.

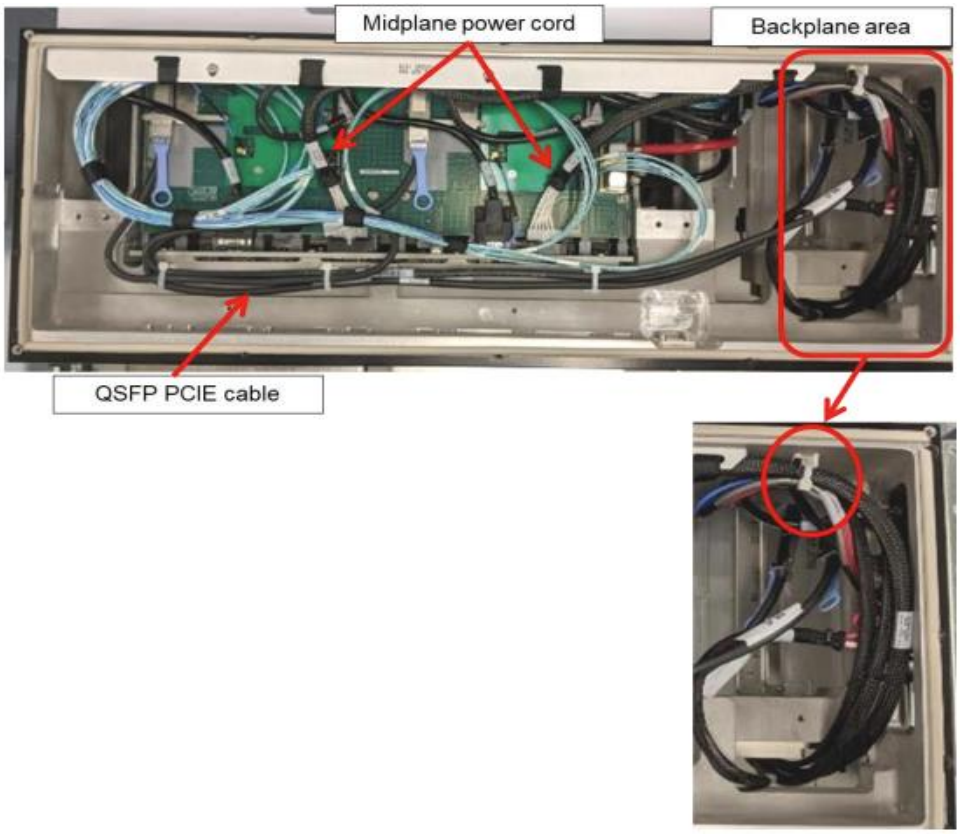

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

Matters needing attention

1. Do ESD and protective safety measures.
2. Be careful during the assembly process so as not to scratch the surface of the parts.
3. After assembly, check the assembled parts for defects and leak-free operation.