Build Overview:

1 Install Bus Bars

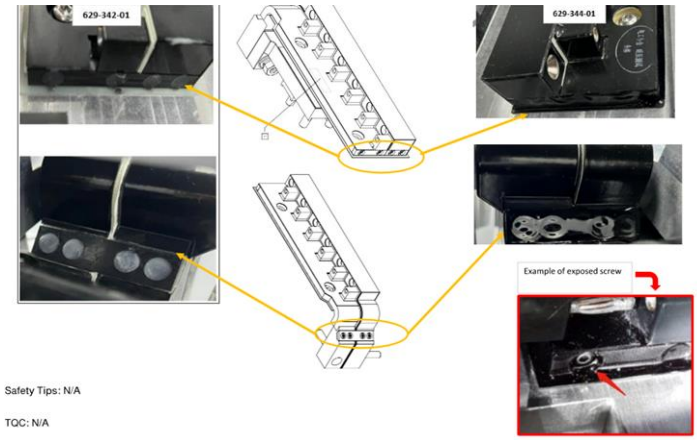

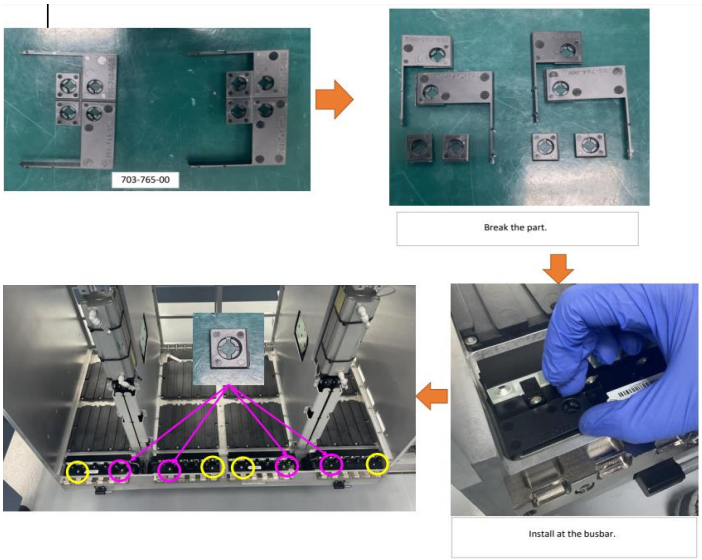

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by	
	1	New Issue	JOSEPH AMAD	**Prepared By:** JOSEPH R. AMAD, Manufacturing Engineer
				Checked By: IVAN NOWELL PANIQUE, Team Lead
				Approved By: SHERWIN ARIOSTE, Operations Manager

MAN: CERTIFIED TECHNICIANS.

MATERIAL:

NO.	PART NO.	DESCRIPTION	QTY.
1	629-342-01	COPPER OR BRASS, UF2 BUSBAR ASSY, LEFT, PLATES	2
2	406-502-20	SCRW PAN HEAD TORX M5X.8P/20MM SS W/NYLOK	8
3	629-344-01	COPPER OR BRASS, UF2 BUSBAR ASSY, RIGHT, PLATES	2
4	703-765-00	MECHANICAL, COVER, END STRAP, BUS BAR, UF2, FOR SEMI	2

METHOD:

Flow chart of operation steps

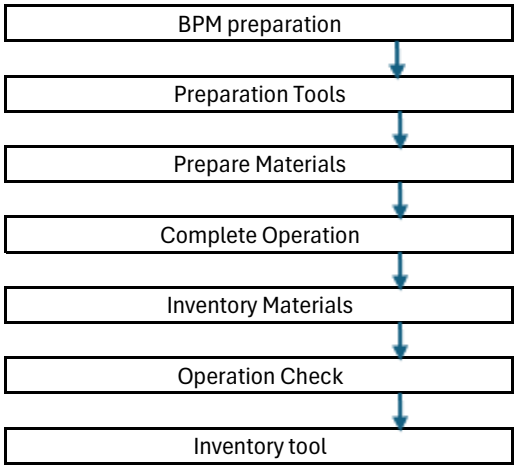

MACHINE:

TOOL NAME	TORQUE VALUE
T25 TORX WRENCH	1.1 N.m
13MM SOCKET SLEEVE	13.5 N.m
MULTIMETER	N/A

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
1	629-342-01	COPPER OR BRASS, UF2 BUSBAR ASSY, LEFT, PLATES	2
2	629-344-01	COPPER OR BRASS, UF2 BUSBAR ASSY, RIGHT, PLATES	2

MACHINE: N/A

METHOD:

Incoming Inspection

1. Take the 2 pcs busbar 629-342-01 and 2 pcs 629-344-01. Then make sure the scew in circle not exposed and cover by epoxy.

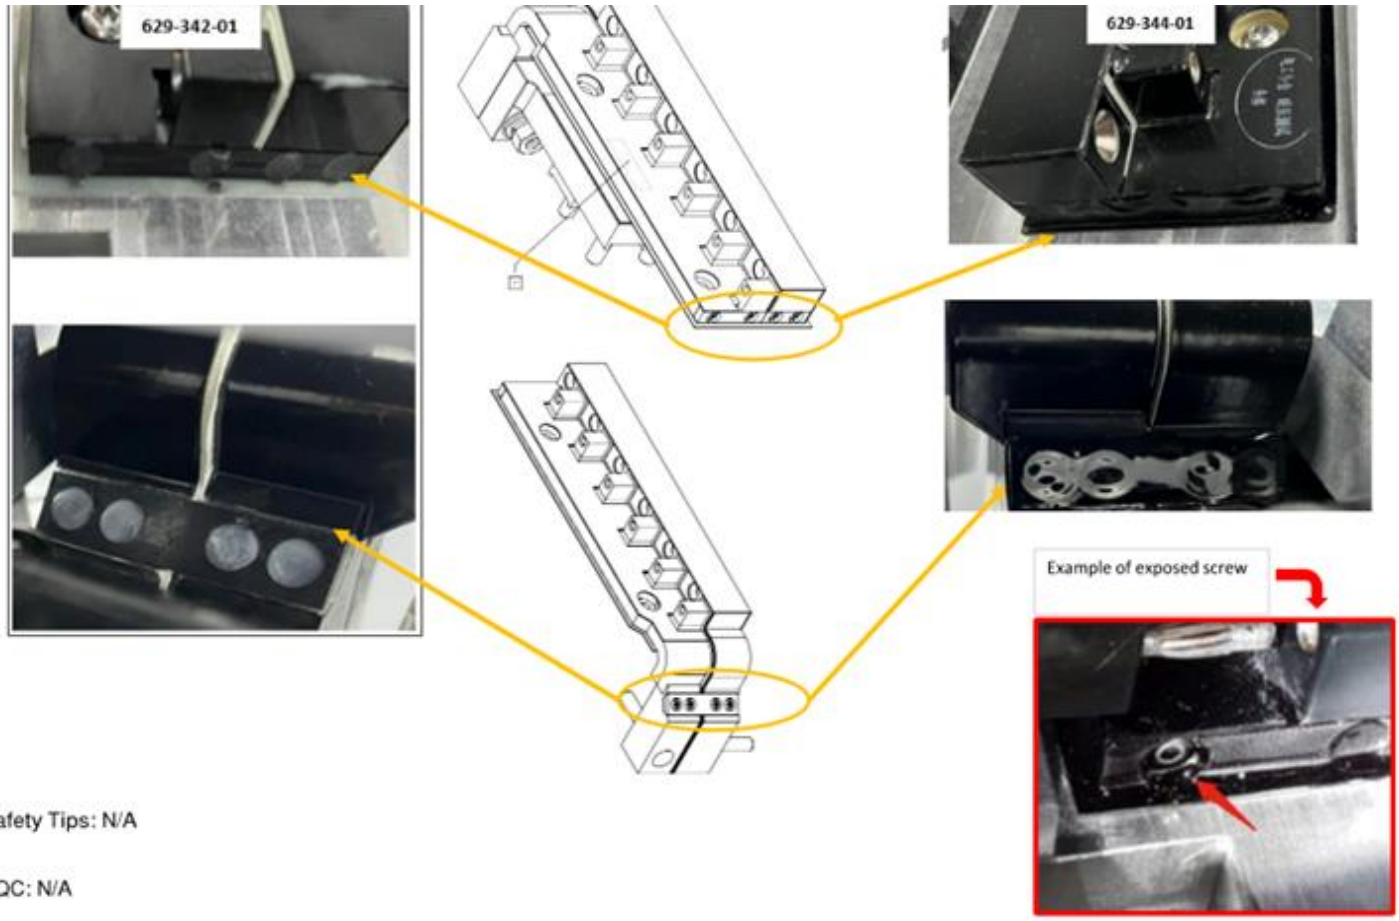

Safety Tips: N/A

TQC: N/A

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
1	629-342-01	COPPER OR BRASS, UF2 BUSBAR ASSY, LEFT, PLATES	2

MACHINE: N/A

METHOD:

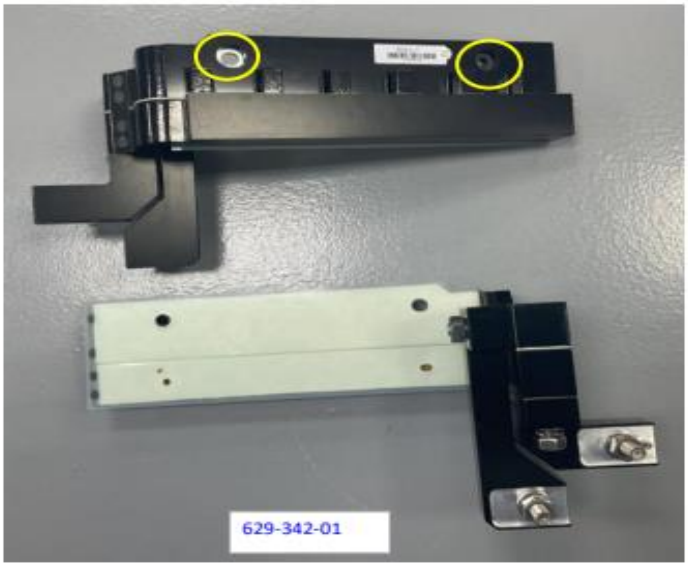

Make sure there is 2 plastic bush on the busbar.

One bush is fix on the busbar and another one is loose.

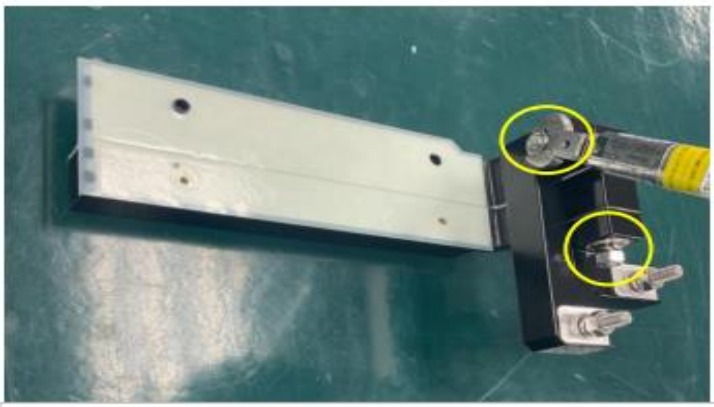

Remove the upper and lower adppter busbar using opne end 13mm and 13.5Nm.

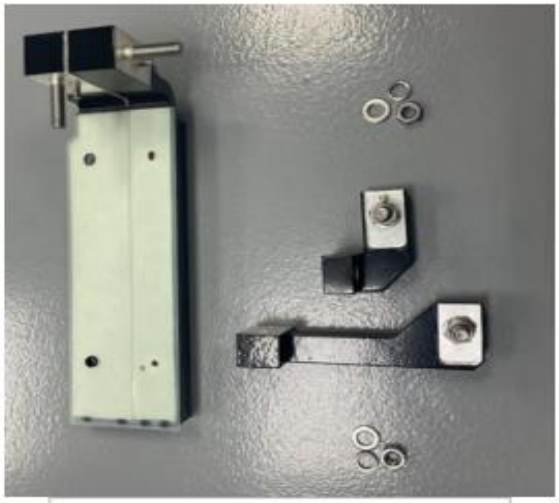

Repeat this process for second busbar.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
2	629-344-01	COPPER OR BRASS, UF2 BUSBAR ASSY, RIGHT, PLATES	2

MACHINE: N/A

METHOD:

Make sure there is 2 plastic bush on the busbar.

One bush is fix on the busbar and another one is loose.

Remove the upper and lower adppter busbar using opne end 13mm and 13.5Nm.

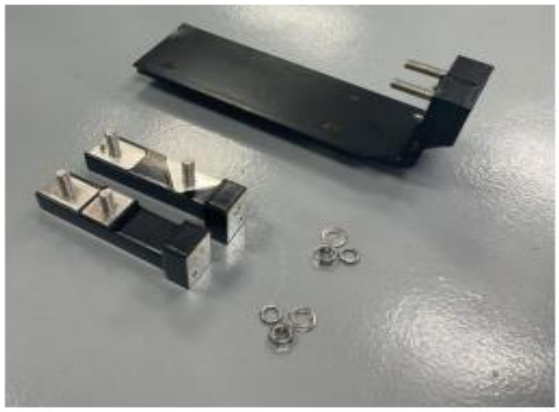

Repeat this process for second busbar.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

Turn the Test head.

Install left busbar. Insert the busbar into the slot opening and turn it to flat frame.

After installing the left busbar.

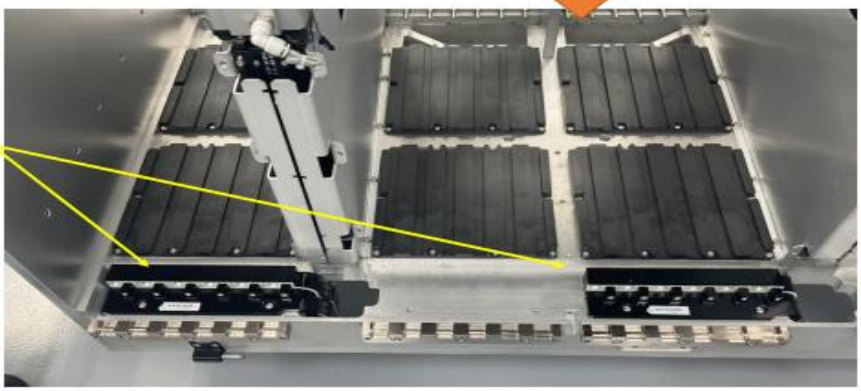

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD:

Install the right busbar.

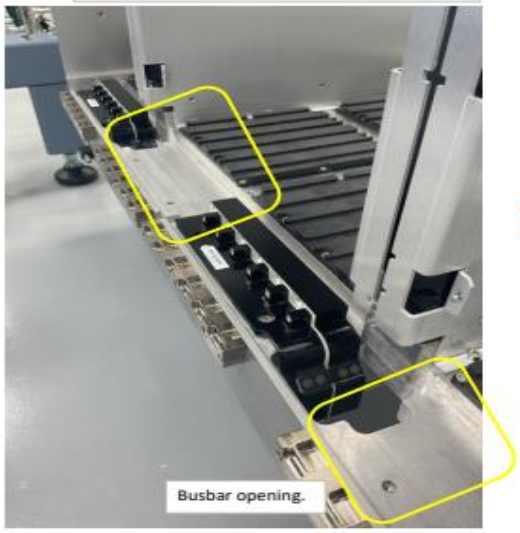

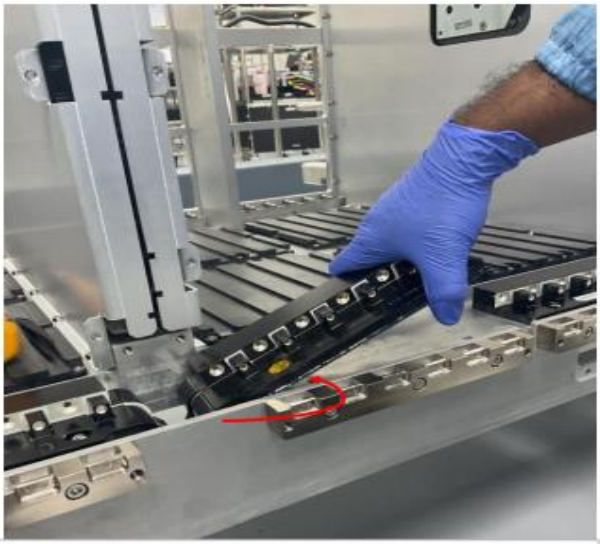

Install right busbar. Insert the busbar into the slot opening and turn it to flat frame.

After installing the right busbar.

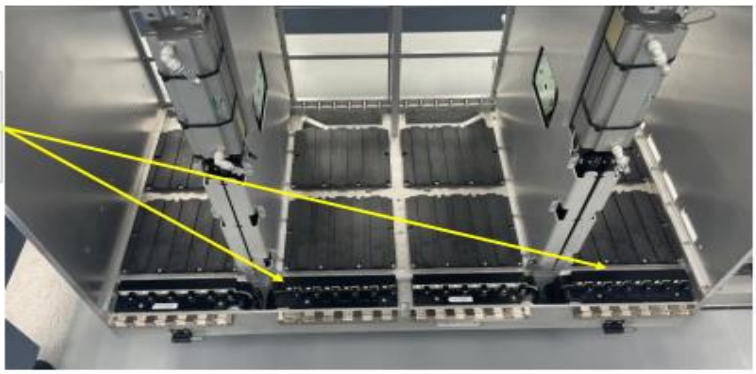

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
3	703-765-00	MECHANICAL, COVER, END STRAP, BUS BAR, UF2, FOR SEMI TEST	2

MACHINE: N/A

METHOD:

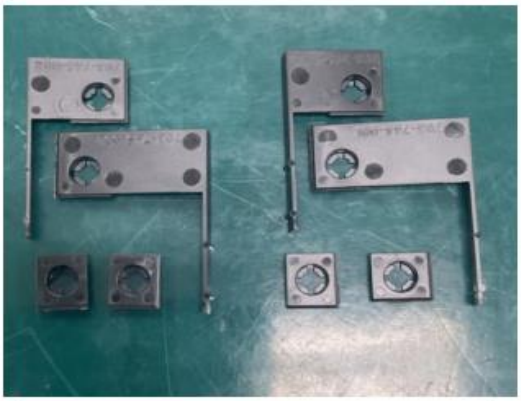

Break the part.

Install at the busbar.

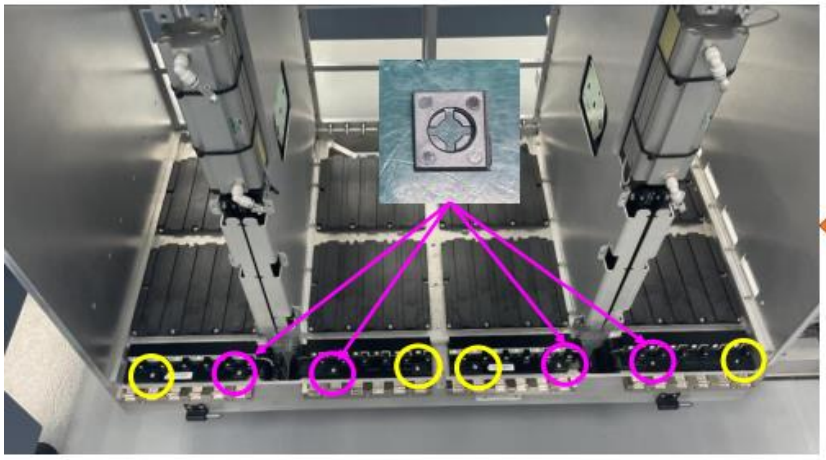

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
4	406-502-20	SCRW PAN HEAD TORX M5X.8P/20MM SS W/NYLOK	8

MACHINE: T25 Torx wrench, 1.1 N.m

METHOD:

Thigthen the busbar by using 8pcs screw (406-502-20).

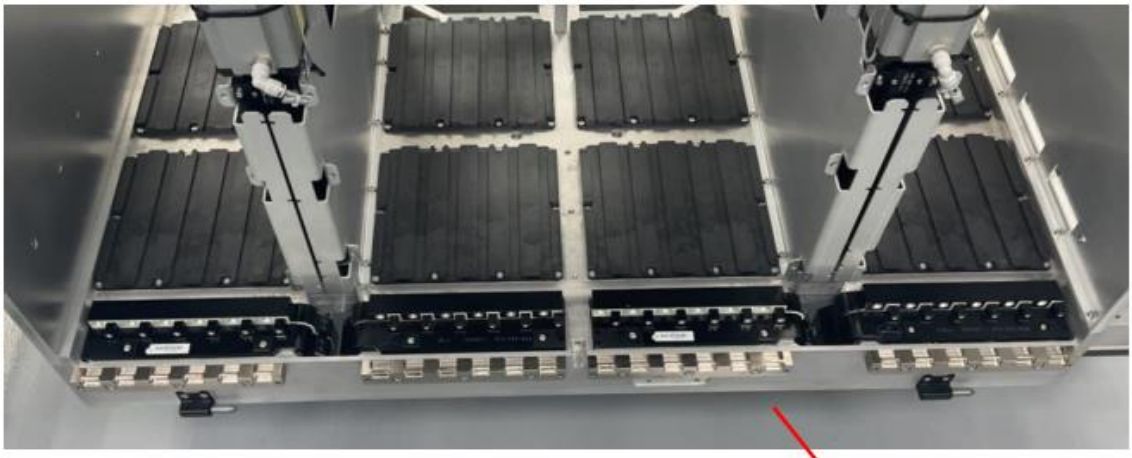

Use T25bit with screwdriver 1.1Nm.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: Multimeter

METHOD:

Check the Busbar is not short-circuited with T/H frame.

Take multimeter and set the multimeter to the ohm range.

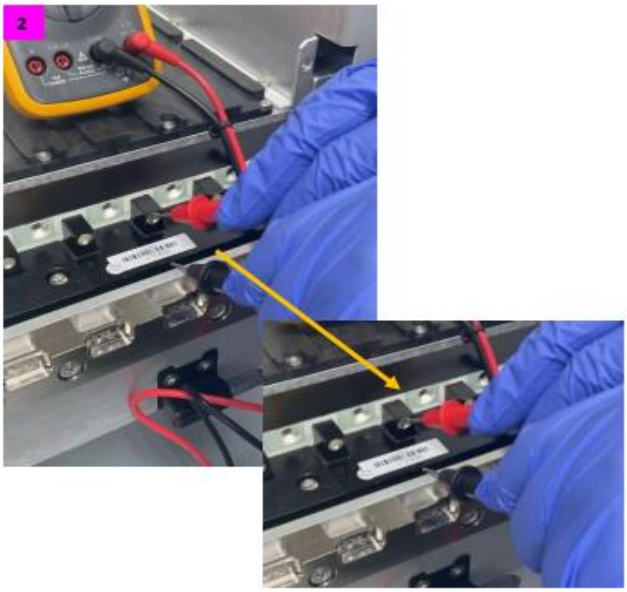

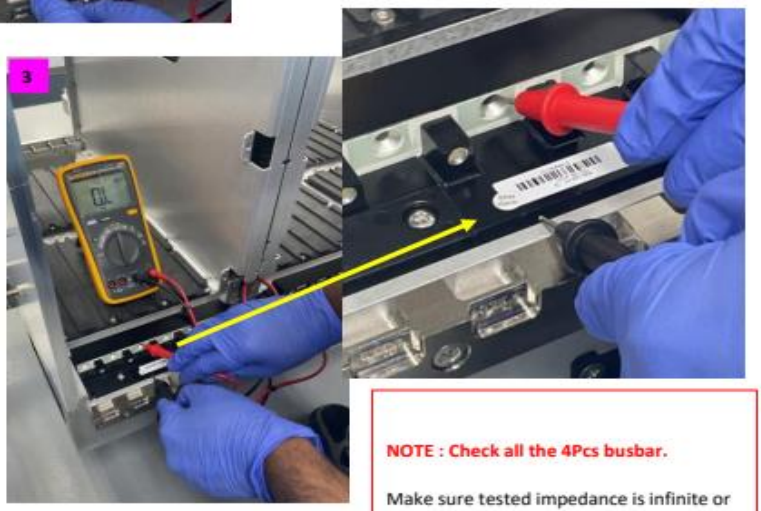

NOTE : Check all the 4Pcs busbar.

Make sure tested impedance is infinite or open.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD: Installation of Bus bar Adaptors from Left, 629-342-01 assembly

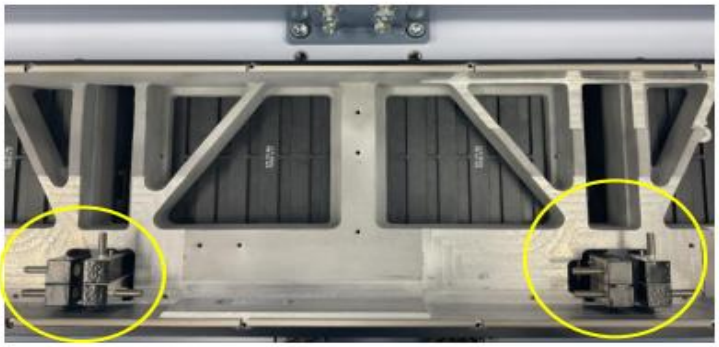

Turn the test head.

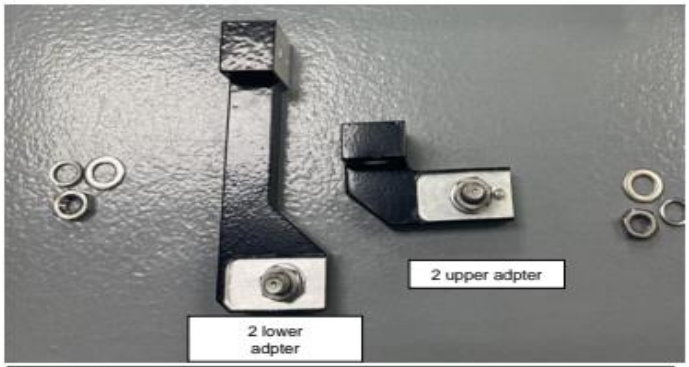

Take the adpter that has been removed.

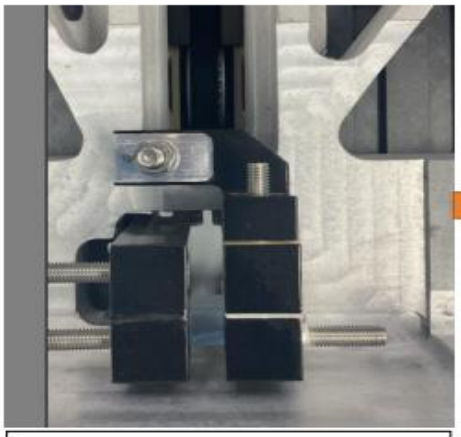

Install upper adpter first.

Then, install lower adpter.

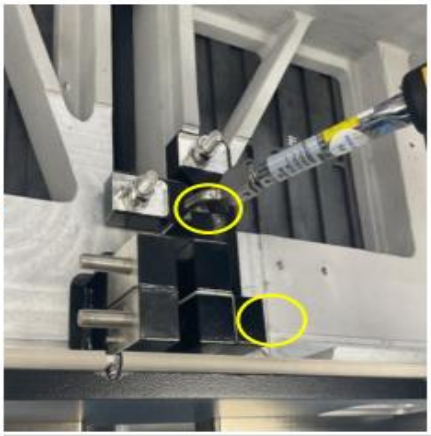

Lock it by using flat washer, split lock dan nut.

Use 13mm open end 13.5Nm

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: N/A

METHOD: Installation of Bus bar Adaptors from Right, 629-344-01 assembly

Turn the test head.

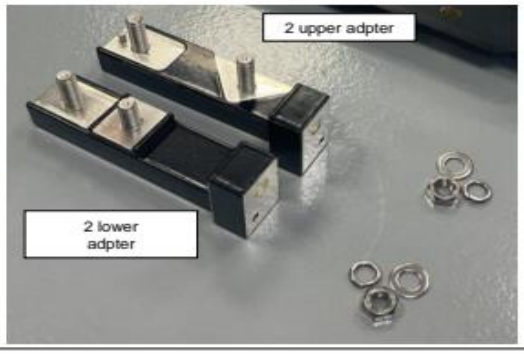

Take the adpter that has been removed.

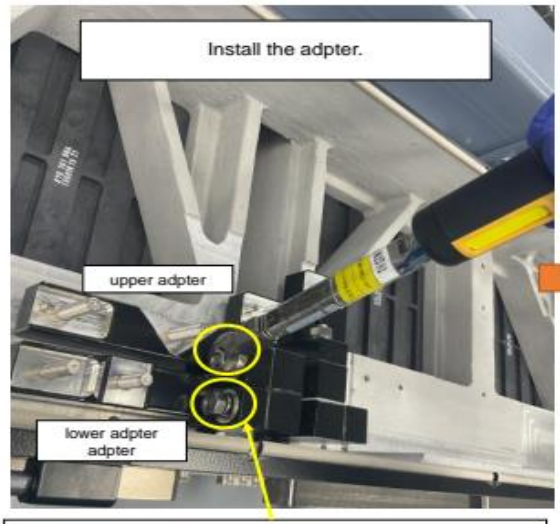

Lock it by using flat washer, split lock dan nut.

Use 13mm open end 13.5Nm

After complete the process.