Build Overview:

1 **TDR Panel Sub-Assembly Build & Install**
2 **Interlock Panel Sub-Assembly Build & Install**

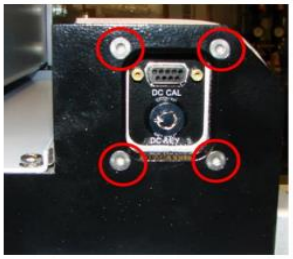

After locking, use a marker to make a mark on the nut and lock lever on the back.

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by
	1	New Issue	JOSEPH AMAD

Prepared By:
JOSEPH R. AMAD
Manufacturing Engineer

Checked By:
IVAN NOWELL PANIQUE
Team Lead

Approved By:
SHERWIN ARIOSTE
Operations Manager

MAN: CERTIFIED TECHNICIANS.

MATERIAL:

NO.	PART NO.	DESCRIPTION	QTY.
1	627-084-01	CABLE UF2 TDR COAX PANEL TELECOM WITH CONN	3
2	632-204-00	PLASTIC INSULATOR TDR PANEL SEAL OR GASKET	1
3	631-669-00	ALUMINUM PANEL TDR BRACKET OR MISC ARTICLE	1
4	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L W/CONE WASHER,	7
5	835-129-00	HDW FSTNR SNAP M ST	4
6	479-133-15	LABEL, CHASSIS GROUN	4
7	813-929-00	HDW VELCRO STRP 5/8	1
8	606-359-12	SCRW FLAT HEAD TORX M4X.7P/12 MM SS W/NYLOK	4
9	654-447-00	CABLE, UF2 DC CAL SAFETY SWITCH, TELECOM, WITH CONN	1
10	626-232-00	CABLE UF2_DCCAL_PANEL TELECOM WITH CONN	1
11	654-503-00	ALUMINUM, DC CAL PANEL, BRACKET OR MISC ARTICLE	1
12	606-359-20	SCRW FLAT HEAD TORX M4X.7P/20MM SS W/NYLOK	4
13	938-104-01	4 INCH TIE WRAP BLA	3
14	835-610-00	HDW CLAMP CBL .312	2

METHOD:

Flow chart of operation steps

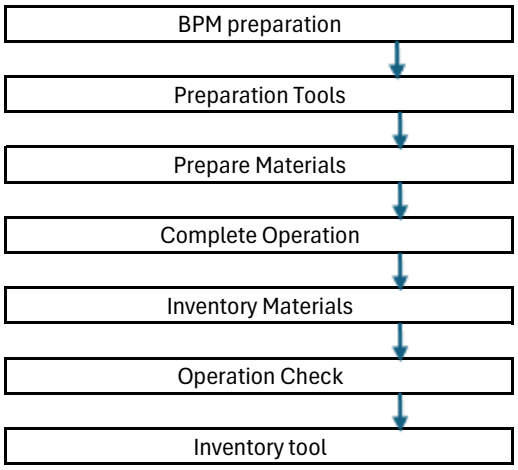

MACHINE:

TOOL NAME	TORQUE VALUE
8MM SOCKET	1.02 N.m(9 in-lbs)
PH2 CROSS HEAD	3.3 N.m
T20 TORX WRENCH	1.6 N.m
5MM HEX SOCKET	0.19 N.m
15MM OPEN-END WRENCH	N/A

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
1	627-084-01	CABLE UF2 TDR COAX PANEL TELECOM WITH CONN	3
2	632-204-00	PLASTIC INSULATOR TDR PANEL SEAL OR GASKET	1

MACHINE: N/A

METHOD:

Operation steps

1.1 Take 3 TDR cables (627-084-01).

a. Remove 3 shoulder washers from 3 wires and save them for later assembly.

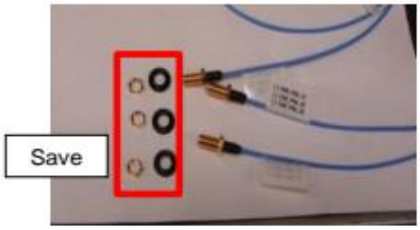

b. Remove 3 copper hexagon nut from 3 wires. Save for subsequent assembly use.

1.2 Take one small insulating board (632-204-00).

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
3	631-669-00	ALUMINUM PANEL TDR BRACKET OR MISC ARTICLE	1

MACHINE: N/A

METHOD:

1.3 Take one TDR panel (631-669-00).

1.4 Turn the TDR panel upside down as shown in the figure and place the small insulating plate face up to ensure that the plane of the small

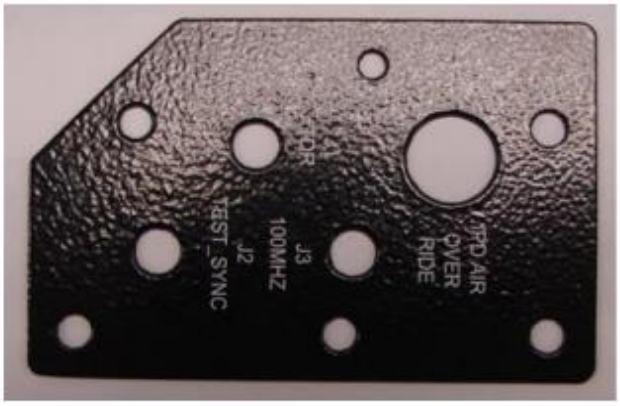

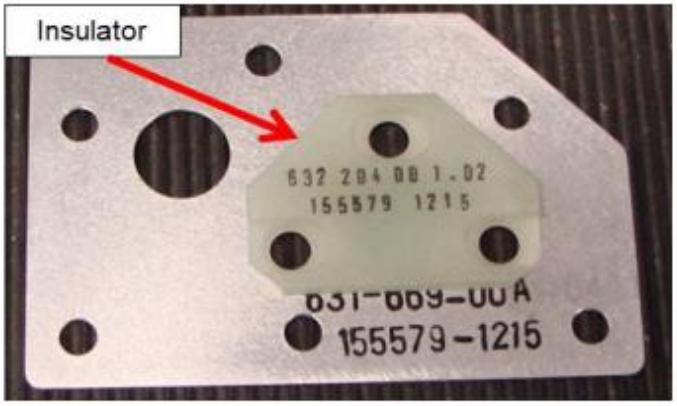

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: Marker pen

METHOD:

1.5 Take 3 TDR wires (627-084-01) and mark them.

a. Mark “TDR_PANEL_J1” on one end of the cable's panel, and mark “SUPPLN J50” on the back of the cable.

b. Mark “TDR_PANEL_J2” on one end of the cable's panel, and mark “SUPPLN J49” on the back of the cable.

c. Mark “TDR_PANEL_J3” on one end of the wire panel, and mark “SUPPLN J48” on the back end of the wire.

1.6 Thread the wire from the surface of the small insulating board.

The wire penetrates into the corresponding hole of the panel according to the mark.

The wire needs to be completely inserted into the slot of the small insulator board.

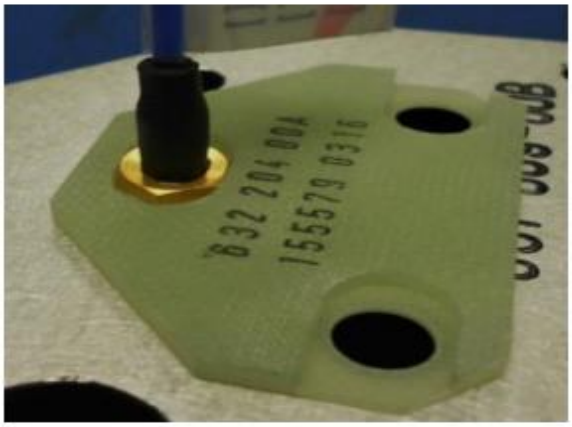

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: 8mm socket, 1.02 N.m. (9 in-lbs.)

METHOD:

1.7 Install a shoulder washer in the connector hole of the panel surface, with the shoulder facing downward into the hole, then install the brass hexagon nut fixing wire, the tool is an 8mm socket
The torque value is 1.02 N.m. (9 in-lbs.)

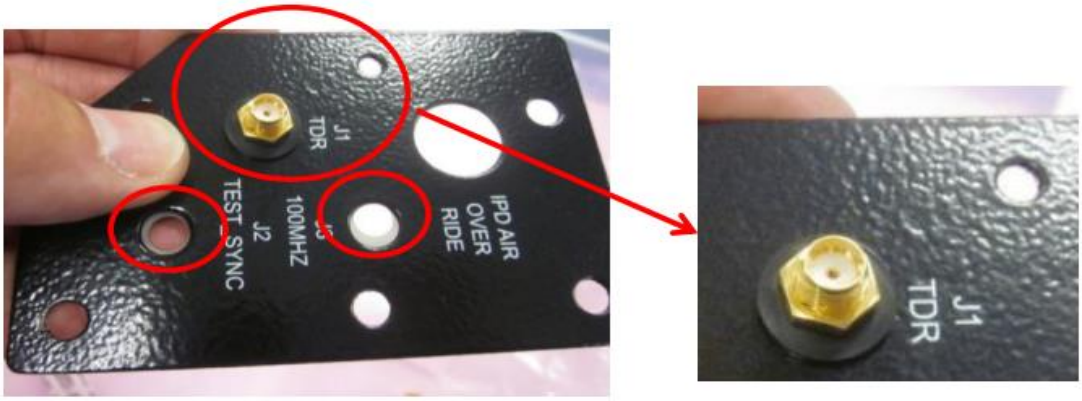

1.8 Repeat the above actions to install the other two wires.

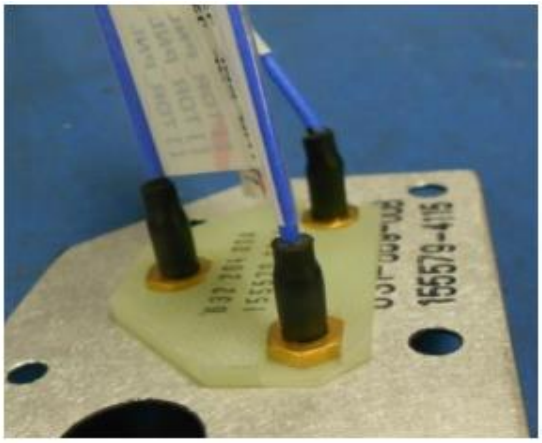

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
4	472-426-12	WASHER. O.D. 11MM	5
5	835-129-00	HDW FSTNR SNAP M ST	1
6	606-359-12	SCRW FLAT HEAD TORX M4X.7P/12MM SS W/NYLOK	1
7	479-133-15	LABEL, CHASSIS GROUN	1

MACHINE: PH2 cross head 3.3 N.m, T20 Torx head 1.6 N.m

METHOD:

2.1 Fix the TDR panel on the T/H with 5pcs M5 screws (472-426-12) as shown in the figure.
The tool is a PH2 cross head and the torque value is 3.3 N·m.

2.2 Install a knob (835-129-00) on the TDR panel as shown in the figure, and then install a flat head screw (606-359-12), the tool is a T20 Torx head, The torque value is 1.6 N·m, and a grounding label (479-133-15) is attached.

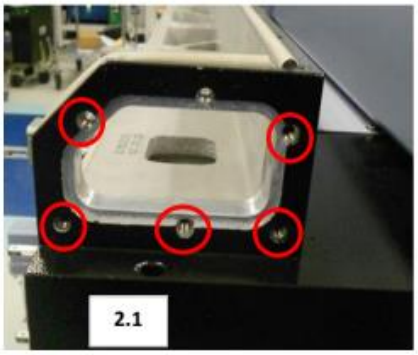

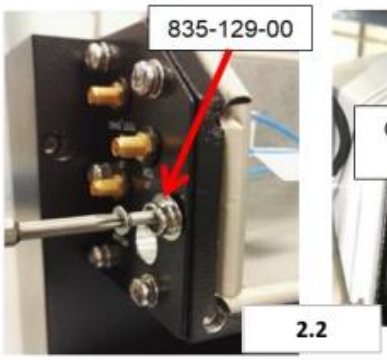

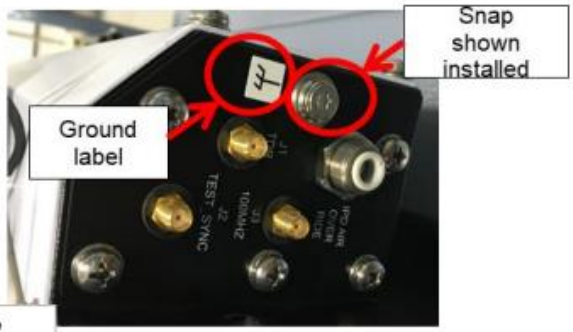

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
8	813	HDW VELCRO STRP 5/8	1

MACHINE: N/A

METHOD:

2.3 Pass the other end of the wire through the small square hole as shown, and the wire is perpendicular to the backplane. Use a black cable tie (813-929-00) to temporarily tie the wire to the T/H frame.

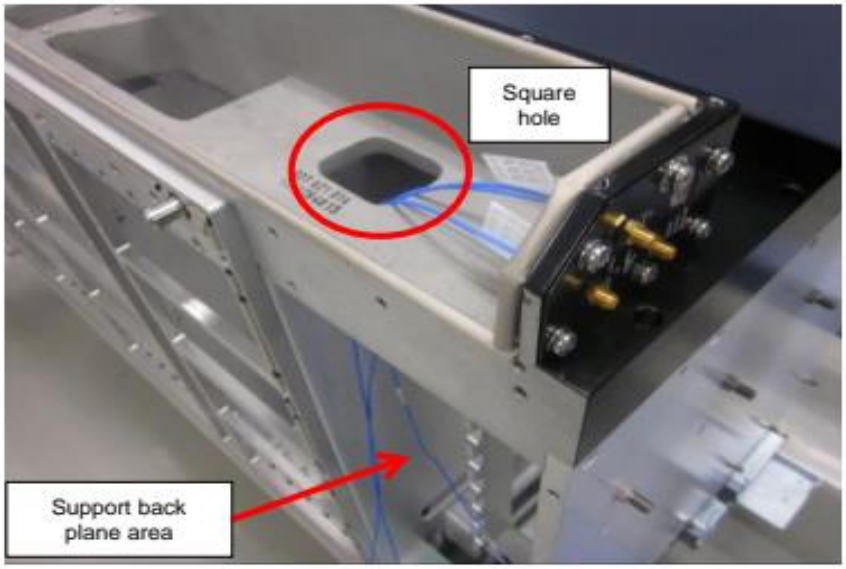

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
9	835-129-00	HDW FSTNR SNAP M ST	3
10	606-359-12	SCRW FLAT HEAD TORX M4X.7P/12MM SS W/NYLOK	3
11	479-133-15	LABEL, CHASSIS GROUN	3

MACHINE: T20 Torx bit 1.6 N.m

METHOD:

2.4 Install the grounding knob and grounding label at the position shown in the figure.

a. Install 3 knobs (835-129-00) as shown in the picture, and then install 3 flat head screws (606-359-12), the tool is a T20 Torx bit. The torque value is 1.6 N·m.

b. Install 3 grounding labels (479-133-15) as shown in the figure.

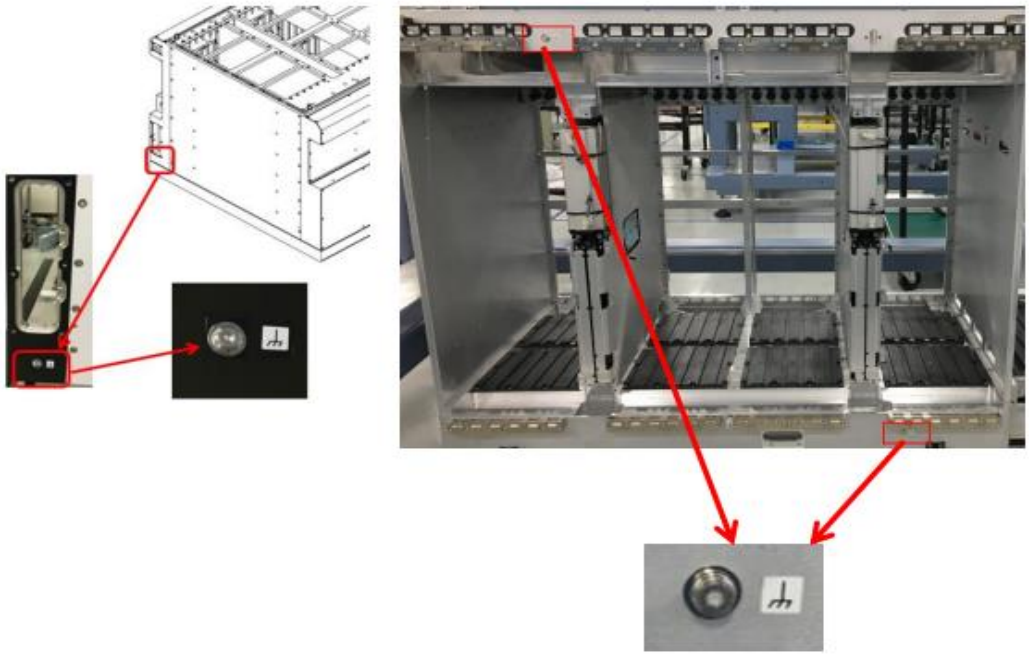

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
12	654-447-00	CABLE, UF2 DC CAL SAFETY SWITCH, TELECOM, WITH CONN	1
13	626-232-00	CABLE UF2_DCCAL_PANEL TELECOM WITH CONN	1
14	654-503-00	ALUMINUM, DC CAL PANEL, BRACKET OR MISC ARTICLE	1

MACHINE: 15mm open-end wrench

METHOD:

3.1 Take one key switch wire (654-447-00) as shown in the figure.

3.2 Take 1 cable (626-232-00).

3.3 Take the DC panel (654-503-00).

3.4 Take a set of keys. From the cable package 626-232-00

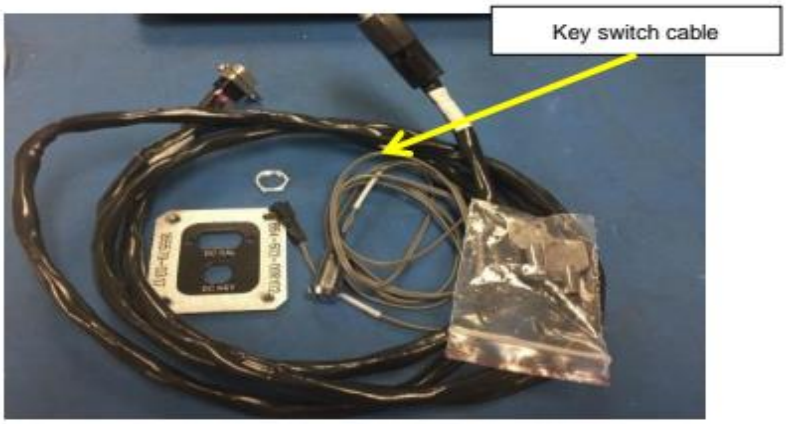

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: 15mm open-end with 2.0 N.m

METHOD:

3.5 Install the key switch cable (654-447-00) on the panel, first manually tighten and then use a 15mm open-end wrench to turn the nut. Use Torque 2.0 N.m

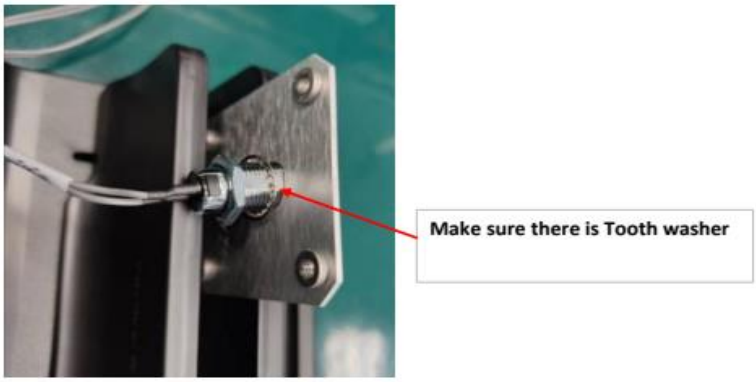

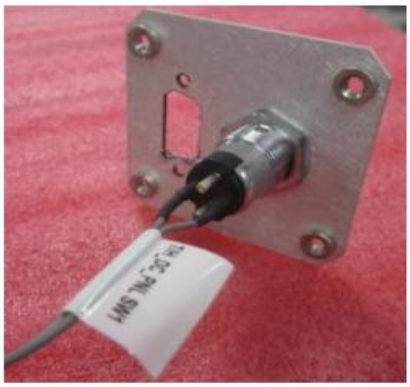

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL: N/A

MACHINE: 5mm hex socket 0.19 N.m

METHOD:

3.6 Remove the gasket at the back of the cable (626-232-00) connector as shown in the figure and discard.

3.7 Remove the stud at the front end of the wire (626-232-00) and save the hexagon nut.

3.8 Install the cable connector from the rear of the panel and reinstall the stud, use a 5mm hex socket to fix the nut to 0.19 N·m.

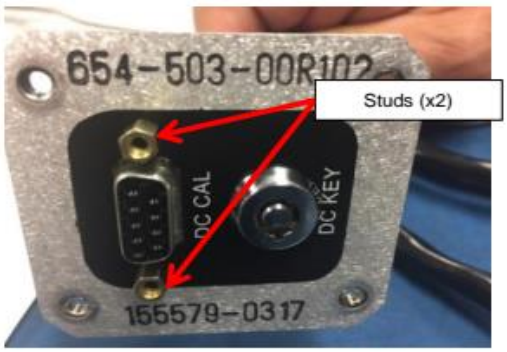

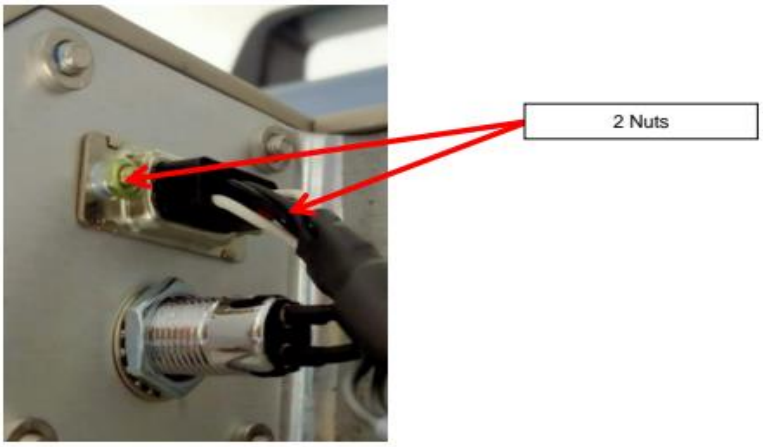

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
15	606-359-20	SCRW FLAT HEAD TORX M4X.7P/20MM SS W/NYLOK	4

MACHINE: N/A

METHOD:

3.9 Install the panel from the inside of the T/H to the T/H frame as shown in the figure, and fix it with 4pcs M4 screws (606-359-20). The tool is a T20 Torx wrench. The torque value is 1.6 N·m.

After locking, use a marker to make a mark on the nut and lock lever on the back.

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
16	938-104-01	4 INCH TIE WRAP BLA	3
17	835-610-00	HDW CLAMP CBL .312	2
18	472-426-12	WASHER. O.D. 11MM	2

MACHINE: PH2 cross head 3.3 N.m

METHOD:

3.10 Use a cable tie (938-104-01) to tie the key to the T/H handle (position as shown) as shown in the figure.

3.11 Install 2 plastic clips (835-610-00) as shown in the figure, thread through the plastic clips, and then fix them with M5 screws (472-426-12). The tool is a PH2 cross head with a torque value of 3.3 N·m.

3.12 Pass the thread through the small square hole to the back plate surface as shown in the figure.

3.13 Use two cable ties (938-104-01) to bind the switch wire and the black wire to the position shown in the figure.

3.14 Use the existing cable ties to tie the wires on the back panel together.

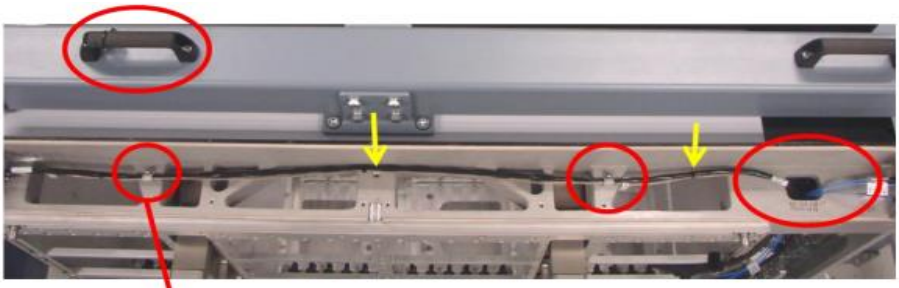

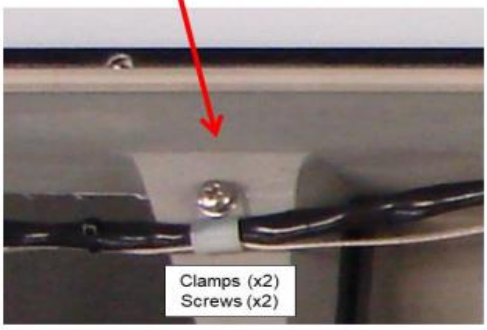

Safety Tips: N/A