Build Overview:

1 DB6 Manifold Assembly Install

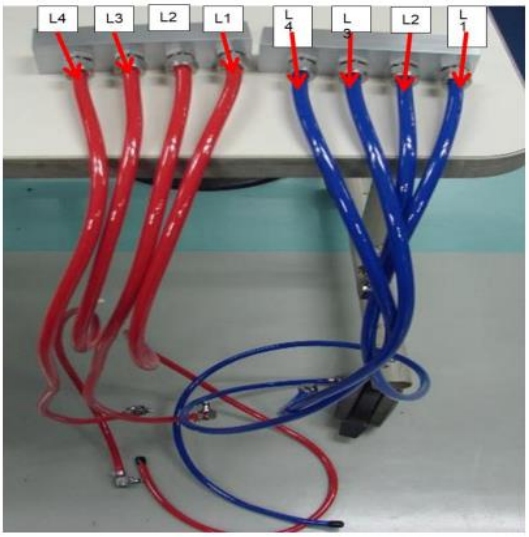

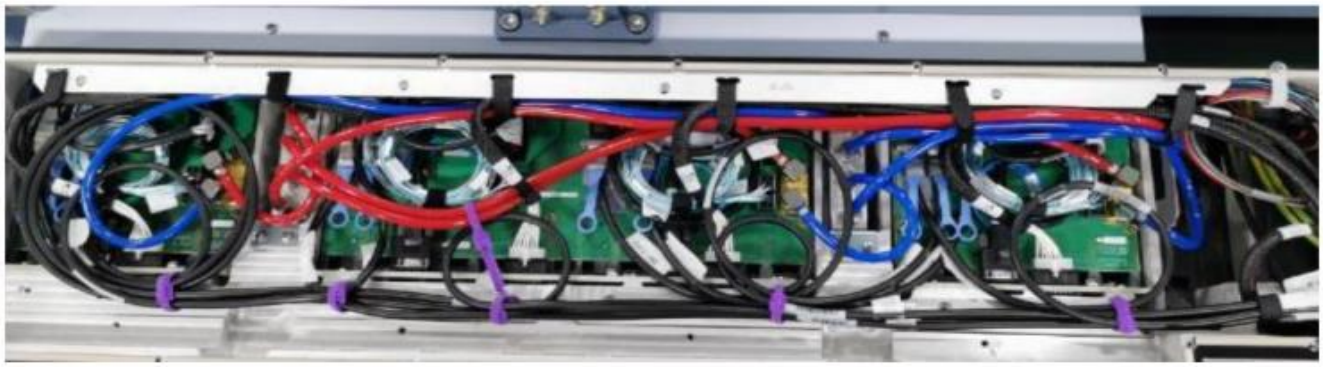

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by
	1	New Issue	JOSEPH AMAD

Prepared By:
JOSEPH R. AMAD
Manufacturing Engineer

Checked By:
IVAN NOWELL PANIQUE
Team Lead

Approved By:
SHERWIN ARIOSTE
Operations Manager

MAN: CERTIFIED TECHNICIANS.

MATERIAL:

NO.	PART NO.	DESCRIPTION	QTY.
1	634-757-00	ELECTRO MECHANICAL DISTRIBUTION BOARD RETURN MANIFOLD ASSEMBLY FOR SEMI TEST	1
2	634-756-00	ELECTRO MECHANICAL DISTRIBUTION BOARD MANIFOLD ASSEMBLY	1
3	632-818-01	FORGED OR STAMPED STEEL DB MINI MANIFOLD BRACKET MISC	2
4	470-420-10	SCRW FLAT HEAD TORX M3X.5P/10MM SS W/NYLOK	8
5	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L W/ CONE WASHER. O.D. 11MM	4
6	813-929-01	HDW VELCRO STRP 5/8	4

METHOD:

Flow chart of operation steps

BPM preparation
↓
Preparation Tools
↓
Prepare Materials
↓
Complete Operation
↓
Inventory Materials
↓
Operation Check
↓
Inventory tool

MACHINE:

TOOL NAME	TORQUE VALUE
T10 TORX WRENCH	0.7 N.m
PH2 PHILLIPS TORQUE SCREWDRIVER	3.3 N.m
OPEN END 16MM	NA
OPEN END 19MM	NA

TERADYNE PHILIPPINES LTD. _ CEBU

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
1	634-757-00	ELECTRO MECHANICAL DISTRIBUTION BOARD RETURN MANIFOLD	1
2	634-756-00	ELECTRO MECHANICAL DISTRIBUTION BOARD RETURN MANIFOLD	1

MACHINE:

N/A

METHOD:

1. Operation steps

1.1 Take 2 DB6 Manifolds.

a. 1 outlet Manifold (634-757-00), red tube.

b. 1 inlet Manifold (634-756-00), blue tube.

1.2 Pay attention to the position corresponding to the length of the tube, L1 should be the longest.

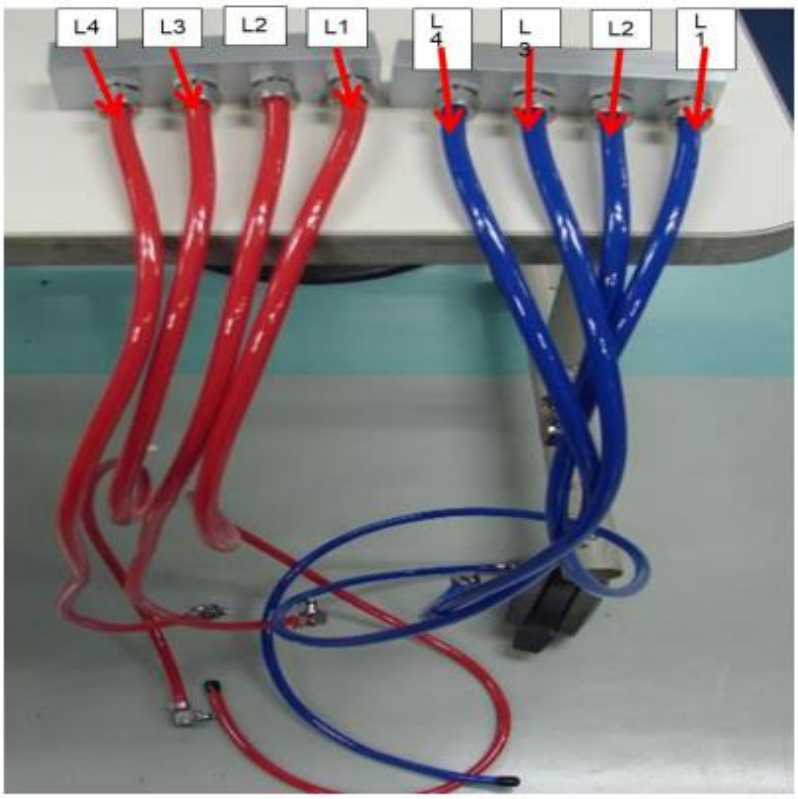

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
3	632-818-01	FORGED OR STAMPED STEEL DB MINI MANIFOLD BRACKET	2
4	470-420-10	SCRW FLAT HEAD TORX M3X.5P/10MM SS W/NYLOK	8

MACHINE:

T10 torx wrench 0.7 N·m

METHOD:

1.3 Install a Manifold with a red tube on a bracket (632-818-01) and fix it with 4 M3 screws (470-420-10), The tool is a T10 torx wrench with a torque value of 0.7 N·m.

a. Pay attention to the Manifold direction when installing Manifold as shown in the figure, and the longest pipe is close to the bend of the bracket.

b. Follow the steps above to install the blue pipe Manifold on the bracket as shown in the figure

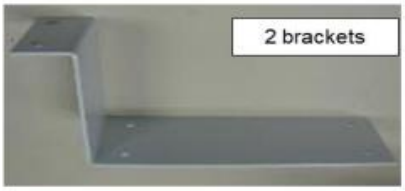

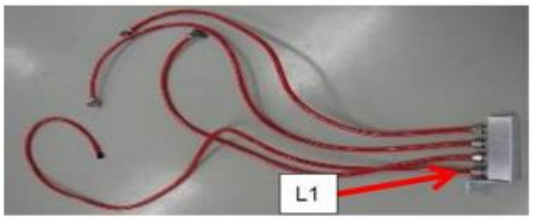

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
5	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8x12MM L W/ CONE	4

MACHINE:

PH2 Phillips torque screwdriver 3.3 N·m

METHOD:

1.4 Install Manifold on T/H

a. Install the red pipe Manifold to the DB_0 area as shown in the figure, and fix it with 2 M5 screws (472-426-12), The tool is a PH2 Phillips torque screwdriver with a torque value of 3.3 N·m.

b. Install the blue pipe Manifold to the DB_3 area as shown in the figure, and fix it with 2 M5 screws (472-426-12), The tool is a PH2 Phillips torque screwdriver with a torque value of 3.3 N·m.

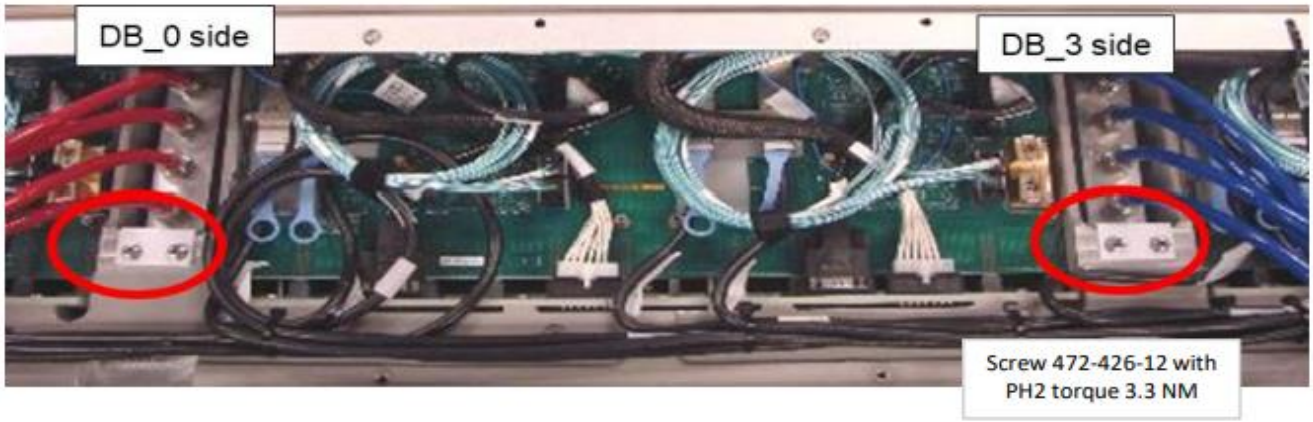

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

1.5 Install the red and Blue HFE pipes in the following order:

a. Pass L1 through the DB_3 area as shown in the figure, and then pass through the T/H frame to the opposite side, so that the line at the pipe interface remains slack.

b. Place L2 in the DB1_2 area as shown in the figure and insert it into the return port of DB12.

c. Place L3 in the DB_3 area as shown in the figure and insert it into the return port of DB3.

d. Place L4 in the DB_0 area as shown in the figure and insert it into the return port of DB0.

e. As shown in the picture, the red and blue pipe is fixed on the T/H frame with the existing cable tie

f. Take 1 black velcro and tie the red tube.

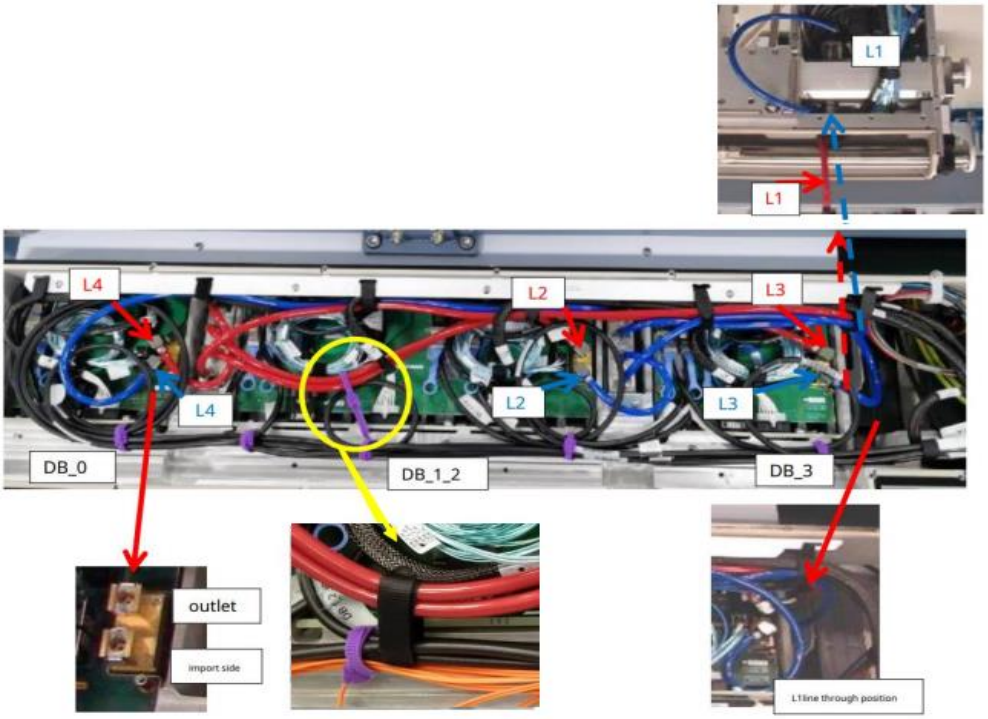

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

2.1 Place the blue pipe at the inlet end as shown in the figure.

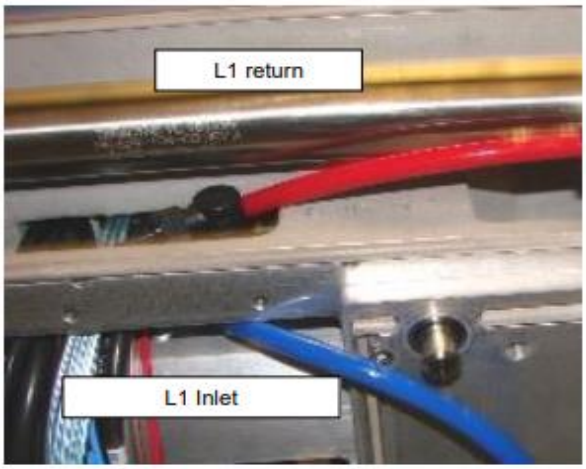

2.2 Remove the nut of the joint sleeve as shown in the figure, put it on the blue pipe, and put on the metal ring.

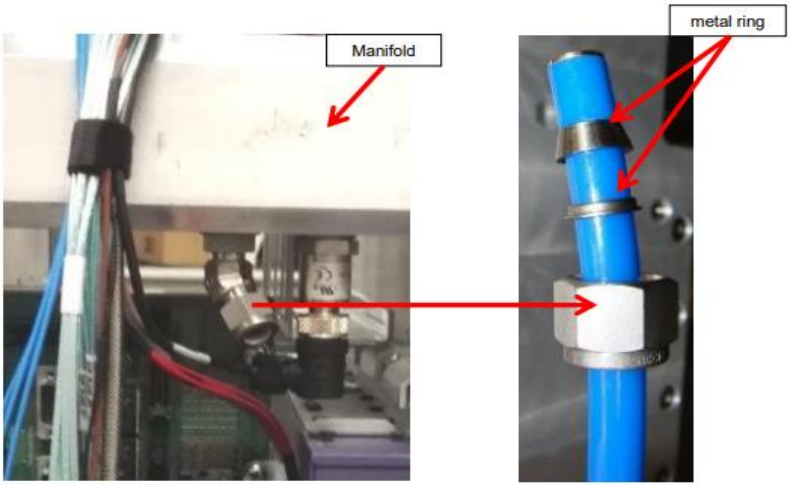

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

open end 16mm and open end 19mm

METHOD:

2.3 Fully insert the blue pipe into the joint sleeve as shown in the figure. Tighten the nut manually.

Mark the nut and joint sleeve. Then use 16mm and 19mm open end adjustable wrenches, hold the fitting body steady and tighten the nut to 1-1/4 turn. (Max 1.25 turn)

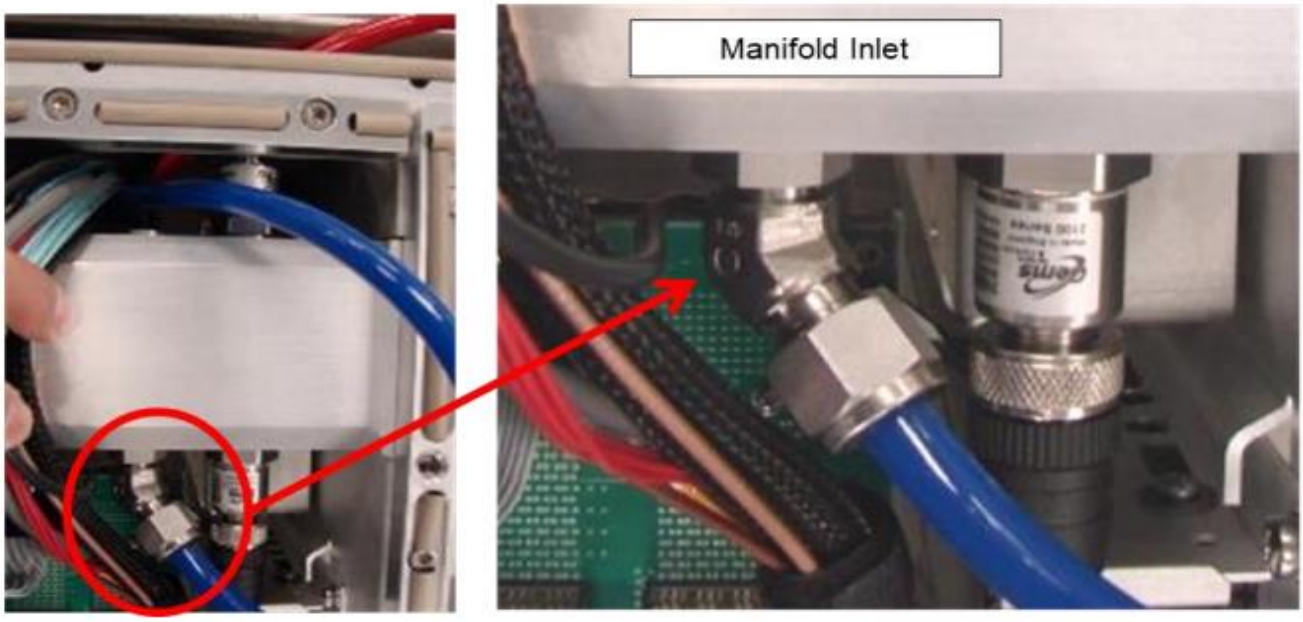

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

open end 16mm and open end 19mm

METHOD:

Connect Return hose line (RED) to return manifold on support backplane side.

2.4 As shown in the figure, remove the nut on the joint sleeve and insert the nut and metal ring into the red pipe according to the previous steps (blue pipe).

2.5 Fully insert the red pipe into the joint sleeve as shown in the figure. Tighten the nut manually. Mark the nut and joint sleeve. Then use 16mm and 19mm open end, one to clamp the joint sleeve, and one to turn the nut to 1-1/4 turn. (Max 1.25 turn)

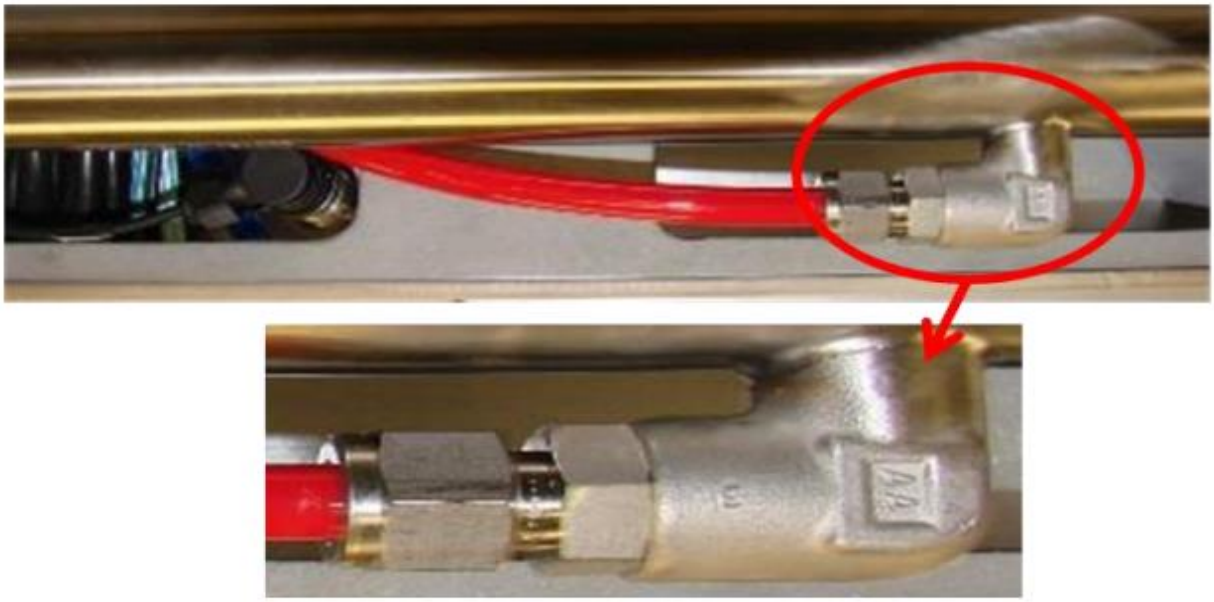

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

2.6 As shown in the figure is the final schematic diagram of the wiring on the T/H distribution board.

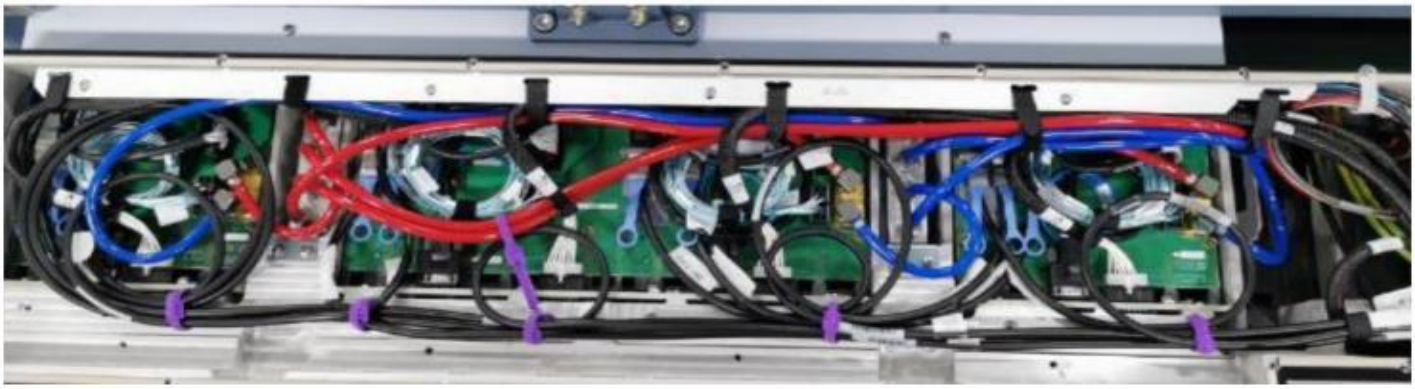
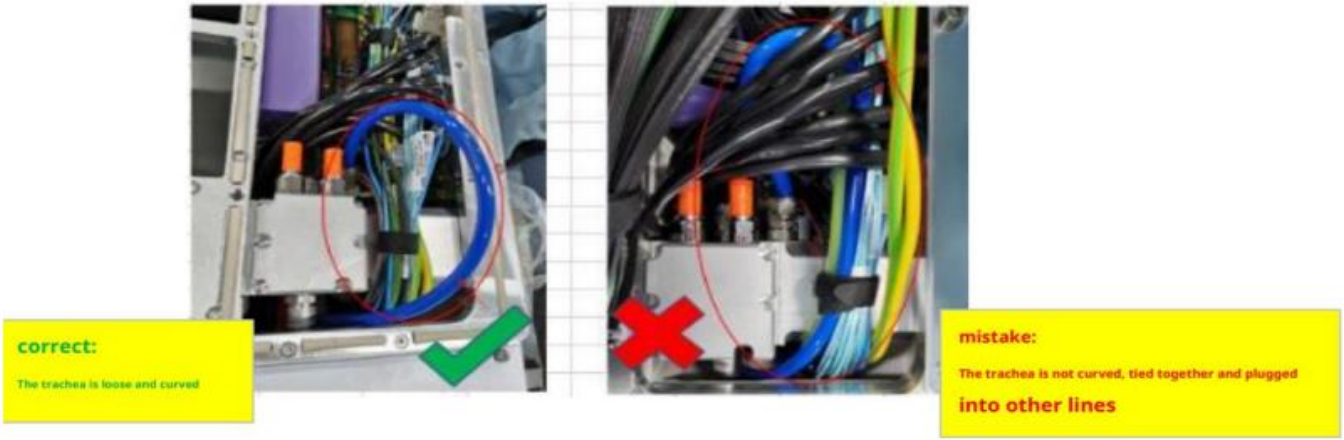
2.7 Check the blue trachea wiring as shown in the figure. The trachea needs to be slack in the normal free arc. It cannot be tied together with other wires, nor can it be stuffed under other wires;