Build Process Manual	DOCUMENT CONTROL No.:	REF-016-19
	VERSION No.:	1
UltraflexPlus 24 _ Test Head _ S11	Effectivity Date:	10/10/2025
	Page No.:	1 of 11

Build Overview:

1 **Routing and dressing of SB cables**
2 **Test Head Cable holder Installation**

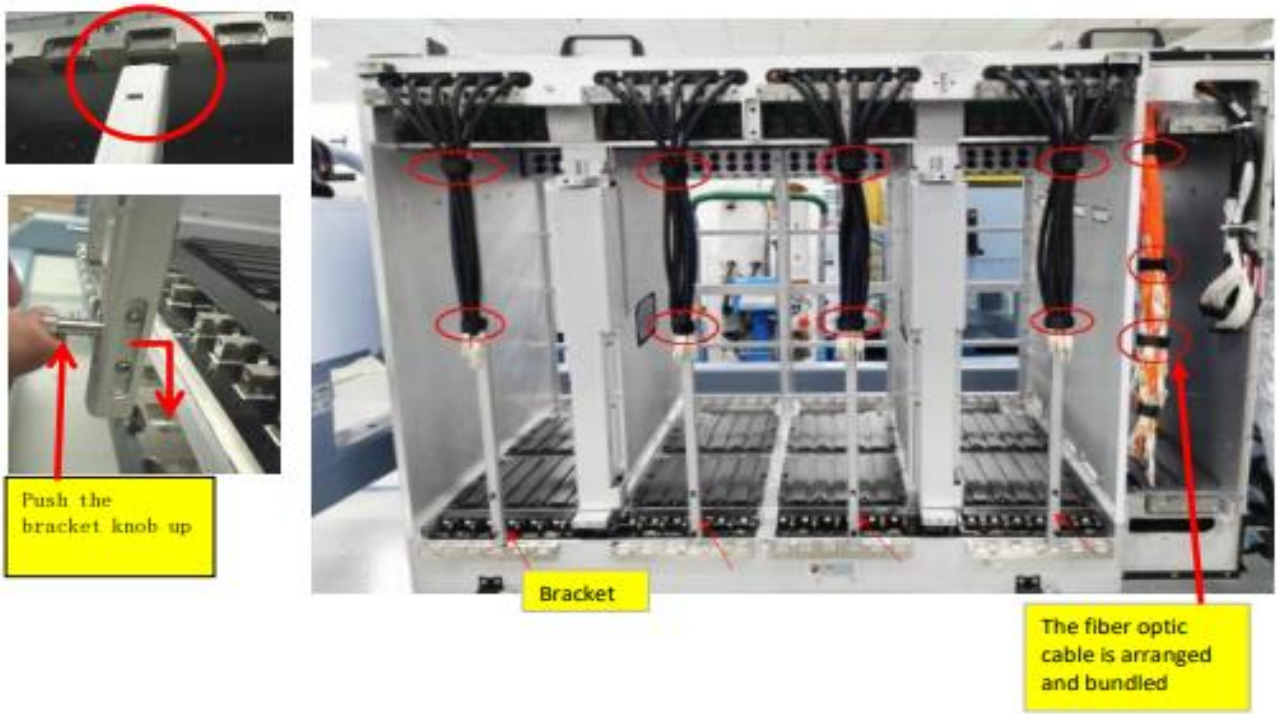

CHANGE HISTORY

Date	BPM Rev	Change Details	Updated by
	1	New Issue	JOSEPH AMAD

Prepared By:
JOSEPH R. AMAD
Manufacturing Engineer

Checked By:
IVAN NOWELL PANIQUE
Team Lead

Approved By:
SHERWIN ARIOSTE
Operations Manager

MAN: CERTIFIED TECHNICIANS.

MATERIAL:

NO.	PART NO.	DESCRIPTION	QTY.
1	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L W/ CONE	1
2	938-195-01	CABLE TIE MOUNT 1/4	1
3	616-972-06	SCREW MACHINE M3X0.5 6MML LOW CARBON STEEL ZINC CLEAR	1
4	938-195-00	WI TIE MOUNT #10 SCREW NATURAL	1
5	938-102-00	TIE WRAP 6.5 X 3/16"	2
6	686-530-00	Slot Label Fiber Optic	1
7	638-930-06	CABLE, UF2 INST FO SHORT, TELECOM, WITH CONN, OPTICAL FIBER	6
8	638-930-07	CABLE, UF2 INST FO SHORT, TELECOM, WITH CONN, OPTICAL FIBER	8
9	638-930-08	CABLE, UF2 INST FO SHORT, TELECOM, WITH CONN, OPTICAL FIBER	10
10	640-834-01	UOM:EA=mm(drawing defines),PLASTIC, UF2 INST PROTECTIVE SLEEVE, HOSE, PIPE OR TUBE	24
11	650-609-00	RUBBER, CABLE PLUG, OTHER ARTICLES	24
12	639-933-00	ALUMINUM 10G CABLE HOLDER BRACKET OR MISC ARTICLE	4
13	813-929-00	HDW VELCRO STRP 5/8	8
14	813-929-01	HDW VELCRO STRP 5/8	3

METHOD:

Flow chart of operation steps

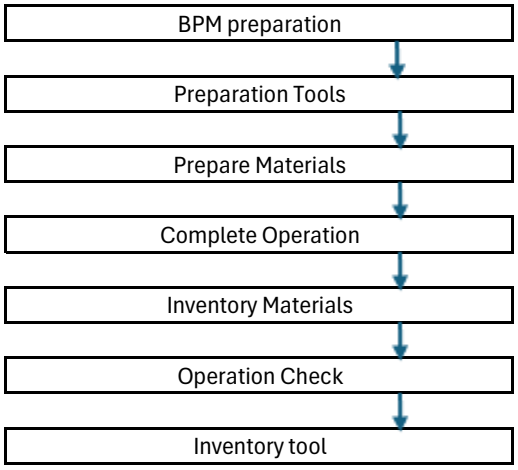

MACHINE:

TOOL NAME	TORQUE VALUE
PH2 Phillips torque screwdriver	3.3 N.m
PH1 Phillips torque screwdriver	0.7 N·m

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
1	472-426-12	PAN HEAD CROSS RECESSED SCREW M5X0.8 x 12MM L W/ CONE	1
2	938-195-01	CABLE TIE MOUNT 1/4	1
3	635-536-00	SCREW MACHINE M3X0.5 6MML LOW CARBON STEEL ZINC CLEAR	1
4	710-048-10	WI TIE MOUNT #10 SCREW NATURAL	1

MACHINE:

PH2 Phillips torque screwdriver 3.3 N·m, PH1 Phillips torque screwdriver 0.7 N·m

METHOD:

Operation steps

1.1 Use one M5 screw (472-426-12) to install one (938-195-01) cable connector on the side wall of the backplane area

The tool is a PH2 Phillips torque screwdriver with a torque value of 3.3 N·m.

1.2 Use one M3 screw (616-972-06) to install one (938-195-00) cable connector on the back plate latch.

The tool is a PH1 Phillips torque screwdriver with a torque value of 0.7 N·m.

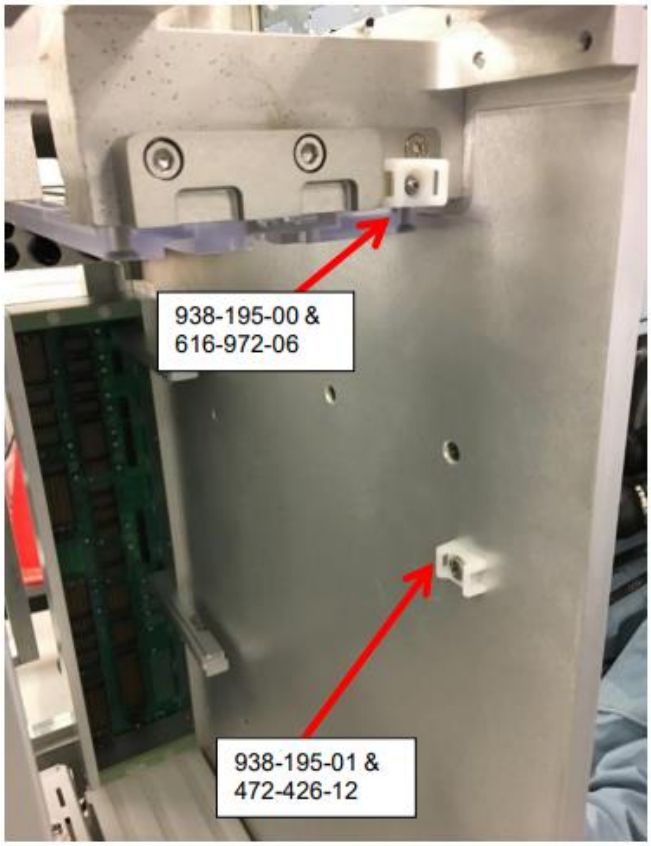

Safety Tips: N/A

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
5	938-102-00	TIE WRAP 6.5 X 3/16"	2

MACHINE:

N/A

METHOD:

2.1 As shown in the figure, use 2 (938-102-00) cable ties to tie the front back panel wire to the side wall of the frame and the wire clip on the latch.

Note: The reserved length of the 3 wires is subject to the 3 wire head and tail just beyond the hole shown in the figure!

2.2 As shown in the figure, use the existing cable tie to tie the wire to the wire clip buckle on the frame.

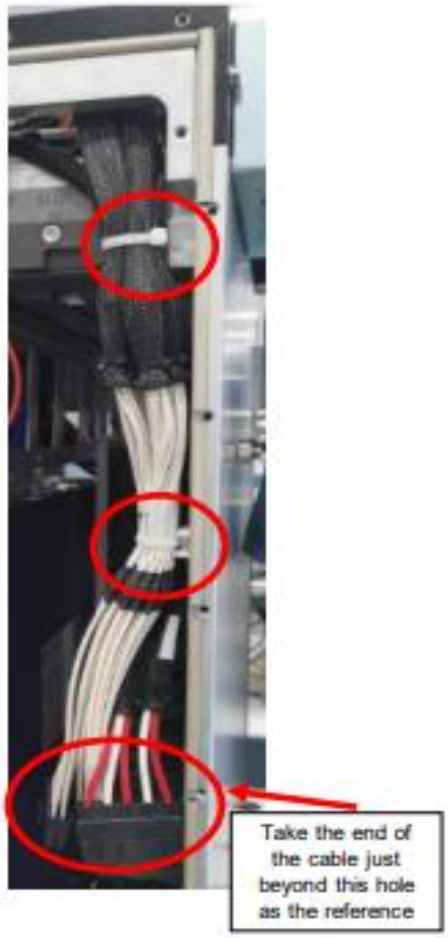

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
6	686-530-00	Slot Lable Fiber Optic	1
7	638-930-06	CABLE, UF2 INST FO SHORT, TELECOM, WITH CONN, OPTICAL FIBER	6
8	638-930-07	CABLE, UF2 INST FO SHORT, TELECOM, WITH CONN, OPTICAL FIBER	8
9	638-930-08	CABLE, UF2 INST FO SHORT, TELECOM, WITH CONN, OPTICAL FIBER	10

MACHINE:

N/A

METHOD:

3.1 Take a slot label (686-530-00), 6pcs 638-930-06 fiber optic cables, 8pcs 638-930-07 fiber optic cables, and 10pcs 638-930-08 fiber optic cables as shown in the figure

3.2 Stick slot labels on both ends of the optical fiber cable as shown in the following rules,

Note that the serial numbers attached to both ends of each optical fiber cable must be the same!

a. 6 pcs of 638-930-06 fiber optic cable, respectively paste S13, S15, S17, S19, S21, S23 on both ends (Inside the green box);

b. 8 pcs of 638-930-07 fiber optic cable,respectively affixed S00, S02, S01, S03, S05, S07, S09, S11 on both ends (Inside the blue box);

c. 10 pcs of 638-930-08 optical fiber cables, respectively affixed S22, S20, S18, S16, S14, S12, S10, S08, S06, S04 on both ends (Inside the red box).

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

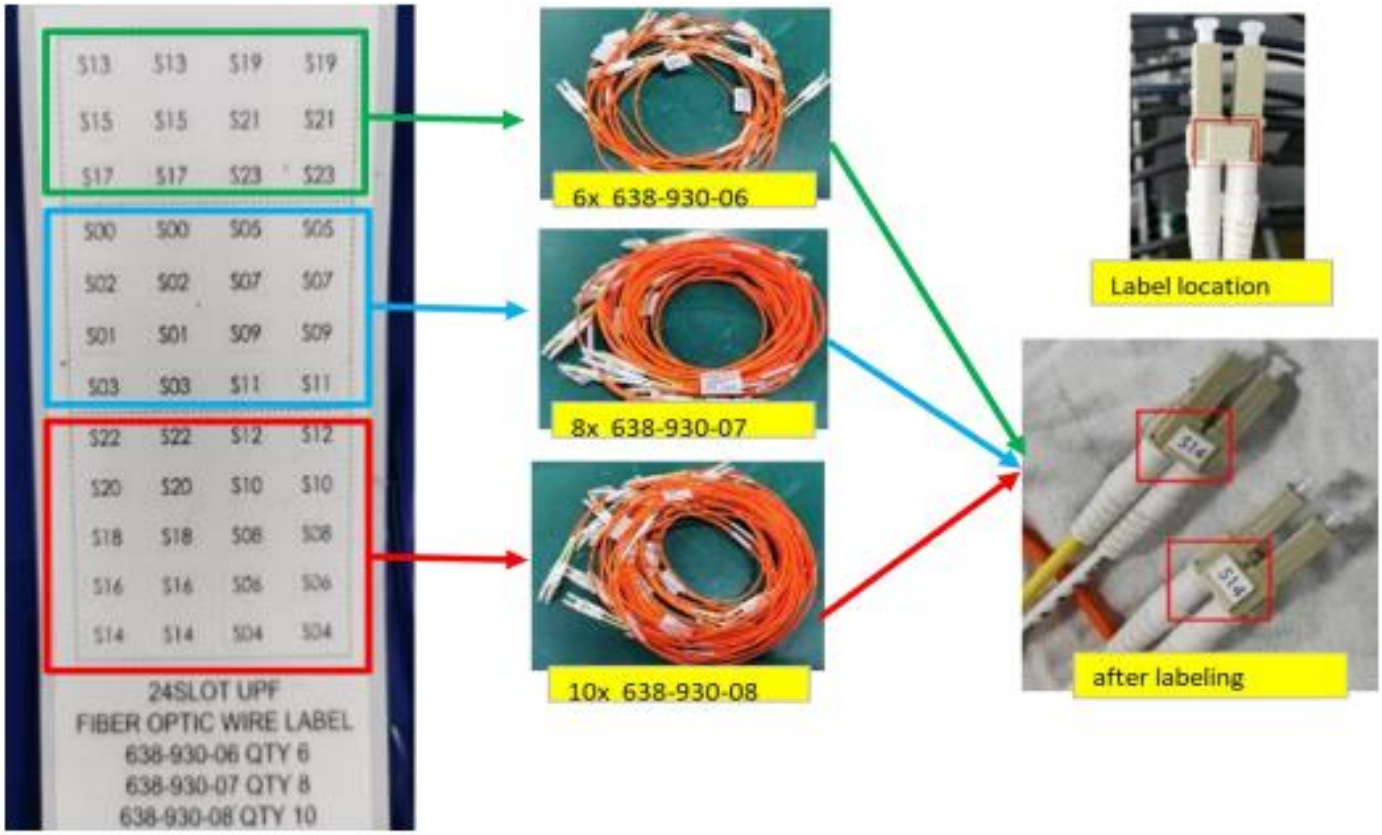

Note: Please protect the optical fiber cable, do not fold or step on it!

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
10	640-834-01	UOM:EA=mm(drawing defines),PLASTIC, UF2 INST PROTECTIVE SLE	24

MACHINE:

Split loom

METHOD:

3.3 Use a split loom tool to install a black protective tube (640-834-01) on the'TH INST' end of each optical fiber cable as shown in the figure;

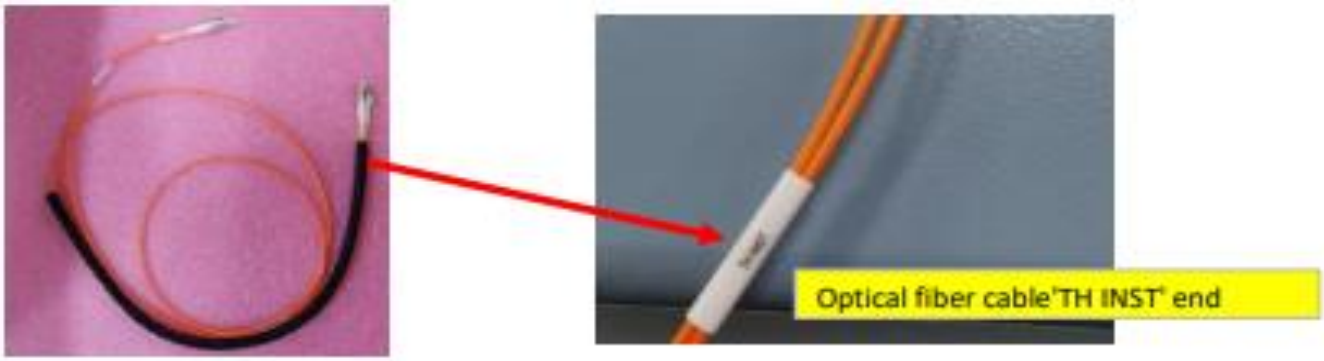

3.4 Install 24 optical fiber cables at the position shown in the figure,

Put the fiber optic cable into the hole according to the label attached to the end of the cable

(For example: S23 corresponds to hole position 23, S01 corresponds to hole position 1)

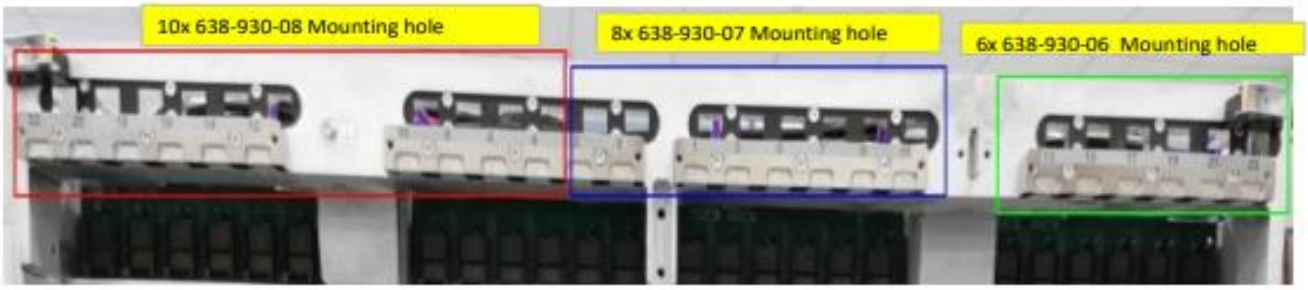

Note: Please protect the optical fiber cable, do not fold or step on it!

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

3.5 Pass the'ENET SW PORT 25 THRU 48' end of each optical fiber cable through the corresponding hole as shown in the figure, and route the cable according to the figure;

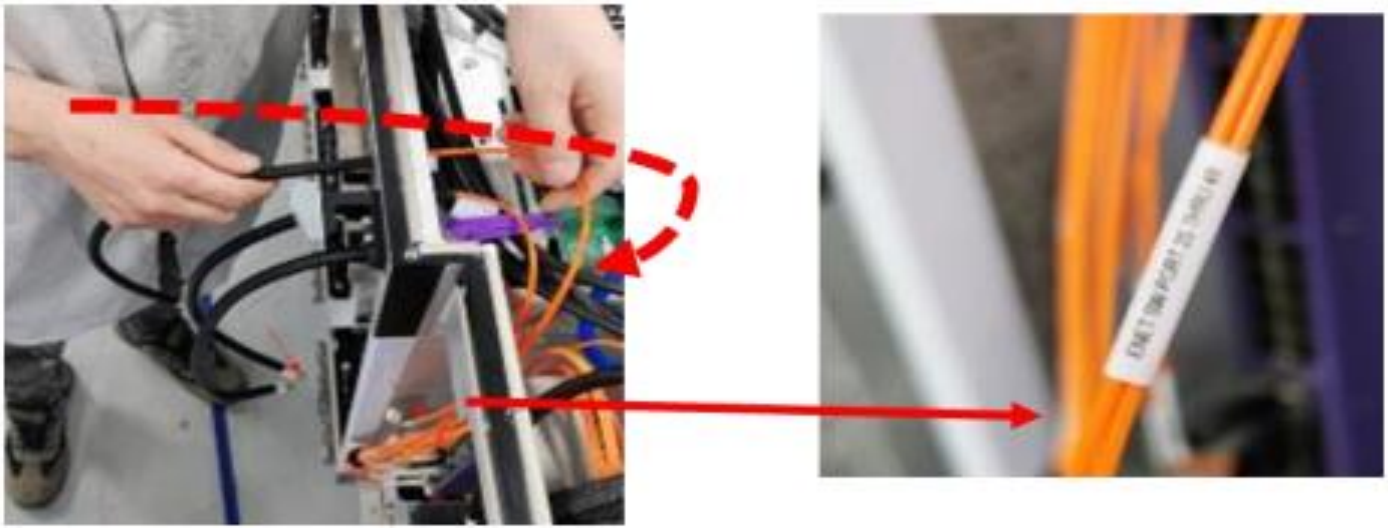

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
11	650-609-00	RUBBER, CABLE PLUG, OTHER ARTICLES	24

MACHINE:

N/A

METHOD:

3.6 Put a slot plug (650-609-00) on each black protective tube of the optical fiber cable as shown in the figure and insert the slot plug into the corresponding hole.

At the same time, adjust the length of the fiber cable protection tube outside the frame from the slot plug to the end of the fiber stub to 16 inches

Or, as shown in the figure, the optical fiber protection tube can be used to reach the edge of the slot in the TH frame as shown in the figure.

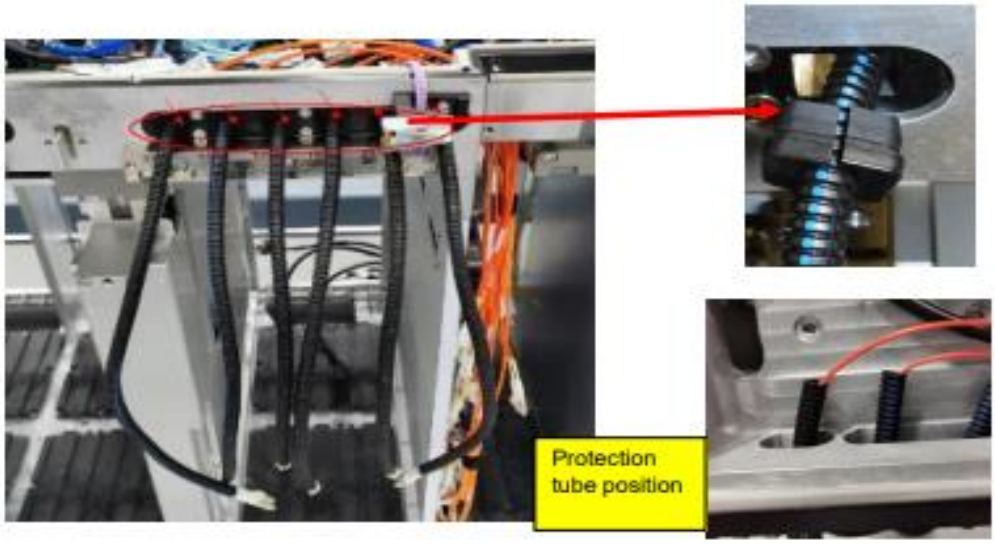

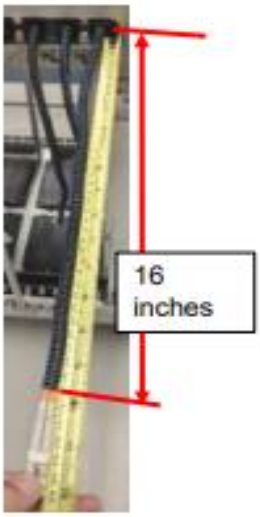

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

N/A

MACHINE:

N/A

METHOD:

3.7 Untie the previous 5 purple cable ties as shown in the figure, and arrange and tie the optical fiber cables, taking care not to be too tight;

MAN: CERTIFIED OPERATOR, TECHNICIAN

MATERIAL:

ITEM	PART NUMBER	DESCRIPTION	QTY
12	639-933-00	ALUMINUM 10G CABLE HOLDER BRACKET OR MISC ARTICLE	4
13	813-929-00	HDW VELCRO STRP 5/8	8
14	813-929-01	HDW VELCRO STRP 5/8	3

MACHINE:

N/A

METHOD:
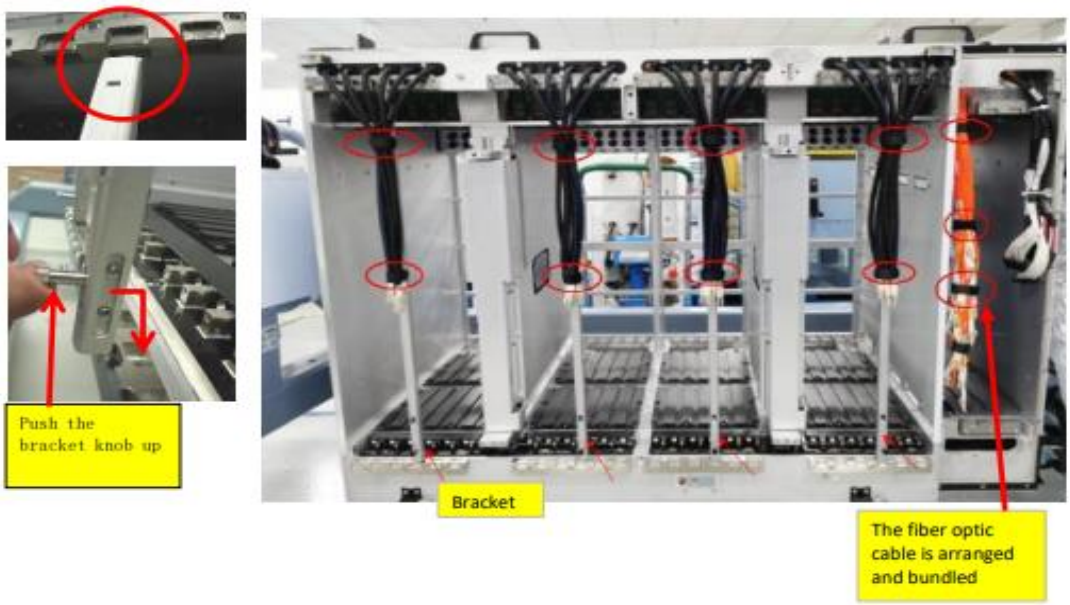
3.8 As shown in the figure, install 4 wire bracket strips (639-933-00) to slots 16, 4, 7, and 19.
The installation method is shown in the figure; the top is inserted into the lock lever cavity, and the bottom of the cable bracket is installed into the lock lever cavity by pushing the bracket knob upward.
3.9 As shown in the figure, use 8 long cable ties (813-929-00) to tie the optical fiber cable to the wire support bar.
3.10 As shown in the figure, arrange and tie the end wires of the 24 optical fiber cables with 3 cable ties (813-929-01).
3.11 Generate the final assembly serial number and record it on the UF PLUS 24SLOT SN record sheet.