1. OVERVIEW

The following document provides a detailed overview of the Kenosha facility's Single Line Outbound Parcel packing process.

2. EQUIPMENT, SUPPLIES AND CONSUMABLES

The following equipment, consumables, and supplies are necessary to perform the function of parcel packing:

RF scanner, tray inserts, and separators, Dangerous Goods (DG) labels, 3” tape, tape gun 3”, cover-up labels, Electrostatic Discharged (ESD) pink polybags, ESD silver bags, and dunnage paper.

3. DROP ZONE

1. The picker drops off the picked product on the conveyor.
2. The picker must print a Pick Drop Audit label (PDAL).

4. PACKING

1. Packer ensures the box has a pick-drop audit label.
2. Inform the supervisor if the picker did not print a pick-drop audit label.

   ✓ If needed, you can also print the Pick Drop Audit Label.

Reference WI – Outbound – Label Printing

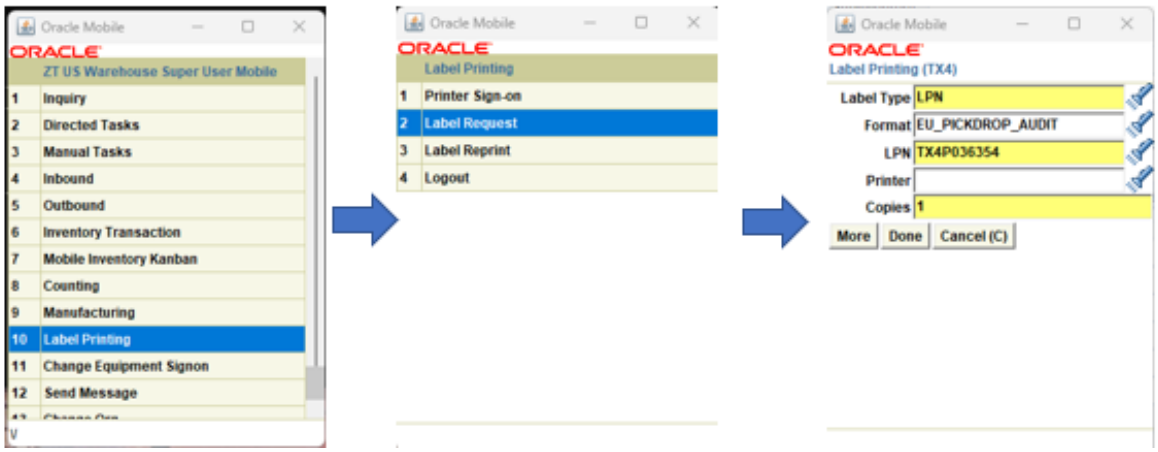

This document contains proprietary information which is the exclusive property of Zebra Technologies Corp.

The most recent version of this document is located on the ISO Library.
Verify revision number before use.

3. Move to the multi-line station:

- ✓ Multiple item quantities exceed box size 107.
- ✓ Vendor-sealed box with loose items.

Reference WI - Outbound - Stage Move v1.0.pdf

4. If the product is smaller than box size 107, overpack it onto a larger box we stock.

- ✓ The general rule is to overpack anything smaller than a 107 box.
- ✓ Do not use box size 103 as the main shipping box.
- ✓ International shipments' minimum box size is 114 or 147. It has the appropriate space for documents.

Overpack

5. Verify that the pick-drop audit label matches the LPN number on the box.

A. Verify the part number on the PDAL matches the picked part.

B. Each item needs to be properly labeled with a part label.

- ✓ No hand-written labels are allowed.

C. Confirm the quantities matched the PDAL

- ✓ If a vendor-sealed box is picked with loose items, do not open the box to verify the quantity. Use the quantity listed on the original part label.

D. Do not count small items such as pins, screws, nuts, etc...

E. If handling ESD material, ground yourself before performing ESD packaging.

This document contains proprietary information which is the exclusive property of Zebra Technologies Corp.

The most recent version of this document is located on the ISO Library.
Verify revision number before use.

- ✓ Finger cots are used to prevent bodily oils from transferring to the product, not to prevent an ESD event.

6. If a quantity or part number discrepancy is discovered, immediately report the issue to the supervisor or area lead.

7. When overpacking the items, ensure the box is filled with enough dunnage to prevent product damage in transit.

- ✓ Layered box with 1-2 inches of dunnage before placing the part in the empty box.
- ✓ Dunnage should not fill more than 80% of the box.
- ✓ If it fills more than 20%, use a smaller box.
- ✓ We must use dividers for motherboards; there are NO exceptions.
- ✓ If the item is packed in dividers, do not remove the dividers to consolidate the material.

8. If a damaged product or box is discovered, immediately notify the supervisor or area lead.

Reference Visual Packaging Damage Criteria Rev01.pdf.

- ✓ Depending on the condition of the packaging, you might be asked to re-box the material or conceal the damages with brown cover-up labels.

9. If a vendor-sealed box, ensure the original shipping labels are covered with a brown mask-out label.

This document contains proprietary information which is the exclusive property of Zebra Technologies Corp.

The most recent version of this document is located on the ISO Library.
Verify revision number before use.

10. If the Pick Drop Label indicates a COO of XX, grab the COO from the actual part and write on a label.

✓ The manifester needs to enter the COO in the system before manifesting.

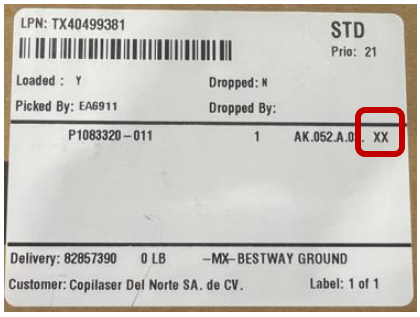

11. After the box is sealed, place the written COO label on top of the box for the manifester to use.

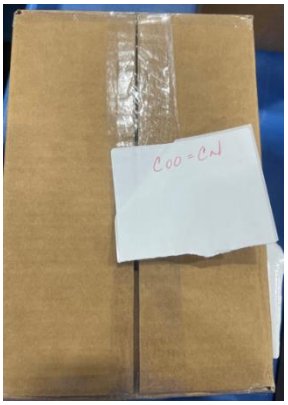

12. Seal the overpack box using the H-method of Taping.

✓ Allow at least 2 inches of tape extension on the sides.

✓ Do not reseal vendor-sealed boxes.

13. Apply the LPN and the pick-drop audit label on one <u>side</u> of the box.

✓ Do not place the LPN & PDAL label on the box's front, back, or bottom.

This document contains proprietary information which is the exclusive property of Zebra Technologies Corp.

The most recent version of this document is located on the ISO Library.
Verify revision number before use.

14. If Dangerous Goods, label the box according to <u>ground</u> regulations.

- ✓ Do not apply DG labels on the same side as the LPN and Pick Drop Label. In the event the box is shipping Air, it will need the remaining required labels.
- ✓ Manifester will apply the remaining labels if the shipment ships via Air.

Labels on the same side!

15. If there is an international battery label on the box, replace it with a USA battery label.

OR

16. When overpacking DG items, ensure that items with different UN codes (e.g., 3480 and 3481, 3090 and 3091) are not packaged together.

This document contains proprietary information which is the exclusive property of Zebra Technologies Corp.

The most recent version of this document is located on the ISO Library.
Verify revision number before use.

17. If the pick-drop audit label states **UN3481**, do not label the box. The manifester will pull up the PCR notes in Oracle to see the corresponding UN3481 Section, **Section I**, or **Section II**.

18. Place the box on the conveyor in front of the sensor, ensuring the LPN faces up so the Dimensioner can scan it and capture the weight and dimensions.

19. Do not place the box too close to each other.

✓ One box per sensor. Allow the Dimensioner to move the boxes.

20. Place empty totes on the return conveyor or in their designated areas.

21. To prevent any safety incidents, clean as you go.

5. REFERENCES

Document #	Document Title
	WI – Outbound – Label Printing
	Visual Packaging Damage Criteria Rev01.pdf.

6. REVISION HISTORY

The following table lists all revisions (including the original document) to this procedure, the date, and the reason for the revision.

Rev.	Rev. Date	Description of Change	Revised By
01	08/22/24	Original issue	A. Cabrera

This document contains proprietary information which is the exclusive property of Zebra Technologies Corp.

The most recent version of this document is located on the ISO Library.
Verify revision number before use.