


Verification de bootstrap / certificats

En cas de probleme de Bootstrap (HU ou TCU) il faut demander à aller chez le dealer pour appliquer une série d'actions pour débloquer la situation et faire en sorte que la pièce demande un nouveau certificat.

Grâce à ce certificat, la pièce pourra se connecter aux serveurs Renault (KMR et vNext notamment)

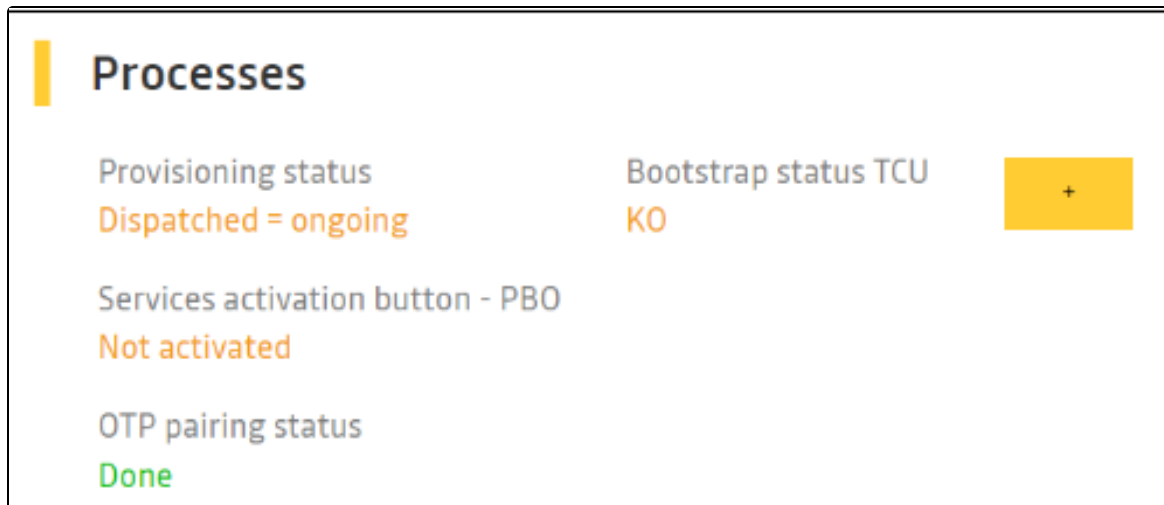

La procédure ne concerne que CCS1 (Easylink), CCS2 (OpenR) et ULC (Médianav). C'est comme suit :

- **Easylink** : Pour HU et TCU
- **OpenR** Pour HU et TCU
- **Medianav** : TCU only (IVC Standalone)

process call restart à appliquer ATTENTION A ADAPTER LA PIECE A RESET/ AUTOCONF

Perform a RESET and AUTOCONF of the Head Unit (IVI / Radionavigation) // TCU (IVC, Telematic Control Unit)

Check also to perform a part replacement process (before / after repair process)

Then perform a CALL RESTART PROCESS as follows :

- 1) Turn the engine On and switch On the device in a network reception area for 15min.
- 2) Turn the engine Off for 15 mins.
- 3) Turn the engine On, start the vehicle & keep it On for 10 mins.
- 4) Turn Off the vehicle