



Entering Parameters Into Dynisco UPR 900 Controller


The parameters can be adjusted after connecting the line and the power supply.

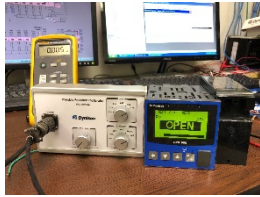



Press the Enter button and hold down while pressing the up button will get you Main Menu.

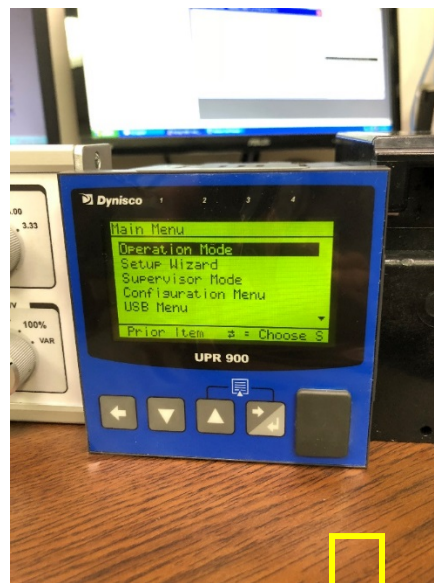



- I. Go to "Setup Wizard" and push enter.

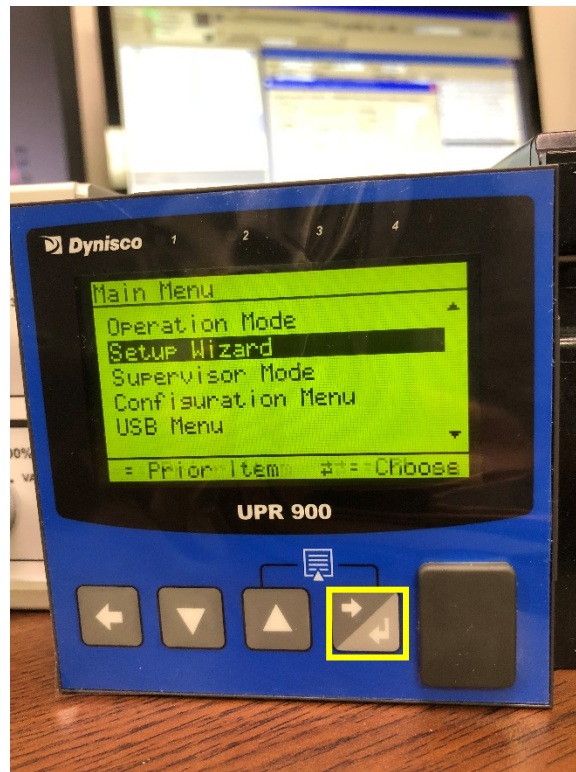


1. Unlock code with Up key and enter to 10 and push Enter.

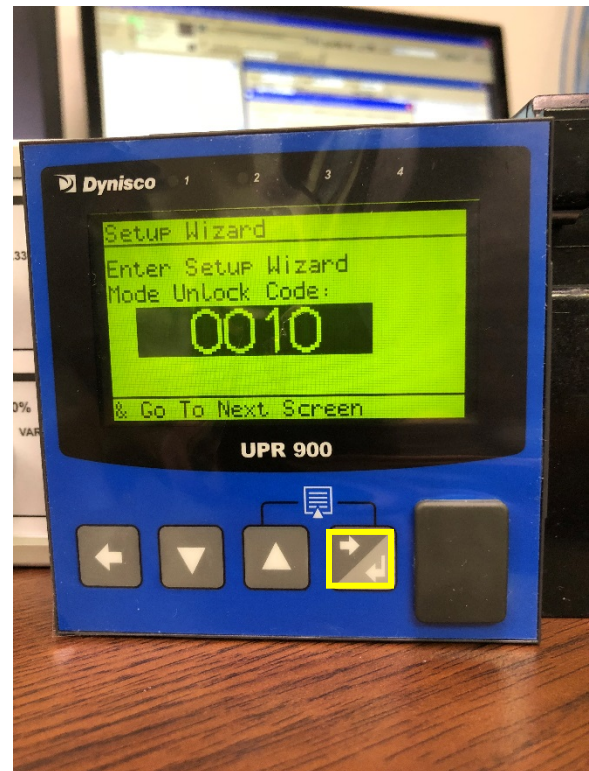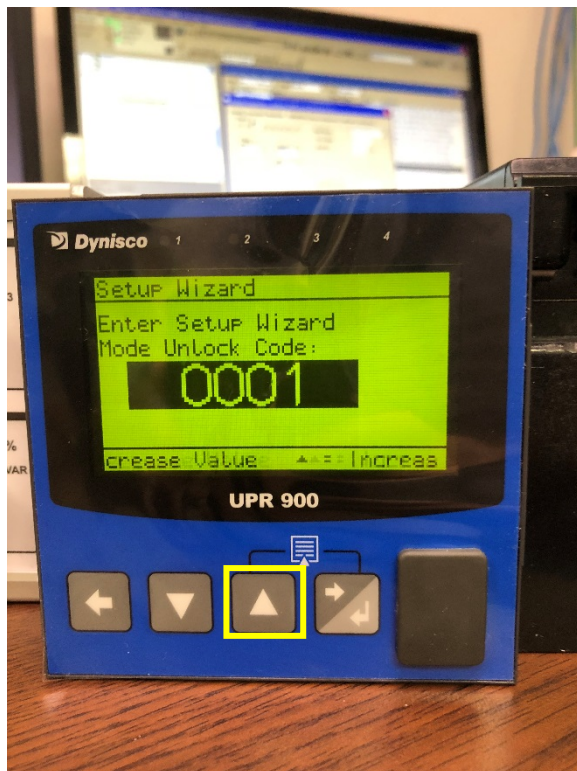


2. Input type to "Strain gauge".

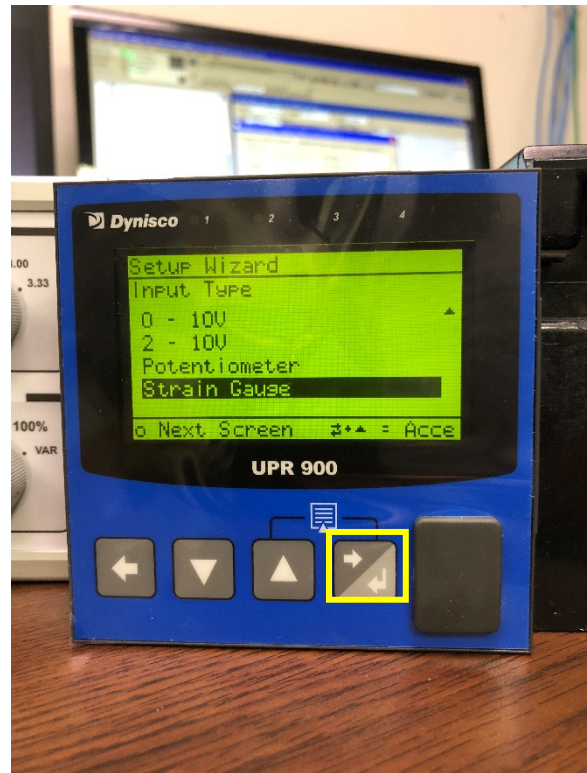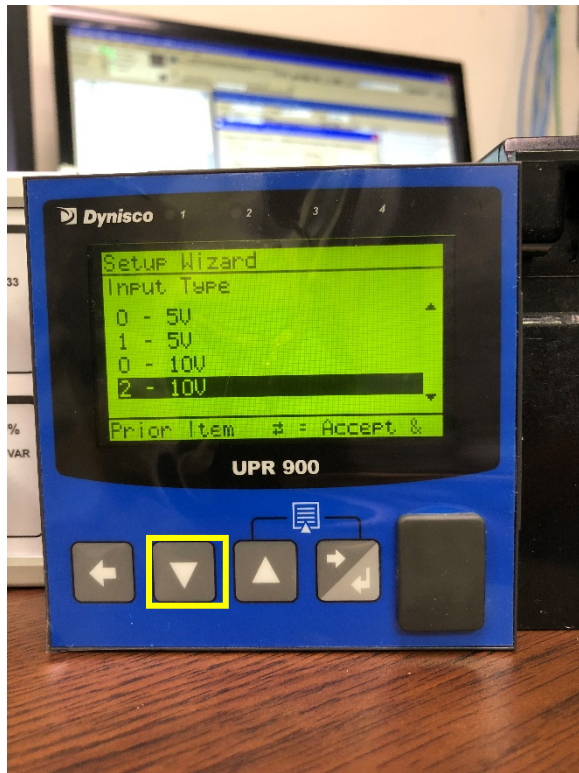

3. Engineering unit-“psi”.


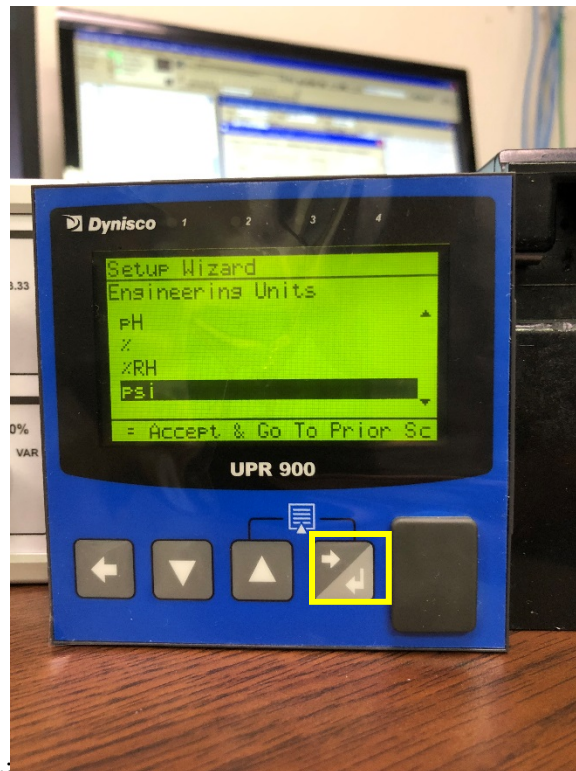


4. Decimal point position- 1234 .

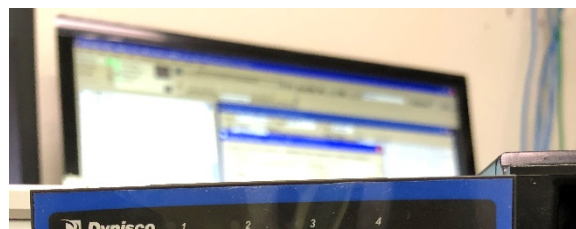


5. Scale input range



- 1) Upper limit -“5000”,”3000”or”1500”, Lower limit-”0”.

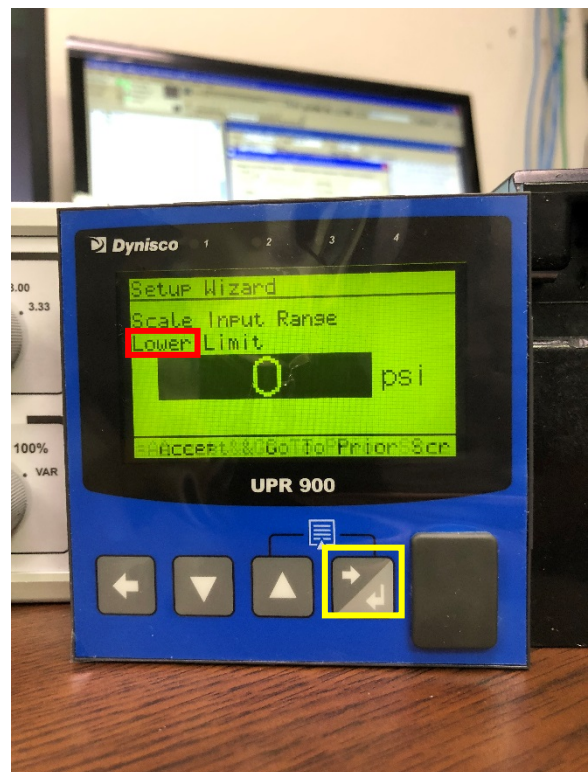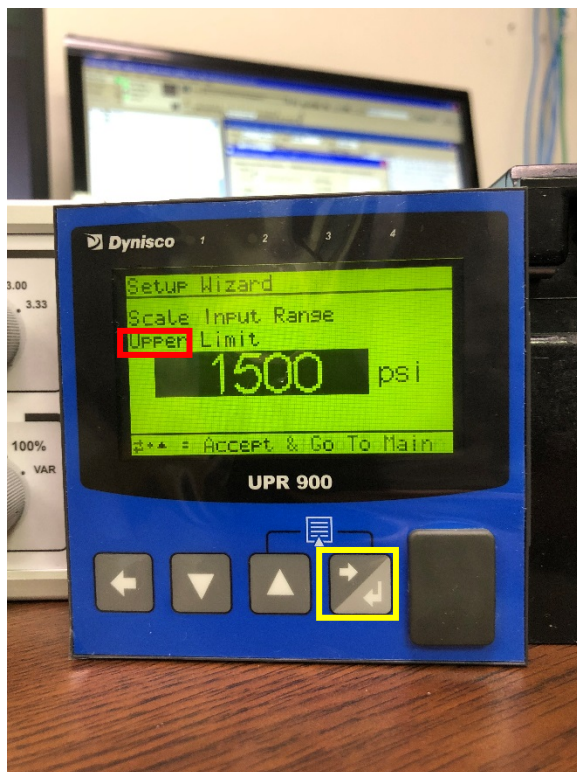

6. Linear output A type-“4-20mA”.


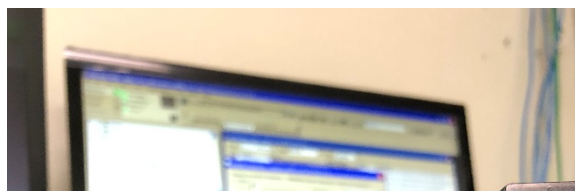


7. Linear output A usage-“Retransmit input 1”.

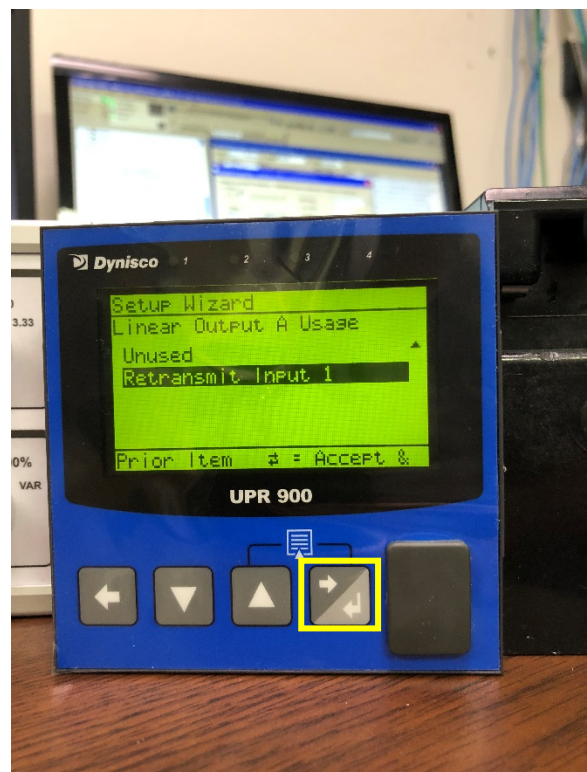
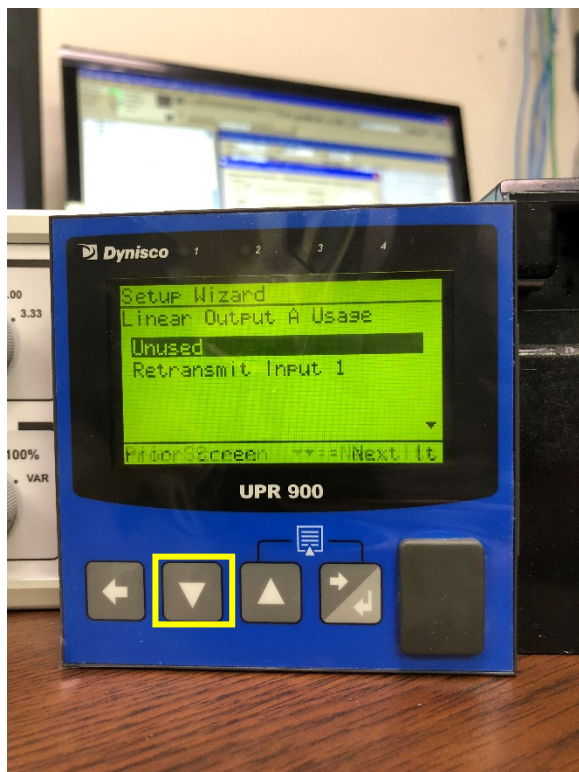


8. Enter value for output 1


- 1) Lower transmit limit-“0”, Upper transmit limit-“5000”, “3000” or “1500”.

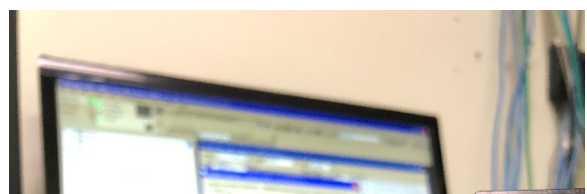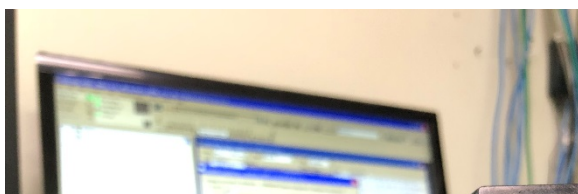


9. Linear output B type-“4-20mA”.

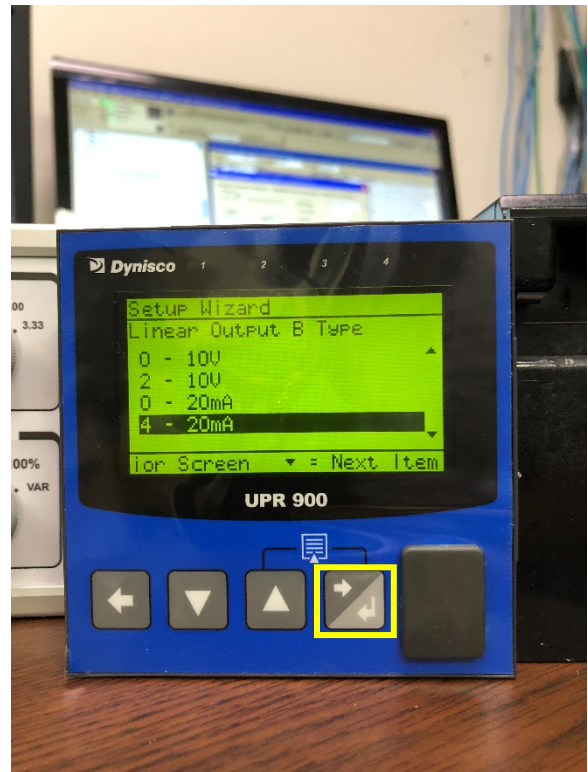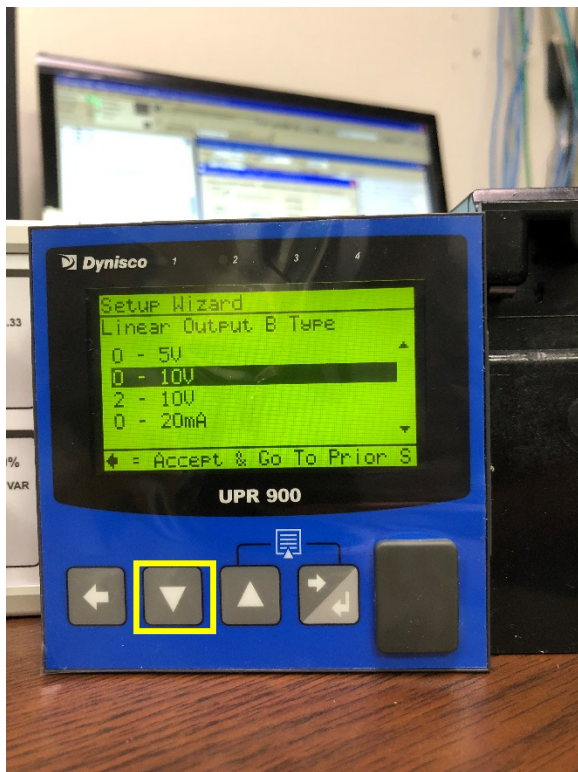


10. Linear output B usage-“Unused” .

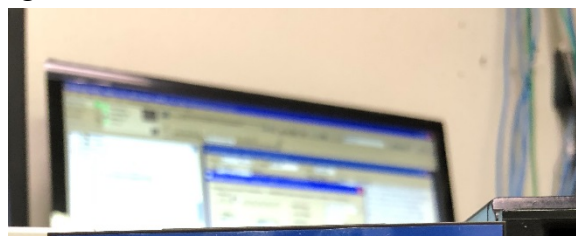


11. Output 1 usage-“Alarm 1 direct”

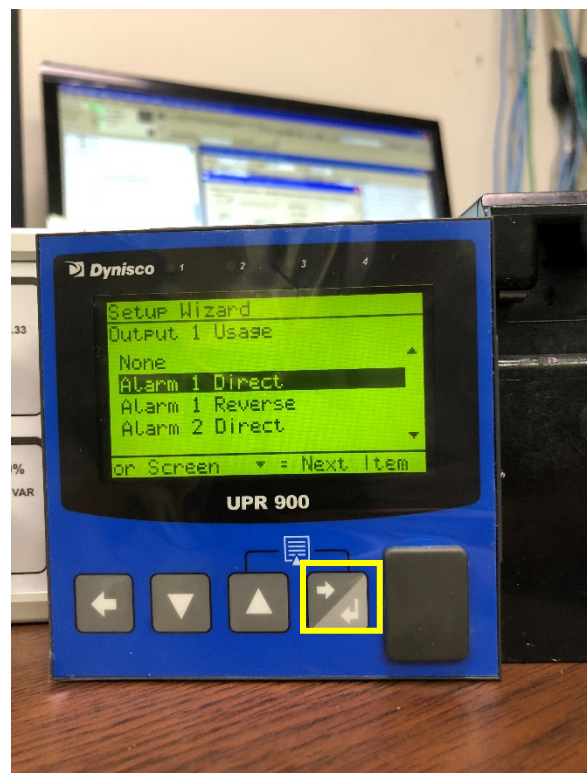

12. Output 2 usage-“Alarm 1 direct”

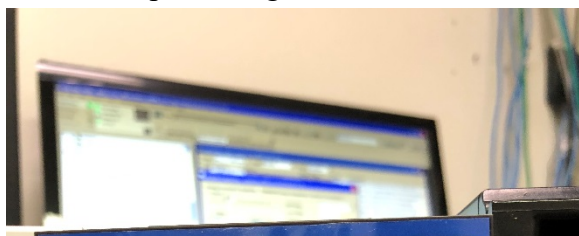


13. Alarm 1 type-“Process High”.

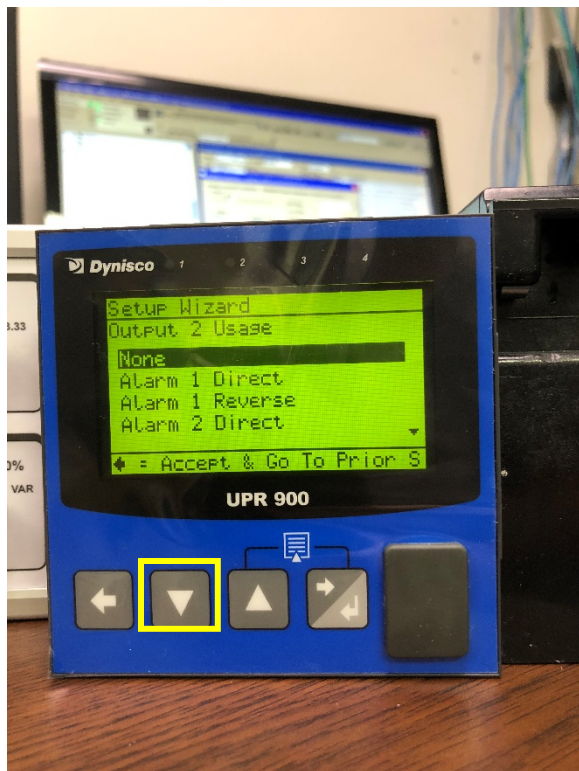


14. Process High

1) Alarm 1 value-“4000”, “2400” or “1200”.


15. Alarm 2 type, Alarm 3 type – Unused.

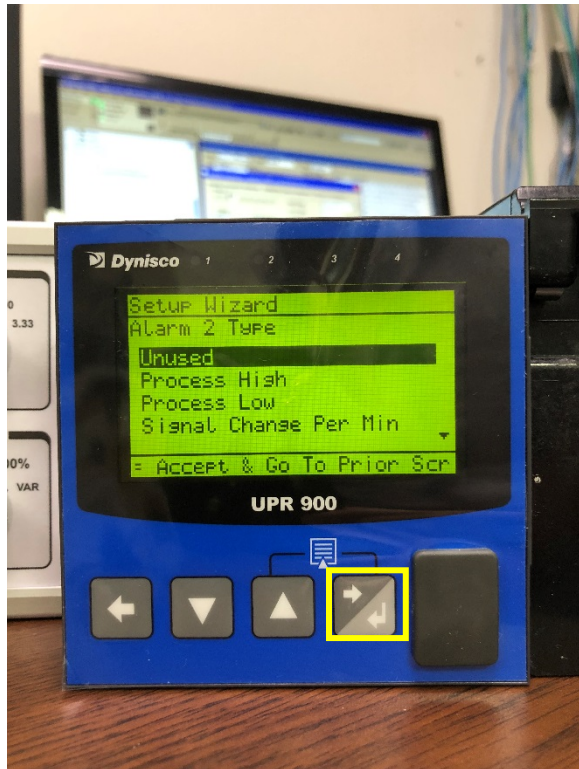


16. Set up complete push enter.

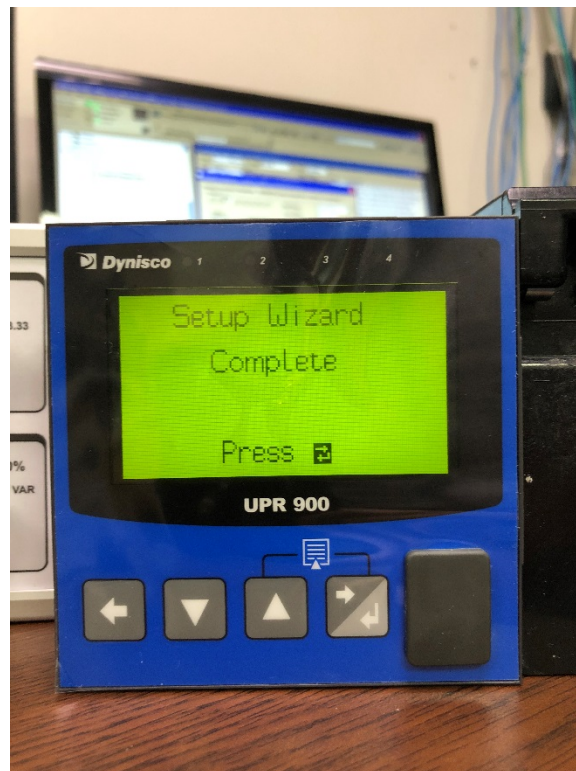

II. Press the Enter button and hold down while pressing the up button will get you Main Menu.

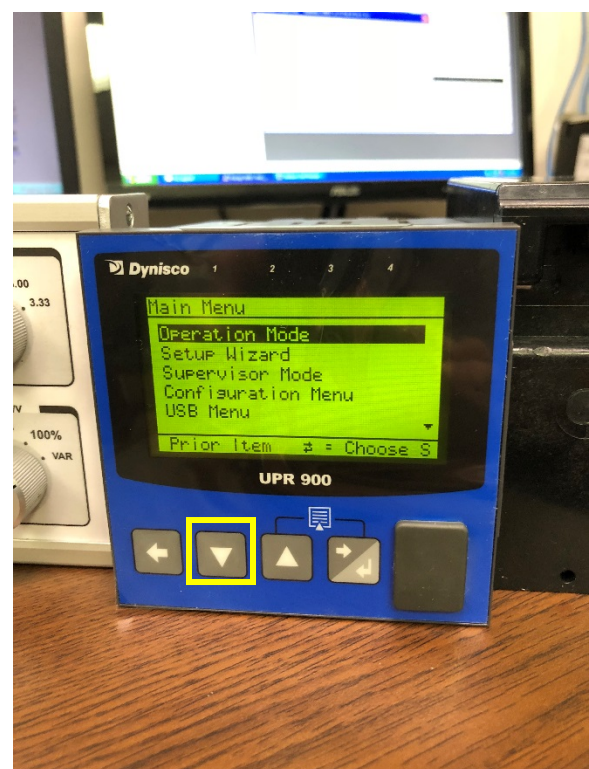



III. Go to “Configuration Menu” and push enter.

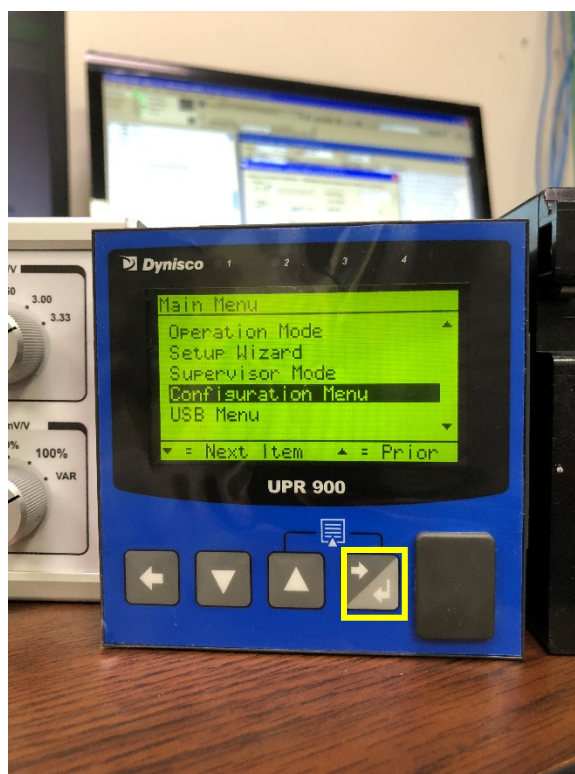

1. Unlock code with Up key and enter to 10 and push Enter.



2. Configuration Menu- “ Input Configuration” - “Strain Gauge Calibration”.

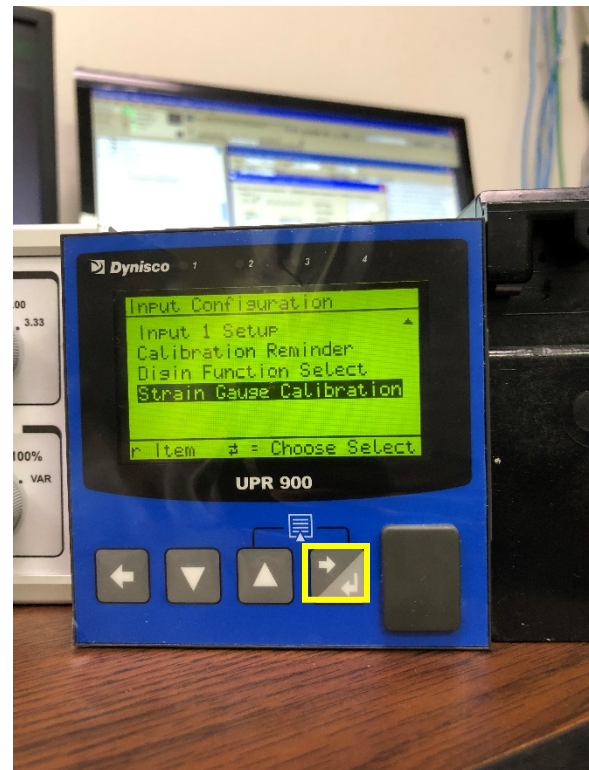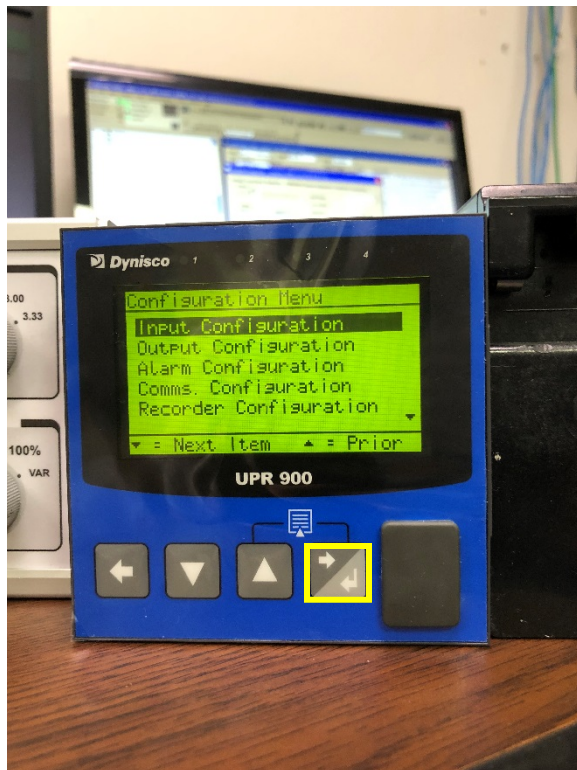

3. If using sensor select "Enable", if using the simulator select "Disable"




1) Enable

a) Input Calibration Resistor- “80%”




2) Disable


a) Input Calibration Resistor- “100%”, simulator %- “VAR”.

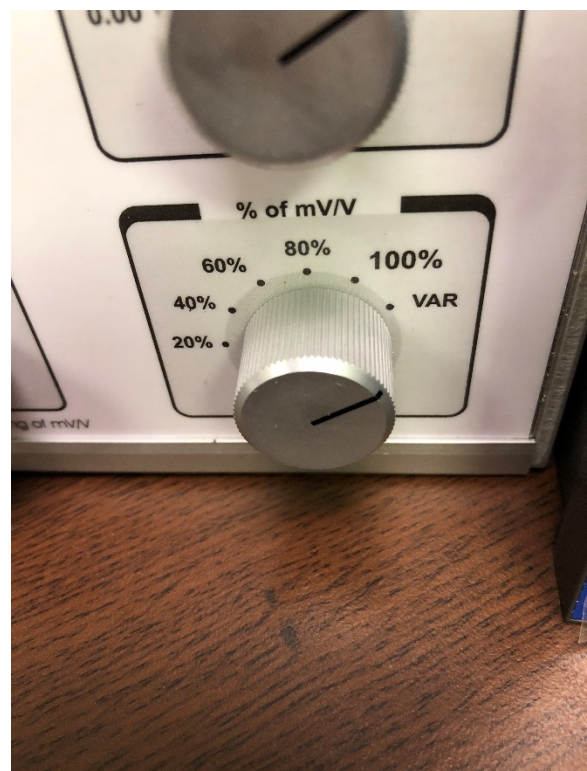

b) Low Point Calibration Press Up and Down button, simulator VAR- “minimum”.

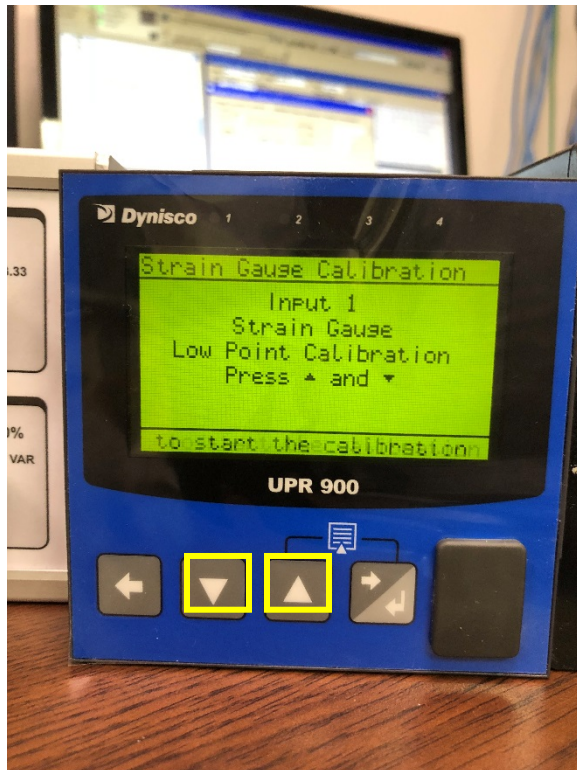

c) Complete the Low Point Calibration

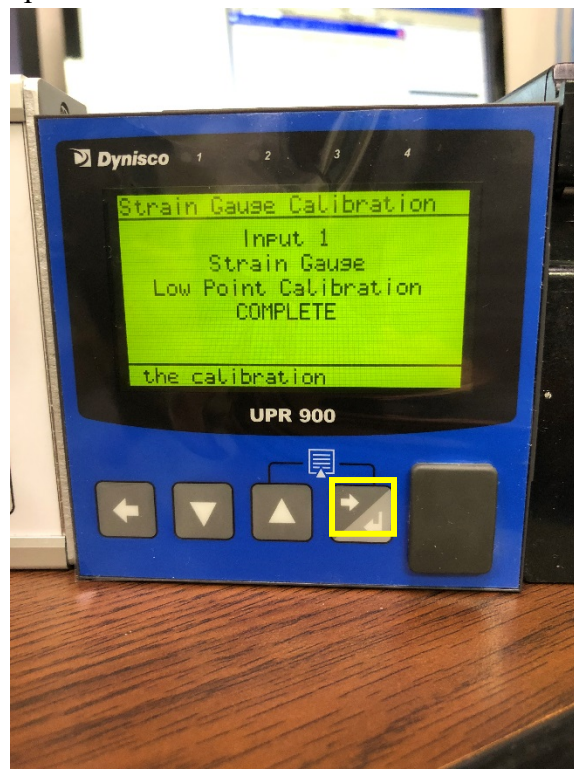

d) High Point Calibration Press Up and Down button, simulator VAR- "maximum".



e) Complete the High Point Calibration.

