


Measurex Profile Correction Procedure.

Date: 11/05/14

Perform flag grad first to verify the profile. If the profile is bad, (Especially CD spread >0.5) then perform Profile Correction as below.

1. Enter into Developer instead of Operator
2. Load any of the production recipes except “FlagIn”
3. Go to “Scanner / Sensor” selection Group on Measurex display.
4. Select “Sensor Maintenance“ button.
5. Select “PRS Scanner Nuclear Sensor Processor”
6. Under “Recipe Based Options”, write down the check items.

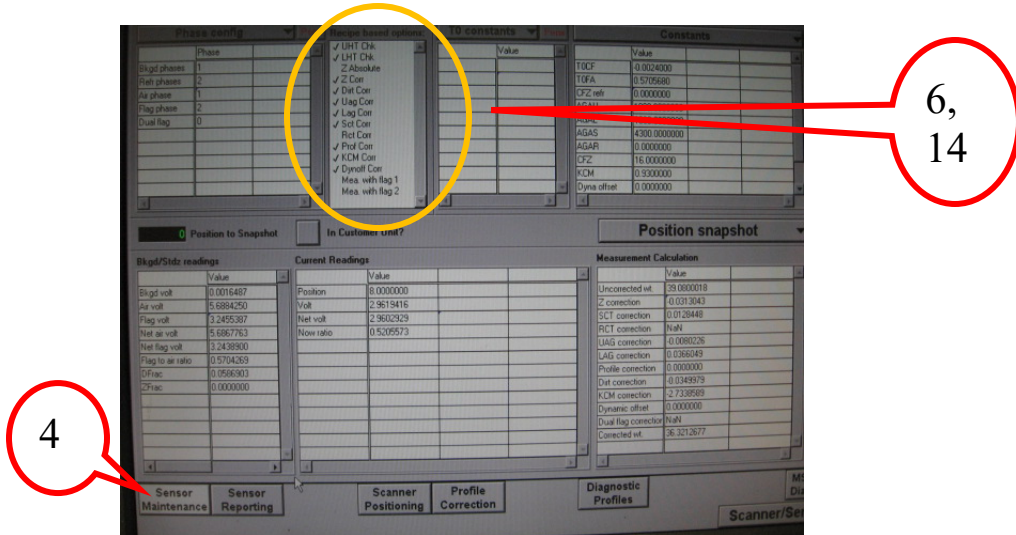

7. Select “Mode & Recipes” Button at the top right.

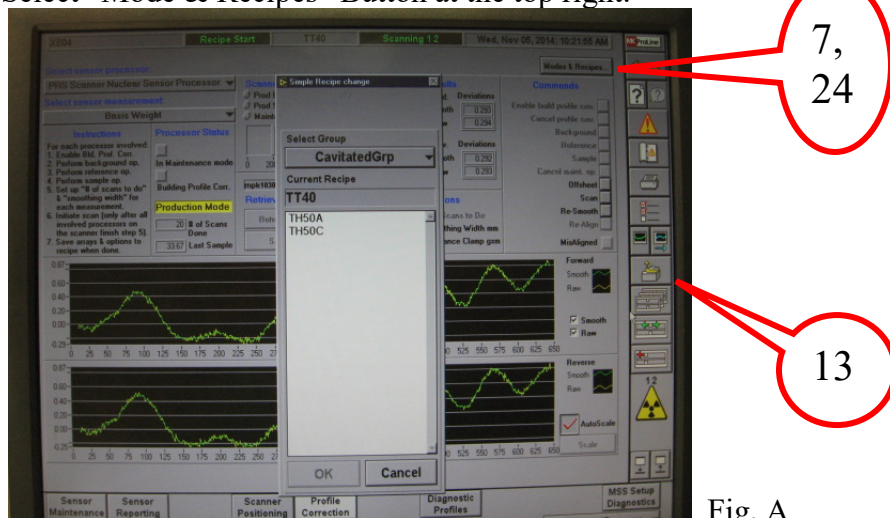


Fig. A

8. Select “FlagIn” for Recipe ID.
9. Select “PRS Scanner” at the top left.
10. Select “Retrieve” button
11. Select “Enter Maint” Button.
12. Select “X” to Exit.
13. Select “Simple Recipe Change” button at the right , then quick load “FlagIn “ for Recipe.

Measurex Profile Correction Procedure.

Date: 11/05/14

14. Go back to page on Fig. A. Double check “Recipe based options“. Make sure the checked items are same as those you write down on step 6. (“Mea. With flag1” should be checked at this time.)

15. Select “Profile Correction“ from the button choices at the bottom of the screen.



16. Select the “Cast Scanner Nuclear Sensor Processor“ for cast scanner or “PRS Scanner Nuclear Sensor Processor for Reel scanner.
17. Select the “Enable build profile corr.” button.
18. Select the “Background” button.
19. Select the “Reference” button.
20. Select the “Sample” button.
21. Select the “Scan” button.
22. The radiation triangle symbol should appear on the lower right side of the screen.
23. It should take 10 minutes for the profile correction procedure to complete.
24. Once the profile correction is complete, select “Save arrays to Recipe” button. Enter a recognizable file ID (as PF05222008), then save that file to all recipes. You must check ”same ID for each weight” and “apply to all”. Press “OK”.

Measurex Profile Correction Procedure.

Date: 11/05/14



25. Go back to the “Modes & recipes” display and select “Exit Maintenance” button.
26. Select “X” to Exit.
27. Select “Simple Recipe Change“ button to load any of the production recipes.
28. Select “Simple Recipe Change “ button again with FlagIn.
29. Scan.
30. Select “control”



31. Select PRS Scanner with PRS scanner + PRS Thickness + Percent around average. Then Press” OK”.
32. Monitor the spread value. Wait till the spread value below 0.5. then complete.
33. If spread is greater than 0.5, then repeat the procedure.
34. If spread is still not below 0.5 after you repeat the procedure, contact engineer for further assistance.