

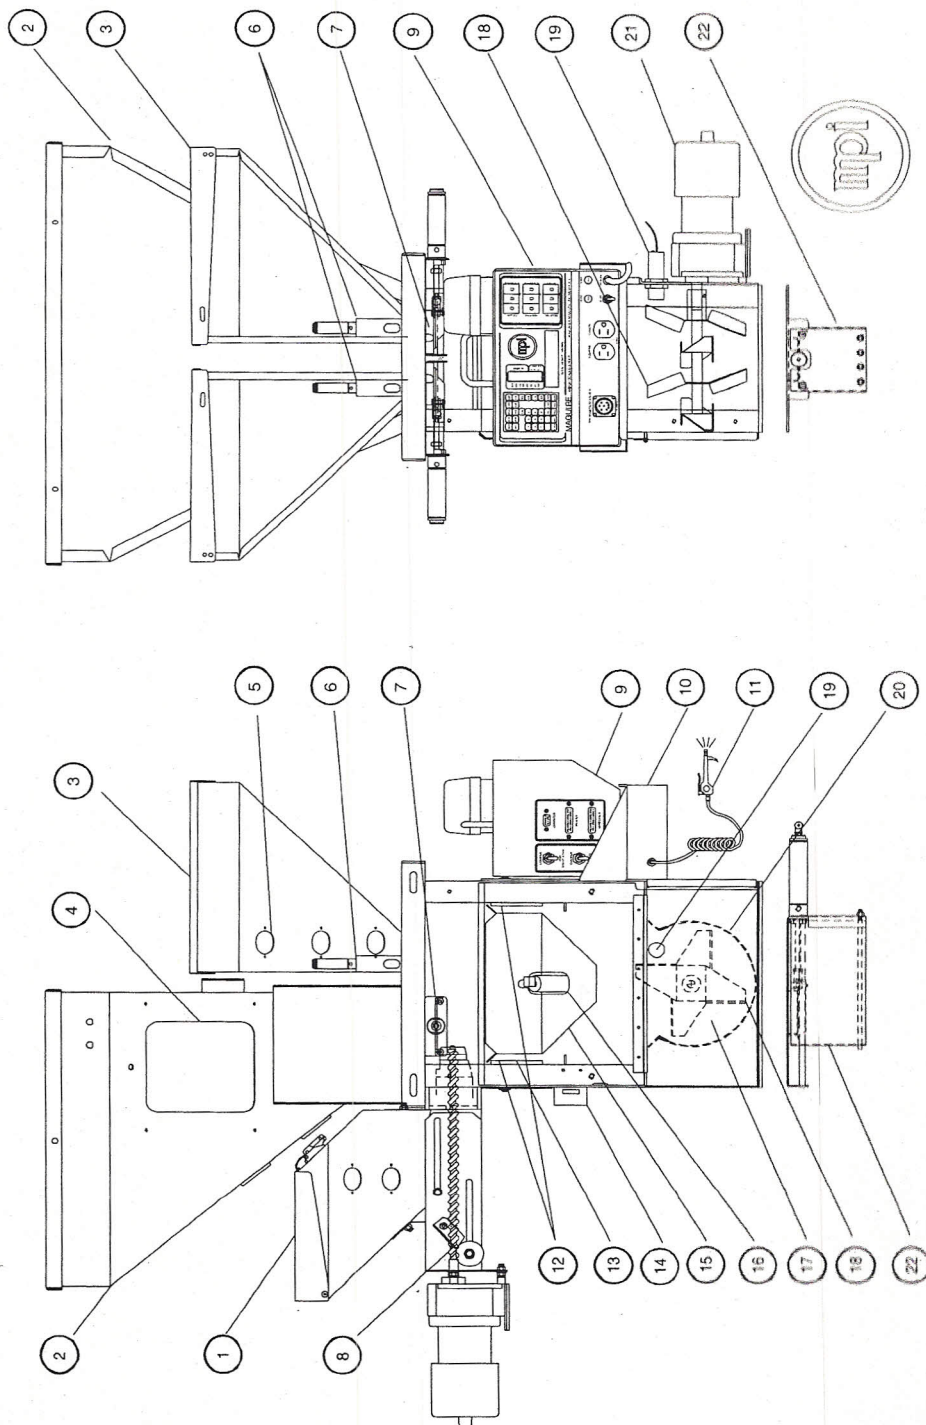
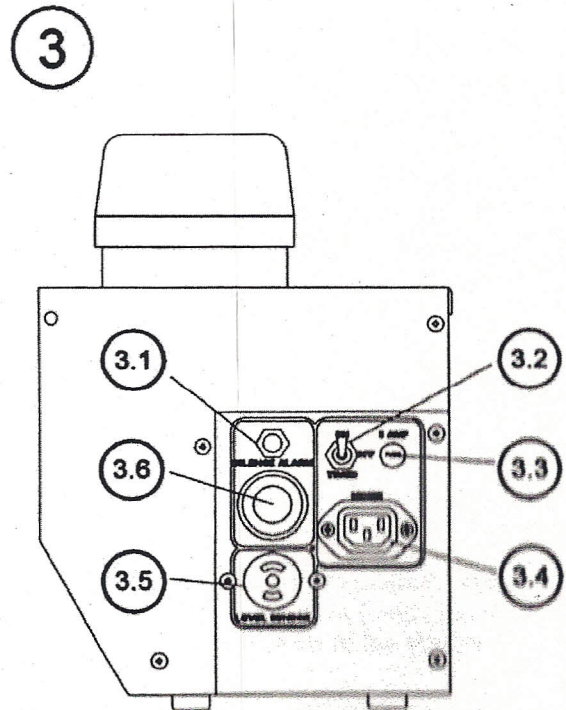


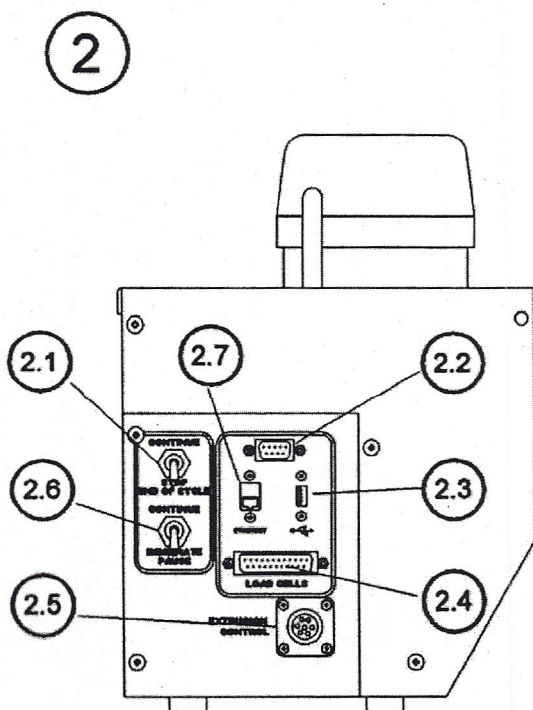

Blender Parts Key

1. **Auger Feeder** – Screw Feeder for feeding in small percentage materials such as Colors and Additives
2. **Fixed Material Hopper** – Material Hopper for main materials to be dosed by the slide gates
3. **Removable Hopper** – Removable Material hopper for small percentage materials such as Colors and Additives
4. **Hopper Access Door** – Door to access inside of hopper for quick cleaning and materials changes
5. **Sight Glass** – Means to view current material level inside the hopper
6. **Vertical Valve** – Dispense Device mounted inside removable hopper for small percentages up to 10%
7. **Slide Gate** – Dispense Device mounted below fixed hoppers to dispense large percentages
8. **Auger Screw** – Dispense Device mounted inside removable hopper for small percentages up to 10%
9. **Controller** – Central Controller for all settings on the blender
10. **Air Assembly & Solenoids** – Pneumatic assembly for activating pneumatic parts automatically and manually
11. **Cleaning Airline** – Airline for quick and easy cleaning of blender during materials changes
12. **Load Cells** – Load Cells monitor continuously the weight in the Weigh Bin
13. **Load Cell Bracket** – Load Cell Bracket for mounting Weigh Bin onto the Load Cells
14. **Safety Interlock** – Pneumatic and Electrical Safety interlock – stops blender operating if door is opened
15. **Weigh Bin** – Weigh Bin holds materials as materials are dispensed during a batch and weighed
16. **Dump Valve** – Pneumatic Valve and Flap to release materials from Weigh Bin when a batch is complete
17. **Mix Chamber** – Area where materials are blended together after being weighed
18. **Mix Blades** – Removable Mix Blades to fold the materials together to achieve an effective blend
19. **Level Sensor** – Sensor to monitor material level in the Mix Chamber, pauses blender when covered and mix chamber is full, once uncovered signals Controller to begin a new batch of material.
20. **Mix Chamber Insert** – Stainless Steel removable insert to assist in quick materials cleaning and changes
21. **Mix Motor – Electric Motor to drive Mix Blades** – Note on WSB MB and WSB 100 Series blenders this motor is a pneumatic Mix Motor
22. **Flow Control Valve** – (Optional) – Additional pneumatic slide gate with finger guards to be used when blender is not mounted directly on the throat of a machine but instead a stand or surge hopper. The Flow Control Valve ensures material remains inside the Mix Chamber long enough to be mixed efficiently. Automatically controlled by the blender Controller.

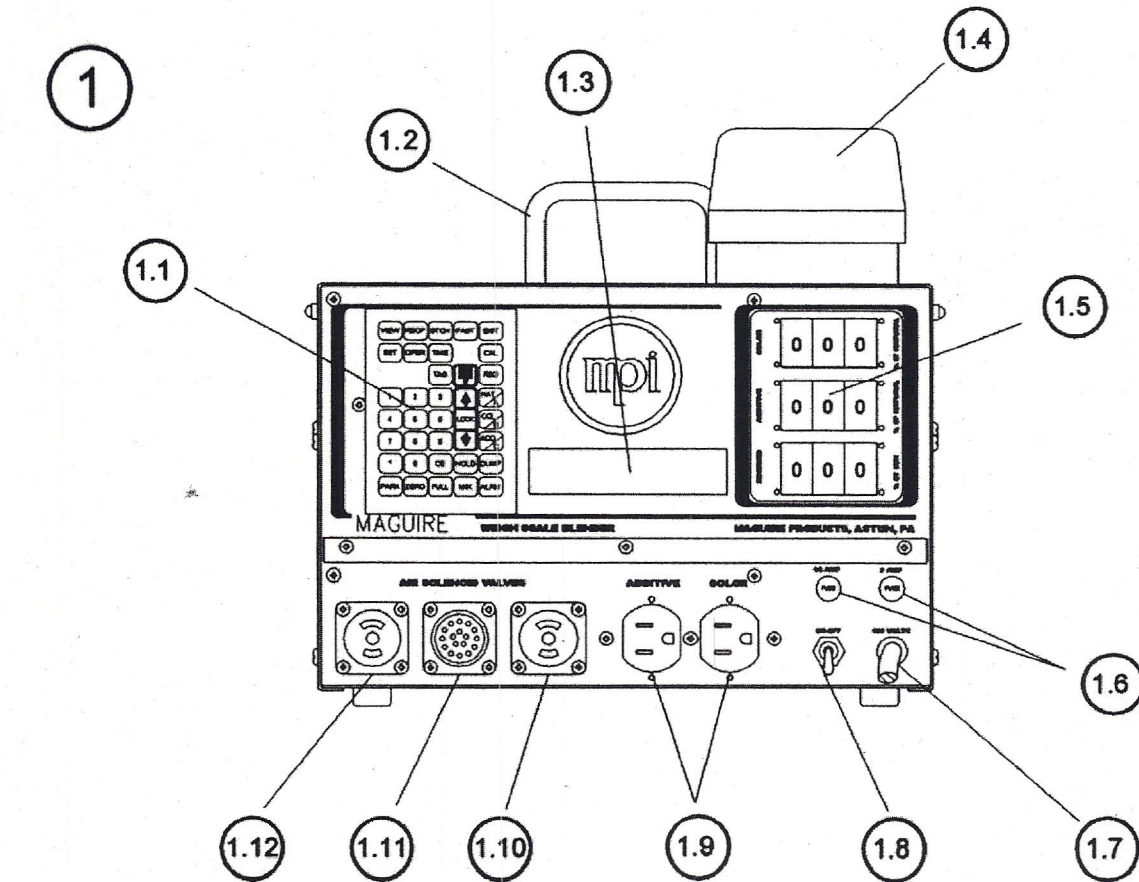

Controller Parts Key

1. Front Panel

- 1.1 Keypad
- 1.2 Service Handle
- 1.3 Main Display
- 1.4 Alarm Beacon
- 1.5 Materials Thumbwheels
- 1.6 Fuses
- 1.7 Power Cord
- 1.8 On / Off Switch
- 1.9 Outputs for additional Feeders
(**NOTE – Feeder Outputs** – These 2 outputs are not available on WSB MB and WSB 100 Series Blenders.)
- 1.10 Options - High Sensor Mount or Remote Alarm Output
- 1.11 Air Solenoid Connection
- 1.12 Optional – Low Sensor Mount

2. Left Side Panel

- 2.1 Stop End of Cycle / Continue Switch
- 2.2 Computer Serial Connection / Optional Fieldbus Connection
- 2.3 USB Printer / Software Update Output
- 2.4 Load Cell Port Input
- 2.5 Optional – Extrusion Control 2 Way Interface
- 2.6 Immediate Pause / Continue Switch
- 2.7 Ethernet Port (RJ-45)

3. Right Side Panel


- 3.1 Silence Alarm Press Down Button
- 3.2 Electrical Mix Motor Operation Switch – Timed (Default), On or Off
- 3.3 Electrical Mixer Output Fuse
- 3.4 Electrical Mix Motor Power Plug
(**NOTE – Mixing Controls** – These 3 features not available on WSB MB and WSB 100 Series Blenders – fitted instead with Pneumatic Mixers.)
- 3.5 Mix Chamber Level Sensor Input
- 3.6 Audible Alarm Loudspeaker

Controller Keypad – Summary Description

Detailed explanations are given on the pages that follow.

AUTOMATIC OPERATION MODE: (normal operation on power up)

- VIEW** View Data: date, time, cycles, and each component weight.
Press VIEW, * to print data.
- RCP** Enter and retrieve stored RECIPES.
- BTCH** View BATCH data: Target Weight, Current Portion, and Accumulated Total, and Batch Count. CE = clear displayed field.
- FAST** Run rapid FAST cycles after a normal weighed cycle.
- TAG** Tag Work Order and Operator numbers to all reports.
- EXIT** Press to EXIT all sequences from ALL MODES.
- SET** Press to review or change settings.
- CE** Press to display "raw signal" weight readout for 3 seconds.

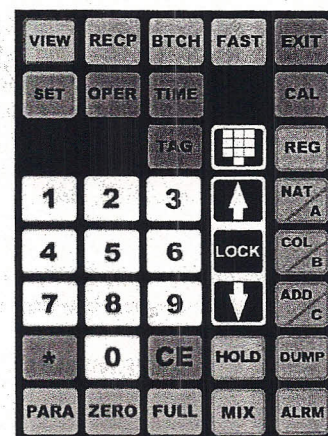

MANUAL OR PROGRAM MODE: Press: *; then (11111) or your own 5 digit password.

- OPER** Operate all devices manually; open and close valves.
- TIME** Operate devices for a selected time period.
- CAL** Operate devices to learn rate.

Above keys use 1 through 9, A, B, C, DUMP, MIX, HOLD, ALARM.

- ZERO** Zero the tare weight with the bin empty.
- FULL** Using known weights, enter gram weight to calibrate load cells.
- *00** Clear DATA fields.
- *99** Set flag to enable weight calibration of load cells.

PROGRAM MODE ONLY: Press: *; then (22222) or your own password.

- SET** Enter settings if access in Automatic mode has been locked out.
- PARA** View or change system parameters.

Press PARA for next in list, "" for previous, SET for next table, VIEW for previous table.

STAR FUNCTIONS: Press * and two numbers for the following functions:

- | | |
|--|---|
| *02 Extrusion and Yield Control. | *69 Regrind as second natural. |
| *03 Four digit (xx.xx) settings. | *71 Color percent of blend. |
| *04 Simulate FOUR software. | *72 Additive percent of blend. |
| *05 Inhibit totals clearing. | *74 Stop, alarm MAX wt exceeded. |
| *11 DATE - TIME, real-time clock. | *75 Alarm on weight drop. |
| *12 Move table from ROM to RAM. | *77 Print parameters. |
| *18 Language Selection | *78 Change program mode PASSWORD. |
| *22 LIW Model Selection | *82 Precision Ratioing. |
| *23 Move from RAM to EEPROM. | *83 Progressive Metering |
| *25 ROM OK flag, "CE" to clear. | *86 Backdoor Password |
| *32 Move from EEPROM to RAM. | *87 VOLUMETRIC operation. |
| *44 End cycle - bin full. | *88 Print display readout. |
| *45 Change MANUAL mode password. | *89 Select pounds, kilos. |
| *47 Totalizer flag. | *93 Update WSB software from USB drive |
| *48 Dispense range xx.x to xxx. | *94 Update WSB Net software from USB drive |
| *52 Double dump weigh bin. | *95 Select COM port Baud Rate |
| *54 Print cycle information. | *97 USB Driver version display, update, verify |
| *57 Alternate Liquid Color | *98 Display raw weight number. |
| *66 WSB I.D. number (1-255). | *99 Enables Weight Calibration of the Load Cells |
| *67 Modbus Enable / Disable. | |