



HOME INSPECTION REPORT

4014 Sparrow House Ln
Burtonsville, MD 20866

Tizita Ayane
05/16/2026



Inspector
Chris Gotsch, CMI
CMI, MHIC
410.970.2337
office@gotschinspect.com



Agent
Reginald Harrison
Redfin Corporation
(443) 375-7216
reginald.harrison@redfin.com

TABLE OF CONTENTS

1: Inspection & Home Details	6
2: Your Inspector & Report	8
3: Roof	10
4: Exterior	12
5: Foundation & Structure	15
6: Insulation & Ventilation	18
7: Exhaust	19
8: Heating & Cooling	20
9: Electrical	23
10: Plumbing	28
11: Interiors	33
12: Doors & Windows	36
13: Appliances	39
14: Final Checks	42

Thank you very much for choosing Gotsch Inspections to perform your home inspection. The inspection and the attached report comply with the InterNACHI Standards of Practice ([InterNACHI SOP](#)) and the State of Maryland Standards of Practice ([Maryland SOP](#)). These documents define the scope of a home inspection.

We encourage you to read the Standards of Practice to fully understand what is included in the home inspection and report, as clients sometimes assume it covers aspects that are beyond its scope.

The report has been prepared exclusively for our client and is not intended for use by third parties. We will not be responsible for the contents of the report to any parties other than the named client.

This report is a snapshot of the house, capturing conditions at the time of the inspection. Home inspectors cannot predict future conditions, and thus, we cannot be held responsible for issues that occur after the inspection. Should conditions change, we are available to revisit the property and update our report.

The inspection was primarily visual, not technically exhaustive, and did not guarantee the identification of every defect. It was based on conditions present at the time and excluded areas that were not accessible without dismantling or potentially damaging the property. We did not inspect concealed or difficult-to-access areas, and no cosmetic conditions such as carpeting, vinyl floors, wallpapering, or painting were included. The inspection focused on the listed items, assessing their functionality and safety, but not code compliance. It was not intended to reflect the property's value or advise on the purchase decision. Any discussed repair costs are estimates and should be confirmed by a qualified contractor.

AN INSPECTION IS INTENDED TO ASSIST IN THE EVALUATION OF THE OVERALL CONDITION OF A BUILDING. THE INSPECTION IS BASED ON OBSERVATION OF THE VISIBLE AND APPARENT CONDITION OF THE BUILDING AND ITS COMPONENTS ON THE DATE OF THE INSPECTION.

THE RESULTS OF THIS HOME INSPECTION ARE NOT INTENDED TO MAKE ANY REPRESENTATION REGARDING LATENT OR CONCEALED DEFECTS THAT MAY EXIST, AND NO WARRANTY OR GUARANTY IS EXPRESSED OR IMPLIED.

IF YOUR HOME INSPECTOR IS NOT A LICENSED STRUCTURAL ENGINEER OR OTHER PROFESSIONAL WHOSE LICENSE AUTHORIZES THE RENDERING OF AN OPINION AS TO THE STRUCTURAL INTEGRITY OF A BUILDING OR ITS OTHER COMPONENT PARTS, YOU MAY BE ADVISED TO SEEK A PROFESSIONAL OPINION AS TO ANY DEFECTS OR CONCERNS MENTIONED IN THIS REPORT.

ONLY HOME INSPECTIONS PERFORMED BY MARYLAND LICENSED HOME INSPECTORS WILL BE RECOGNIZED AS A VALID HOME INSPECTION UNDER A REAL ESTATE CONTRACT.

The inspection did not include analysis or testing for environmental health hazards, concealed wood decay, mold, mildew, fungi growth (unless specifically requested),

insects, vermin, or any other potential hazards. The inspection and report are provided on an 'opinion only' basis and are not a guarantee or warranty of the building or any of its components. Our company assumes no liability for any mistakes, omissions, or errors in judgment beyond the cost of this report. We also assume no responsibility for the costs of repairing or replacing any unreported defects or conditions. This report is intended solely for our client's use, and no third-party liability is assumed.

The report itself is copyrighted and may not be used in whole or in part without our express written permission.

Again, thank you for choosing Gotsch Inspections for your home inspection needs.

- ⊖ 4.1.1 Exterior - Siding, Flashing & Trim: Siding Loose
- ⊖ 4.1.2 Exterior - Siding, Flashing & Trim: Siding Loose 2
- ⊖ 4.1.3 Exterior - Siding, Flashing & Trim: Siding Trim Damage
- ⊖ 4.1.4 Exterior - Siding, Flashing & Trim: Peeling and Chipping Exterior Paint
- ⊖ 5.1.1 Foundation & Structure - Foundation: Evidence of Moisture Intrusion
- 🔧 5.2.1 Foundation & Structure - Basement: Moisture Intrusion Potential in Basement/Crawlspace
- ⊖ 7.2.1 Exhaust - Dryer Exhaust System: Dryer Vent Missing Exterior Door
- 🔧 8.7.1 Heating & Cooling - Fireplace: Firebrick Cracked
- ⊖ 8.7.2 Heating & Cooling - Fireplace: Fireplace Requires Further Evaluation
- ⚠ 8.7.3 Heating & Cooling - Fireplace: Chimney Leaning
- ⊖ 9.3.1 Electrical - Service Panel: Electrical Panel Knockouts Open
- ⊖ 9.3.2 Electrical - Service Panel: White Wire Connected to Circuit Breaker
- 🔧 9.4.1 Electrical - Branch Wiring Circuits, Breakers & Fuses: Grounded (Neutrals) Double Tapped
- 🔧 9.5.1 Electrical - Receptacles (All Accessible): Junction Box Cover Missing - Higher
- 🔧 9.5.2 Electrical - Receptacles (All Accessible): Receptacle Loose
- ⊖ 9.5.3 Electrical - Receptacles (All Accessible): Receptacle Not Holding Plug - Many
- ⊖ 9.5.4 Electrical - Receptacles (All Accessible): Receptacle Not Installed
- ⊖ 9.5.5 Electrical - Receptacles (All Accessible): Receptacle Painted
- ⊖ 9.6.1 Electrical - Switches & Lighting (All Accessible): Light Fixture Missing
- ⊖ 10.1.1 Plumbing - Water Supply, Distribution System: Water Line Reversed - Hot / Cold
- ⊖ 10.2.1 Plumbing - Drain, Waste, & Vent System (DWV): Flex Waste Drain Pipe
- 🔧 10.3.1 Plumbing - Faucets: Diverter Degraded - Tub Spout
- 🔧 10.3.2 Plumbing - Faucets: Hose Bibb Anti-Siphon Missing
- 🔧 10.4.1 Plumbing - Sink, Shower, Tub Fixtures: Drain Stop Missing - Tub
- 🔧 10.4.2 Plumbing - Sink, Shower, Tub Fixtures: Drain Stop Missing - Tub 2
- 🔧 11.2.1 Interiors - Floors Coverings: Floor Covering Gap
- 🔧 11.3.1 Interiors - Countertops, Cabinets, Vanities: Cabinet Damaged
- ⊖ 11.5.1 Interiors - Steps, Stairways & Balustrade: Steps / Stairs Handrail Loose
- ⊖ 11.5.2 Interiors - Steps, Stairways & Balustrade: Interior guard rail loose
- ⊖ 11.5.3 Interiors - Steps, Stairways & Balustrade: Interior guard rail loose 2
- ⊖ 11.5.4 Interiors - Steps, Stairways & Balustrade: Open Risers on Interior Stairs
- ⊖ 12.1.1 Doors & Windows - Exterior Doors: Sliding Glass / Screen Door Difficult to Open/Close
- 🔧 12.1.2 Doors & Windows - Exterior Doors: Sliding Glass / Screen Door Does Not Latch
- 🔧 12.1.3 Doors & Windows - Exterior Doors: Sliding Glass / Screen Door Does Not Latch 2
- ⊖ 12.2.1 Doors & Windows - Interior Doors: Interior Door Rubbing - Floor
- ⊖ 12.2.2 Doors & Windows - Interior Doors: Interior Door Hardware Damage

1: INSPECTION & HOME DETAILS

Information

Inspection Conditions: In Attendance

Client, Client's Agent

Inspection Conditions: Occupancy

Occupied, Staged, Utilities On

Inspection Conditions: Type of Building

Townhouse

Inspection Conditions: Style

Townhouse

Inspection Conditions: Temperature (approximate)

70 Fahrenheit (F)

Inspection Conditions: Weather Conditions

Clear

Orientation (Elevation): Rear Elevation



Orientation (Elevation): Front Elevation



Inspection Conditions: Townhouse

A townhouse is an individual unit within a multi-unit complex. Our inspection will cover only your townhouse, front/back yards (and side yard if you are an end unit). We also inspect all interior systems such as electrical, plumbing, HVAC, appliances and structural components like walls and floors. However, our inspection excludes shared elements like common walls and community amenities, which are usually the responsibility of the homeowners association. We may offer comments concerning our observations of common areas as a courtesy.

Shut/Cut Off: Water Shut Off

Front Basement

The main water shutoff is designed to stop all water flow the home. All homes should have at least one primary shutoff. If city water there will be at least one at the meter and maybe another at the home. If well water, usually there is one at the well components and the breaker can be turned off to isolate flow as well.



Shut/Cut Off: Electric Shut Off

Front Basement

The main electric shutoff is designed to stop all electricity in the home. All homes need at least one primary shutoff and is located at the main service panel.



Detached Structure(s): No Detached Structures

No detached structures were present at the time of the inspection or the client did not want the inspector to inspect the structure(s).

Furniture Limits: Stored or Furnished Items

Limitation Many wall, floor and/or ceiling surfaces were obscured by large amounts of furniture and/or stored items. Certain areas could not be evaluated.

2: YOUR INSPECTOR & REPORT

Information

Inspection Company Disclosure (Licensed State): Inspector & Company Information

HOME INSPECTOR COMPLIANCE STATEMENT: I, Chris Gotsch, CMI, represent that the State of MD licenses me to perform home inspections. My credentials are CMI, MHIC. I will conduct a home inspection of the previously mentioned property per the State's Code of Ethics, Standards of Practice, and the signed Home Inspection Agreement.

Report: Copywrite Notice

© Copyright Notice: This report is the property of Gotsch Inspections, LLC. The Client(s) and their direct Real Estate Representative named herein have been named licensee(s) of this document. This document is non-transferrable, in whole or in part, to any third parties, including; subsequent buyers, sellers, and listing agents. Copying and pasting deficiencies to prepare the repair request is permitted. **THE INFORMATION IN THIS REPORT SHALL NOT BE RELIED UPON BY ANYONE OTHER THAN THE CLIENT NAMED HEREIN.** This report is governed by an Inspection agreement that contains the scope of the inspection, including limitations, exclusions, and conditions of the copyright. Unauthorized recipients are advised to contact a qualified Home Inspector of their choosing to provide them with their own Inspection and Report.

Report: How Read Your Report

[Click here for the video in the .pdf.](#) The video below is a quick video that can help you navigate your report:

Watch video on YouTube

Error 153

Video player configuration error

Inspection Categories: Inspection Categories

Explanation of Ratings (How to Read Report)

MONITOR / RECOMMEND

- Monitor noted items are observations the inspector found that are not defective yet could become an issue over time. They should be watched to ensure long-term proper operation / function.

MAINTENANCE / MINOR

- Maintenance items, DIY items, or recommended upgrades will fall into this category. These concerns will ultimately lead to Prioritized Observations or High Importance if left neglected for extended periods. These items are generally more straightforward to remedy and normally inexpensive.

PRIORITIZED OBSERVATIONS

- A functional component that is *not operating as intended or defective*. Items that inevitably lead to or directly cause (if not addressed in a timely manner) an adverse impact on the value of the home or unreasonable risk (unsafe) to people or property. These concerns typically require further evaluation or may be more complicated to remedy.

HIGH IMPORTANCE

- A specific issue with a system or component may have a significant, adverse impact on the property's condition or that poses an immediate risk to people or property. These items are often imminent and/or very difficult or expensive to remedy.

Throughout the report, we include expanded notes, limitations, and recommendations.

***Notes* are in Green** - generally are expanded information about a specific component or system in the home. These are 'good to know' information, typically found in the 'Info' sections.

***Limitations* are in Orange** - generally means we could not visually inspect, access, or test components within the home. These are viewable in the 'Limitations' tab on the right of each section.

***Recommendations* are in Blue** - general recommendations of improvements, maintenance, repairs, or replacement for components, systems, or appliances in the home. These are only recommendations based on the Inspectors' experience and are not considered facts. It's always recommended to have the item further evaluated by the respective trade. These are generally found in the 'Limitations' or 'Defects' sections.

3: ROOF

Information

Roof Inspection: Inspection Method Drone	Roof Inspection: Roof Type / Style Gable Roof	Roof Inspection: Number of Layers Unknown
Coverings - Asphalt Shingles: Asphalt Shingle Material Asphalt, 3-tab Shingle	Vent Stack Flashing: Number of Vent Stacks One	Roof Drainage Systems: Gutter Material & Type Aluminum
Roof Drainage Systems: Downspout Material Aluminum		

Roof Inspection: Roof & Coverings Inspection

The roof inspection includes what is required by the state's SOP and general inspection standards. The Inspector visually identifies and describes the roof structure, type, coverings, all penetrations, and flashing including the building and penetrations, and sheathing (decking).

This is not an exhaustive inspection of every installation detail of the roof system according to the manufacturer's specifications or construction codes. It is virtually impossible to detect a leak except as it is occurring or by specific water tests, which are beyond the scope of our inspection. Service life or age of the roof is only an estimation, as knowing the exact age is difficult due to many factors. The roof structure and coverings are considered in serviceable condition unless otherwise noted in the report.

Roof Inspection: Drone Inspection

Note An aerial drone was used for the roof evaluation. It is understood that this method of inspection is not as thorough as if the inspector was actually able to walk the roof surface, and is considered a limited inspection. Any comments made in this report relating to the roof covering, roof protrusions, gutters, chimneys, etc. are limited to the visible perspective of the drone. If a more thorough inspection is desired I recommend consulting a roofing contractor.



Coverings - Asphalt Shingles: Asphalt Shingle Estimated Age

Late Lifespan

The age of the roof is a rough estimation. There are many factors that determine the condition of the roof which can make it difficult to know the true age. Also environmental factors such as heavy wind areas or sides of the roof that receive a lot of sun may prematurely deteriorate the shingles.

Generally 3-tab shingle lifespan from 20-25 years; Architectural lifespan from 25-30 years; Luxury lifespan 30+ years. The estimated age in each section (early, mid, late - including mid) is a spread of 6-7 years in each category and these ages are based on the maximum lifespan for the type of asphalt shingle installed. For example, a mid lifespan for 3-tab shingle is approximately 9-16 years old. A mid-late lifespan for an Architectural shingle is 16-23 years old. The roof is considered in operational and functional condition unless otherwise noted in this report.

Coverings - Asphalt Shingles: 3-Tab Asphalt Shingle

One-piece, single-layer 3-tab asphalt shingles (or strip shingles) are economical asphalt shingles made from durable fiberglass base mat coated with mineral granules, giving each piece varying color tones. 3-tab shingles are lightweight and designed to withstand the elements for about 20 years or more and are easy to recognize by their clean, horizontal appearance. Their exposed layer is notched (usually into three tabs, hence 3-tab moniker) to give a more decorative appearance.

Penetrations & Flashing: Roof Penetrations

Chimney, Plumbing, Ventilation

A roof penetration is anything that protrudes through your roof structure and coverings. There are many different types of penetrations, yet all need some type of flashing or sealed protection to ensure your roof does not leak. The Inspector will visually check for proper flashing, support, and sealing (if needed). Penetrations and flashing are satisfactory unless otherwise noted in this report.

Penetrations & Flashing: Building Flashing

Flashing refers to thin pieces of impervious material installed to prevent the passage of water into a structure from a joint or as part of a weather-resistant barrier (WRB) system. In modern buildings, flashing is intended to decrease water penetration at objects such as chimneys, vent pipes, walls, windows and door openings to make buildings more durable and to reduce indoor mold problems. Flashing is most important and visually available on the roof level. Images provided in the report of flashings are just samplings of what the inspector looks at; not all flashing points are shown. Any discrepancies will be noted in the observations.

Vent Stack Flashing: Vent Stack Flashing Inspected

Plumbing vent stacks are part of the drain, waste, vent (DWV) system and allow for proper venting of waste gases. These protrusion require special flashing which is inspected. Unless otherwise noted the vent stacks had proper flashing for the roof covering type and the flashing boots/gaskets were in good condition. Only a few up-close pictures for perspective on flashing/gaskets condition; not all may be shown. Any deficiencies will be noted in the report.

Attic Vents: Attic Vent Penetrations

Ridge Vents

Attic vents were installed, allowing hot and moist air ventilation from the attic area. Vents can be passive or active; see the Ventilation section for more information. The Inspector looks for proper installation, including flashing. Attic vents are considered satisfactory unless otherwise noted in this report. penetrations

Exhaust: Exhaust & Flashing Inspected

None

Exhaust allow for proper venting of combusted gases (flues), and kitchen and bathroom exhaust. These protrusions require special covers and/or flashing to stop moisture to the attic area. The exhaust was in satisfactory condition and properly flashed unless otherwise noted in this report.

Only a few up-close pictures for perspective on flashing condition; not all exhausts may be shown.

Limitations

Roof Drainage Systems

LIMITED GUTTER INSPECTION - NO RAIN

Limitation Inspection of the gutter system's full function is impossible due to lack of or insufficient rain. Leaks and proper drainage cannot be ascertained on the day of the inspection. Recommend a gutter review to ensure no leaking before closing.

4: EXTERIOR

Information

Siding, Flashing & Trim: Siding & Trim Material

Metal

Porch & Veranda: Porch / Veranda Type

Front Porch

Porch & Veranda: Porch / Veranda Base

Concrete

Eaves, Soffits & Fascia: Wood/Composite Fascia

Recommend Wood and/or composite fascia is more prone to moisture damage and should have consistent stain protectant.

Eaves, Soffits & Fascia: Wood/Composite Soffit

Recommend Wood and/or composite soffit is more prone to moisture damage and should have consistent stain and/or paint applied for protection.

Driveway & Walkway: Driveway & Walkway Inspection

The driveway and walkway are evaluated for signs of structural issues, material degradation, and safety hazards. This includes assessing the condition of the paving material, checking for cracks, uneven surfaces, and drainage problems. The inspection is visual, and the surfaces are considered functional unless otherwise noted in this report.

Porch & Veranda: Porch Inspection

Porches are a structure that forms a covered entrance to a doorway. They are generally in the front, though rear porches are called a 'back porch.' It is an outside extension on the same floor level as the interior and is normally built from the same materials. Porches are considered part of the home.

Our inspection is a visual inspection of the structural components such as columns, beams, base (foundations), stringers, floor joists (if present), and guardrails (if required). Any enclosure including the walls and screens / window will be inspected for visual indications of defects.

Grading & Drainage (affecting the condition of the building): Grading (with respect to the condition of the building)

Grading away from the home is moderate

Knowing the grading and drainage issues are crucial for the home's structural integrity and its long-term value. We do our best to visually determine if these elements negatively affect the home, though some issues are not visible and can't be reported.

Grading & Drainage (affecting the condition of the building): Drainage (with respect to the condition of the building)

Drainage Installed

Knowing the grading and drainage issues are crucial for the home's structural integrity and its long-term value. We do our best to visually determine if these elements negatively affect the home, though some issues are not visible and can't be reported.

Observations

4.1.1 Siding, Flashing & Trim

SIDING LOOSE

ROOF CHIMNEY



Recommendation

Siding was loose, which could result in moisture intrusion.

Recommend: siding is refastened and/or repaired.

Recommendation

Contact a qualified siding specialist.



4.1.2 Siding, Flashing & Trim

SIDING LOOSE 2

REAR EXTERIOR WALL

Siding was loose, which could result in moisture intrusion.

Recommend: siding is refastened and/or repaired.

Recommendation

Contact a qualified siding specialist.



Recommendation



4.1.3 Siding, Flashing & Trim

SIDING TRIM DAMAGE

FRONT EXTERIOR WALL

Trim or wood siding shows signs of damage which will continue to degrade leading to moisture issues.


Recommend: correction by replacing fouled wood and/or applying a protectant stain/paint.

Recommendation

Contact a qualified handyman.



Recommendation

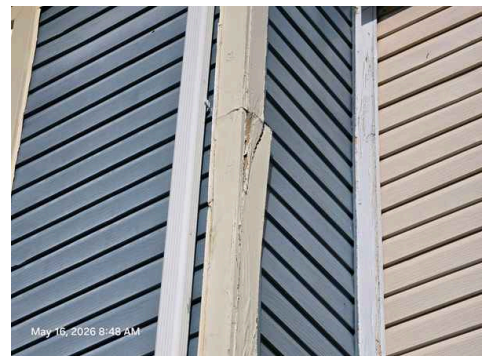

4.1.4 Siding, Flashing & Trim

PEELING AND CHIPPING EXTERIOR PAINT

VARIOUS

Peeling and chipping paint on exterior surfaces exposes underlying materials to moisture intrusion and weather-related damage.

****Recommend:**** remove loose paint, properly prepare surfaces, and apply exterior-grade paint to restore protection.



Recommendation



Recommendation

Contact a qualified professional.

5: FOUNDATION & STRUCTURE

Information

Foundation: Foundation Material & Build Type Poured Concrete	Wall Structure: Wall Structure Material Wood	Ceiling Structure: Ceiling Structure Material Wood
Attic Structure & Sheathing: Access Type Ceiling hatch	Attic Structure & Sheathing: Structure Type Trusses	Attic Structure & Sheathing: Sheathing Material Plywood

Basement: Below Grade Foundation

Limitation Areas below grade were inspected for signs of past or present water intrusion by examining visible portions of the foundation walls, floors, and/or soil looking for moisture stains and/or other signs of current or prior water intrusion. No indications of water/moisture intrusion was present at visible areas below grade unless otherwise noted in this report. I can only report on the conditions as they existed at the time of inspection, and can not guarantee that water will not infiltrate this area at a future time due to a heavy rain or changes in conditions. I have inspected homes where no water or indications of water intrusion was present at the time of inspection, but days later water infiltration occurred due to a rainfall event. For this reason, I highly recommend consulting with the sellers as to prior moisture infiltration into areas below grade.

Basement: Walk-out Basement

Home had a walk-out basement. All related information will be noted in relevant sections within this report.

Basement: Basement

Basement was inspected and any findings will be reported under their respective sections.

Wall Structure: Duplex/Townhouse Firewall Separation


Multi-family structures (such as duplexes/triplexes and townhouses) shall be separated by a fire-resistance-rated wall that extends up to the roof. These firewalls are not allowed to have plumbing, electrical, and/or HVAC penetrating the firewall. This multi-family structure was noted as having the proper fire-resistant wall separation unless otherwise noted in this report.

Attic Structure & Sheathing: Attic Inspection

Inspection from hatch

Inspection typically includes evaluation of attic spaces; condition of the access opening (including location), structure type, sheathing type and conditions, insulation type, ducts, visible electrical components, exhaust terminations, plumbing components, and ventilation if applicable.

Attic Structure & Sheathing: Attic Structure Photos

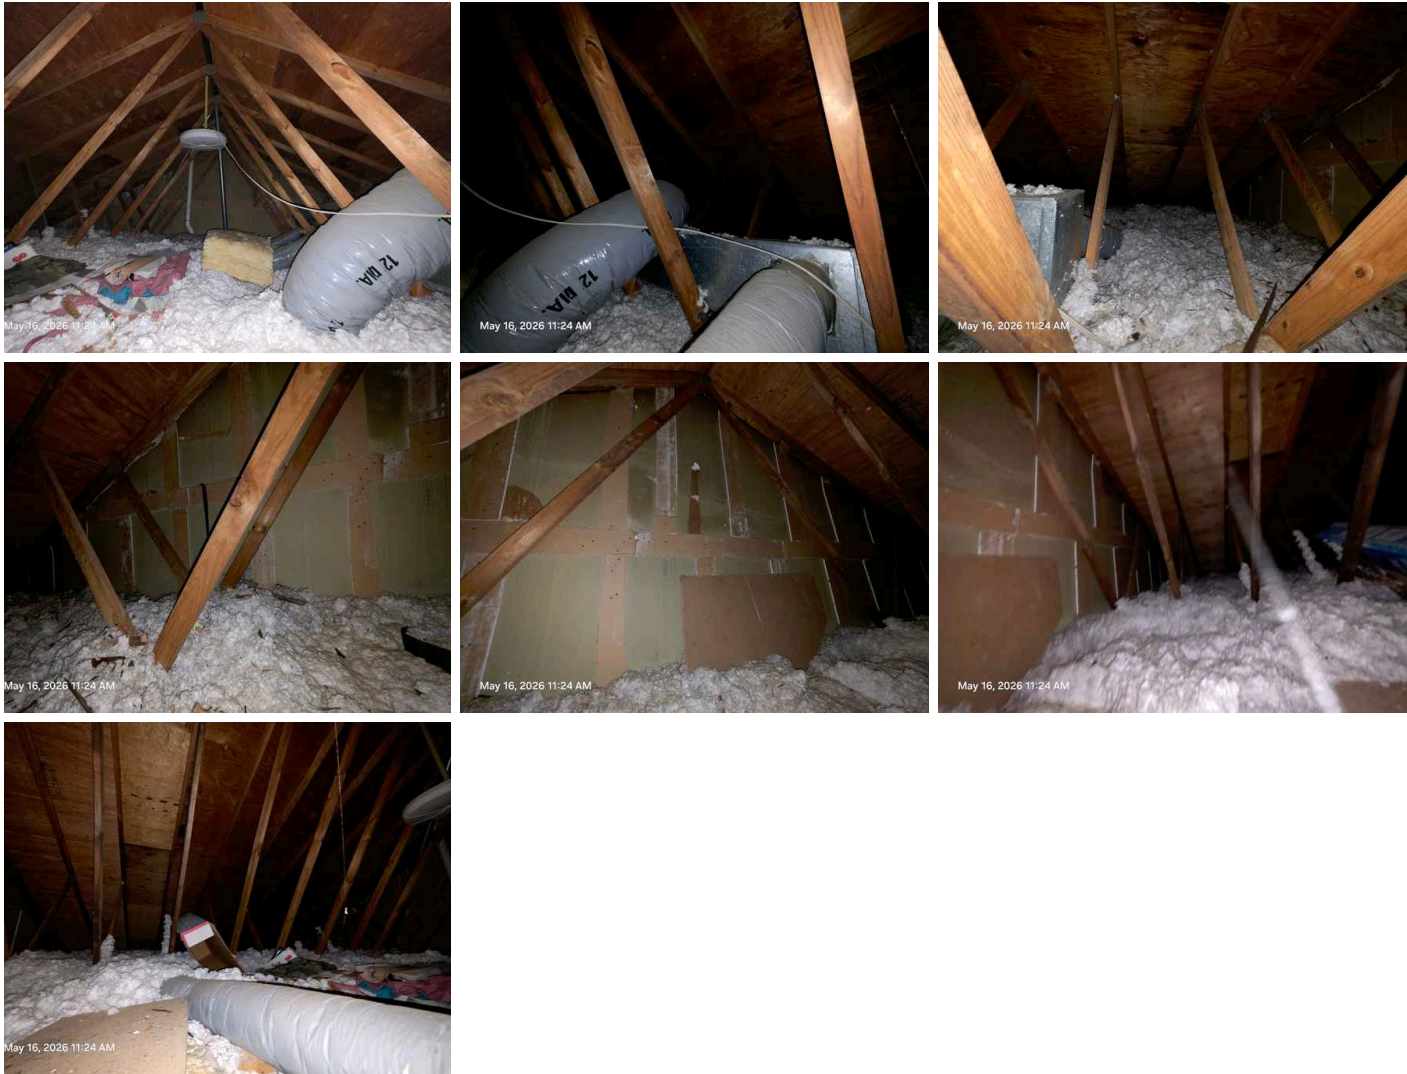

Limitations

Basement
FINISHED BASEMENT

Limitation Basement was finished in some or most wall surfaces meaning poured/masonry foundation walls were covered by studs and drywall. Inspector makes every attempt to determine possible leak points with thermal and moisture meter, yet is limited on what can be seen or determined at the time of the inspection.

Wall Structure
WALL STRUCTURE INSPECTION LIMITED VISABILITY

Limitation Due to wall coverings such as drywall and siding many wall areas could not be visibly inspected.

Ceiling Structure
CEILING STRUCTURE LIMITED INSPECTION - ACCESS / INSULATION

Limitation Due to ceiling coverings such as drywall and insulation in the attic many ceiling areas could not be visibly inspected.

Observations

5.1.1 Foundation

EVIDENCE OF MOISTURE INTRUSION



Recommendation

FRONT EXTERIOR WALL

Foundation Shows Evidence of Moisture Intrusion

Moisture staining, efflorescence, or material decay on foundation surfaces indicates past or ongoing water infiltration, potentially weakening structural materials and encouraging microbial growth. Recommend: Locate and address moisture source; repair affected areas to maintain foundation integrity and interior dryness.

Recommendation

Contact a foundation contractor.



5.2.1 Basement

MOISTURE INTRUSION POTENTIAL IN BASEMENT/CRAWLSPACE



Maintenance Item

All basements and crawlspaces have potential to leak under certain conditions due to factors such as hydrostatic pressure, poor exterior drainage, or foundation cracks. Even if currently dry, future moisture intrusion remains possible.

Recommend: Monitor regularly for signs of water entry and maintain exterior grading, gutters, and drainage systems to direct water away from foundation. Consult specialist if signs of moisture appear.

6: INSULATION & VENTILATION

Information

Ventilation: Passive Ventilation Passive, Soffit Vents, Ridge Vents	Ventilation: Active Ventilation None	Insulation: Attic Insulation Type Blown, Fiberglass
---	--	---

Insulation: Flooring Insulation
Unknown

Insulation: Insulation Inspection
The insulation in the attic (if accessible) and crawlspace (if applicable and accessible) are assessed for thermal efficiency, proper installation, and amounts. The inspection includes assessing the type and condition of insulation materials, checking for adequate coverage, and identifying any signs of moisture or pest damage.

7: EXHAUST

Information

General Exhaust Systems: Home Exhaust Systems

Bathroom Exhaust, Dryer Exhaust, Kitchen Exhaust, Wood Burning Flue

A home exhaust system is critical to a residential building's mechanical systems. It serves to remove combusted air (CO), stale air, moisture, and contaminants, thereby improving indoor air quality and maintaining a healthy living environment. The top reasons for properly installed and functioning exhaust systems are: ventilation, moisture control, odor removal, temperature regulation, and pollutant removal like CO, VOCs, smoke, and allergens.

Dryer Exhaust System: Dryer Exhaust System

Out Exterior Wall

A dryer exhaust is essential to remove humid air from inside the home. The exhaust must be kept clear and should be cleaned yearly.

Kitchen Exhaust System: Kitchen Exhaust System

Microwave Vented, Out Exterior Wall

A kitchen exhaust is essential to remove smoke, grease, and cooking smells from the kitchen area. Most exhaust systems are installed directly above the range, yet some are installed on the range / cooktop or through the wall. Most exhaust appliances come with filters that should be washed and kept clean.

Observations

7.2.1 Dryer Exhaust System

DRYER VENT MISSING EXTERIOR DOOR

FRONT EXTERIOR WALL

Exterior dryer vent missing damper door may allow pests, debris, and cold air to enter vent system, reducing efficiency and increasing fire risk.

****Recommend:**** Install appropriate damper door to fully enclose vent when dryer not in use.

Recommendation

Contact a qualified professional.



Recommendation



8: HEATING & COOLING

Information

Heating & Cooling System: Air filter

Disposable, 1" thick, 16"x20"

Condensation Draining: Discharge Method

Condensation Pump

Fireplace: Fuel Type

Wood

Air Conditioner / Heat Pump Equipment: Condenser Unit

Brand
Trane

Distribution System: Configuration

Ductwork

Air Conditioner / Heat Pump Equipment: Air Handler / Evaporator Unit Brand

Trane

Heating & Cooling Source: Heating/Cooling Source

Ceiling Register, Floor Register

Heating & Cooling System: HVAC Split System - Heat Pump

This home employs a HVAC Heat Pump to both cool and heat the home. It's a split system that utilizes an outdoor condenser (or heat pump) unit and inside air handler/evaporator unit.

A heat pump is a heat transporter constantly moving warm air from one place to another, to where it's needed or not needed, depending on the season. Even in air that seems too cold, heat energy is present. When it's cold outside a heat pump extracts this outside heat and transfers it inside. When it's warm outside, it reverses directions and acts like an air conditioner, removing heat from your home. **In colder climates - average 25 degrees - a heat pump will struggle to pull warm air from outside and the backup heating system (either electric strips or gas furnace) will become the primary heat source.*

Air Conditioner / Heat Pump Equipment: Estimated Condenser Age

3 years

The age of the condenser does not guarantee how well the unit will function or for how long. Location of the condensing unit, maintenance, and conditions of the area also has an impact on the future function.

Air Conditioner / Heat Pump Equipment: Condenser Photos




Air Conditioner / Heat Pump Equipment: Estimated Air Handler / Evaporator Age

3 years

The age of the air handler/evap coil does not guarantee how well the unit will function or for how long. Location of the air handler/evap coil unit, maintenance, and conditions of the area also has an impact on the future function.

Air Conditioner / Heat Pump Equipment: Air Handler / Evaporator Coil Photos

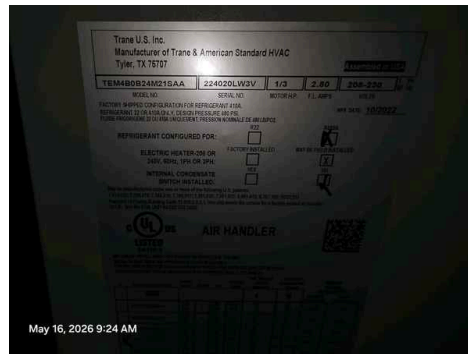

Condensation Draining: Evaporator Coil Moisture

Every evaporator coil unit (located near or in the air handler unit) creates condensation (water) which must be moved to the exterior of the unit. Normally this water must be moved to an exterior location away from inside of home, basement, or crawlspace as moisture will build up. Most discharge methods are either passively through a gravity fed condensation line or actively through a powered condensation line pump. Method of discharge is normally based on the installed location of the evaporator coil.

Normal Operating Controls: Thermostat Brand

Ecobee

A thermostat exerts control by switching heating or cooling devices on or off and maintaining the correct temperature. As the main control unit for the heating and cooling system, the inspector will use the thermostat to test the system.

Normal Operating Controls: Cooling Temperature - Satisfactory

The temperature was taken from noted source using an IR thermometer; both register and ambient (return) temps are measured. Temps differentials are within norms. Temps from the register should be within at least 15 degrees or lower from ambient return temps. Also measured is the condensation on the refrigerant line, heat transfer emitting from the condenser, and condensation moisture from the line. All factors are used to determine operating efficiency.

Distribution System: Return

Recommend Returns move air from in the home back through the HVAC system. Returns normally need a filter to help stop dust, dander, and larger particles from blocking the evaporator coil. Filters should be changed 1-3 months, depending on the type of filter installed.

Fireplace: Wood-burning Fireplace Visually Inspected

Inspection of wood-burning fireplaces typically includes visual examination of the following: adequate hearth; firebox condition; operable damper; visible flue condition; spark barrier; exterior condition. Any basic deficiencies will be noted.

*Full inspection of wood-burning fireplaces lies beyond the scope of the General Home Inspection. For a full inspection to more accurately determine the condition of the fireplace and to ensure that safe conditions exist, the Inspector recommends that you have the fireplace inspected by an inspector certified by the Chimney Safety Institute of America (CSIA).

Find a CSIA-certified inspector near you at <http://www.csia.org/search>

Observations

8.7.1 Fireplace

FIREBRICK CRACKED

BASEMENT

Firebrick has a minor crack, yet likely still provides adequate protection.

Recommend: *monitor crack does not worsen and replace as needed.*

Recommendation

Recommend monitoring.



Maintenance Item



8.7.2 Fireplace

FIREPLACE REQUIRES FURTHER EVALUATION

BASEMENT FIREPLACE

Visible conditions at fireplace or chimney structure may indicate hidden damage or deficiencies not fully observable during inspection, including potential venting, structural, or fire safety concerns.

****Recommend:**** Further evaluation of fireplace and chimney by qualified professional to determine condition and necessary repairs.



Recommendation

8.7.3 Fireplace

CHIMNEY LEANING

ROOF


Chimney visibly leaning may indicate structural movement or foundation failure, creating risk of collapse, water intrusion, and damage to roof structure. Recommend: further evaluation to determine extent of movement and repair or stabilization as needed.

Recommendation

Contact a qualified professional.



Safety Hazard

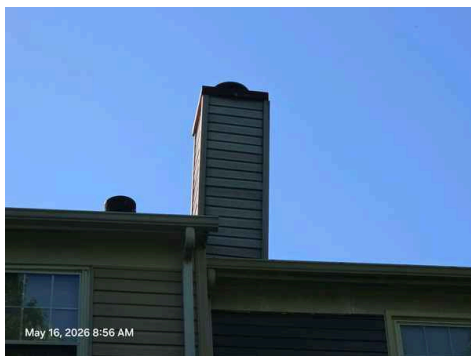

9: ELECTRICAL

Information

Service Entrance Conductors:
Service Entrance Photos



Service Panel: Electrical Panel
Type
Circuit Breaker

Service Panel: Electrical Panel
Amperage
200 AMP

Branch Wiring Circuits, Breakers
& Fuses: Branch Wire 15/20 AMP
Copper

Branch Wiring Circuits, Breakers
& Fuses: Wiring Method / Type
Non-metallic Sheathed Cable

Electrical System: Electrical System Inspection - Electric Power Provided

Electrical power was provided to the home. The electrical system assessment includes examining the service entrance and panels for correct installation and condition, checking circuit breakers and fuses for appropriate size and capacity, and testing GFCI devices. Inspectors also evaluate a representative number of outlets and switches for operation, grounding, and correct polarity, alongside inspecting light fixtures, fans, and visible wiring for integrity and safety. The presence and functionality of smoke and carbon monoxide detectors are verified, and major electrical appliances are checked for proper connections and operation.

Service Entrance Conductors: Service Entrance Conductors (SEC)

Service Lateral (Underground), 120-240 Voltage, Aluminum, 200 Amp Service

The conductors from the service point to the service disconnecting means (service equipment). Service conductors would include service-entrance conductors for both overhead (service drop) and underground (service lateral).

The service amperage is determined by inspecting the service entrance conductors size as well as the service disconnects size. Voltages are not tested for and therefore not confirmed, so 120/240VAC is presumed based on the ratings at the meter. If a concern, a licensed electrician could test for proper voltages to see if 120/208VAC is present. In some situations the sizing of the service entrance conductors will not be legible or marked and the stated amperage will be followed by "presumed" as it could not be verified.

Service Entrance Conductors: Grounding Electrode System (GES)

Grounding Rod

Grounding offers excess electricity the most effective and safest route from an appliance back to the ground through an electrical panel. Electrical grounding is a backup pathway generally only used if there is a fault in the wiring system.

Service Panel: Service Panel Inspection

The main service panel (breaker panel) is to control the electricity that reaches different rooms and areas in your home. It protects the circuits and keeps track of the panels amperage capacity. The service panel is also known as a service disconnect panel as it can be used to cut power to your house including all the circuit breakers.

The panel prevents your circuits from getting overheated due to defective appliances or wiring issues. A breaker is connected by 3 wires (or 2 if an older ungrounded wire system) to several connection boxes or outlets along each circuit. Electric current is passed through the live/hot wire. The grounding (ground) and grounded (neutral) serve as the safety features and are connected to the breaker terminal that is further connected to the panels grounding system.



Receptacles (All Accessible): Receptacle Inspection

Receptacles are visually inspected, and a representative number is tested in each room throughout the home with a polarity tester to confirm proper wiring. The inspector found no receptacle or wiring defects unless otherwise noted in this report.

Receptacles (All Accessible): GFCI Tested

The Inspector tests every accessible **Ground Fault Circuit Interrupter (GFCI)** (if present) using a receptacle tester to ensure the receptacle was wired correctly, trying to induce a trip or use the test button, and then resetting the receptacle. If any part of this test fails, we will report the defect in this report.

Switches & Lighting (All Accessible): Switches & Lighting

Switches and lighting are visually inspected and tested in each room throughout the home. The inspector found no receptacle or wiring defects at the time of the inspection unless otherwise noted in this report.

Limitations

Branch Wiring Circuits, Breakers & Fuses

LOW VOLTAGE WIRING NOT INSPECTED

Limitation Any low voltage systems in the home were not inspected and are excluded from this inspection. Including but not limited to: phone/telecom systems, cable coaxial systems, ethernet wiring, alarm systems, low voltage lighting and applicable wiring, etc.

Observations

9.3.1 Service Panel

ELECTRICAL PANEL KNOCKOUTS OPEN

MAIN PANEL

Safety Knockouts in the service panel were left open which allow for pests and rodents into the panel.

Recommend: knockouts are sealed to stop access to the interior panel.

Recommendation

Contact a qualified handyman.



Recommendation



9.3.2 Service Panel

WHITE WIRE CONNECTED TO CIRCUIT BREAKER

MAIN PANEL

White (neutral) wire connected to breaker indicates repurposed hot conductor, which may confuse identification and increase shock risk during servicing if not properly marked.


****Recommend:**** Confirm wire is re-identified for hot use with permanent marking (e.g., black or red tape) at both ends, or have corrected by qualified professional.

Recommendation

Contact a qualified professional.



Recommendation

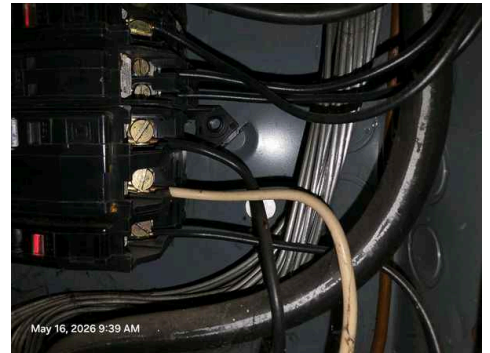

9.4.1 Branch Wiring Circuits, Breakers & Fuses

GROUND (NEUTRALS) DOUBLE TAPPED

MAIN PANEL

Safety Two grounded (neutral) conductors were noted under one lug on the bus bar which is not a recognized practice and could cause shock by allowing an isolated circuit to remain active.


Recommend: correction ensuring no more than one grounded (neutral) is installed under one lug which is an easy and inexpensive repair.

Recommendation

Contact a qualified electrical contractor.



Maintenance Item

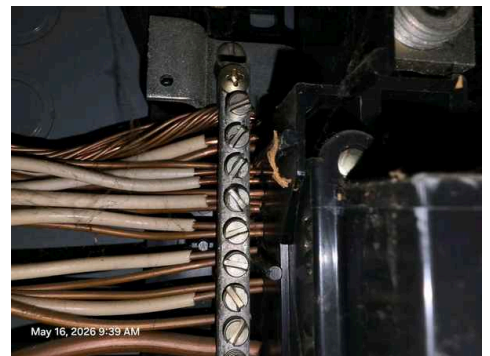

9.5.1 Receptacles (All Accessible)

JUNCTION BOX COVER MISSING - HIGHER

KITCHEN

Safety Noted junction boxes were missing cover plates in a location (i.e. on the ceiling or attic/crawlspace) which is not immediately accessible and is not a direct danger, yet should still be covered.


Recommend: installing cover plate.

Recommendation

Contact a qualified handyman.



Maintenance Item

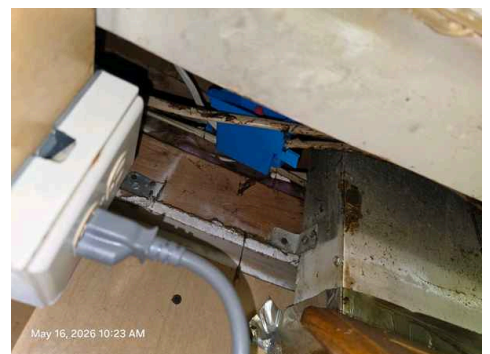

9.5.2 Receptacles (All Accessible)

RECEPTACLE LOOSE

VAROUS

Safety Receptacles noted with a blue sticker were loose; not all receptacles may be shown. Loose receptacles can eventually work wires loose over time becoming a shock hazard.

Recommend: all loose receptacles are secured.

Recommendation

Contact a qualified handyman.



Maintenance Item



9.5.3 Receptacles (All Accessible)

RECEPTACLE NOT HOLDING PLUG - MANY

THROUGHOUT

Many of the receptacles were not correctly holding the tester in the noted location(s); this condition will allow electric device plugs to dislodge when used.

Recommend: affected receptacles are replaced.

Recommendation

Contact a qualified electrical contractor.



Recommendation

9.5.4 Receptacles (All Accessible)

RECEPTACLE NOT INSTALLED

2ND FLOOR HALL BATHROOM

Safety Receptacle was not installed though the box and wires were present


Recommend: installation of receptacle and should be GFCI.

Recommendation

Contact a qualified electrical contractor.



Recommendation

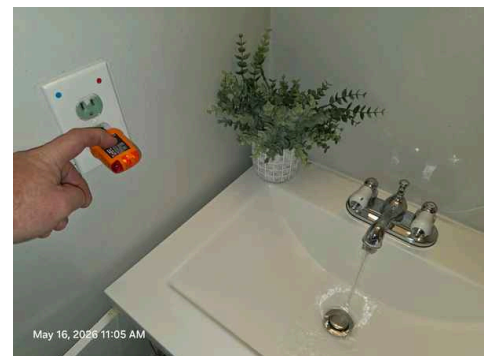

9.5.5 Receptacles (All Accessible)

RECEPTACLE PAINTED

VAROUS

Receptacle(s) were painted which made plugging in my test difficult; this condition will limit or impact the use by electrical devices.

Recommend: affected receptacles are replaced.

Recommendation

Contact a qualified electrical contractor.



Recommendation



9.6.1 Switches & Lighting (All Accessible)

LIGHT FIXTURE MISSING

BASEMENT UTILITY ROOM

Light fixture missing at ceiling electrical box leaves wiring and connections exposed, creating potential shock and fire hazard. Recommend: install approved fixture or properly cover electrical box with blank cover plate.

Recommendation

Contact a qualified professional.



10: PLUMBING

Information

Water Supply, Distribution System: Water Source Public	Water Supply, Distribution System: Water Service Material (External) Copper	Water Supply, Distribution System: Water Distribution Material (Internal) Copper
Water Supply, Distribution System: Main Shut Off Valve Home	Drain, Waste, & Vent System (DWV): DWV Material PVC	Hot Water Systems: Water Heater Manufacturer AO Smith
Hot Water Systems: Water Heater Capacity 50 gallons	Hot Water Systems: Water Heater Fuel / Power Source Electric	Fuel Storage, Distribution Systems, Combustion: Main Gas Shutoff Not Present

Water Supply, Distribution System: Water Supply & Distribution System

The Inspector will inspect *all visible water lines*, including the supply and distribution lines installed from the water meter to the residence. Valves are also visually inspected for current condition. The inspector assesses for acceptable pressure, looks for leaks, and ensures that cold and hot water lines are properly attached and not leaking.

Limitation Water valves are NOT operated during the inspection as issues could arise and cause leaking if manipulated during the inspection, especially on older valves.

Supply vs. distribution water lines: 1. supply, the main conduits that bring water from the municipal supply (meter) or other external sources (well) into a residence. 2. distribution, the network of smaller pipes that distribute water from the supply line to various fixtures within the residence (e.g., sinks, toilets, showers).

Water Supply, Distribution System: Pressure Reducing Valve (PRV)

A pressure reducing valve (PRV) was present on the water system for this home which is a control valve that reduces the input pressure of a fluid to a desired value at its output. On a home recommended pressure is 40-80 psi. Higher water pressures can damage fixtures and appliances. **If water pressure ever gets erratic, your PRV could be failing and it's recommended to check this valve first.*



Faucets: Faucets Inspected & Tested

A faucet (also known as a tap or spigot) is a specific type of fixture that controls the flow of water. A faucet is the part of a fixture (tub, shower, sink) that you turn on or off to release or stop the water flow.

Our inspection will turn on (if possible) and test each faucet and hose bibb (external faucet) for proper operation. Both hot and cold water are tested; pressure and flow rate are observed though not fully assessed. Any discrepancies will be noted in this report.

Sink, Shower, Tub Fixtures: Shower, Tub & Sink Inspected & Tested

Tubs, showers, and sinks were visually checked for proper installation, visual condition, operational flow, and functional discharge. These fixtures were tested for operational flow and functional drainage. No observable defects were noted at the time of the inspection unless otherwise noted in this report.

Toilet Fixtures: Toilet Fixtures Inspected & Tested

Toilet fixtures were visually checked for proper installation, visual condition, operational flow, and functional discharge. Each toilet was flushed a minimum of five times to ensure proper operation which includes being able to discharge the full contents of the bowl. No observable defects were noted at the time of the inspection unless otherwise noted in this report.

Hot Water Systems: Water Heater Estimated Age

3 years

Note The age of the water heater does not guarantee how the unit will function or for how long. Location of the water heater and condition at the time of the inspection also have an impact on the future function of the water heater.

Recommendation Flushing & servicing your water heater tank annually for optimal performance. Water temperature should be set to at least 120 degrees F to kill microbes and no higher than 130 degrees F to prevent scalding.

[Here is a maintenance guide.](#)


Hot Water Systems: Water Heater Tested

Multiple Locations, Hand Tested

Water heater was tested during the inspection (if operational). Hot water was verified at each supplied faucet or location, yet it was only visually shown in one or two areas for confirmation. Inspection only confirms that the water heater can heat water above ambient temperatures; water temperature can vary depending on settings. Unless otherwise noted in this report, the water heater was operational and provided heated water.

Hot Water Systems: Water Heater (Electric) Visually Inspected

The electric water heater inspection visually checks the overall condition looking for visible signs of rust, corrosion, or leakage on the tank and surrounding area, inspect the unit's data plate to verify its age and capacity, and ensure the water heater was installed according to acceptable building practices. Water supply connections are checked for secure fittings and proper material use, like copper or PEX for water lines. The power supply is checked for proper wiring and electrical conduits. The pressure relief valve, often a crucial safety component, would be visually assessed for proper installation and any signs of malfunction like dripping or discharge.

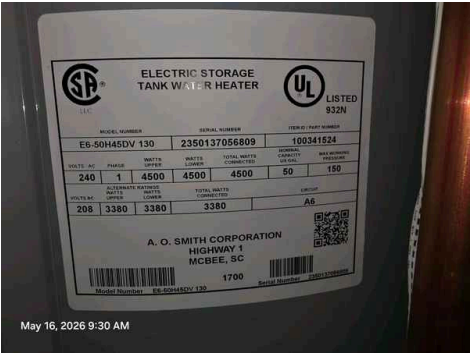

Hot Water Systems: Expansion Tank

A water heater expansion tank is another small tank that is attached to the water supply pipe of the water heater. The expansion tank is designed to handle the thermal expansion of water as it heats up in the water heater, preventing excessive water pressure. This is especially important for public water sources that have backflow preventers installed at the meter.



Fuel Storage, Distribution Systems, Combustion: Gas Connections

None

Gas connections are all the points noted and not of actual installed gas appliances. Gas connection points not in use should have a proper cap after the shutoff.

Fuel Storage, Distribution Systems, Combustion: Combustion Gas Sources

Wood Fireplace

Combustion gases (such as from spent natural/propane gas, or wood) release toxic compounds and can be present in the home air if not properly vented to the exterior of the home. The presence of these gases in household air can lead to problems ranging from nuisance headaches to serious illness, carbon monoxide (CO) poisoning and even death. The most problematic combustion gas is CO which is odorless and colorless, so homeowners may not be aware of the gas.

For this reason, the inspector wears a special device during the inspection to detect the presence of CO when gas appliances are tested; [Sensorcon](#) is an extremely sensitive CO detector. The CO levels in the home were measured during the inspection and found to be within acceptable levels unless otherwise noted in this report.

Washer Connections / Drain Pipe: Washer Connections Inspected and Tested

Washer valves, visible distribution pipes, drain pipe, and plumbing box (if installed) were visually inspected for proper installation and indications of leaking; valves were off. Hoses were present so the Inspector placed the hoses in the drain line and tested the valves. This test DOES NOT ensure not leaking as the hoses are not under pressure. After installation ensure the hoses are not leaking. Any discrepancies will be listed in the report.

Recommendation Use hoses with gaskets/seals and a properly looped drain line from the washer.

Continuously monitor both items for leaks and proper draining when using a washer, especially after the initial hook-up.

Limitations

Faucets

FROST FREE HOSE BIBB

Recommend Non frost hose bibbs were noted installed and are more prone to freeze causing possible leak issues. Recommend frost free hose bibbs are installed. *At a minimum, the hose bibbs need to be protected from the cold using a cover during freezing months.*

Sink, Shower, Tub Fixtures

TUB AND SINK OVERFLOW LIMITATIONS

Tub and sink overflows are not tested for functionality due to the very high likelihood the gaskets will leak. Care should be exercised in filling tubs to not allow water into the overflow. While they will likely drain away the bulk of water, some amount of leaking should be anticipated. As an improvement, a licensed plumber could check the gaskets and make repairs deemed necessary. Again, it should be assumed these overflows will not be water tight.

Observations

10.1.1 Water Supply, Distribution System

WATER LINE REVERSED - HOT / COLD

MASTER BATHROOM SINK

Cold and hot water distribution lines (either hose or hard plumbing) was reversed; still operational.

Recommend: cold and hot water lines are installed properly. *it's possible the faucet fixture/diverter might be able to be switched.

Recommendation

Contact a qualified plumbing contractor.



Recommendation



10.2.1 Drain, Waste, & Vent System (DWV)

FLEX WASTE DRAIN PIPE

1ST FLOOR BATHROOM

Flex drain lines tend to trap more debris and clog quicker and is not an authorized installation method or material.

Recommend: smooth drain pipes are properly installed.

Recommendation

Contact a qualified plumbing contractor.



Recommendation



10.3.1 Faucets

DIVERTER DEGRADED - TUB SPOUT

MASTER BATHROOM

Tub spout diverter did not fully engage and allowed water to run into the tub while engaging to the showerhead.


Recommend: repair or replace tub spout/diverter.

Recommendation

Contact a qualified plumbing contractor.



Maintenance Item

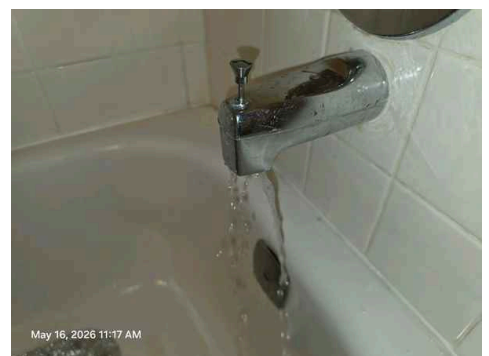

10.3.2 Faucets

HOSE BIBB ANTI-SIPHON MISSING

FRONT AND REAR EXTERIOR WALL

Outdoor hose bibb does not have an anti-siphon (vacuum breaker) which prevents unsanitary water from being pulled back through a garden hose and contaminating your water system; this is known as a cross-connection. Recommend installation of a anti-siphon equipped hose bibb.



Maintenance Item



10.4.1 Sink, Shower, Tub Fixtures

DRAIN STOP MISSING - TUB

2ND FLOOR HALL BATHROOM

Tub drain stop was missing, and therefore, the tub could not be tested for proper operation.

Recommend: *drain stop is replaced or installed.*

Recommendation

Contact a handyman or DIY project



Maintenance Item



10.4.2 Sink, Shower, Tub Fixtures

DRAIN STOP MISSING - TUB 2

MASTER BATHROOM

Tub drain stop was missing, and therefore, the tub could not be tested for proper operation.

Recommend: *drain stop is replaced or installed.*

Recommendation

Contact a handyman or DIY project



Maintenance Item



11: INTERIORS

Information

Walls / Ceilings: Walls & Ceilings Inspection

The Inspector will assess the general condition of the interior walls and ceilings by visually observing the structural integrity, general condition, moisture damage or indications of moisture issues, and notable damage. The Inspector is not looking for cosmetic and aesthetic issues such as nail holes, paint issues, or minor damage.

Floors Coverings: Floor Coverings

Carpet, Engineered Wood, Laminate, Wood

Visible portions of the floors throughout the home were inspected, looking for significant floor defects. The inspector is not reporting on aesthetic or cosmetic issues like scratches unless they are substantial. No reportable conditions were visibly present at the time of inspection unless otherwise noted in this report.

Floors Coverings: Carpet

Carpet flooring was noted installed; general wearing and condition is not noted as part of an inspection.

Floors Coverings: Laminite Flooring

Laminite flooring was noted installed in the home. This type of flooring is usually very durable yet cosmetic bubbling, raising and/or separating panels can occur over time as the flooring expands and contracts due to moisture in homes. Small areas will not be identified as small cosmetic areas are common in the laminate. However, if defective or severe problems are noted in areas, the Inspector will identify them in the report.

Floors Coverings: Wood Flooring

Wood flooring was noted installed; scratches or general wearing are not noted as part of an inspection, yet damage will be called out if present. Some areas which are covered and near windows/doors may have faded differently from the surrounding flooring. Recommend noting this during the final walkthrough.

Countertops, Cabinets, Vanities: Countertops & Cabinets Inspected

The cabinets and countertops were inspected looking for significant damage and by testing a representative number of doors and drawers evaluating their operation. No reportable conditions were present at the time of inspection unless otherwise noted in this report.

Ceiling Fan: Ceiling Fans Not Installed

Note No ceiling fans were installed the day of the inspection, and could not be inspected or tested.

Steps, Stairways & Balustrade: Type of Steps / Stairs Present

Staircase

Inspection of steps (if present) and stairs (internal, if present) typically includes a visual examination of the following: treads and risers, and landings. Steps and stairs are considered in operational working order unless otherwise noted in the report.

Steps, Stairways & Balustrade: Staircase & Balustrade Inspected

Inspection of staircases typically includes a visual examination of the following: treads and risers, landings; angle of the staircase; handrails; balustrade (handrails and balusters); lighting; and support. Staircases, handrails, and balustrades are considered in operational working order unless otherwise noted in the report.

Observations

11.2.1 Floors Coverings

FLOOR COVERING GAP

VAROUS 1ST FLOOR

Floor coverings have gaps between some connection points; likely due to floor movement or moisture changes. Floor coverings are still functional and gaps can be closed for aesthetic purposes.

Recommend: closing flooring gaps.

Recommendation

Contact a qualified flooring contractor



Maintenance Item

11.3.1 Countertops, Cabinets, Vanities

CABINET DAMAGED

KITCHEN

Cabinet was noted as damaged; cracked door.




Recommend: repair or replace door.

Recommendation

Contact a handyman or DIY project



Maintenance Item

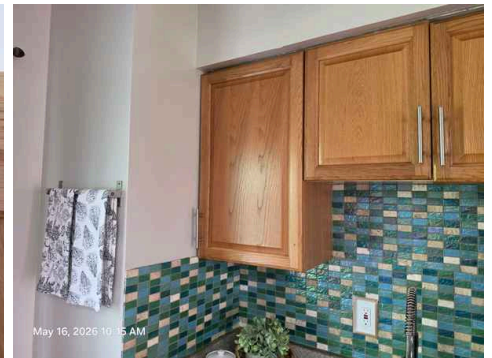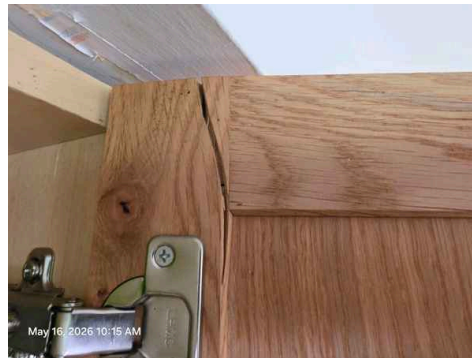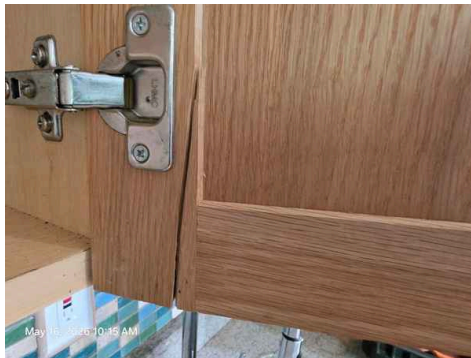

11.5.1 Steps, Stairways & Balustrade

STEPS / STAIRS HANDRAIL LOOSE

2ND FLOOR STAIRCASE

Handrail was loose at the time of the inspection.

Recommend: repairs by tightening.



Recommendation



11.5.2 Steps, Stairways & Balustrade

INTERIOR GUARD RAIL LOOSE

1ST FLOOR

Interior guard rail not firmly secured may fail to prevent falls, especially on elevated surfaces such as stairs or landings.

****Recommend:**** Secure guard rail to restore stability and maintain safety.



Recommendation



11.5.3 Steps, Stairways & Balustrade

INTERIOR GUARD RAIL LOOSE 2


2ND FLOOR HALL

Interior guard rail not firmly secured may fail to prevent falls, especially on elevated surfaces such as stairs or landings.

****Recommend:**** Secure guard rail to restore stability and maintain safety.



Recommendation

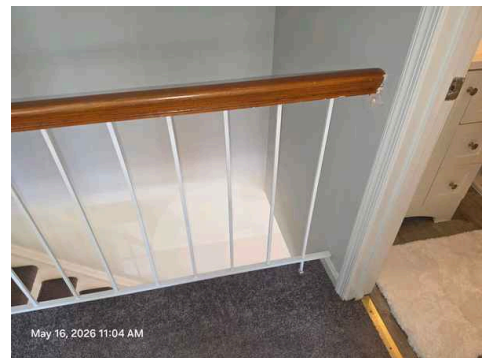

11.5.4 Steps, Stairways & Balustrade

OPEN RISERS ON INTERIOR STAIRS


2ND FLOOR STAIRCASE

Interior stairs have open risers that may allow objects or small children to fall through, creating a potential safety hazard.

****Recommend:**** Install riser enclosures or guards to reduce openings and improve safety.



Recommendation

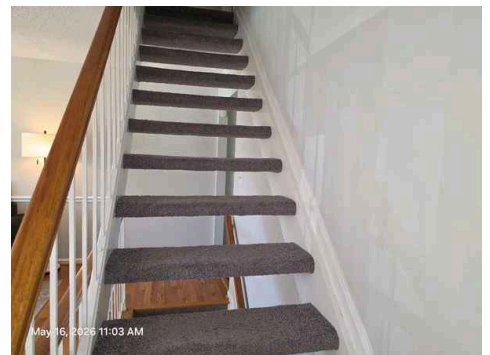

12: DOORS & WINDOWS

Information

Windows (All): Window Type

Double-hung, Vinyl, Double Pane

Exterior Doors: Exterior Door Inspection

Exterior doors differ from interior doors as they provide protection from the weather, increase energy efficiency, and provide security to the home. Doors are visually inspected for condition, fully tested for proper function, and hardware is tested including the deadbolt (if present). Unless otherwise noted in this report, the doors are in satisfactory condition.

Interior Doors: Interior Doors Inspected

All accessible interior doors were inspected by operating them ensuring they opened and closed properly, as well as latched properly without binding on jams or the floor. Any discrepancies present at the time of inspection will be noted in this report.

Windows (All): Windows Inspected and Tested

The windows were visually observed and tested by operating a representative number (I will try and operate every window in the home, but personal belongings may block accessibility to some). Windows tested for proper operability, along with visible signs of damage, broken glass, and failed seals. No reportable deficiencies were present unless otherwise noted in this report.

Limitations

Windows (All)

BLINDS/WINDOW DRESSINGS

Limitation Blinds and/or window dressings (if installed) are used during the inspection, yet are not considered a permanent fixture and are beyond the scope of a general home inspection.

Windows (All)

WINDOW SEAL FAILURE

Limitation Reporting on double pane glass seal failure is not required by the Standards of Practice. It lies beyond the scope of a home inspection, as glass may not show signs of seal failure at the time of inspection, but may become visible later due to changes in conditions. Desiccant material in the glass spacer can absorb moisture between the panes, masking seal failure. Also, changes in weather conditions (high humidity, etc.) may reveal seal failure that was not visible at the time of inspection. Seal failure is where the double pane glass loses its adhesion with the inner spacer, allowing moisture and debris between the glass panes. I will report on any insulated glass units showing signs of seal failure at the time of inspection, but this should not be relied upon as a complete listing of affected units. If glass seal failure is a concern, you are advised to seek the services of a window or glass repair contractor.

Observations

12.1.1 Exterior Doors

**SLIDING GLASS / SCREEN DOOR
DIFFICULT TO OPEN/CLOSE**

REAR BASEMENT

Sliding door was stiff to open/close and is likely caused by dirty and/or fouled wheels.

Recommend, consult with a door contractor for replacement.

Recommendation

Contact a handyman or DIY project



Recommendation



12.1.2 Exterior Doors

**SLIDING GLASS / SCREEN DOOR DOES
NOT LATCH**

REAR BASEMENT

Sliding door does not properly latch and/or lock due to hardware issues either on the door or on the frame.

Recommend: lock is repaired or replaced.

Recommendation

Contact a qualified handyman.



Maintenance Item



12.1.3 Exterior Doors

**SLIDING GLASS / SCREEN DOOR DOES
NOT LATCH 2**

REAR 1ST FLOOR

Sliding door does not properly latch and/or lock due to hardware issues either on the door or on the frame.


Recommend: lock is repaired or replaced.

Recommendation

Contact a qualified handyman.



Maintenance Item

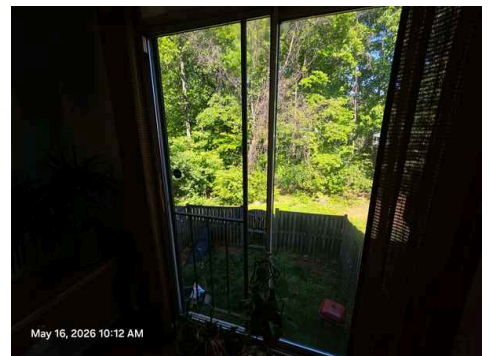

12.2.1 Interior Doors

INTERIOR DOOR RUBBING - FLOOR

2ND FLOOR FRONT RIGHT BEDROOM

Door was rubbing the floor and is causing slight damage.


Recommend: repair *repair can include planing the bottom of the door or by adjustment.

Recommendation

Contact a qualified handyman.



Recommendation

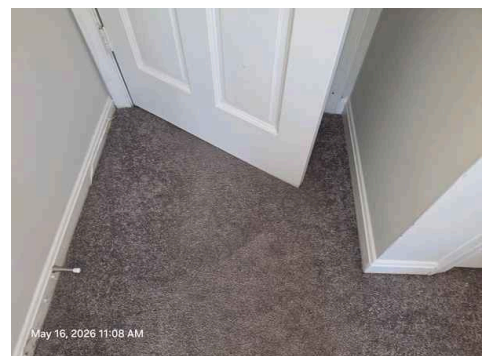

12.2.2 Interior Doors

**INTERIOR DOOR HARDWARE
DAMAGE**

2ND FLOOR FRONT LEFT BEDROOM

Door hardware is damaged and/or not functioning properly which is not allowing door to secure.

Recommend: door handle and/or latch is repaired or replaced.

Recommendation

Contact a handyman or DIY project



13: APPLIANCES

Information

Dishwasher: Dishwasher Brand Samsung	Range / Oven / Cooktop: Range/Oven/Cooktop Brand GE	Range / Oven / Cooktop: Energy Source Electric
Refrigerator: Refrigerator Brand Whirlpool	Garbage Disposal: Garbage Disposal Brand Unknown	Built-in Microwave: Microwave Brand GE
Washer & Dryer: Washer & Dryer Limited Inspection Washer Present, Dryer Present		

Dishwasher: Dishwasher Inspected & Tested

Dishwasher was visually inspected and run through a basic cycle to test for functionality. Testing does not guarantee cleaning ability or full capabilities of the unit. Any material defects will be noted in this report.



Range / Oven / Cooktop: Range/Cooktop/Oven Inspected & Tested

The unit was tested by turning on all the burners (electric or gas) on the highest function; the oven was turned on to 350 degrees to test operability. Any material defects will be noted in this report. ***Limitation*** Full cooking or capability are not gauged nor guaranteed by the test. *if concerned about full functionality, inquire with the seller, who should disclose any known issues.



Refrigerator: Refrigerator Inspection

If present, the refrigerator was inspected visually to ensure no major damage. Temperature check of the freezer and refrigerator was conducted to ensure temps are within norms and able to properly freeze/cool (if able). If installed the water/ice dispenser is tested for proper operation (if water provided). Water line to the fridge is checked for leaking and proper shutoff (if accessible). Any discrepancies and/or limitations will be listed in the report. **Full cooling and capabilities are not gauged nor guaranteed by the test. *if concerned about full functionality inquire with the seller who should disclose any known issues.**



Garbage Disposal: Garbage Disposal Inspected & Tested

The unit was visually inspected and tested (if possible) to determine if functional. Disposal was operational *unless* otherwise noted in the report. ***Full grinding or shredding ability was noted tested.**



Built-in Microwave: Microwave Inspected & Tested

Microwave was visually inspected and tested for proper installation and for basic operation. **Full cooking or capability is not gauged nor guaranteed by the test. *if concerned about full functionality inquire with the seller who should disclose any known issues.** Any material defects will be noted in this report.



Washer & Dryer: Washer & Dryer Visual Inspected & Tested

Washer and dryer are not considered permanent fixtures and are not part of standard home inspection; however, we go above and beyond and test the appliances when possible (if present). Washer was tested by running a basic cycle, ensuring unit functioned and drained. Dryer was tested by ensuring dryer functioned and produced heat.

Recommendation Full cleaning or drying capability as well as each type of cycle are not gauged nor guaranteed by the test. *if concerned about full functionality inquire with the seller who should disclose any known issues.

14: FINAL CHECKS

Information

Appliances: Dishwasher Canceled, Drained, Opened Completed	Appliances: Fridge On / Closed Completed	Appliances: Oven Off Completed
Appliances: Washer Canceled, Drained, Opened Completed	Plumbing: Tubs / Faucets Off Completed	Plumbing: Tubs Drained Completed
HVAC: HVAC Set to Original Condition Cooling Set, Completed	Door Locked: Front Door Locked Agent Present	Door Locked: Back Door Locked Agent Present
Door Locked: Side Door(s) Locked N/A	Door Locked: Garage Door Shut / Locked N/A	Door Locked: Realtor Box Locked Agent Present
Tool Check: All Tool Present Completed	Tool Check: Ladder In Vehicle Completed	
Plumbing: Water Meter Checked Covered Inspector attempts to discern the meter status at the end of the inspection. This helps in determining if there are leaks in the ground. However, if the meter is covered or the display does not turn on, it's impossible to know. We recommend if the inspector was unable to determine meter status at the end of the inspection to contact the water company to ensure no inground leaks.		