


Issue:


- o If the Linear Distributor Hook is not mounted levelly, then the auto teaching of the Distributor will not be accurate. This is because, when the Linear Distributor auto teaches, if the hook is slanted downward, then the Linear Distributor will falsely think that teach pin is higher than it is, as shown (exaggerated) in the drawing below:

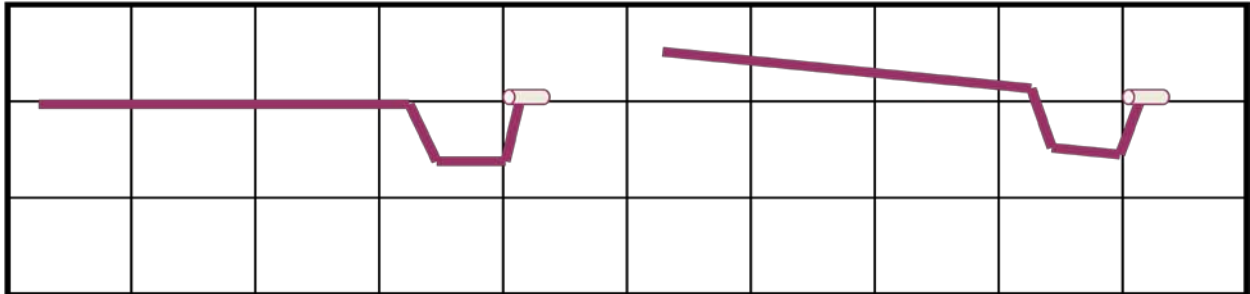


- o When the hook is mounted so that it is angled downward, then the z-axis will be taught too high. This effect is seen most frequently at the Chiller Ramp. The error will manifest as a Linear Distributor Theta Motor “Lost Some Steps” or “Step Loss” at the Chiller Ramp (positions 12-17, hex). This is because if the Distributor is taught too high, then as the Distributor rotates to pick the MTU out of the Chiller Ramp, the hook will clip the bottom of the MTU tab, causing the step loss.

Solution:


1. Power down the instrument and pull out the Service Drawer.
2. Manually move the Linear Distributor Head to all the way to the left.
3. Manually move the Linear Distributor Hook out as far as it will go.

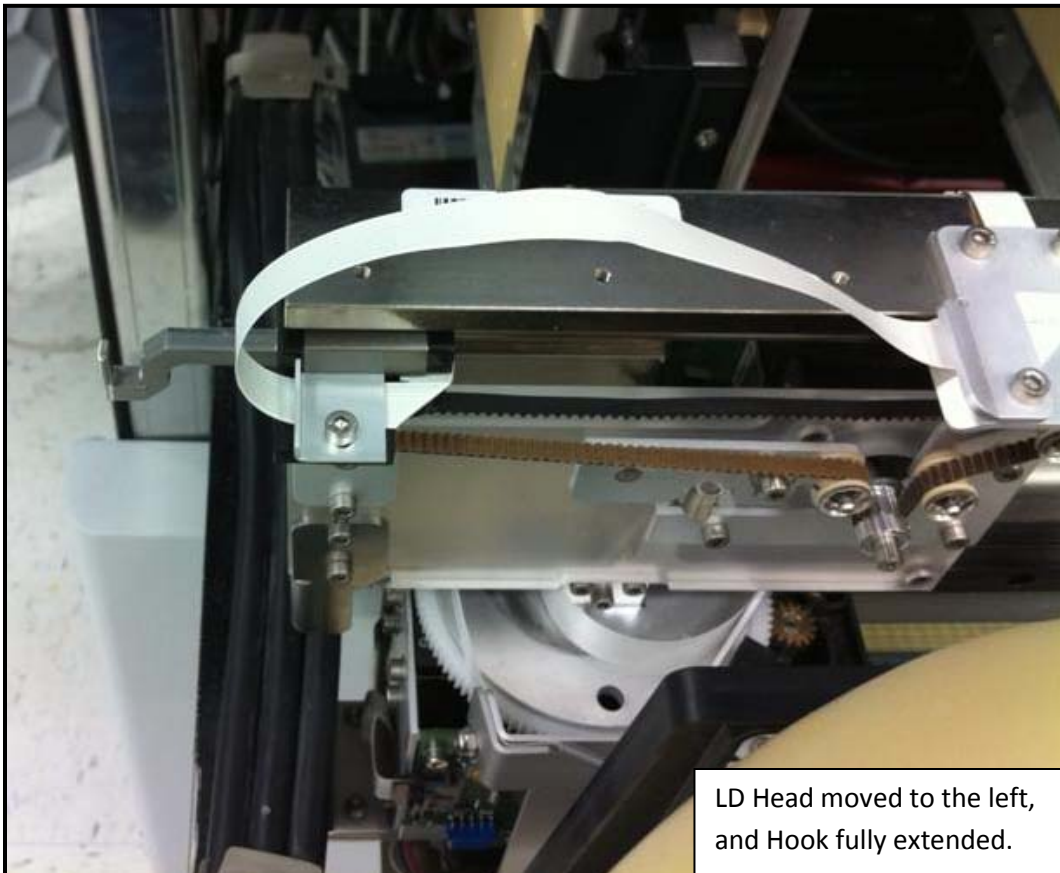

4. Using a Square (for example a block of small sticky notes), check the levelness of the Linear Distributor hook.

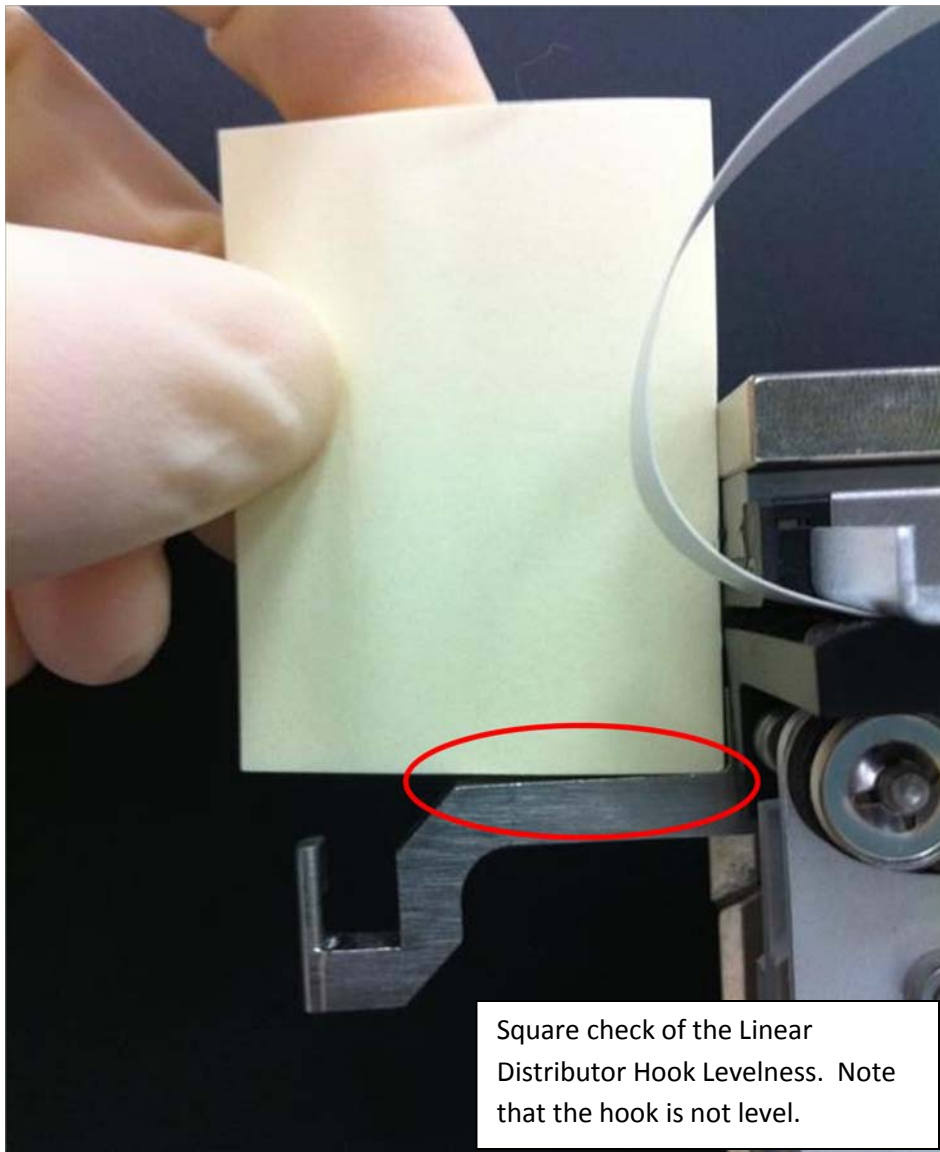


5. Adjust the hook levelness by loosening the two hook mounting screws.

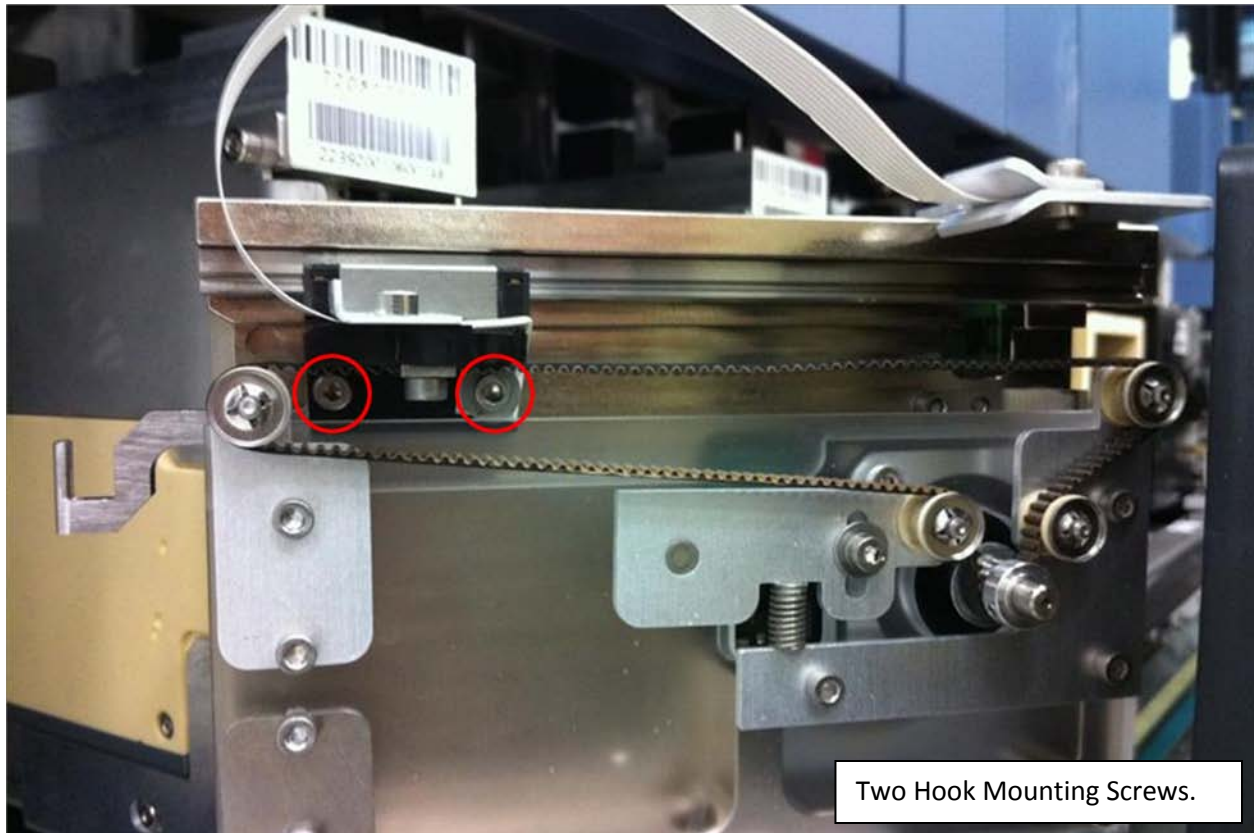


Two Hook Mounting Screws.

6. With the hook extended, push up in the middle of the 2 screws, and tighten the back screw.

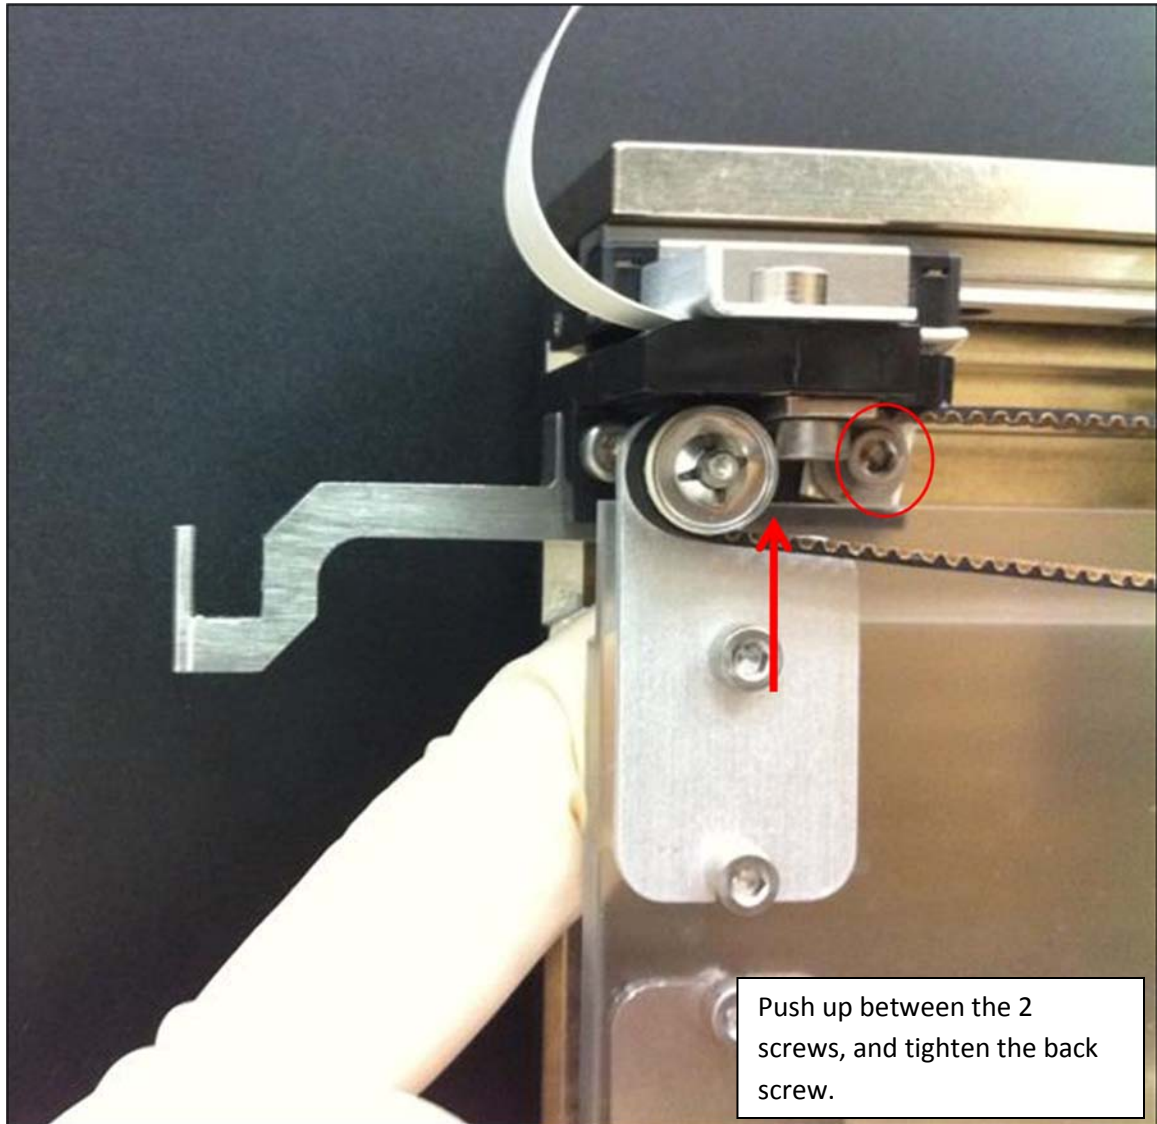

7. While continuing to push up in between the screws, push the hook in partially to allow access, and tighten the second screw.
8. Recheck the levelness of the hook.

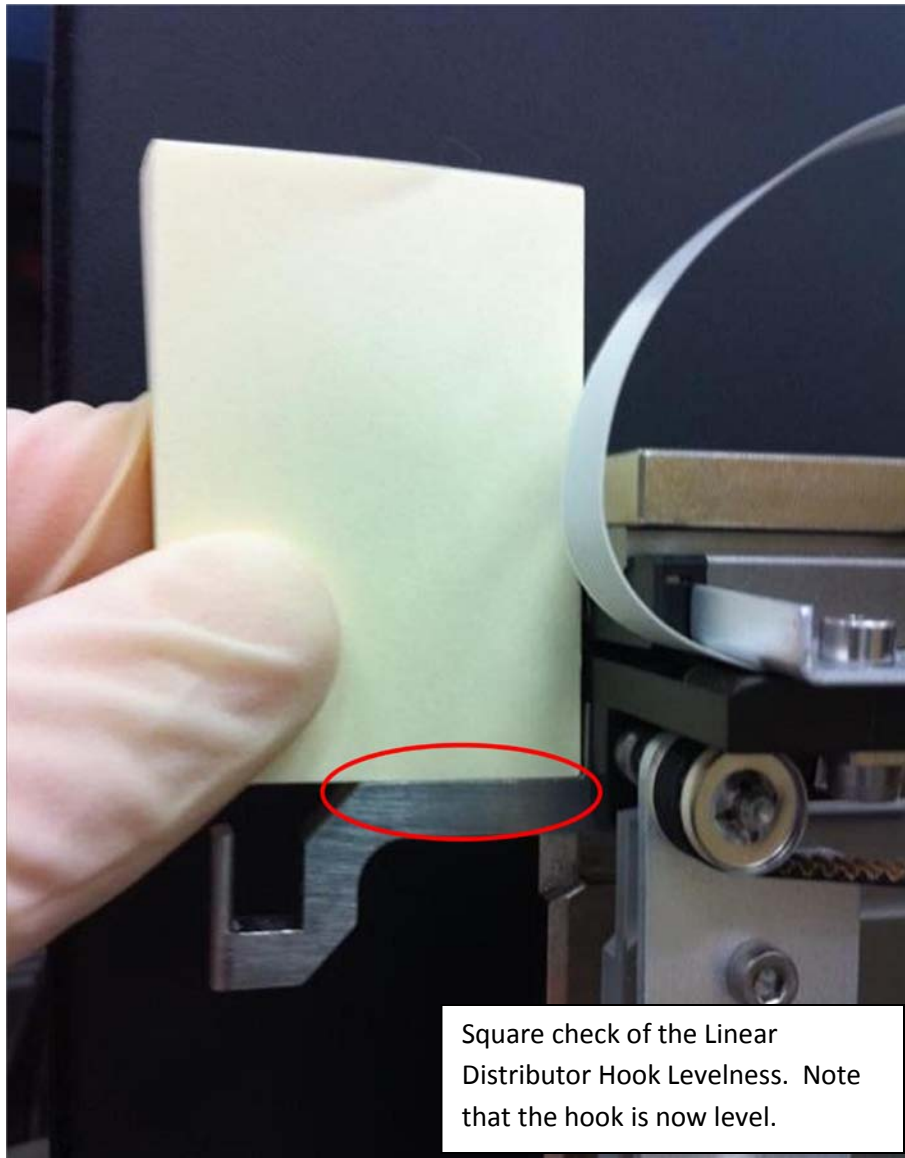

9. Reteach the Linear Distributor to all modules, starting with the Input Queue.
10. Run two OQs, and confirm no step losses.