


IMPORTANT: Read before Using

Purchased 2022 October, Amazon \$49.99 - David M

PREXISO® PLT40LI

RECHARGEABLE LASER & TAPE MEASURE

2-IN-1



135FT/40M
LASER

16FT/5M
TAPE

2 YEARS LIMITED
WARRANTY

www.prexiso-eu.com

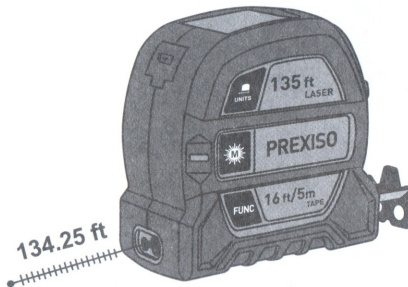


Table of Contents

Safety Instructions	1
Instrument Set-up	2
Overview	2
Display	2
Battery Charging	2
Operations	3
Switching ON/OFF	3
Measuring single distance	3
Continuous measuring	3
Unit setting	4
Measurement reference changing	4
Area	4
Volume	4
Pythagoras (2-point)	5
Pythagoras (3-point)	5
Technical Data	6
Troubleshooting	6
Care	6
Disposal	6
Warranty	6
Safety Instructions	7
Symbols used	7
Permitted use	7
Prohibited use	7
Hazards in use	7
Limits of use	7
Areas of responsibility	8
Electromagnetic Compatibility (EMC)	8
FCC statement (applicable in U.S.)	8
Laser classification	8

Safety Instructions

Retract Tape Measures Slowly

Guide the tape back to retract it slowly in a controlled manner when you finish measuring. The quick return of the tape might damage the blade and blade control mechanism. To minimize injury, slowly retract metal blade tape, keeping fingers away from edges.



Do not use the product before you have studied the User Manual on the enclosed CD or on our Homepage.

If you have no such manual, or it is in the wrong language, please ask your agency for an appropriate copy.

The product is permitted to use for skilled persons only.



CAUTION:

Use of controls or adjustment or performance of procedures other than those specified herein may result in hazardous radiation exposure



WARNING:

- It is a **Class 2** laser product in accordance with IEC 60825-1:2014



- Do not attempt to modify the performance of this laser device in any way. This may result in a dangerous exposure to laser radiation.
- Do not operate the tool outdoors.
- Do not attempt to repair or disassemble the laser-measuring tool. If unqualified persons attempt to repair this product, serious injury may occur. Any repair required on this laser product should be performed only by qualified service personnel.
- Do not stare into the laser beam or direct it towards other people unnecessarily.
- Don't dazzle other individuals.
- Looking directly into the beam with optical aids can be hazardous.
- Do not operate the product in explosion hazardous areas or in aggressive environments.
- Only use chargers recommended by the manufacturer to charge the batteries.
- Keep extremities in a safe distance from the moving parts.
- Watch out for erroneous measurements if the product is defective or if it has been dropped or has been misused or modified.
- Carry out periodic test measurements. Particularly before, during and after important measurements.
- The product and batteries must not be disposed of with household waste.


Instrument Set-up

Overview




The safety instructions and the user manual should be read through carefully before the product is used for the first time.


The person responsible for the product must ensure that all users understand these directions and adhere to them.

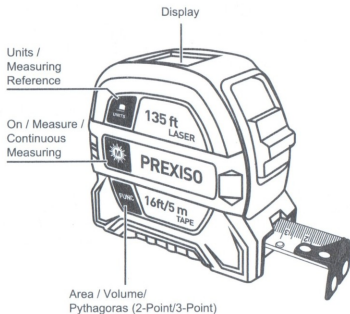


Display

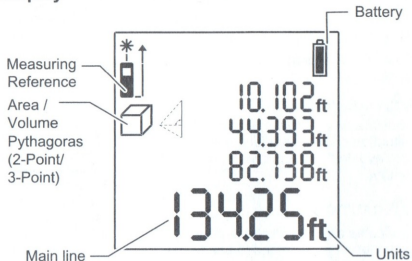

Battery Charging

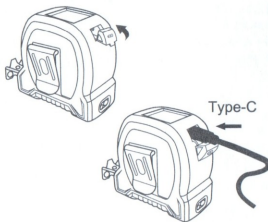

Charging the device when battery symbol is empty.

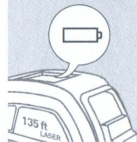

Operations

Switching ON/OFF



ON



OFF

5 sec

Device is turned OFF.



If no key is pressed for 120 sec, the device switches off automatically.

Measuring single distance



2



Aim active laser at target.



Target surfaces: Measuring errors can occur when measuring to colourless liquids, glass, styrofoam or semi-permeable surfaces or when aiming at high gloss surfaces. Against dark surfaces the measuring time increases.

Continuous Measuring



3 Sec

2



Aim active laser at target.



Target surfaces: Troubleshooting can occur when measuring to colourless liquids, glass, styrofoam or semi-permeable surfaces or when aiming at high gloss surfaces. Against dark surfaces the measuring time increases.

Unit setting



Switch between the following units:

0.000 m
0.00 ft
0 1/16 in
0'00" 1/16

Measurement reference changing

1


The system default measurements start at the bottom as a reference point.



2



Press button to change the reference to top for measurement.



Area

1



2



Aim laser at first target point.

3



4



Aim laser at second target point.

5




i

The result is shown in the main line and the measured distance above.

Volume

1



2



Aim laser at first target point.

3



4



Aim laser at second target point.

5



6



Aim laser at third target point.



7

i

The result is shown in the main line and the measured distance above.



Pythagoras(2-point)




1




2

Aim laser at first target point.

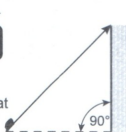


3

Aim laser at second target point.

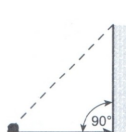

4

The result is shown in the main line and the measured distance above.



Pythagoras(3-point)




1




2

Aim laser at first target point.



3

Aim laser at second target point(Perpendicular to the measuring surface).




4

Aim laser at third target point.



5

The result is shown in the main line and the measured distance above.





HIGH ACCURACY

With Swiss ASIC Measuring Technology

Consistent Precise Measurement

Longer Working time

Reliable Durability



EXTRA LARGE DISPLAY

General

Range with favourable conditions *	1.15-135ft 0.35-40m
Accuracy with favourable conditions *	±1/8in ±3mm
Smallest unit displayed	1/16in 1 mm
Laser class	2
Laser type	620-690 nm, < 1 mW
Power OFF automatically	after 120 s
Continuous measuring	yes
Dimension (H x D x W)	3.35 x 3.35 x 1.7 in 85 x 85 x 43 mm
Battery durability	up to 5000 measurements
Weight (with batteries)	13.4 oz 380 g
Temperature range:	
- Storage	14 to 140 °F -10 to 60 °C
- Operation	32 to 104 °F 0 to 40 °C

* The typical measurement uncertainty of ±3 mm is valid for measurements on white, diffusive, reflective targets up to 10m at low ambient light and moderate temperatures. For distances greater than 10 m, the measurement uncertainty could increase additionally by 0.1 mm/m. In unfavourable conditions (such as bright sunlight, targets with poor reflectivity, or high or low temperatures) the measurement uncertainty could further increase up to ±6mm for distances below 10 m.

Troubleshooting

Potential issue table

ISSUE	CAUSE	ACTION
Failure to switch on	Hardware protection after shocking	Restart the device
	Low battery	Recharge the device
	Insufficient On/Measure/Units button press	Press the On/Measure/Units button firmly
IC000 IC255	Beam is moved too fast	Move the measuring tool slowly
	The object is out of rated range	Measure within rated range
	Received signal too weak Measuring time too long	Change target surface (e.g. white paper)
	Received signal too strong (target is too reflective)	Change target surface (e.g. white paper)
	Ambient light is too strong	Shadow target area
IC301	Running program is not in a proper way	Restart in a proper way by the instructions of manual
IC401	Hardware problem	Restart the device. If not work, contact a local dealer

Care

- Clean the device with a damp, soft cloth.
- Never immerse the device in water.
- Never use aggressive cleaning agents or solvents.

Disposal



Flat batteries must not be disposed of with household waste. Care for the environment and take them to the collection points provided in accordance with national or local regulations. The product must not be disposed with household waste.

Dispose of the product appropriately in accordance with the national regulations in force in your country. Adhere to the national and country specific regulations. Product specific treatment and waste management can be downloaded from our homepage.



Warranty

Two-Year Limited Warranty. This product is warranted to the original purchaser from the original purchase date for two years subject to the warranty coverage described herein. Please retain your receipt. This product is warranted to the original user to be free from defects in material and workmanship. If you believe that the product is defective at any time during the specified warranty period, please contact Prexiso customer service agent by sending email to info@prexi-so-eu.com. This warranty does not cover: (1) Part failure due to normal wear or product abuse; (2) Any parts have been altered or modified by anyone other than an authorized Prexiso personnel or failure to install and operate equipment according to the guidelines put forth in the instruction manual. (3) Any products or parts used for rental purposes, damage resulting from shipping (claims must be filed with freighter), accident, abuse, act of God, misuse, or neglect. Prexiso will replace or repair the defective unit, at its option, subject to verification of the defect.

Safety Instructions

The person responsible for the instrument must ensure that all users understand these directions and adhere to them.

Symbols used

The symbols used have the following meanings:

WARNING

Indicates a potentially hazardous situation or an unintended use which, if not avoided, will result in death or serious injury.

CAUTION

Indicates a potentially hazardous situation or an unintended use which, if not avoided, may result in minor injury and/or appreciable material, financial and environmental damage.

 Important paragraphs which must be adhered to in practice as they enable the product to be used in a technically correct and efficient manner.

Permitted use

- Measuring distances

Prohibited use

- Using the product without instruction
- Using outside the stated limits
- Deactivation of safety systems and removal of explanatory and hazard labels
- Opening of the equipment by using tools (screwdrivers, etc.)
- Carrying out modification or conversion of the product
- Use of accessories from other manufacturers without express approval
- Deliberate dazzling of third parties; also in the dark
- Inadequate safeguards at the surveying site (e.g. when measuring on roads, construction sites, etc.)
- Deliberate or irresponsible behaviour on scaffolding, when using ladders, when measuring near machines which are running or near parts of machines or installations which are unprotected
- Aiming directly in the sun

Hazards in use

WARNING

Watch out for erroneous measurements if the instrument is defective or if it has been dropped or has been misused or modified. Carry out periodic test measurements. Particularly after the instrument has been subject to abnormal use, and before, during and after important measurements.

CAUTION

Never attempt to repair the product your-self. In case of damage, contact a local dealer.

WARNING

Changes or modifications not expressly approved could void the user's authority to operate the equipment.

Limits of use

 Refer to section "Technical data". The device is designed for use in areas entirely habitable by humans. Do not use the product in explosion hazardous areas or in aggressive environments.

Safety Instructions

Areas of responsibility

Responsibilities of the person in charge of the instrument:

- To understand the safety instructions on the product and the instructions in the User Manual.
- To be familiar with local safety regulations relating to accident prevention.
- Always prevent access to the product by unauthorised personnel.

Electromagnetic Compatibility (EMC)

WARNING

The device conforms to the most stringent requirements of the relevant standards and regulations. However, the possibility of causing interference in other devices cannot be totally excluded.

FCC statement (applicable in U.S.)


This equipment has been tested and found to comply with the limits for a Class B digital device, pursuant to part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference in a residential installation. This equipment generates, uses and can radiate radio frequency energy and, if not installed and used in accordance with the instructions, may cause harmful interference to radio communications. However, there is no guarantee that interference will not occur in a particular installation. If this equipment does cause harmful interference to radio or television reception, which can be determined by turning the equipment off and on, the user is encouraged to try to correct the interference by one or more of the following measures:

- Reorient or relocate the receiving antenna.
- Increase the separation between the equipment and receiver.
- Connect the equipment into an outlet on a circuit different from that to which the receiver is connected.
- Consult the dealer or an experienced radio/TV technician for help.

Laser classification

The device produces visible laser beams, which are emitted from the instrument: It is a Class 2 laser product in accordance with:

IEC60825-1 : 2014 "Radiation safety of laser products"



Laser Class 2 products:

Do not stare into the laser beam or direct it towards other people unnecessarily. Eye protection is normally afforded by aversion responses including the blink reflex.

WARNING

Looking directly into the beam with optical aids (e.g. binoculars, telescopes) can be hazardous.

CAUTION

Looking into the laser beam may be hazardous to the eyes.

Wavelength: 620 - 690 nm


Pulse duration: > 600ps

Maximum radiant output power





for classification: < 1 mW

Pulse repetition frequency: 320 MHz


Beam divergence: 0.16 mrad x 0.6 mrad



1x

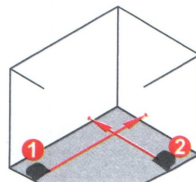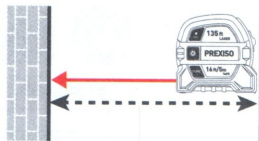




3 sec




3 sec



2x

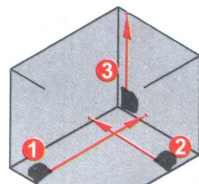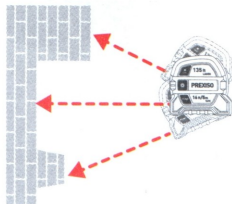



www.prexiso-eu.com



IEC/EN 60825-1: 2014
<1.0mW @ 620-690nm

Laser radiation. Do not stare into the beam.
Class 2 Laser product. Complies with 21
CFR 1040.10 and 1040.11 except for
conformance with IEC 60825-1 Ed. 3., as
described in Laser Notice No. 56, dated
May 8, 2019

PREXISO®






RECHARGEABLE
LASER & TAPE MEASURE

2-IN-1



135FT/40M
LASER

16FT/5M
TAPE

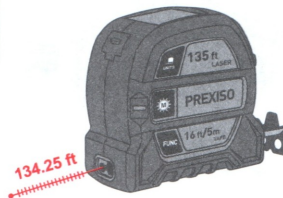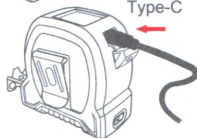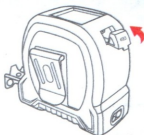

134.25 ft