Victa

DATE: 5/9/63

SERVICE BULLETIN NO. 13

THIS SERVICE BULLETIN SUPERSEDES ALERT SERVICE BULLETIN NO.A.12

SUBJECT: Redesigned tailplane to fuselage attachment fittings. MOD. NO. B.53

PURPOSE: To improve tailplane to fuselage rear attachment.

REASON: Cracking on the rear attachment brackets has occurred in service.

EQUIPMENT AFFECTED: All Airtourer 100 and 115 aircraft.

COMPLIANCE: Next 100 hourly inspection or failure of rear attachment brackets.

DETAILS: Rectification of the above fault has been achieved by redesigning the rear attachment brackets. Detailed below is method of attaching new brackets and reworking rear fuselage and tailcone to suit:-

(a) Remove fuselage to empennage fairing, tailcone, elevator and tailplane.

(b) In order to maintain the correct tailplane position during rework it is suggested that one of the following two methods be adopted before removing the tailplane rear attachments:-

(i) Place a block or wedge between the rear fuselage and the tailplane in the vicinity of the rear frame and the tailplane spar. See Fig. 1.

(ii) Make up a steel bracket to pick up between the top centre tooling hole in the rear frame and the hole in the elevator centre hinge bracket. See Fig. 1.

(c) Remove the tailplane rear attachment brackets Pt. Nos. 33014/1 and 2 and 20007/1 from rear frame of fuselage and tailplane.

(d) Refer to sheets 1 and 2 of drawing No. 03077 and rework rear fuselage and tailcone.

NOTE: Before drilling through tailplane attachment brackets to pick up with holes in tailplane, check tailplane alignment. Refer to Fig. 2. 'Alignment Check', Chapter 50 of Maintenance Manual.

(e) Replace tailplane, elevator, tailcone and fuselage to empennage fairing.

W A R N I N G: Following adjustment, overhaul, repair or replacement of any part of the flying control system — in this case the elevator — two independent inspections of the portion affected must be carried out and recorded prior to flight. The two inspections must be carried out independently by different persons licensed in the airframe category.

PARTS REQUIRED: Mod. Kit No. B.11/1, consisting of the following items:-

Part No.	Description	No. Off
03077/21	Doubler 4.6" x .75" x 16 swg (.064)	2
20031/3	Bracket, tailplane attachment - port	1
20031/4	Bracket, tailplane attachment - stbd.	1
20032/1	Packer	6
20033/1	Spacer	4
33047/1	Lug	4
30012/2	Spigot	2
AN4H5A	Bolt, 1/4 - 28 UNF - 3A	8
AN4-5A	Bolt, 1/4 - 28 UNF - 3A	8
AN4-6A	Bolt, 1/4 - 28 UNF - 3A	4
AN366F 1032	Nut plate No. 10 - 32	4
AN364-428	Nut, self locking, thin 1/4 - 28	8
AN960-10L	Washer No. 10	4
AN960-416L	Washer 1/4"	24
402/510	Rivet, 'Avdel' 5/32" dia.	20
TAP/K 220 BS	Rivet, 'Tucker Pop' csk. h'd. 3/32" dia.	6
TAP/K 329 BS	Rivet, 'Tucker Pop', csk. h'd. 3/32" dia.	8

PARTS REMOVED

Part No.	Description	No. Off
33014/1	Bracket, rear attachment - tailplane - port	1
33014/2	Bracket, rear attachment - tailplane - stbd.	1
20007/1	Bracket, fuselage pick-up - tailplane	2
33011/3	Bracket, longeron end - port	1
33011/4	Bracket, longeron end - stbd.	1
33012/1	Spigot, tailplane mounting	2

SPECIAL TOOLS REQUIRED: Nil

EFFECT ON WEIGHT AND C.G.: Nil

PUBLICATIONS AFFECTED: Maintenance Manual to be amended.

Victa

DATE: 5/9/63

SERVICE BULLETIN NO. 13

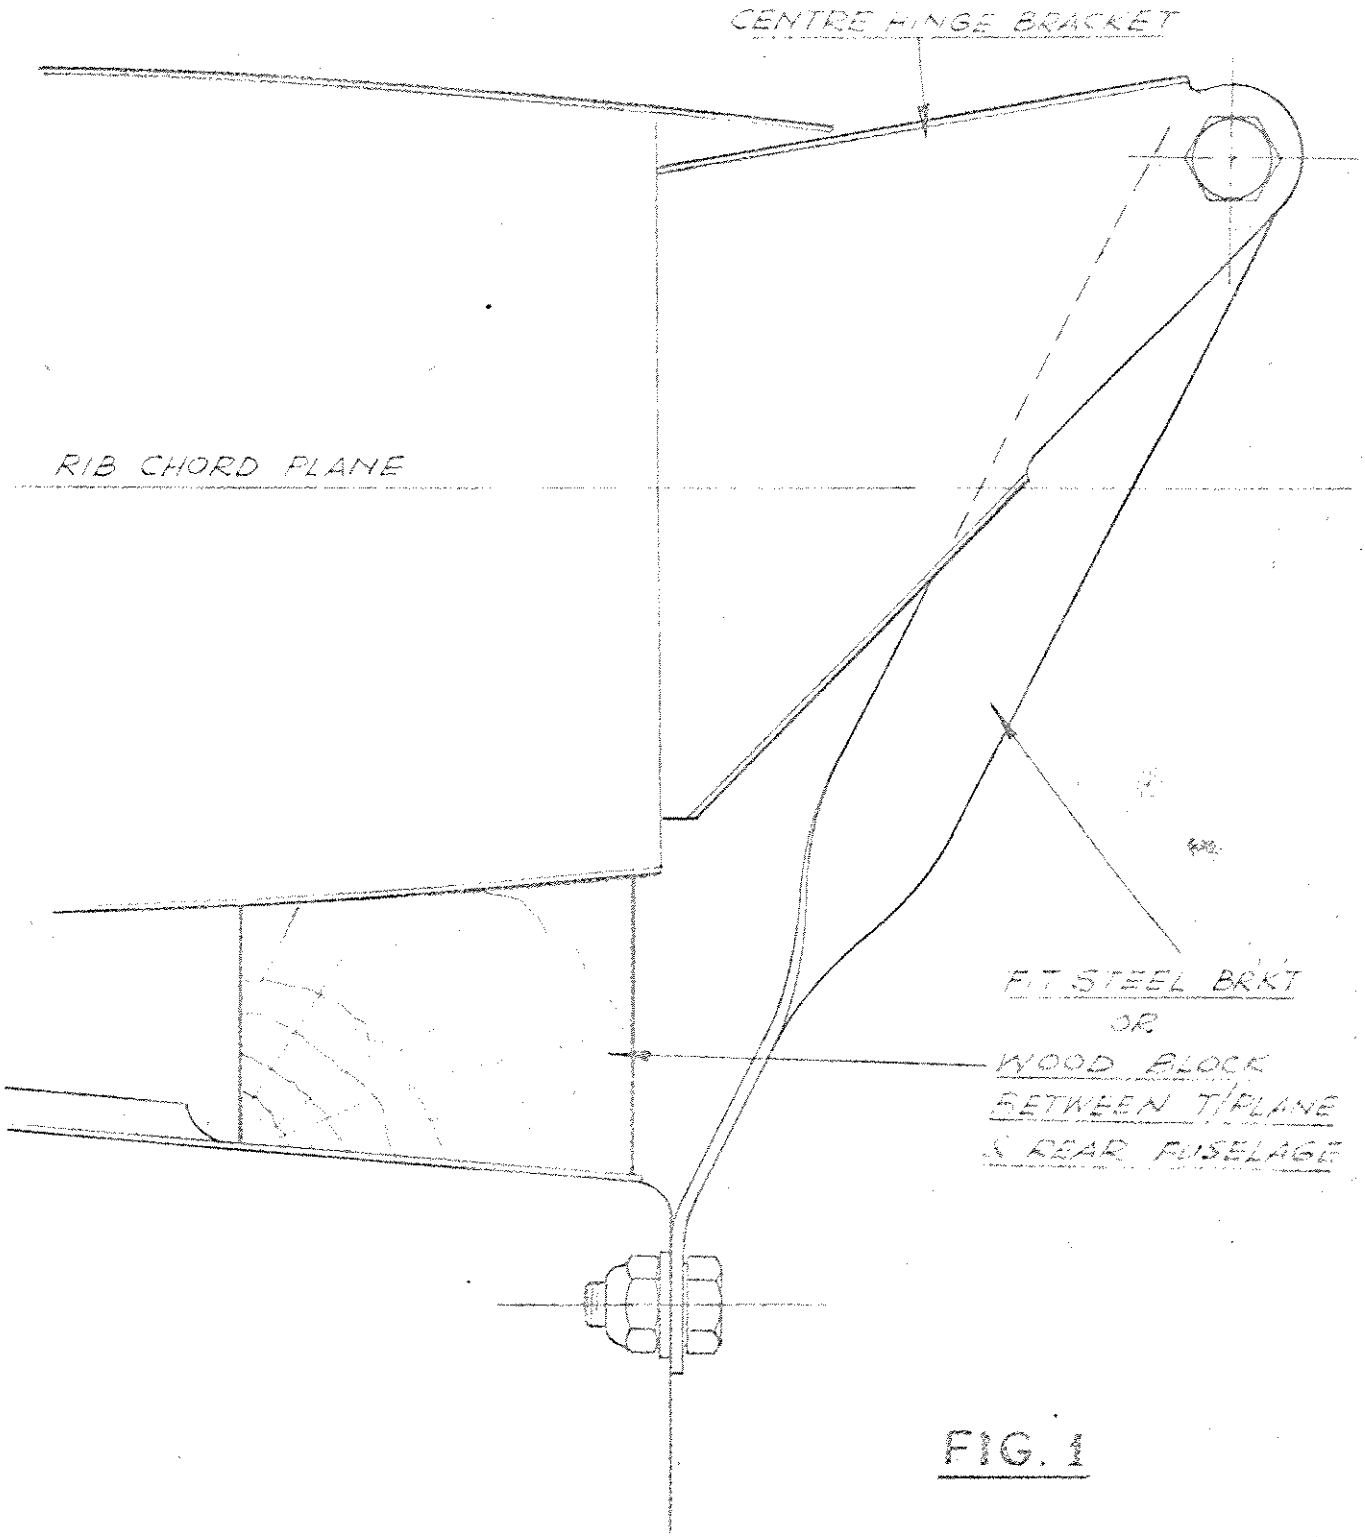

FIG. 1

AVIATION DIVISION HORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA.

Victa

DATE: 17/9/63

SERVICE BULLETIN NO. A.14.

ALERT SERVICE BULLETIN

SUBJECT: Mandatory inspection of main undercarriage legs

Until this Alert Bulletin is superseded by a Service Bulletin, inspect main undercarriage legs on all Airtourer aircraft having a total flying time exceeding 100 hours.

Cracking has occurred on upper outer edges of legs adjacent to the upper clamp plate. Inspection necessitates removal of leg and examination by magna-flux techique. Replace cracked components before next flight and return suspect legs to Service Department - Victa Limited, Aviation Division.

DATE: 20/9/63

SERVICE BULLETIN

NO. A.14
Issue 2.

ALERT SERVICE BULLETIN NO. A.14 AMENDED TO READ AS FOLLOWS:-

SUBJECT:

MANDATORY INSPECTION OF MAIN UNDERCARRIAGE LEGS

Until this Alert Bulletin is superseded by a Service Bulletin, inspect main undercarriage legs on all Airtourer Aircraft having a total flying time exceeding 200 hours before further flight, and thereafter at intervals not exceeding 100 hours.

Cracking has occurred on upper outer edges of legs adjacent to the upper clamp plate. Inspection necessitates removal of leg and examination by magna-flux technique. Replace cracked components before next flight and return suspect legs to Service Department - Victa Limited, Aviation Division.

DATE: 23/9/63

SERVICE BULLETIN NO. A.15

ALERT SERVICE BULLETIN

(confirmation of telegram dated 18th September, 1963)

Permit to fly will be granted by Regional Aircraft Surveyor, to all Airtourer aircraft, for purpose of flying to base for Magnaflux inspection of undercarriage legs if required. Authority D.C.A. N.S.W. region.

ALERT SERVICE BULLETIN

SUBJECT:

Aileron and Flapperon Drive Spigots

Immediate inspection of the drive spigot attaching rivets on the inboard ends of the ailerons and the outboard ends of the flapperons is advised. (Refer Detail A). If the rivets show signs of working then a further internal inspection of the spigot to determine the amount of penetration through the nose rib will be necessary before the next flight. A minimum of .10" total penetration of the spigot through the nose rib is required. (See detail A). (If no signs of working are apparent then further internal inspection can be deferred until the next 25 hourly inspection).

To accomplish internal inspection, drill a hole .50" dia. in upper surface of ailerons and flapperons as shown in Details B and C respectively, and with the aid of a flashlight ascertain degree of penetration of spigots. If penetration is less than .10" inform Victa Limited, Aviation Service Department and a new longer spigot will be despatched.

After inspection, cover hole with 28 swg. cover plate and rivet with Tucker 'Pop' rivets as shown in Detail D.

A11 10/4/67

Removal of working & inspection of Spigots on Crystal Gloss

SERVICE BULLETIN NO. A.16

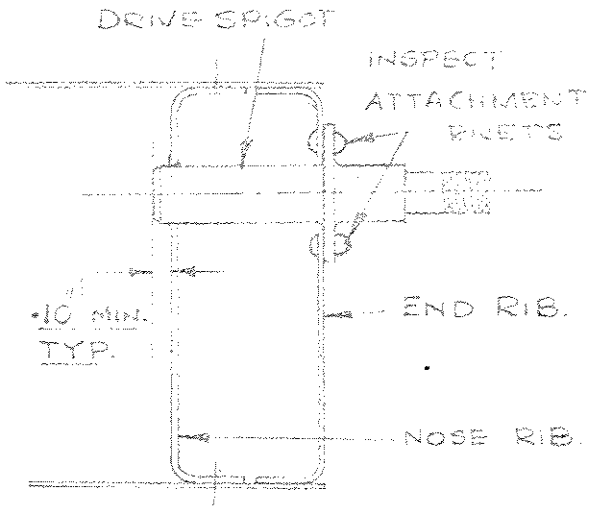

DETAIL 'A'

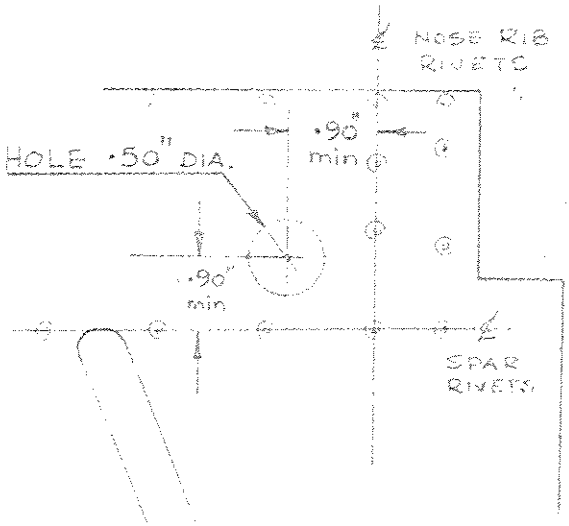

DETAIL 'B'

UPPER SURFACE OF AILERON.
(PORT SHOWN - STBD SIMILAR.)

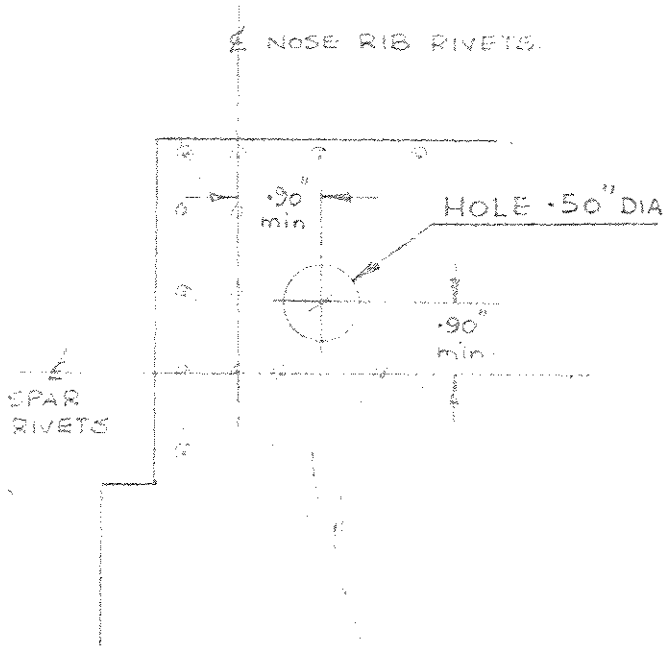

DETAIL 'C'

UPPER SURFACE OF FLAPPERON
(PORT SHOWN - STBD SIMILAR)

4 HOLES #30 (·128
TO SUIT TUCKER 'POP'
RIVETS. TLP/D
419 BS.

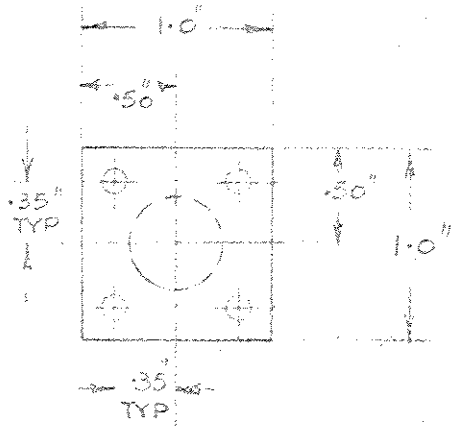

DETAIL 'D'

COVERPLATE - MAKE FROM
28 SWG AL. ALLOY SHEET.

Victa

DATE: 16/10/6

SERVICE BULLETIN NO. 17

SUBJECT: Deletion of rudder cable fairleads on rear fuselage. Mod. No. B.73.

PURPOSE: To give adequate clearance between rudder cables and fuselage skin.

REASON: Chafing between cable and nylatron fairlead due to incorrect position of hole in fairlead has occurred in service.

EQUIPMENT AFFECTED: All Airtourer 100 and 115 aircraft.

COMPLIANCE: Next 25 hourly inspection.

DETAILS: Remove Nylatron fairlead and if necessary enlarge cut-out in rear fuselage skin to give a minimum of .25" clearance around rudder cable. If enlarging of cut-out interferes with doubler plate attachment rivets, remove doubler plate and replace with larger one to suit enlarged cut-out. If fitment of a new doubler plate is necessary, it is advisable to split the doubler plate rather than disturb the rudder cable and necessitate a dual control inspection.

PARTS REQUIRED: Nil

PARTS REMOVED: Pt. No. 52028/1 - fairlead - 2 off

SPECIAL TOOLS REQUIRED: Nil

EFFECT ON WEIGHT AND C.G.: Nil

PUBLICATIONS AFFECTED: Nil

AVIATION DIVISION HORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA.

WIGTA

DATE: 16/10/63

SERVICE BULLETIN NO. 17

SUBJECT: Deletion of rudder cable fairleads on rear fuselage. Mod. No. B.73.

PURPOSE: To give adequate clearance between rudder cables and fuselage skin.

REASON: Chafing between cable and nylatron fairlead due to incorrect position of hole in fairlead has occurred in service.

EQUIPMENT AFFECTED: All Airtourer 100 and 115 aircraft.

COMPLIANCE: Next 25 hourly inspection.

DETAILS: Remove Nylatron fairlead and if necessary enlarge cut-out in rear fuselage skin to give a minimum of .25" clearance around rudder cable. If enlarging of cut-out interferes with doubler plate attachment rivets, remove doubler plate and replace with larger one to suit enlarged cut-out. If fitment of a new doubler plate is necessary, it is advisable to split the doubler plate rather than disturb the rudder cable and necessitate a dual control inspection.

PARTS REQUIRED: Nil

PARTS REMOVED: Pt. No. 52028/1 - fairlead - 2 off

SPECIAL TOOLS REQUIRED: Nil

EFFECT ON WEIGHT AND C.G.: Nil

PUBLICATIONS AFFECTED: Nil

VICTA

DATE: 19/11/63

SERVICE BULLETIN NO. 19

SUBJECT: Rudder cable tension

PURPOSE: Assist in the reduction of wear on cables

REASON: To increase cable and pulley life

EQUIPMENT AFFECTED: Airtourer 100 and 115

COMPLIANCE: Next 25 hourly inspection.

DETAILS: Reduce tension on rudder cables from 90 lbs. to 50 lbs.

W A R N I N G

Following adjustment of tension, re-lock rudder control cables and carry out two independent inspections of the portion of the control system affected, prior to the next flight.

The two inspections must be carried out independently by different persons licensed in the airframe category.

PARTS REQUIRED: Nil

PARTS REMOVED: Nil

SPECIAL TOOLS REQUIRED: Nil

EFFECT ON WEIGHT AND C.G.: Nil

PUBLICATIONS AFFECTED: Maintenance Manual, Chapter 13, para. 11c. Amend 90 lbs. to read 50 lbs.

D. C. A. APPROVED

AVIATION DIVISION HORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA

VICTA

DATE: 20/10/65

SERVICE BULLETIN

NO. 20
Issue 3

In accordance with Air Navigation Order DCA/VAT/10A this Service Bulletin supersedes and cancels Bulletin No. 20 Issue 2.

SUBJECT: Replacement of main undercarriage attachment bolts.

PURPOSE: As a precaution to ensure safety of main undercarriage.

REASON: Two accidents caused by bolt failure and many washers have been found dished and bolts loose.

AEROPLANES AFFECTED: All Airtourer 100 and 115 aircraft.

REQUIREMENTS:

(a) Inspect the 7/16" main undercarriage attachment bolts to ensure that they are not threadbound or loose and that the washers P/N 61026 are not dished. Replace loose bolts or defective washers.

(b) Replace the 7/16" main undercarriage attachment bolts with new bolts.

COMPLIANCE: Para. (a) At intervals not exceeding 100 hours flight time.

Para. (b) At intervals not exceeding 200 hours flight time.

Bolts already exceeding 200 hours flight time shall be replaced within the next 10 hours flight time. (Tighten bolts to 450-500 in. lbs.)

PARTS REQUIRED: AN7H11A - 7/16 - 20UNF-3A Bolt - 2 off.
P/N 61026 Washer - 2 off.

PARTS REMOVED: as Parts Required.

SPECIAL TOOLS REQUIRED: Nil

EFFECT ON WEIGHT & C.G: Nil

PUBLICATIONS AFFECTED: Nil

LABOUR INVOLVED: 1.0 hours.

DISTRIBUTION: 2 (c) General. (Ref. S/B 50)

D.C.A. Approved.

AVIATION DIVISION HORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA.

DATE: 28/11/63

SERVICE BULLETIN NO. A.21

ALERT BULLETIN

SUBJECT: MANDATORY INSPECTION OF FUEL TANK VENT HOSE

Inspect the fuel tank vent hose between the fuel tank filler neck and the seat back frame before the next flight.

Check that the polyurethane foam lining in the fuselage wall is grooved to take the vent hose, check also that the hose runs within this groove with maximum possible bend radii.

Check for kinks in the hose that could cause the line to be blocked.

Check for adequate clearance between vent hose and safety harness anchor straps.

Engine failure has occurred in service due to fuel starvation caused by lack of fuel tank venting.

Victa

DATE: 10.12.6

SERVICE BULLETIN NO. 22.

SUPERSEDES ALERT BULLETIN NO. A.14

SUBJECT: New main undercarriage legs and attachment clamps. Service life of main leg extended to 1000 hours.

PURPOSE: To over come cracking at attachment of undercarriage legs.

REASON: Cracking due to localised clamping loads has occurred on main legs in service and this bulletin is issued as a result of the several tests carried out thereafter.

EQUIPMENT AFFECTED: Airtourer 100 and 115 (all aircraft).

COMPLIANCE: This is not a mandatory requirement and can be carried out at the operator's convenience. However, until such time as the new legs and new clamp plates are fitted, the operator must comply with Alert Bulletin No. A.14 and inspect at intervals not exceeding 100 hours.

The 7/16" dia. bolt securing the main leg to the wing structure must be replaced every 500 hours as required by Service Bulletin No. 20, (not applicable to aircraft Nos. 1 - 5, inclusive).

The 3 off bolts (aircraft 6 and subsequent)
The 5 off bolts (aircrafts 1 through to 5) } - attaching the main leg to the wing are to be check tightened after the first 100 hours and thereafter at 200 hour intervals to the torque values quoted in the Maintenance Manual.

DETAILS: Aircraft Nos. 1 - 5 inclusive

Remove wheel and brake assemblies.

Remove and discard main undercarriage legs and attaching parts.

Fit new undercarriage legs Part No. 61002/2, new attachment clamps Part Nos. 61016/1 and 61019/1, and new nuts, bolts and washers.

Refit wheel and brake assemblies (see fitting note).

Aircraft Nos. 6 - 26 inclusive

Remove wheel and brake assemblies.

Remove and discard main undercarriage legs and attaching parts.

Before fitting new legs fit shear plate Part No. 03080/21 as indicated on drawing 03080.

Fit new undercarriage legs Part No. 6102/2, new attachment clamps Part Nos. 61022/1 and 61024/1 and new nuts, bolts and washers.

Refit wheel and brake assemblies (see fitting note).

DETAILS (Cont'd).

Aircraft Nos. 27 and subsequent

As for 6 - 26 except that, before fitting new upper clamp plates it will be necessary to machine bosses flush with shear plate (refer to drawing 03080).

FITTING NOTE - All aircraft

When fitting lower clamp plate, gradually tighten up bolts (nuts in case of aircraft 1 - 5), until the clamp plate just engages the lower surface of the leg. With the lower clamp plate unbowed check that the clearance between the upper and lower clamps is between .010" - .020" at each end. If the clearance is greater than this figure make up difference by fitting washers between clamp plates. When this figure has been achieved tighten up both ends of clamp plate to torque load of 216 - 240 in. lbs.) This will give a .010" - .020" arc on lower clamp.

Torque loading of main attachment bolt is 450 - 500 in. lbs. for all aircraft.

PARTS REQUIRED:

Part No.	Description	No. Off	Applicability
61002/2	Main undercarriage leg	2	All aircraft
61016/1	Upper clamp plate assembly	2	A/c. 1 - 5 incl.
61019/1	Lower clamp plate assembly	2	A/c. 1 - 5 incl.
61022/1	Upper clamp plate assembly	2	A/c. 6 and subs.
61024/1	Lower clamp plate assembly	2	A/c. 6 and subs.
03080/21	Shear plate	2	A/c. 6 and subs.
AN7-H-11A	Bolt, main leg, attachment	2	A/c. 6 and subs.
AN960-716L	Washer	2	A/c. 6 and subs.
AN365-720	Nut, main leg attachment	2	A/c. 1 - 5 incl.
AN960-0716	Washer	2	A/c. 1 - 5 incl.
AN6-H-15A	Bolt, clamp attachment	4	A/c. 6 and subs.
AN960-616L	Washer	8	A/c. 6 and subs.
AN365-428	Nut, clamp attachment	8	A/c. 1 - 5 incl.
AN960-416	Washer	16	A/c. 1 - 5 incl.

PARTS REMOVED

Part No.	Description	No. Off	Applicability
61002/1	Main undercarriage leg	2	All aircraft
61003/1	Lower clamp plate	2	A/c. 1 - 5 incl.
61004/1	Upper clamp plate	2	A/c. 1 - 5 incl.
61008/1	Upper clamp plate	2	A/c. 6 and subs.
61009/1	Lower clamp plate	2	A/c. 6 and subs.

SPECIAL TOOLS REQUIRED: (A/c. 27 and subs.)

Spot facing cutter Pt. No. 2475 to machine bosses flush with shear plate.

EFFECT ON WEIGHT AND C.G.: Nil

PUBLICATIONS AFFECTED: Nil

D.C.A. APPROVED

SERVICE BULLETIN NO. 23

SUBJECT: Repositioning of Venturi from underside of fuselage to side of fuselage - Mod. B.82.

PURPOSE: To give increased suction for flight instrumentation.

REASON: Insufficient suction in underfuselage location, also contamination by oil and dirt.

EQUIPMENT AFFECTED: Airtourer 100 aircraft.

COMPLIANCE: Mandatory requirement to be carried out as soon as conveniently possible.

DETAILS:

(a) Remove venturi from underside of fuselage (Refer Maintenance Manual Chapter 15 para. 18).

(b) Fit blanking plate to underside of fuselage and fit venturi to side of fuselage as detailed on drawing No. 02-04055.

(c) Check system for cleanliness and leaks. (Refer Maintenance Manual Chapter 15 para. 21).

PARTS REQUIRED: (single venturi installation)

PART NO.	DESCRIPTION	NO. OFF
03079/1	Blanking plate	1
TLP/D424BS	Domed Head 'Pop' rivets 1/8" dia.	34
31468/1	Doubler plate	1
04055/21	Bracket - manifold mounting	2
AN3-6A	Bolt	2
AN3-17A	Bolt	2
AN364-1032	Nut	4
AN960-10	Washer	4
51211/1	Distance piece	2
402-407	1/8" dia. Avdel snap head rivet	7
402-409	1/8" dia. Avdel snap head rivet	2

PARTS REMOVED: Nil

SPECIAL TOOLS REQUIRED: Nil .

EFFECT ON WEIGHT AND C.G.: Nil

PUBLICATIONS AFFECTED: Maintenance Manual to be amended.

D.C.A. APPROVED

VICTA

DATE: 23.4.64

SERVICE BULLETIN NO. 24.

SUBJECT: Brake Master Cylinder, deletion of secondary cup (Mod.B97)

PURPOSE: To remove tendency of Brake Master Cylinder Plunger to stick and not fully return, causing locked and dragging brakes.

REASON: Tendency of secondary cup to run dry and jam the plunger.

EQUIPMENT AFFECTED: All Airtourer 100 and 115 aircraft.

COMPLIANCE: This is not a mandatory requirement, and can be carried out at the operator's discretion. The deletion of the secondary cup does not adversely affect the functioning of the unit, and is, in fact, in line with modern brake cylinder design.

DETAILS: Remove brake master cylinder in accordance with Maintenance Manual, Chapter 16, Para. 14.

Pull the rubber boot back along operating rod and remove circlip.

Withdraw plunger.

Remove secondary cup (this seal is the taper seal, nearest to the operating rod). Discard the seal.

Smear the plunger and pack the empty groove with Molydbenum Di-sulphide grease (Energrease LMS 210 or equivalent).

Reassemble cylinder and refit to aircraft in accordance with Maintenance Manual, Chapter 16, Para. 15.

PARTS REQUIRED: Nil.

PARTS REMOVED:

PART No.	DESCRIPTION	No. OFF
CYL.1-26	SECONDARY CUP	1

SPECIAL TOOLS REQUIRED: Nil.

EFFECT ON WEIGHT & C.G.: Nil.

PUBLICATIONS AFFECTED: Nil.

D. C. A.
APPROVED.

DATE: 3.2.64.

SERVICE BULLETIN NO. 25

SUBJECT: Introduction of Stall Warning Indicator - Mod. B47.

PURPOSE: To provide adequate pre-stall warning.

REASON: D.C.A. Requirement

EQUIPMENT AFFECTED: Airtourer 100 and 115 (all aircraft)

COMPLIANCE: Next 25 hourly inspection

DETAILS: Referring to retrofit Drawing No. 03075, Sheets 1 & 2. Fit the Stall Warning Detector assembly at the leading edge of the port wing between ribs 8 and 9, ensuring that the measurement between the leading edge tangent and the detector tongue is strictly adhered to. Mount the horn assembly below luggage floor on port side.

Final adjustment must be made by test flying, to give a warning margin of 5 - 8 knots before stall with flaps fully down.

If warning margin is found to be too large, move the warning unit down and aft, if too small move unit up and forward. A movement of 1/4" will alter the operating speed by approx. 5 knots.

PARTS REQUIRED: Mod. Kit No. B47/1, consisting of:

PART No.	DESCRIPTION	No. off
02-03082/1	LEADING EDGE & DETECTOR ASSEMBLY	1
02-51013/1	MOUNTING PLATE & HORN ASSEMBLY	1
02-10058/1	DIAPHRAGM	1
02-03075/21	CONDUCTOR	1
02-03075/22	CONDUCTOR	1
02-03075/23	CONDUCTOR	1
02-03075/24	CONDUCTOR	1
02-03075/25	CONDUCTOR	1
02-03075/26	CONDUCTOR	1
CIR 3-2	CIRCUIT BREAKER, auto reset, 2 amp.	1
CLI 1-2	CLIP, strap type	8
GRO 1-9	GROMMET, 1/4" dia.	3
AN 364-1032	NUT, thin, self locking, No. 1032	2
AN366F-1032	NUT PLATE, No. 1032	1
AN 520-10-8	SCREW, round head, No.1032, 1/2" long	2
AN 526-1032-10	SCREW, truss head, No.1032, 5/8" long	2
AN 960-10L	WASHER, No. 1032	2
TAP/D 320 BS	RIVET, 'pop', 3/32" dia.	8
TLP/D 419 BS	RIVET, 'pop', 1/8" dia.	30
TLP/D 424 BS	RIVET, 'pop', 1/8" dia.	10
	6 mm P.V.C. insulation sleeving	1 ft.

PARTS REQUIRED: (cont.)

PART No.	DESCRIPTION	No. off
03075	4 mm P.V.C. insulation sleeving Drawing-RETROFIT STALL WARNING . (2 sheets)	12 ft. 1.

PARTS REMOVED: nil

SPECIAL TOOLS REQUIRED: nil

EFFECT ON WEIGHT & C.G. : nil

PUBLICATIONS AFFECTED: nil.

D.C.A. APPROVED

VICTA AVIATION DIVISION

A unit of the Victa Group

HORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA

TELEPHONE: 77-0122. CABLE ADDRESS: "VICTAMO," SYDNEY

[illegible]

[illegible]

Since the distribution of modification kits for the fitment of [illegible] stall warning to Airtourer aircraft, several suggestions have been made to ease the incorporation of the modification. The function or integrity of the system is not affected by these recommendations in any way and they may be accepted only if thought worthwhile.

1. A check on the position of the detector vane around the profile may be obtained by measurement along the contour between the bottom edge of the vane and the skin join on the bottom surface of the spar, refer Fig. 1.

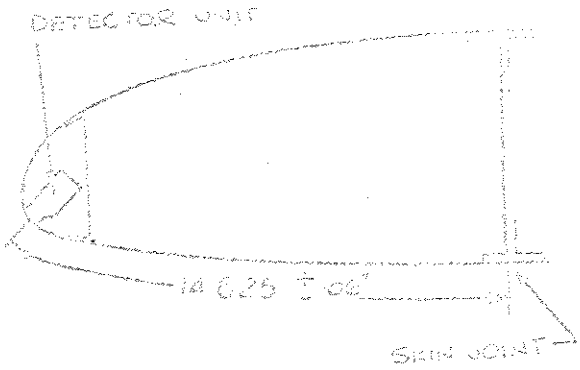

Fig. 1

Because the detector is at the mid-point of [illegible] adjustment when measuring. The position of the skin join is not fixed however, production techniques [illegible] and [illegible] that it may be used as a reliable and easy check on the [illegible] to position the detector as shown on Victa Drg. No. 02-03076.

2. It has been found that the wire from the wing disconnect to the horn (Part No. 02-03076/22) can be moved more conveniently by passing it up over the wing attachment frame and back, clipping to the lower [illegible] under the seat before passing through the repositioned grommet in the bottom left hand corner of the seat back frame.

/2

3. The director comb wire and [illegible] positioned behind the inboard 9" [illegible] (Part No. 02-[illegible]) before installation, [illegible]

4. [illegible] wire, [illegible] No. 02-0270, [illegible] rubber to the area where it runs along the seat floor [illegible] be fitted by a guard as shown. Refer Fig. 2 & 3. Drill [illegible] at or 24 0150 diameter holes, and rivet a piece [illegible] the floor and cockpit side using 3 pop rivets at 3" pitch.

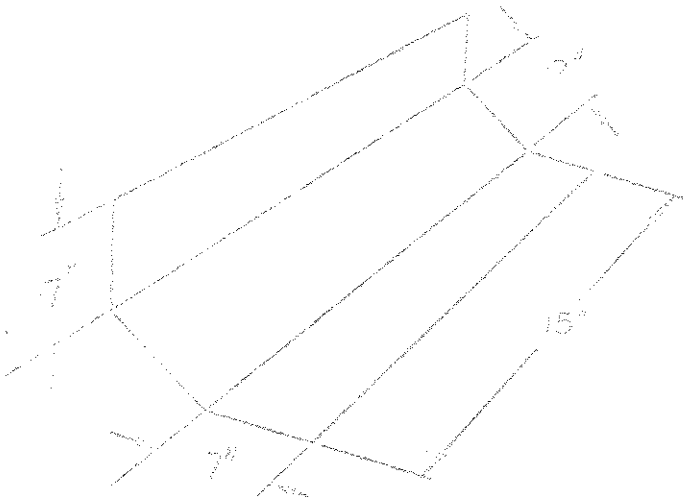

Fig. 2

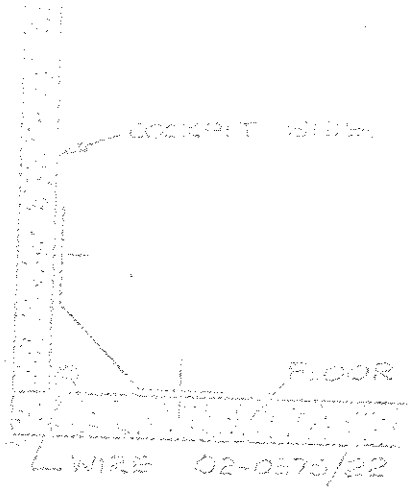

Fig. 3

D. C. A. APPROVED

SERVICE BULLETIN NO. A.26

ALERT BULLETIN

SUBJECT: MANDATORY INSPECTION OF ELEVATOR CENTRE HINGE
ALL AIRTOURER 100 & 115
AIRCRAFT

A. Within the next 10 hours flying time and thereafter daily carry out a visual inspection of elevator centre hinge bracket for signs of cracking.

B. Within the next 25 hours flying time and thereafter in accordance with a later D.C.A. instruction, remove the elevator and inspect the elevator centre hinge by dye penetrant technique in the area around centre pin bushes.

This special inspection supersedes VAT/64/1.

D. C. A. APPROVED

DATE: 28/2/64

SERVICE BULLETIN NO. 27.

SUBJECT: Clipping of flexible fuel lines (AIRTOURER 100). (Mod. B102.)

PURPOSE: To prevent the fuel lines sagging into close proximity to the heater muff and exhaust outlet pipe.

REASON: Existing plastic strip fails under elevated temperatures and allows fuel lines to sag near muffler and cause vapour lock.

EQUIPMENT AFFECTED: Airtourer 100 aircraft.

COMPLIANCE: Mandatory Requirement to be carried out at the next 10 hourly inspection.

DETAILS: (a) Remove plastic strap beinding flexible fuel lines to port engine mount.

(b) Instal new metal clips in accordance with sketch avoiding sharp bend radii and kinks in the flexible lines.

PARTS REQUIRED: Mod. Kit No. B102/1, consisting of:

PART NO.	DESCRIPTION	NO. OFF
AN3-4A	Bolt, hex head 10-32	2
AN364-1032	Nut, thin 10-32	2
AN742-14C	Clamp, 3/4" I.D.	2
AN960-10L	Washer 3/16" I.D.	2
CLI.3-5	Clip, 1/2" I.D.	2

PARTS REMOVED: nil.

SPECIAL TOOLS REQUIRED: nil.

EFFECT ON WEIGHT & C.G.: nil.

PUBLICATIONS AFFECTED: nil.

D.C.A. APPROVED

SERVICE BULLETIN NO. 27

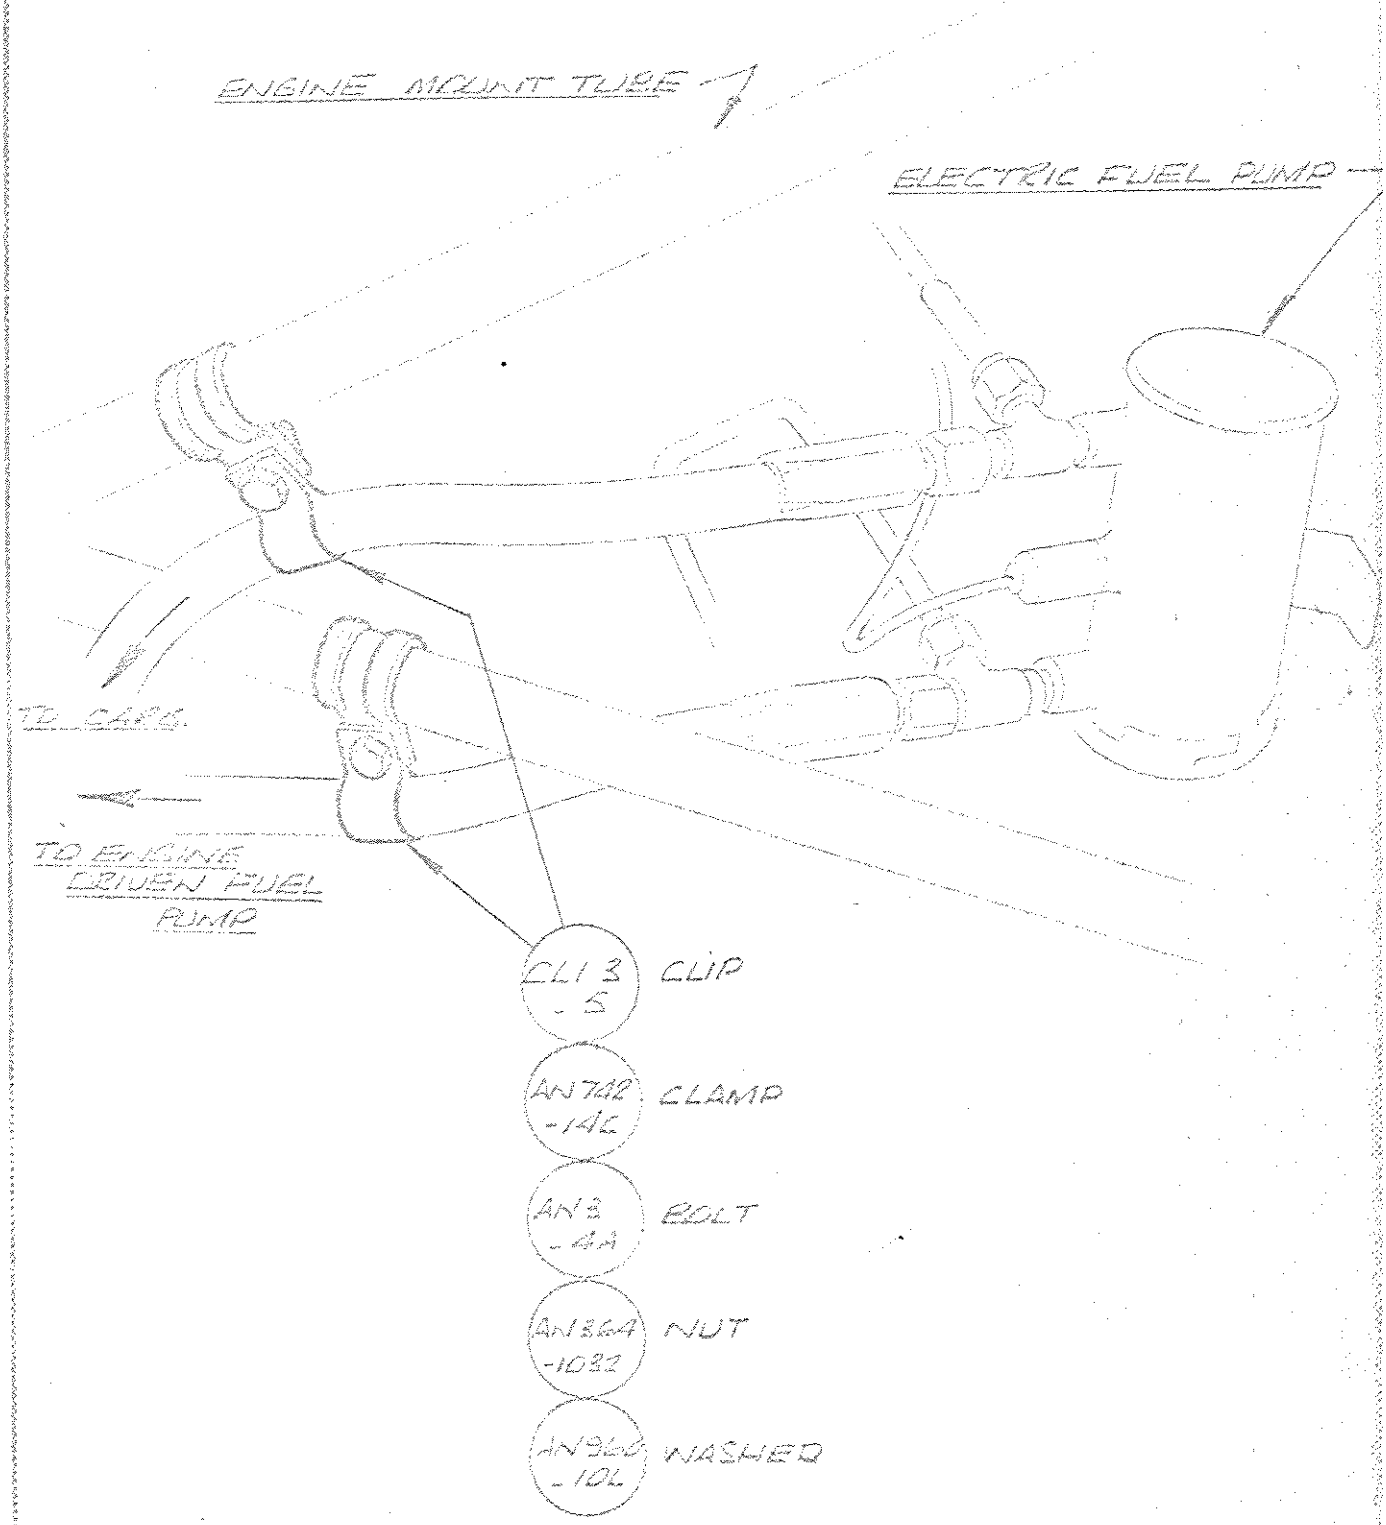

DATE: 24/2/64

SERVICE BULLETIN NO. 28.

SUBJECT: To instal scoop over fuel tank vent (Mod. No. B104).

PURPOSE: To ensure that the fuel tank airspace between pressure remains above static during flight.

REASON: Flight tests indicate that during some manoeuvres the fuel tank airspace pressure falls below static ambient. This has been associated with field reports of fuel bag tank buttons being found withdrawn from their holes.

EQUIPMENT AFFECTED: Airtourer 100 & 115 (all aircraft)

COMPLIANCE: Next 25 hourly inspection

DETAILS: Position scoop (Part No. 55023/1) as shown over fuel tank vent on the right hand side of the rear fuselage. Drill five holes No.40 (.098" dia.). Remove scoop and smear mating faces with "Bostik" or similar caulking compound. Reposition scoop and rivet.

Clean area and touch up paint as required.

PARTS REQUIRED: Mod. Kit No. B104/1,

Consisting of:

PART NO.	DESCRIPTION	NO. OFF
55023/1	Air Scoop	1
TAP/D320 BS	Pop Rivet 3/32" dia.	5

PARTS REMOVED: nil.

SPECIAL TOOLS REQUIRED: nil.

EFFECT ON WEIGHT & C.G. nil.

PUBLICATIONS AFFECTED: nil.

D.C.A. APPROVED