(5) Legs which have indications of fatigue cracks are to be replaced before further flight and the reject leg marked in such a way as to prevent its re-use.

(6) Legs with no evidence of fatigue cracks are to have the wall thickness of the tube measured, using the Victa checking tool number 05029 supplied, at all rivet hole positions, see Figure 1.
Feeler gauges are to be used to measure the gap as shown.

(7) Prior to measuring, the rivet holes are to be deburred, both internally and externally. For internal deburring using the special tool supplied No. 05028 held in hand drill or air drill and inserting and positioning in rivet holes so that the lip of the tool is contacting the internal edges of the holes. Care must be taken to rotate the tool slowly to avoid damage to the hole and to ensure that no excessive deburring occurs. Use conventional methods for external deburring.

(8) Comparison of the feeler gauge measurement and the figures given in Table 1, is to be made, and replacements and subsequent inspections to be carried out in accordance with the requirements contained therein.

(9) Upon completion of the inspections reassemble the Steering Collar to Nose Leg using 5/32" Avdel Rivets Part No. 402/508 as supplied.

(10) The accompanying questionnaire is to be completed and returned in the stamped, addressed envelope enclosed.

(11) The serial number of the leg is to be found on the lower spring seat. Any leg without a serial number is to be taken as a Type II leg.

PARTS REQUIRED: Rivet - Avdel 5/32 Part No. 402/508 as required.

PARTS REMOVED: NIL

SPECIAL TOOLS REQUIRED: Victa Checking Tool No. 05029
Internal Deburring Tool No. 05028

EFFECT ON WEIGHT & C OF G: NIL

PUBLICATIONS AFFECTED: Appropriate Log Book Entry stating life and inspection classification.

LABOUR INVOLVED: 3 Man Hours.

D.C.A. APPROVED

TABLE 1. (ISSUE 2)

LEG TYPE	RIVETS	MAXIMUM FEELER GAUGE THICKNESS AS READ		TOTAL LEG LIFE HRS.	INSPECTION PERIODS-HOURS.
		Greater Than	Less Than		
TYPE 1. SERIAL NOS. N.L. 1 to N.L. 35	4 x 5/32"	.	.070"	2000	IMMEDIATE EVERY 100 HRS. THEREAFTER.
		.070"	.081"	1000	
		.081"		500	
	8 x 5/32"		.070"	1000	
		.070"	.081"	500	
TYPE 11. SERIAL NOS. N.L. 36 AND SUBS. AND ALL LEGS WITHOUT SERIAL NOS.	4 x 5/32"		.070"	4000	
		.070"	.081"	2000	
		.081"	.089"	1000	
		.089"		500	
	8 x 5/32"		.070"	2000	
		.070"	.081"	1000	
		.081"		500	

VICTA

DATE: 11/10/69

SERVICE BULLETIN NO. 48

AMENDMENT No. 1.

DELETE -

EQUIPMENT AFFECTED

All Airtourer 100 and 115 aircraft.

ADD -

EQUIPMENT AFFECTED

All Airtourer 100 and 115 aircraft not incorporating Mod. B206.

NOTE:- Mod. B206 introduced a thicker walled tube and was incorporated in production at aircraft serial No. 112. Replacement legs P/N 02-62049/2 (Airtourer 115) and P/N 02-62049/3 (Airtourer 100) have Mod. B206 incorporated.

When Mod. B206 is incorporated, the inspections required by DCA/VAT/22 do not apply.

DELETE - Sheet 3

ADD - New Sheet 3

D.C.A. APPROVED

PARTS REMOVED:

Part No.	Description	No. Off
02-62002/1	Outer Tube Assembly	1
02-62036/1	Cap	1
02-62007/2	Bearing Housing	2
02-62028/1	Bearing	2

SPECIAL TOOLS REQUIRED: It is recommended, but not essential that the following tools be used to dismantle the strut:-

FORD Part No. A/E 5433
A2/ET 5310
A2/ET 55462

EFFECT ON WEIGHT & C.G.: Negligible

PUBLICATIONS AFFECTED: Nil

LABOUR INVOLVED: 6 Hours

DISTRIBUTION: 2(a)

VICTA

SERVICE BULLETIN

AVIATION DIVISION HORSLEY ROAD, CHIPPING NORTON, N.S.W. AUSTRALIA 2170

Date: 16th March, 1966.

No. 48
Issue No. 3
D.C.A. APPROVED

(THIS SERVICE BULLETIN SUPERSEDES AND CANCELS BULLETIN 48 ISSUE 2 AND AMENDMENT NO. 1)

SUBJECT: Service life nose leg strut.

PURPOSE: To replace all extended life nose struts in service.

REASON: Service experience has cast some doubt on to the method of measuring wall thickness as described in Issue 1 of this bulletin.

A failure has occurred involving a strut at a total time less than its lifed 1000 hours. A probable contributary factor was an out of balance nose wheel. Tyres supplied to Victa for use on Airtourer aircraft are especially balanced, and when installed with the spot positioned adjacent to the inflation valve an acceptable balance is achieved.

EQUIPMENT AFFECTED: All Airtourer 100 and 115 aircraft not incorporating Mod. B206.

N O T E

Mod. B206 introduced a thicker walled tube and was incorporated into production at aircraft serial No. 112. Replacement legs P/N. 02-62049/2 (Airtourer 115) and P/N. 02-62049/3 (Airtourer 100) have new outer tubes 02-62050/2 and 02-62050/3 respectively, which incorporate Mod. B206.

COMPLIANCE:

(1) Nose legs which have reached or exceeded 500 hours — within the next 25 hours flying.

(2) Nose legs with less than 500 hours flying — at 500 hours flying time.

DETAILS:

(1) Remove nose leg assembly in accordance with Victa Airtourer Maintenance Manual, Chapter 16, Para. 5.

(2) Disassemble nose strut in accordance with Maintenance Manual Chapter 61, Para. 1.

(3) Inspect strut components in accordance with Chapter 61 Para 2.

(4) Re-assemble nose strut in accordance with Chapter 61, Para 3. Use new outer tube assembly, Part No. 02-62050/3 (Airtourer 100) or Part No. 02-62050/2 (Airtourer 115).

N O T E

It has been found that renewal of seals has not been necessary unless seals show obvious signs of wear. It is, however, necessary to renew the cap nut, Part No. 02-62036/1 as thread damage occurs during the disassembly.

(5) Re-install the leg onto the aircraft in accordance with the Maintenance Manual Chapter 16, Para. 6. Use new bearing housings Part No. 02-62057/1 and split bearings, Part No. 02-62056/1.

N O T E

Full credit for the new bearing housings will be allowed upon the return of the old housings to Victa Service Department.

(6) Refill strut in accordance with Chapter 7, Para. 5. Use only approved oil listed in Table 1, Chapter 7.

PARTS REQUIRED: Airtourer 100, Mod. Kit 48/1 consisting of:-

Part No.	Description	No. Off
02-62050/3	Outer Tube Assy.) Supplied Assembled	1
02-62058/1	Collar) as P/N.02-62049/3SF	
02-62036/1	Cap	1
02-62057/1	Bearing Housing	2
02-62056/1	Bearing	2

Airtourer 115, Mod. Kit 48/2 consisting of:-

Part No.	Description	No. Off
02-62050/2	Outer Tube Assy.) Supplied Assembled	
02-62058/1	Collar) as P/N.02-62049/2SF	1
02-62036/1	Cap	1
02-62057/1	Bearing Housing	2
02-62056/1	Bearing	2

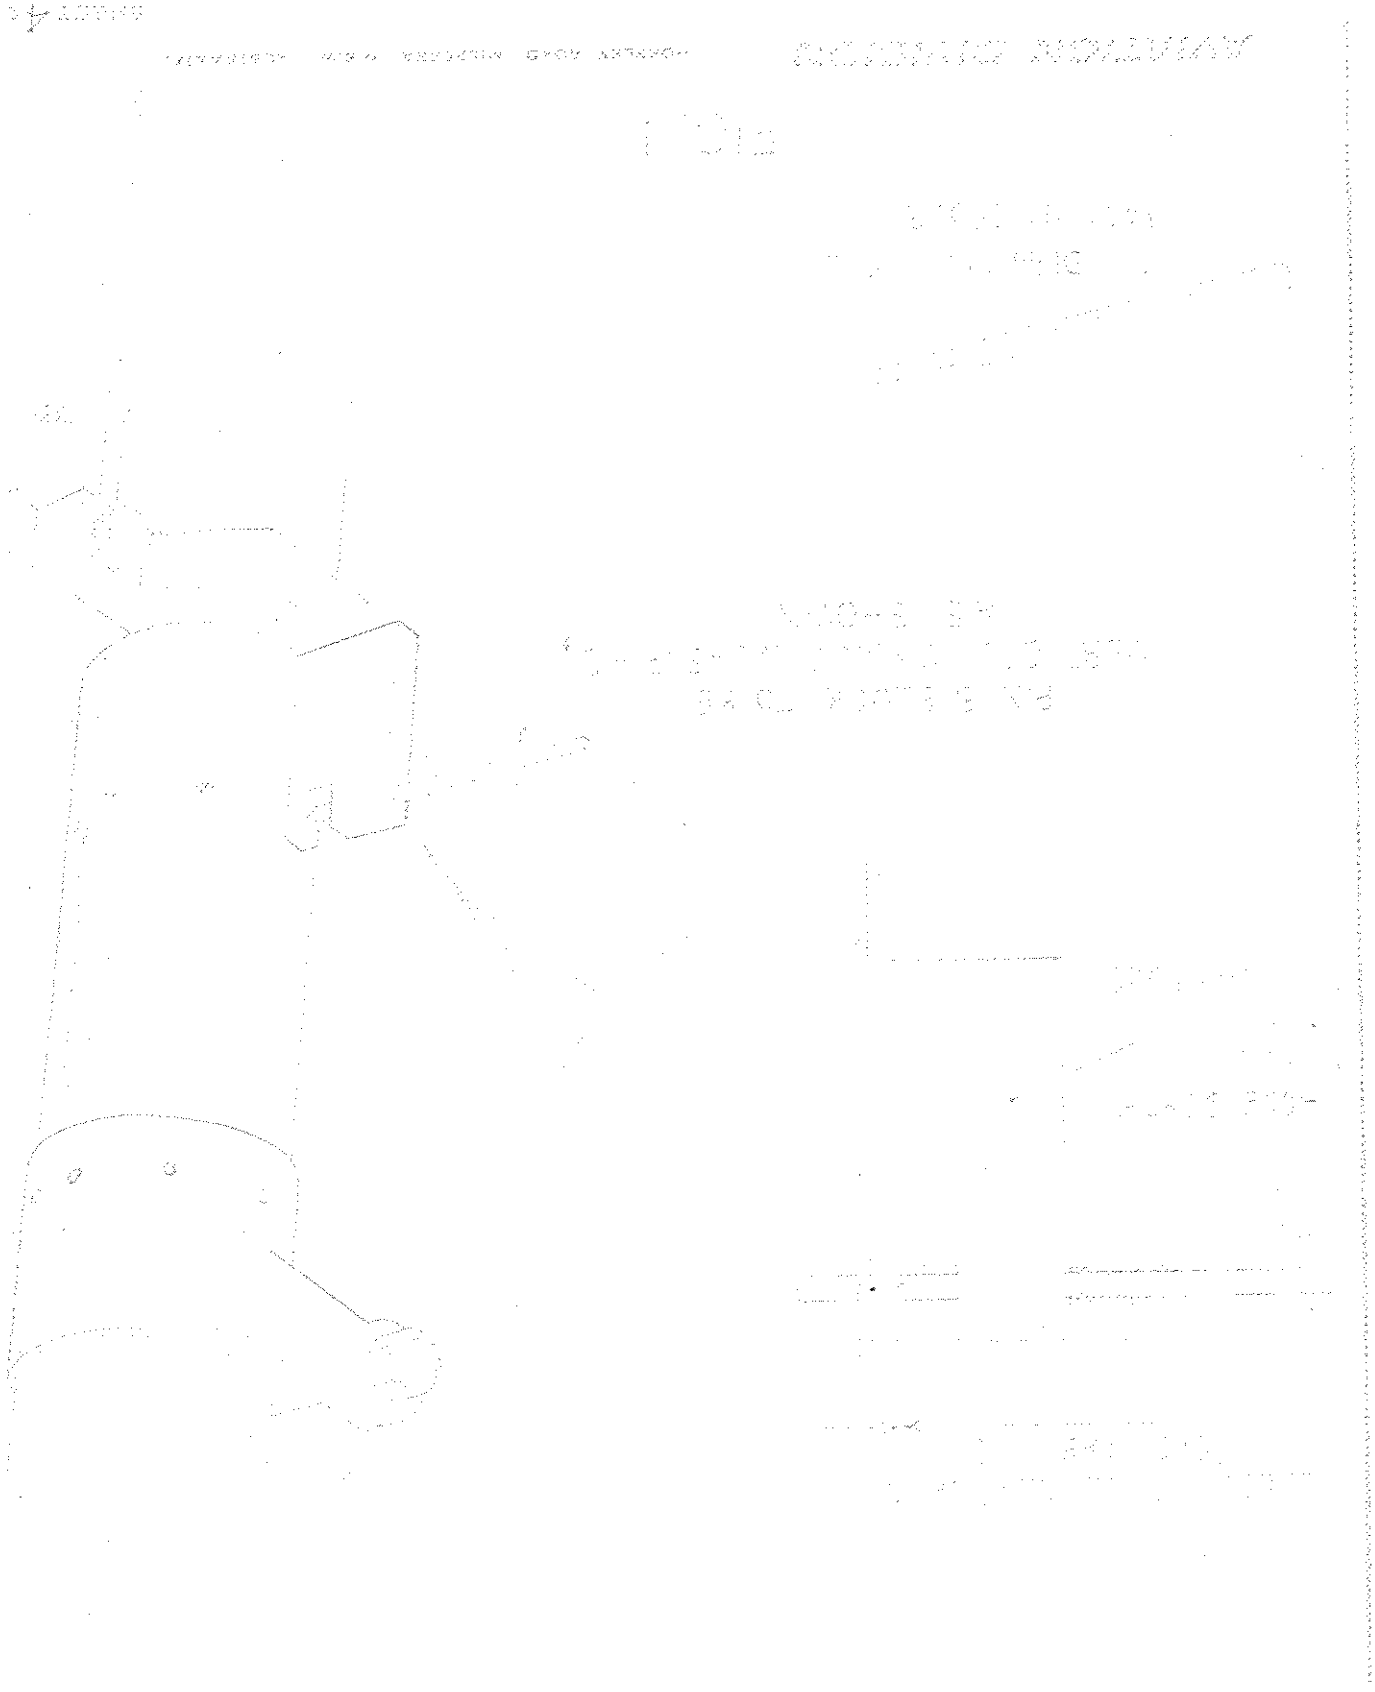

VISTA

DATE: 4/1/1965

SERVICE BULLETIN NO. 49

SUBJECT: Inspection - Nose Wheel Steering Rod.

PURPOSE: To inspect nose wheel steering rod P/N 62018/2 for evidence of wear.

REASON: Service experience has shown that wear of the nose steering rod P/N 62018/2 takes place where it passes through the shutter P/N 62016/1 on the firewall when the rudder is in the streamlined position. This wear results in reduction of wall thickness of the steering rod with possibility of collapse under load.

EQUIPMENT AFFECTED: All AT100 and AT115 Aircraft.

COMPLIANCE: (a) Nose steering rods which have reached or exceed 200 hours flying time - next 25 hourly inspection.

(b) Subsequent inspection - every 100 hours.

DETAILS: (a) With rudder in streamlined position, mark steering rod with pencil at point of passing through shutter on firewall.

(b) Raise nose wheel off ground by weighing down of tail plane.

(c) Apply full left rudder and check steering rod in vicinity of pencil mark with 0" - 1" micrometer for evidence of reduction of diameter from nominal diameter of .875". A maximum reduction of diameter of .015" is permissible. If a greater reduction of diameter than .015" is evident, the steering rod is to be replaced.

NOTE: When ordering new rods please state distance between centres of old steering rod, as some early aircraft were fitted with rods of non-standard length.

PARTS REQUIRED: Nil.

PARTS REMOVED: Nil.

SPECIAL TOOLS REQUIRED: Nil.

EFFECT ON WEIGHT & C OF G: Nil.

PUBLICATIONS AFFECTED: Nil.

LABOUR INVOLVED: ½ hour.

D. C. A. APPROVED

WIGTA

DATE: 5/7/65.

SERVICE BULLETIN NO. 51 Issue 2.

THIS BULLETIN SUPERSEDES AND CANCELS SERVICE BULLETIN No. 51.

SUBJECT: Inspection and replacement of main undercarriage inner attachment bolt P/N AN7H-11A and Special Washer P/N 61026/2.

PURPOSE: As a precautionary measure to ensure safety of main undercarriage.

REASON: Failure of inboard attachment bolt has occurred at less than 500 hours in service.

EQUIPMENT AFFECTED: Airtourer 100 and 115 Aircraft S/No. 6 and subsequent. Airtourer 100 and 115 Aircraft S/No. 1 thru 5 when Mod B51 has been incorporated.

COMPLIANCE: (a) Inspect at 100 hours as detailed below, inner bolts which have not exceeded 100 hours since fitment.

(b) Bolts which have exceeded 100 hours to be inspected as below-within next 10 hours.

(c) Replace bolts at 200 hourly periods.

(d) At first bolt replacement, discard special washer P/N 61026/1 and replace with thicker special washer P/N 61026/2.

DETAILS: (a) Remove screws and drop undercarriage attach fairing.

(b) With weight of aircraft on undercarriage, check by means of feeler gauge that no clearance exists between upper surface of main leg and inner attachment block face.

(c) If evidence of any clearance exists, replace, bolt P/N AN7H-11A and Special Washer P/N 61026/2.

(d) Delete undercarriage fairing inner attach bracket P/N 10043/1.

(e) Tighten bolt to a torque of 38-42 ft. lbs.
NOTE: When torquing the bolt ensure it is not thread bound in the attachment block thus giving a false reading. If in doubt it is permissible to fit an AN960-716 plain washer between the head of the bolt and the special washer.

(f) When replacing bolts at 200 hourly period ensure that no "Dishing" of the Special Washer exists. "Dishing" of the washer renders it unserviceable and it must be replaced.

PARTS REQUIRED:	Bolt AN7H11A.	2 off
	Washer Special P/N61026/2.	2 off
	Washer Plain AN960-716.	As required.

PARTS REMOVED:	Bolt AN7H-11A.	2 off
	Washer Special P/N 61026/1.	2 off
	Bracket-Main Leg Fairing P/N 10043/1.	2 off

SPECIAL TOOLS REQUIRED: NIL

EFFECT ON WEIGHT & BALANCE: NIL

PUBLICATIONS AFFECTED: NIL

D.C.A. APPROVED.

AVIATION DIVISION HORSLEY ROAD, MILPERRA, N.S.W., AUSTRALIA.