WICTA

DATE: 15/9/6

SERVICE BULLETIN NO. 54 Iss.

SUBJECT: Mandatory Inspection of Nose Leg Spring Characteristics.

EQUIPMENT AFFECTED: Airtourer 115 aircraft, Serial No. 1 thru 109. If the inspection has been made to issue 1 of this Service Bulletin, or replacement leg P/N 02-62049/2 is fitted, no further action is required.

REASON: Springs of incorrect load rating may have been fitted in production.

CONFIGURATION: Empty aircraft with no occupants or luggage.

INSPECTION:

(1) With propeller in vertical position and the aircraft on hard level ground, raise nose wheel clear of ground by 3". It is suggested that this be done by pushing down on the tailplane.

(2) Release aircraft and allow to settle.

(3) Measure clearance of propeller tip from ground and record.

(4) Repeat this procedure three times to even out the effects of friction.

(5) Remove spinner and hang 100 lb. weight on crankshaft behind propeller.

(6) Repeat the previous test three (3) times again measuring the propeller ground clearance.

(7) If the difference between propeller ground clearance with and without the weight exceeds 4" an incorrect spring has been fitted.

(8) The spring should be replaced at the first 100 hrs. and the Victa Service Department should be contacted for the replacement component.

(9) Meanwhile continued operation should be carried out using some caution. The following types of operation should be avoided if possible.

(a) Run ups exceeding 1800 rpm on brakes - elevator must be held in full up position in this configuration.

(b) Sudden application of brakes particularly on uneven ground.

NOTE: As the softness of the nose spring is only considered a problem under slowly applied loads, this commonsense approach will ensure satisfactory operation until the spring is replaced.

D.C.A. APPROVED

VICTA

DATE: 9/9/65.

SERVICE BULLETIN NO. 55

SUBJECT: Sealing of Lower Skin Seams and Rivets, Rear Fuselage - Mod. B221

PURPOSE: To minimise the ingress of CO from exhaust fumes through pop rivet

REASON: Experience has shown that pop rivet tails work loose and fall out in service. Although this does not effect the rivet strength in any way, it does provide an entry for exhaust fumes into the rear fuselage and then forward into the cabin.

EQUIPMENT EFFECTED: All Airtourer 100 and 115 aircraft, Serial No. 1 through 110.

COMPLIANCE: At next 100 hourly inspection.

DETAILS: Trestle aircraft under rear fuselage.
Remove tail cone assembly.
Remove access panel at rear of luggage bay.
Seal all pop rivets and skin laps in the lower rear fuselage as far forward as the rear of the luggage bay. Sealing is not required along the lower longerons, but particular attention is necessary along the capping strip at the lower centreline, and around the rotating beacon if fitted.

Use 3M Duct Sealer 88 as follows:-

(1) Surfaces must be dry and free from dust, grease, oil or other foreign matter.

(2) Sealer and materials should be at temperatures above 65°F for best results.

(3) Apply a bead of sealer along the inside edge of lap seams, and apply a drop of sealer on each rivet tail, using a brush, extruder, or narrow spatula.

CAUTION

The Sealer is highly inflammable when wet. Do not open or use within 30 feet of a fire or flame, and avoid using spark producing electrical equipment until vapours are gone. Avoid prolonged breathing of vapour and repeated contact with skin.

PARTS REQUIRED:	Mod. Kit No. B 221/1 consisting of:-
	TUBE, Sealer 1 OFF
PARTS REMOVED:	Nil
SPECIAL TOOLS REQUIRED:	Nil
EFFECT ON WEIGHT & CG:	Negligible
PUBLICATIONS AFFECTED:	Appropriate Log Book Entry
LABOUR INVOLVED:	1.5 hours
DISTRIBUTION:	2 (a) (Ref. S/B 50)

D.C.A. APPROVED.

VICTA

DATE:20/10/65

SERVICE BULLETIN NO. 56

SUBJECT: Addition of Protective Plastic Sleeves on Fuel Tank Retention Buttons.

PURPOSE: To provide protection for the neck of the button against wear and abrasion.

REASON: It has been found in service that some aircraft sustain damage to the tank retention buttons caused by the edge of the mounting hole cutting into the neck of the button. On several occasions this has resulted in the head of the button being severed. The most susceptible location has been the two lower front, and the first indication is normally a "spongy" feel on the tank bottom with the dip stick. While it is not considered dangerous to have several buttons not retaining the tank bag to the structure, the resultant transfer of load to the remaining buttons may hasten their deterioration.

Inspection of the two front lower buttons can be made by removing the grommets at the front of the underpan. The top buttons can be inspected by removing the seat cushions and luggage bay floor. Lifting the grommets will then expose the button heads.

EQUIPMENT AFFECTED: Airtourer 100 and 115. This problem has not been common to all Airtourers and has arisen mainly, but not exclusively, in some later production aircraft.

COMPLIANCE: As necessary, or at operators discretion.

DETAILS: (a) Remove tank in accordance with the Maintenance Manual Chapter 14, Para. 13. Refer also to Service Bulletin No. 44 re the C washers retaining the tank buttons. The next issue of the Maintenance Manual will contain this information in Chapter 14.

(b) Inspect buttons for evidence of damage and repair as necessary in accordance with Victa Service Letter 65/2.

(c) Insert clear plastic hose in a plastic softening solution and allow time for it to become soft and easily workable.

N O T E

The plastic hose may be softened by immersion in hot water, but difficulty will be experienced in subsequent operations as the tube cools. A far better method is to soak the length of tube in acetone for 20-25 minutes to both dilate and soften. No trouble will then be encountered in passing the sleeve over the head of the button, and later manipulating the C washer.

P.T.O.

(d) Cut off a .30" length of softened tube, ensuring the ends are square and push over tank button. Allow bottom of sleeve to flare out over base of button using a blunt instrument to remove any fold unders and to provide a smooth skirt around the neck of the button.

(e) Repeat for all buttons.

(f) Replace tank in the aircraft as in accordance with the Maintenance Manual Chapter 14, Para. 13.

(g) Install C washers (Pt.No. 02-48023/1) making sure they pass between the end of the plastic sleeve and the head of the button. Rotate the washer when in position to flare out the ends of the sleeve as shown in the sketch.

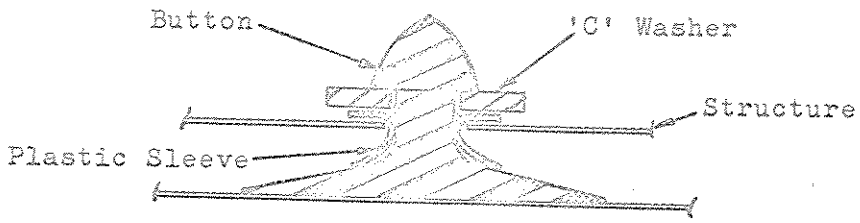

N O T E S.

(1) Although the C washer is fitted to only 15 of the tank buttons, fit plastic sleeves over all buttons.

(2) If the two front lower buttons have not grommets in the under-pan to obtain access, cut two holes in the front corners in accordance with Service Bulletin No. 44, positioned on a line 2.5" rear of the front edge of the under-pan and 1.5" in from each side. Install "C" washers and close access with Grommet GR01-21.

(h) Complete the installation and replace cockpit trim, luggage bay floor and wing/fuselage fairings.

PARTS REQUIRED:

PART NO.	DESCRIPTION	NO. OFF
Nylex IP 187 Victa HOS1-3-240	Tube, PVC 3/16 ID x 3/64 Wall 24" long.	1

PARTS REMOVED: Nil

SPECIAL TOOLS REQUIRED: Nil

AFFECT ON WEIGHT & C.G: Nil

PUBLICATIONS AFFECTED: Nil

LABOUR INVOLVED: 8 hours

DISTRIBUTION: 2 (a)

D.C.A. Approved

DATE: 7/2/66

SERVICE BULLETIN NO. A57

Issue 1.

ALERT BULLETIN

SUBJECT: Spinner Inspection.

PURPOSE: To detect any cracks in the fibreglass spinner.

REASON: Field reports have indicated instances of cracks appearing around propeller blade cutouts. Continued operation has resulted in fretting necessitating the eventual replacement of the propeller. On several occasions, disintegration of the spinner in flight has occurred.

EQUIPMENT AFFECTED: Airtourer 100 aircraft.

COMPLIANCE: Before next flight and before each subsequent flight.

DETAILS: Inspect spinner, Pt. No. 02-44102/1 for evidence of cracking, especially in area of propeller blade cutout. Ensure positive clearance around propeller blade and inspect for evidence of contact between spinner and propeller.

Inspect mounting screws for evidence of movement of the spinner under the heads. If spinner shows evidence of movement, but there are no cracks or propeller contact, check condition of mounting screws and holes and re-tighten screws. Maintain pre-flight inspection.

If cracks or fretting are evident, remove spinner Pt. No. 02-44102/1, and continue flying operations.

PARTS REQUIRED: Nil

PARTS REMOVED: Nil

DRAWINGS REQUIRED: Nil

SPECIAL TOOLS: Nil

EFFECT ON WEIGHT AND BALANCE: Negligible.

PUBLICATIONS AFFECTED: Nil

DISTRIBUTION: 2C (i)

D.C.A. APPROVED.

VICTA

DATE: 16/2/66

SERVICE BULLETIN

NO. 58

D.C.A. Approved

(THIS BULLETIN SUPERSEDES AND CANCELS BULLETIN NO. 51 ISSUE

SUBJECT: Inspection and replacement of main undercarriage inner attachment bolt.

PURPOSE: Required as a precautionary measure pending the development of a long life attachment. Standard AN7H-11A bolts have been found cracked at 200 hours replacement.

EQUIPMENT AFFECTED: Airtourer 100 and 115 aircraft serial No. 6 through 159. Airtourer 100 and 115 Serial No. 1 through 5 when B51 has been incorporated.

COMPLIANCE:

(a) Replace AN7H-11A bolts with special bolts Part No. 02-61032/1 as follows:-

(i) For aircraft with inner attachment bolts with less than 100 hours - at the next 100 hours inspection.

(ii) For aircraft with inner attachment bolts between 100 and 200 hours - within the next 10 hours flight time.

(b) Special bolts Part No. 02-61032/1 are to be inspected as detailed below at 100 hours flying time after installation.

(c) Special bolts Part No. 02-61032/1 are lifed, and are to be replaced with new bolts of the same Part No. after 200 hours flying time.

DETAILS: (a) BOLT REPLACEMENT

Remove screws and drop undercarriage fairing.
Trestle wings with main landing gear clear of ground.
Remove inner main leg attachment bolts and loosen clamp plates.
With leg clear of inner attachment block, chamfer inboard edge of block as shown:

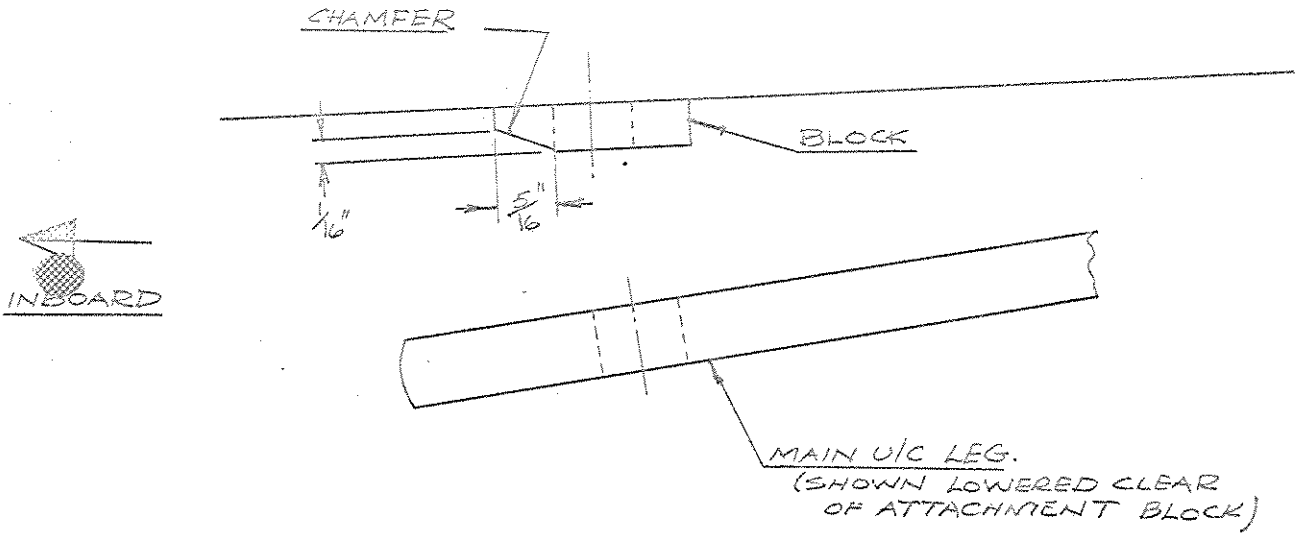

N O T E

Use a piece of scrap sheet metal against wing under skin to prevent damage when filing chamfer.

Re-assemble leg to block using special bolts Part No. 02-61032/1

N O T E

(i) This bolt has a stress relieving groove machined at the end of the thread. Care is to be taken that this bolt does not have any marks or nicks, especially in the area of the groove.

(ii) Service Bulletin No. 51 incorporated a thicker washer, Part No. 02-61026/2 to replace washer, Part No. 02-61026/1. The current washer is .180" thick and care is to be taken that the washer is, in fact, installed.

DETAILS (Continued):

Torque inner attachment bolts to 38-42 ft.lb. (456-504 in.lb.) with dry thread and lockwire.
Remove aircraft from trestles
Check main undercarriage clamp plate preload with a straight edge described in Victa Service Letter 64/8. Adjust if necessary.
Replace undercarriage fairings.

(b) BOLT INSPECTION

Remove screws and drop undercarriage fairing.
Trestle wings with main undercarriage clear of ground.
Back off inner main leg attachment bolts two turns, and retorque to 38-42 ft.lb. (456-504 in.lb.) and lockwire.
Replace fairings and remove trestles.

PARTS REQUIRED:

Part No.	Description	No. off
02-61032/1	Bolt, Special	2

PARTS REMOVED:

Part No.	Description	No. off
AN7H-11A	Bolt 7/16 UNF	2

DRAWINGS REQUIRED: Nil

SPECIAL TOOLS REQUIRED: Nil

EFFECT ON WEIGHT & CG: Negligible

PUBLICATIONS AFFECTED: Make ink amendment to Airtourer Spare Parts Catalogue, page 72.

Item 11 Delete AN7H-11A, add 02-61032/1
Item 10 Delete 61026/1, add 02-61026/2

LABOUR INVOLVED: (a) Replacement - 2 hours
(b) Inspection - 1½ hours

DISTRIBUTION: 2a

VICTA

SERVICE BULLETIN

AVIATION DIVISION HORSLEY ROAD, CAMPBELLTOWN, N.S.W. AUSTRALIA. 77-0222

28th April, 1966.

No. 59
Issue 1
D.C.A. APPROVED

SUBJECT: Carburettor Throttle Shaft

PURPOSE: To replace throttle shaft, Marvel Schebler Carburettor MA-3A, with one of improved design.

REASON: Two cases have occurred in service where the shaft has failed at the corner of the valve recess at the end nearest the limit stops and lever. The return spring then rotated the butterfly past full throttle to a reversed part throttle position.

EQUIPMENT AFFECTED: All Airtourer 115 aircraft.

COMPLIANCE: Within 25 hours flying time.

DETAILS:

(i) Disconnect throttle linkage at carburettor, and remove throttle shaft part No. A13-768.

(ii) Install throttle shaft part No. 03-43308/1 with existing valve, using 2 off screws part No. A15-58. Lock screws in accordance with Marvel Schebler Overhaul Instructions.

(iii) Fit throttle opening spring and secure with split pin. Check operation of throttle assembly and ensure valve snaps to full throttle position in the relaxed condition.

(iv) Reconnect throttle linkage and check range and operation.

N O T E

Throttle shaft part No. 03-43308/1 may be purchased complete through Victa Service Department or alternatively may be re-worked from shaft assembly, Marvel Schebler Part No. A13-949 in accordance with page 3. of this service bulletin.

PARTS REQUIRED: Mod. Kit 59/1 consisting of

Part No.	Description	No. Off
03-43308/1	Throttle Shaft	1
A15-58	Screw	2
AN380-2-2	Cotter Pin 1/16" dia.	1

PARTS REMOVED:

Part No.	Description	No. Off
A13-768	Throttle Shaft	1
A15-483	Screw	2

DRAWINGS REQUIRED: Nil

SPECIAL TOOLS REQUIRED: Nil

EFFECT ON WEIGHT & C.G.: Nil

PUBLICATIONS AFFECTED: Nil

DISTRIBUTION: 2(ii)

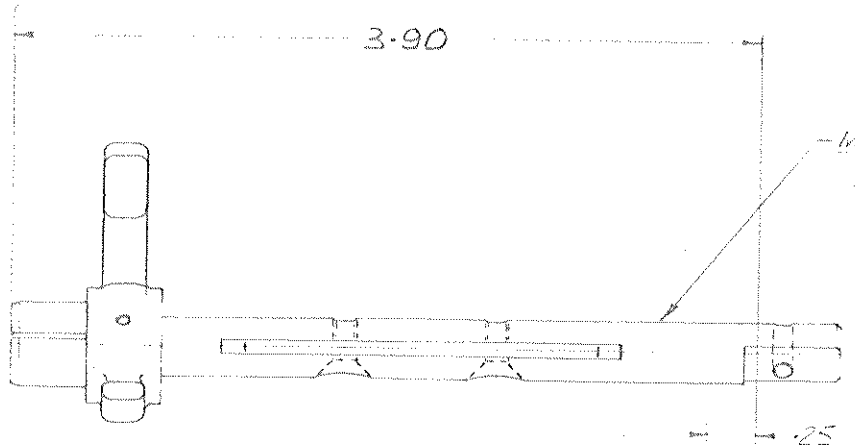

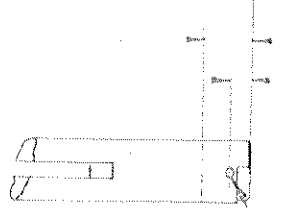

DRILL THRU 1/16" DIA

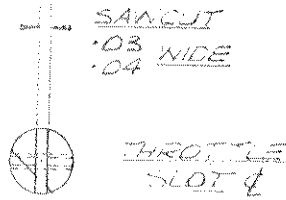

REWORK DETAILS

PART NO 03-43308/1 IS MADE BY
REWORKING MARVEL SCHEBLER
PART NO 413-949 AS SHOWN

ICTA SERVICE BULLETIN No 59 REFERS

PART No. L.H.	QTY.	PART No. R.H.	QTY.	DESCRIPTION	MATERIAL	SIZE	FINISH

1	ISSUE						
	MOD. No.						
PRODUCTION	CHANGE						
	DRAWN		1	03-40503	03	THROTTLE SHAFT ASSEMBLY	03-43308
	CHECK		QTY. PER AC	QTY. PER AC			
	APPROVED						
	DATE			PARTS ASSY.	MODEL		

UCSA

DATE 26 APR 64
DRAWN
CHECK
STRESS
APPROVAL
SCALE 2 X FULL

MATERIAL —
FINISH NIL

AVIATION DIVISION

UNLESS OTHERWISE SPECIFIED TOLERANCES
DECIMALS ± .01
FRACTIONAL ± 1/64
ANGULAR ± 1°

PART No. 03-43308/1

DESCRIPTION THROTTLE SHAFT ASSEMBLY

DRAWING No. 03-43308

VICTA

SERVICE BULLETIN

AVIATION DIVISION: [illegible] CANBERRA, N.S.W. AUSTRALIA [illegible]

Date: 26th April, 1966

No. 60

D.C.A. Approved

SUBJECT: Rubber Seal, Rear Fuselage

PURPOSE: To inspect seal for deterioration or damage.

REASON: One aircraft in service on a routine check exhibited a CO concentration above normal. Investigation revealed a torn rubber seal in the rear fuselage. When this seal was repaired, the CO concentration reverted to its normal negligible level.

N O T E

The rear fuselage under surface has been shown to be an area where exhaust gasses flow close to the skin. The opportunity to inspect the sealing in this area could be taken at the same time. Service Bulletin No. 55 applies.

COMPLIANCE: Within the next 25 hours flying time.

DETAILS:

(i) Remove the panel at the rear of the luggage bay.

(ii) Inspect the rubber diaphragm on both sides of the aircraft between the side and bottom skins and rear of frame at Station 115.03.

(iii) If rubber seal general condition has deteriorated, replace rubber. Attach using rivets and Baer-Manning Contact Adhesive Type 626 or equivalent.

(iv) If rubber conditions is satisfactory but seal is torn, repair by patching using 1/16 rubber sheet as required and Baer-Manning Contact Adhesive Type 626 or equivalent.

PARTS REQUIRED: Nil

PARTS REMOVED: Nil

DRAWINGS REQUIRED: Nil

SPECIAL TOOLS REQUIRED: Nil

EFFECT ON WEIGHT & C.G.: Negligible.

PUBLICATIONS AFFECTED: Nil

DISTRIBUTION: 2(c)(i) and (ii)

VICTA

SERVICE BULLETIN

AVIATION DESIGNS HOUSTON POST MURRAY N.S.W. AUSTRALIA 70-0122

Date 22nd June, 1966. D.C.A. APPROVED. No. 62

(INCORPORATION OF THIS BULLETIN CANCELS BULLETIN NO. 58 Issue 1)

SUBJECT: Rework to main undercarriage inner attachment, Mod. No. B268.

PURPOSE: To provide a longer life attachment.

REASON: The existing attachment modified to Service Bulletin 58 has a life of 200 hours with inspection at each 100 hours. A new attachment has been developed with an initial life of 500 hours without recurring inspections. As experience is accumulated in service it is confidently anticipated that this life will be progressively extended.

EQUIPMENT AFFECTED: Airtourer 100 & 115 aircraft, Serial No. 6 and subsequent. Airtourer 100 & 115 aircraft, Serial No. 1 through 5, when Mod B51 has been incorporated.

COMPLIANCE:

(i) Aircraft with less than 50 hours since last 100 hourly inspection - at 50 hours.

(ii) Aircraft with more than 50 hours since last 100 hourly inspection - at next 100 hourly inspection.

DETAILS:

(i) Remove main landing gear in accordance with Maintenance Manual chapter 16, para. 2.

(ii) With a small triangular file, cut a notch in the top coil of the insert about 1/4 turn from the end of the wire. Be careful not to damage the threads in the tapped hole. Place one edge of a 3-edge scraper in the notch. While maintaining a steady downward pressure, turn the scraper counter-clockwise until the entire insert is backed out.

(iii) Using a file, and with a small piece of sheet metal held to protect the wing under-surface, chamfer lower edge of block approximately 1/16" to clear internal radius of conical cup to when assembled. See sketch. Chamfer, introduced by Service Bulletin No. 58, is not necessary along edge of chamfer.

(iv) Instal new insert in tool No. 535-7 and wind new insert into block as shown.